


HIM overheat

Wednesday, February 9, 2022 10:41 AM

Gun temperature too high bc LN2 exhausted


2. In system manager, found service machine

a. Power distribution -> uncheck accelerator, lens1 and extractor

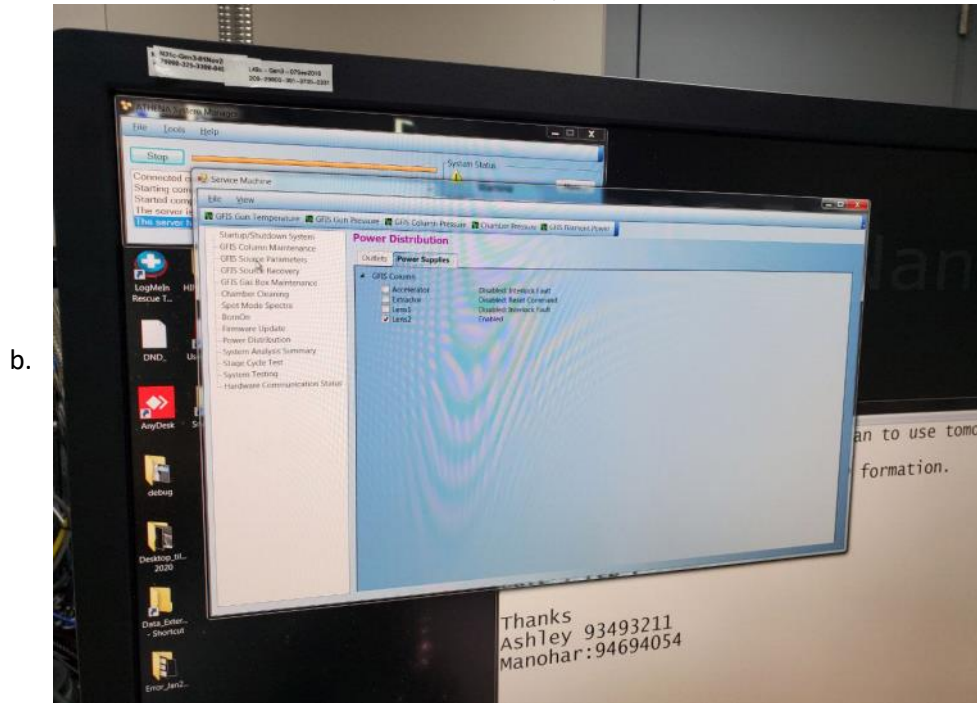


c. Physically unplug HVP cables for accelerator, lens1 and extractor. Cover the ends of cables with gloves




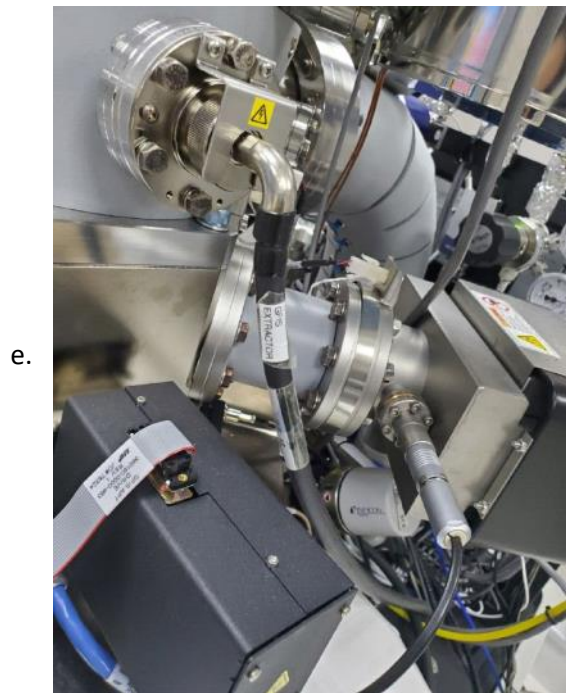

f. Connect heating cable

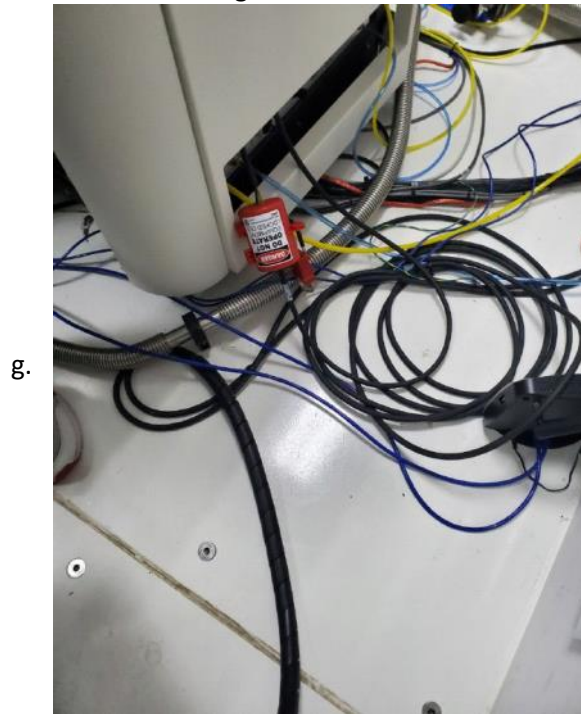

3. Start baking process

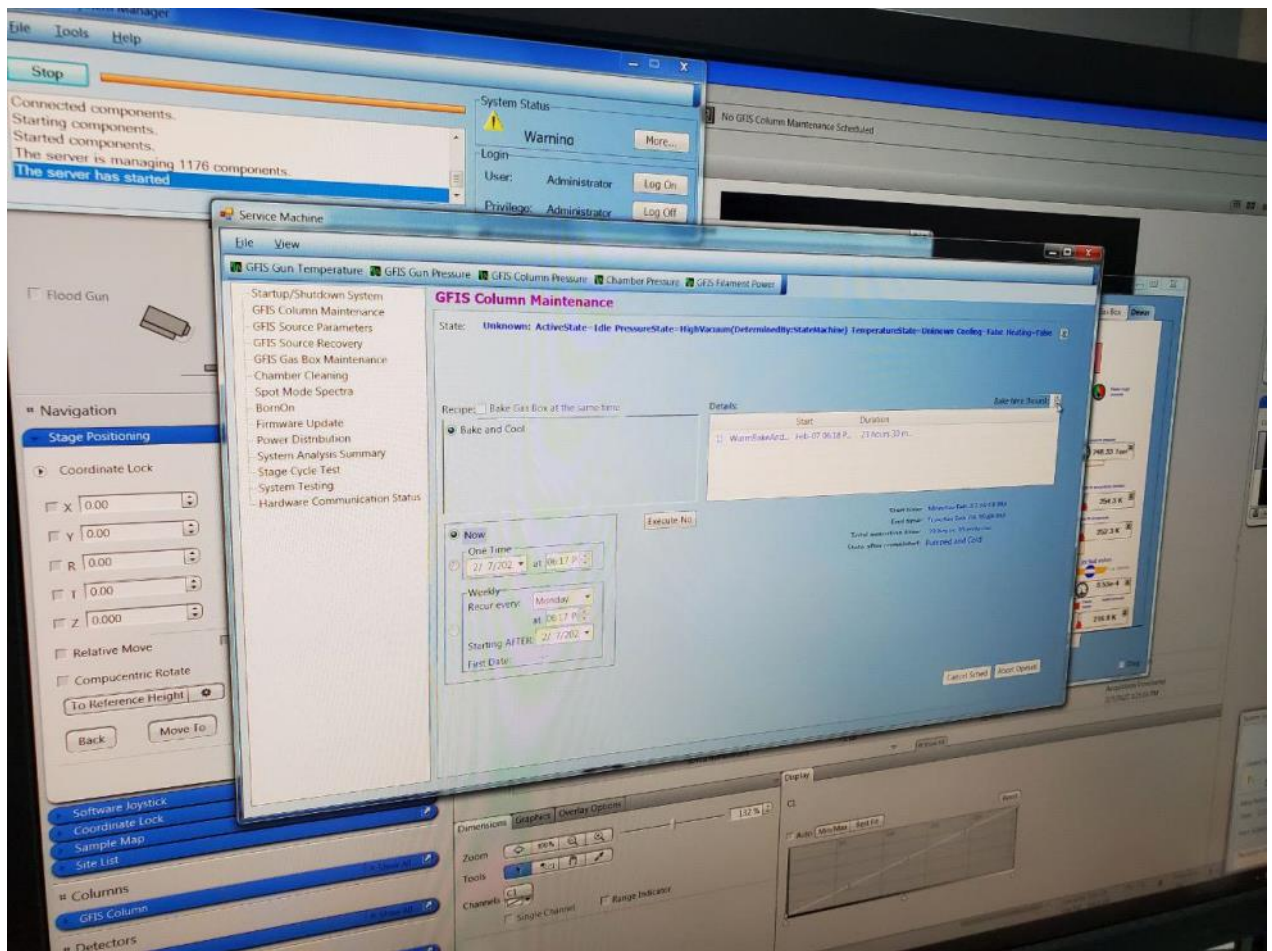

4.

When finish,

1. Plug back lenses and extractor
2. Unplug heating cable
3. In ZEN, start GFIS source maintenance -> source repair -> degas
4. Form the source and trimer

When trimer cannot be formed even at very high, choose decrease BIV source build at form the source stage. Record the BIV number at next trimer formation