T4 Book interconnects

Print sheets 1 and 2 on the two sides of one card, flipping on the long edge. Make three.

V2 bench test

H1 · no net

2 Links at the edge and inboard

E1 At the edge
solder bridge across the wrapped edges

E2 At the edge
stranded wire, 30 mm service loop


E3 At the edge
one ribbon conductor, 30 mm loop

I1 10 mm inboard
stranded wire, 30 mm loop

I2 10 mm inboard
one ribbon conductor, 30 mm loop


1 Edge wraps

Lay each W lane on side A, run the tape over the edge and down side B to the test point behind. W1 and W2 cross the top edge, W3 and W4 the outer edge, W5 and W6 the bottom edge. W1, W3 and W5 are 5 mm tape; W2, W4 and W6 are 12 mm.

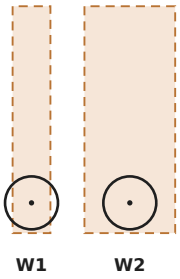

ring axis

H2 · no net

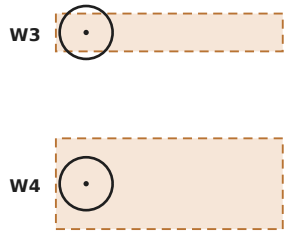

3 The spine contract

Proposed pins, 8 mm apart. Each passes to side B through a wire via.

C1 GND

C2 BUS A

C3 V+

C4 BUS B

C5 GND

H3 · no net

4 Links on the ring axis

X1 On the axis
stranded wire laid 15 mm along it

X2 On the axis
one ribbon conductor laid along it

X3 On the axis
wire under a stitched card patch


X4 On the axis
solder bridge

X5 Your version

H4 · no net

Print three cards: pages 1, 2 and 3 of a test book. Side A, this side, takes each link from the page before; side B sends it on to the page after.


With the book open, the back of one page lies beside the front of the next, so both ends of a link can be probed at once. Sheet 3 says how to build and test the links.

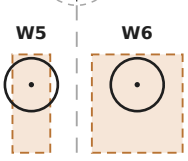

Print at 100 %: this bar should measure 100 mm.

T4 Book interconnects: side B

This side prints on the back of sheet 1. Links leave from here for the next page.

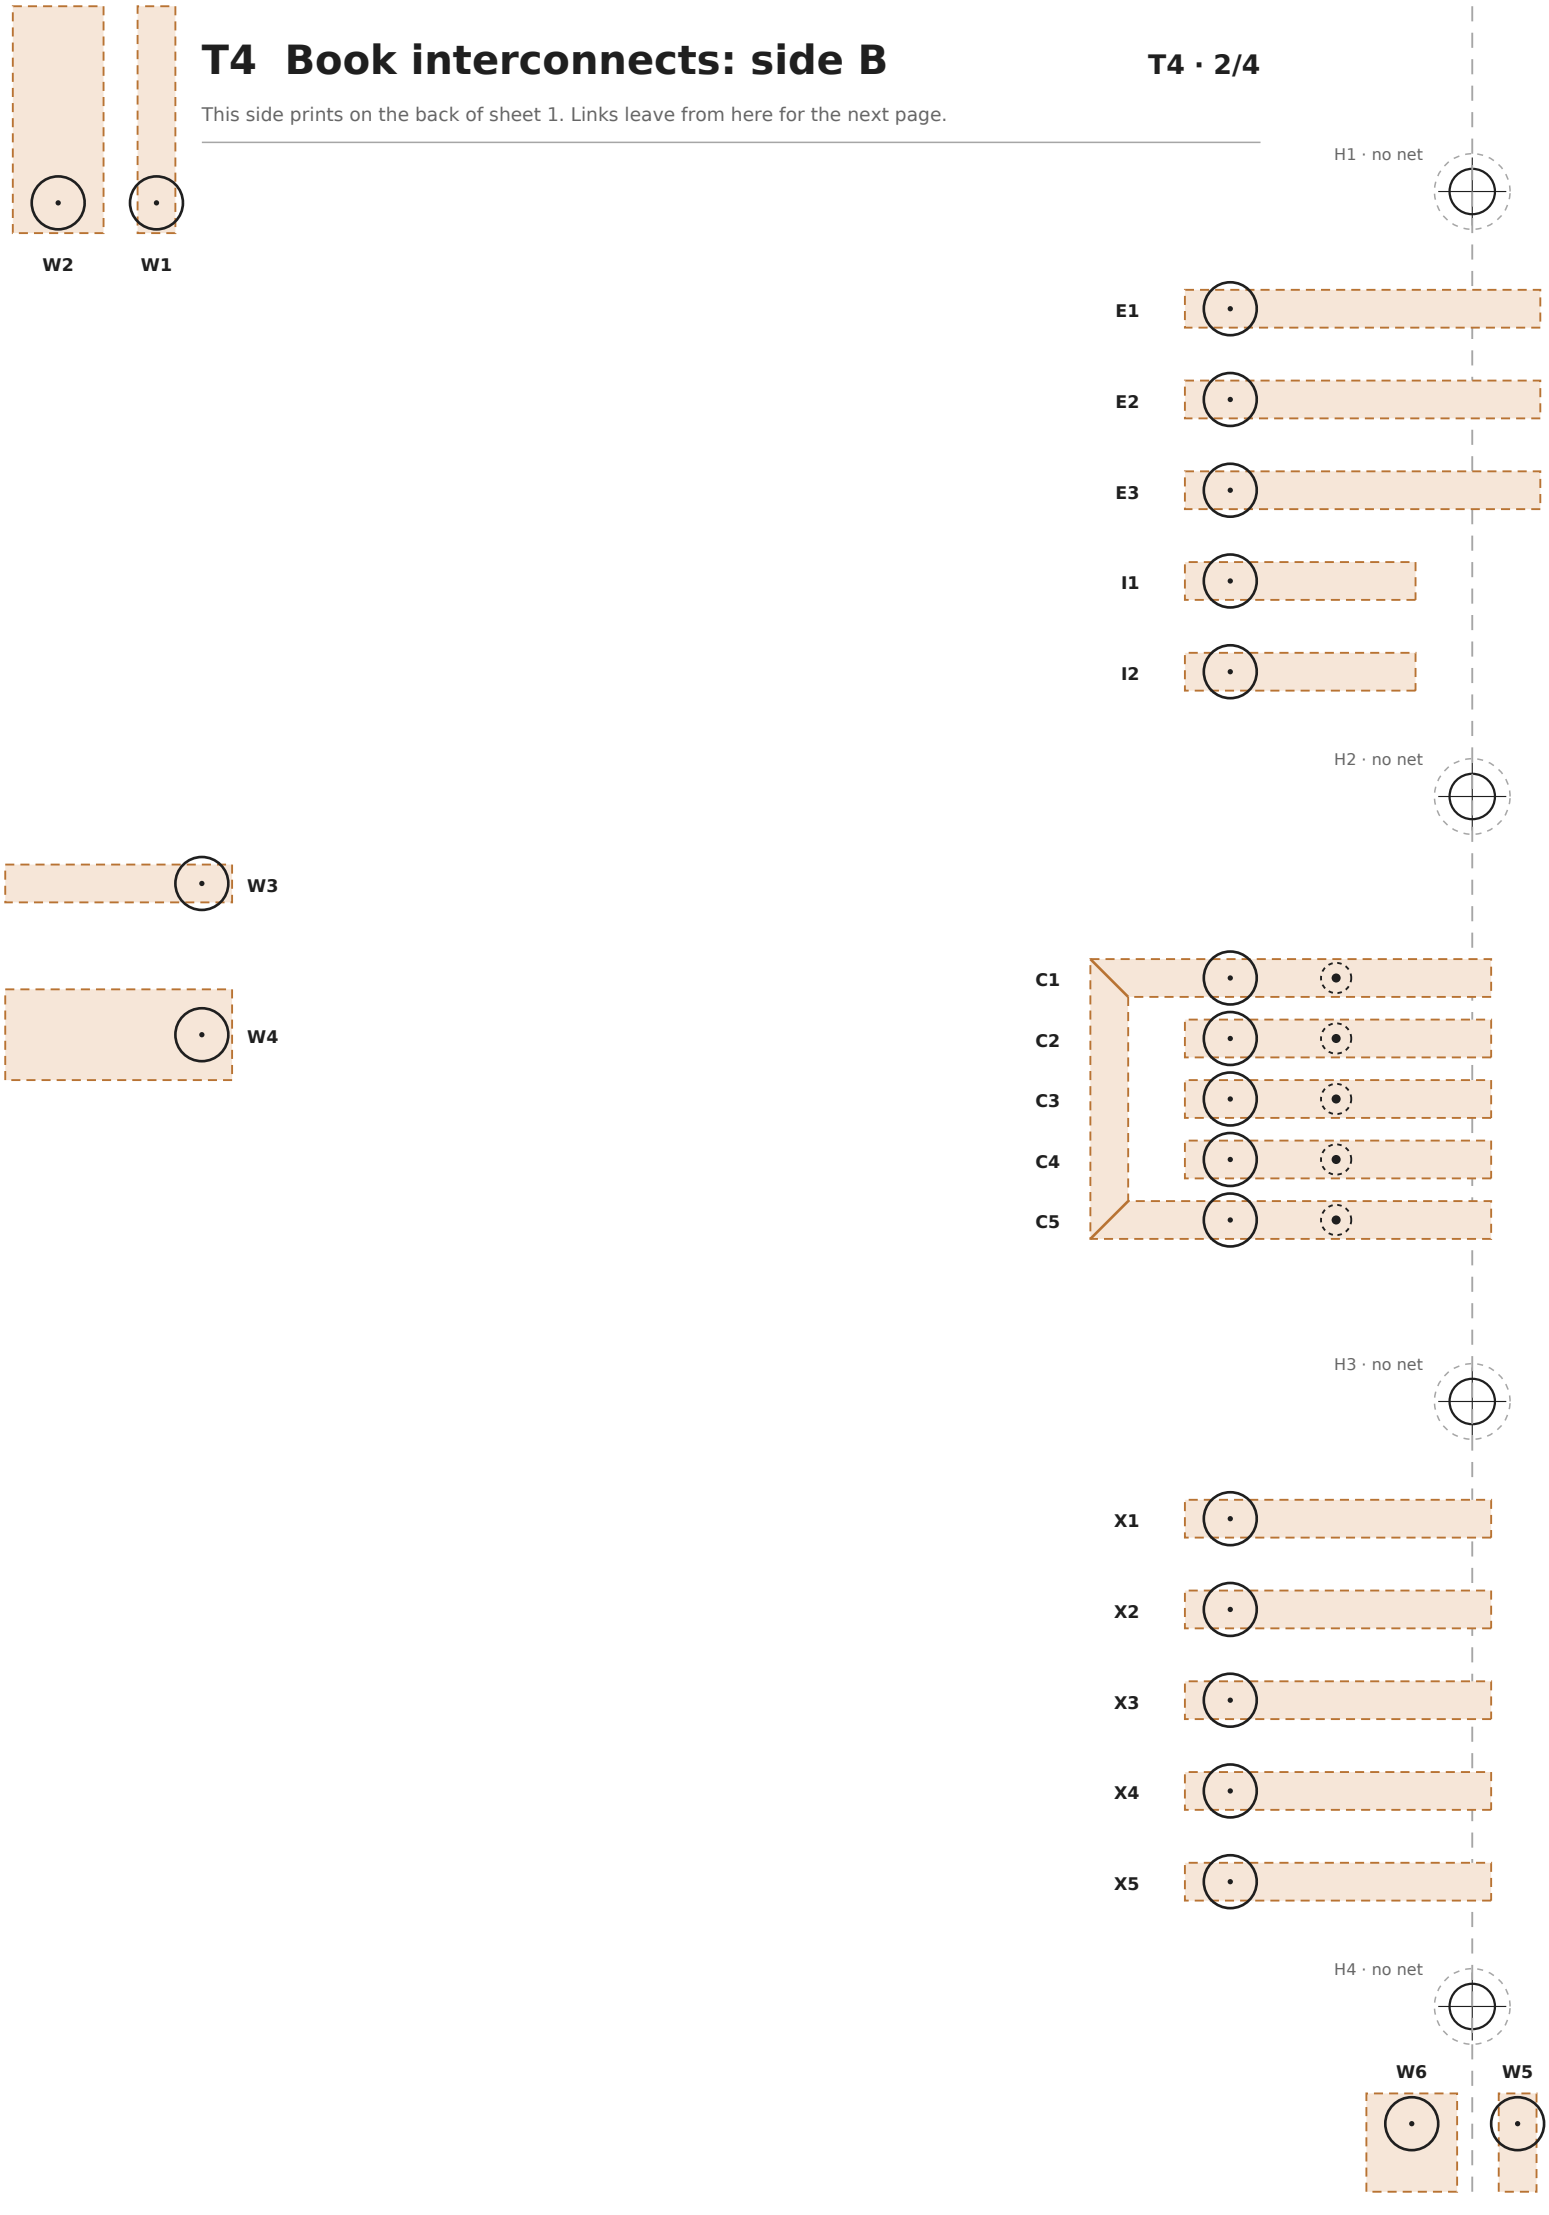

T4 Running the book interconnect tests

Print sheets 3 and 4 once on plain paper. Print sheets 1 and 2 double-sided on card, three times.

H1 · no net

You need

- Three cards printed double-sided (sheets 1 and 2), and a ring binder that fits them
- 5 mm and 12 mm copper tape, solder and a soldering iron
- Stranded hookup wire, about 28 AWG, and a strip of ribbon cable
- Thin card, clear tape, a needle and thread for strain relief
- A 100 Ω resistor (¼ W or more), a 3 × AA holder and clip leads
- A multimeter with a 200 mV range

1 · Wraps

1. Lay W1 to W6 on side A of one card, run the tape over the edge and on down side B to the test point behind. Burnish the fold.

2. Measure each wrap from its side A test point to its side B test point, as in step 3.

3. Bend each wrapped edge back and forth ten times and measure again. Look for cracks.

2 · Build the test book

H2 · no net

1. On all three cards, lay every link lane (E1 to X5) and the contract lanes (C1 to C5) on both sides.

2. Make the contract block's wire vias: push a cut-off resistor leg through each via mark and solder it on both sides.

3. Bind the cards in order, page 1 on top.

4. For every row, join the back of page 1 to the front of page 2, and the back of page 2 to the front of page 3, the way the row's label says. Keep each solder joint at least 5 mm from the ring axis, except X4's, which tests a joint on it. On the axis rows, lay the wire or ribbon along the axis between the two joints.

5. Join C1 to C5 the same way, with a five-conductor strip of ribbon laid along the axis.

3 · Measuring a link

1. Clip the holder, the 100 Ω resistor and the link in a loop: holder +, resistor, the link's test point on the back of one page, the link, its test point on the front of the next page, holder −.

2. Measure the voltage across the resistor and divide by 100 Ω: that's the current, about 45 mA.

3. On the 200 mV range, measure from one test point to the other. 4.5 mV at 45 mA is 0.1 Ω.

H3 · no net

4 · The spine contract chain

1. Clip the holder to page 1: red to C3 (V+), black to C1 (GND).

2. Clip the 100 Ω resistor across C3 and C1 on page 3.

3. Measure each of C1, C3 and C5 from one page to the next on the 200 mV range. Measure C2 and C4 as in step 3.

5 · Flex cycles

1. One cycle: open the spread between pages 1 and 2 all the way, close it, then do the same for pages 2 and 3.

2. Measure every link after 10, 100, 500 and 1,000 cycles.

3. While turning the pages slowly, watch the meter across the load on page 3. Any jump is a flicker; note which link moved.

4. Check every joint with a magnifier for cracks, lifted tape and torn paper.

6 · Repair

1. Unclip the holder. Cut every link to page 2, take it out, bind a fresh page 2 and resolder.

2. Note how long it took, then measure page 2's links again.

Pass or fail

- **Pass:** 0.1 Ω or less after the flex-life target, and steady while the pages turn.
- **Fail:** a crack, lifted tape, torn paper or any flicker.
- Links at the edge move about 24 mm each cycle. If they fail, the V2 standard will prohibit them.

H4 · no net

T4 Results

Readings in mV at the measured current. Divide by the current for ohms.

H1 · no net

Wraps, side A to side B

	New	Bent	Cracks?
W1			
W2			
W3			
W4			
W5			
W6			

The spine contract chain

Current, from the load: _____ mA

	1 to 2	2 to 3
C1 GND		
C2 BUS A		
C3 V+		
C4 BUS B		
C5 GND		

H2 · no net

Results for the standard

Best link construction	
Closest safe distance from the axis	
Service loop needed	
Wrap tape: 5 mm or 12 mm	
Flex-life target met (cycles)	
Constructions to prohibit	

H3 · no net

Links, page 1 to page 2

	0	10	100	500	1,000	Flicker?
E1						
E2						
E3						
I1						
I2						
X1						
X2						
X3						
X4						
X5						

Links, page 2 to page 3

	0	10	100	500	1,000	Flicker?
E1						
E2						
E3						
I1						
I2						
X1						
X2						
X3						
X4						
X5						

H4 · no net