

GARMIN®

AVIATION TRAINING

Upgrading the G1000: Technician Fundamentals

From NAV III to Perspective+
NXi Upgrade Fundamentals

Garmin Aviation Training is intended to provide the best practices for the installation, use and maintenance of Garmin Aviation products. It is incumbent on technicians and pilots to ensure that the instructions contained in the most recent versions of Garmin product manuals, bulletins and notifications are followed.

© GARMIN LTD. OR ITS SUBSIDIARIES. ALL RIGHTS RESERVED.


Objectives

Monday, March 30, 2026

- ✈ Notes from Field Service on NXi Upgrades
- ✈ Pre Installation Double Checks using the Garmin STC Addendums and Equipment Lists
- ✈ Post Installation Double Checks for Delivery

Objectives

Monday, March 30, 2026

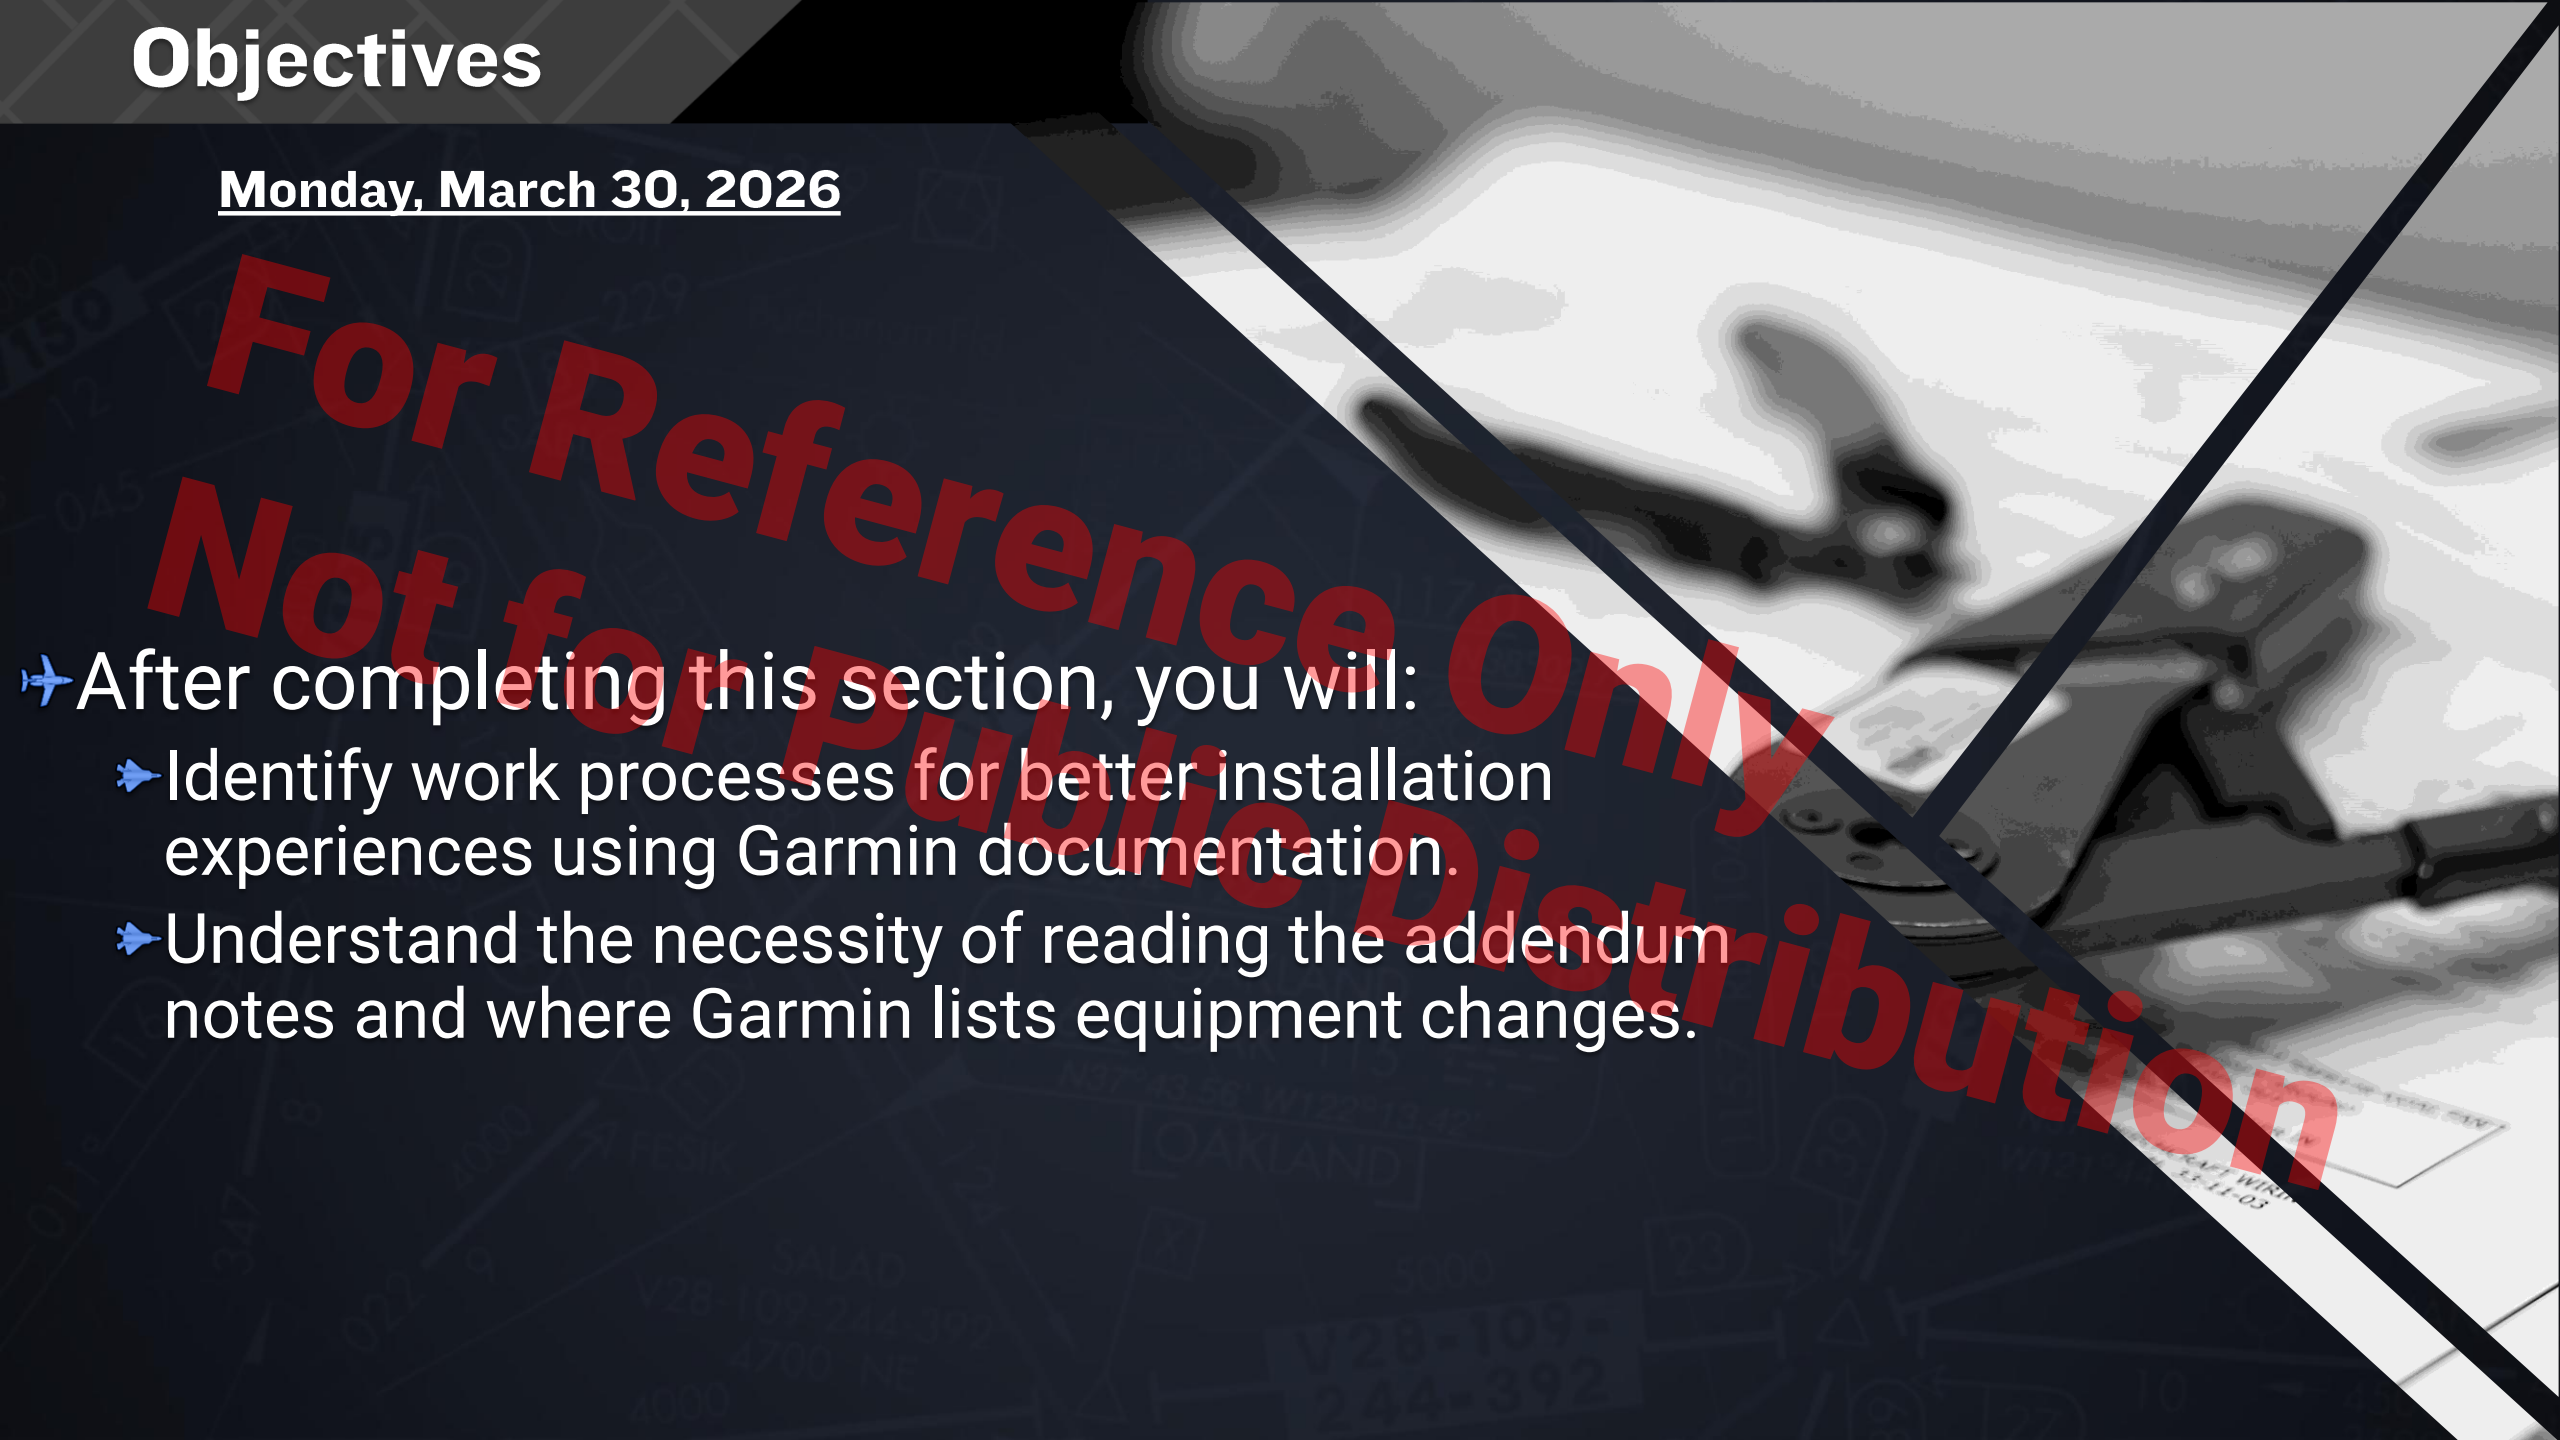- 
- The background of the slide features a grayscale photograph of a person, likely a technician, working on a piece of electronic equipment. A large, semi-transparent red watermark is overlaid diagonally across the entire slide, reading "For Reference Only Not for Public Distribution".
- ✈ After completing this section, you will:
 - ✈ Identify work processes for better installation experiences using Garmin documentation.
 - ✈ Understand the necessity of reading the addendum notes and where Garmin lists equipment changes.

Garmin Training Center: Course

[training.garmin.com/Saba/Web_spf/NA10P1PRD010/app/me/learningeventdetail:spf-url=common%2Fledetail%2Fcourse000000000046732%3Freturnurl%3Dcatalog%252Fsearch%253FsearchText%253Dfundamentals%2526selectedTa...](#)
Paused

GARMIN.
Browse
Learning Catalog
Enter text to search...

[< Back](#)

Garmin Technician Fundamentals | Retrofit Avionics eLearning Course
Course | ID: 0000044652
Not Registered

LAUNCH

Overview

The Garmin Technician Fundamentals | Retrofit Avionics eLearning Course can help you master the essential skills to be a Garmin technician.

The course showcases how to find and use the technical information needed to install and maintain Garmin avionics. Additionally, this course offers practical troubleshooting tips. You will be introduced to Garmin's Troubleshooting Guidance, a framework that is

[Show More](#)

Other Classes

Available
Completed
Filters

1 Available class(es).

English | Web-Based | Class ID: 0000256966
Total duration: 03:00 Hrs | [Check cancellation policy](#)

Show More

LAUNCH

Other Information

- ✈️ Boost in features and performance of the basic G1000 system
 - ✈️ Faster processor, higher resolution
 - ✈️ Advanced situational awareness features such as Surface Watch, HSI Map etc.
 - ✈️ Easier maintenance with Smart LRU Replacement



- ✈ Displays are the same size and use mostly the same wiring
- ✈ There are some background changes and limitations:
 - ✈ GTX 345R
 - ✈ Active Traffic systems
 - ✈ Complications with older LRUs, OEMs, software level compatibilities



- ✈️ Dealers may purchase hardware kits directly from Garmin for install, but must purchase software from the OEM
- ✈️ If the customer previously completed the G1000 NXi upgrade and would like the latest software, dealers will need to request it from Garmin
 - ✈️ Must provide aircraft serial number and date of G1000 NXi installation
 - ✈️ Copy of Logbook is sufficient

- ✈ Read the service bulletin notes before starting.
- ✈ Repair Shop reports we see a ton of missed boot block loads that should be accomplished with the old GDU's installed.



Not for Reference Only
Distribution

3. MAIN SOFTWARE AND DATABASE UPDATE




CAUTION

While performing this procedure make sure the aircraft is connected to and drawing power from a ground power unit. A loss of power during this procedure may result in an unresponsive LRU, which may require replacement.



CAUTION


For installations with 011-01105-00 or 011-01105-01 GIA 63Ws, the boot block (006-B1881-00) must be loaded before the system software. Failure to do so may result in an inoperative GIA 63W. The 006-B1881-00 boot block is available on <https://dealers.garmin.com>.

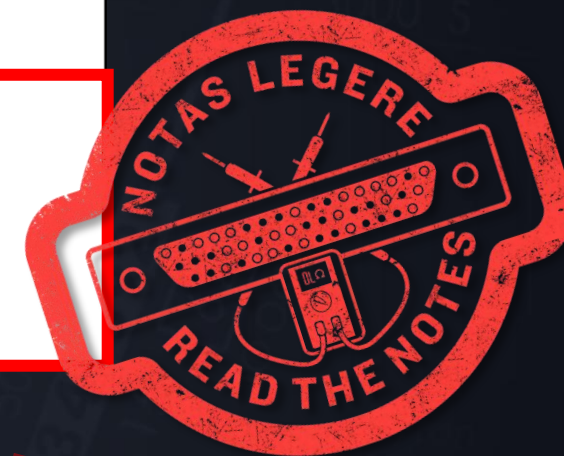

✈ Most often overlooked mistake:

✈ STC Service Bulletin 1917

- ✈ You must install GIA 63W Boot Block software version 6.10 BEFORE removing the legacy displays.
- ✈ Cannot load the boot block with the NXi display units

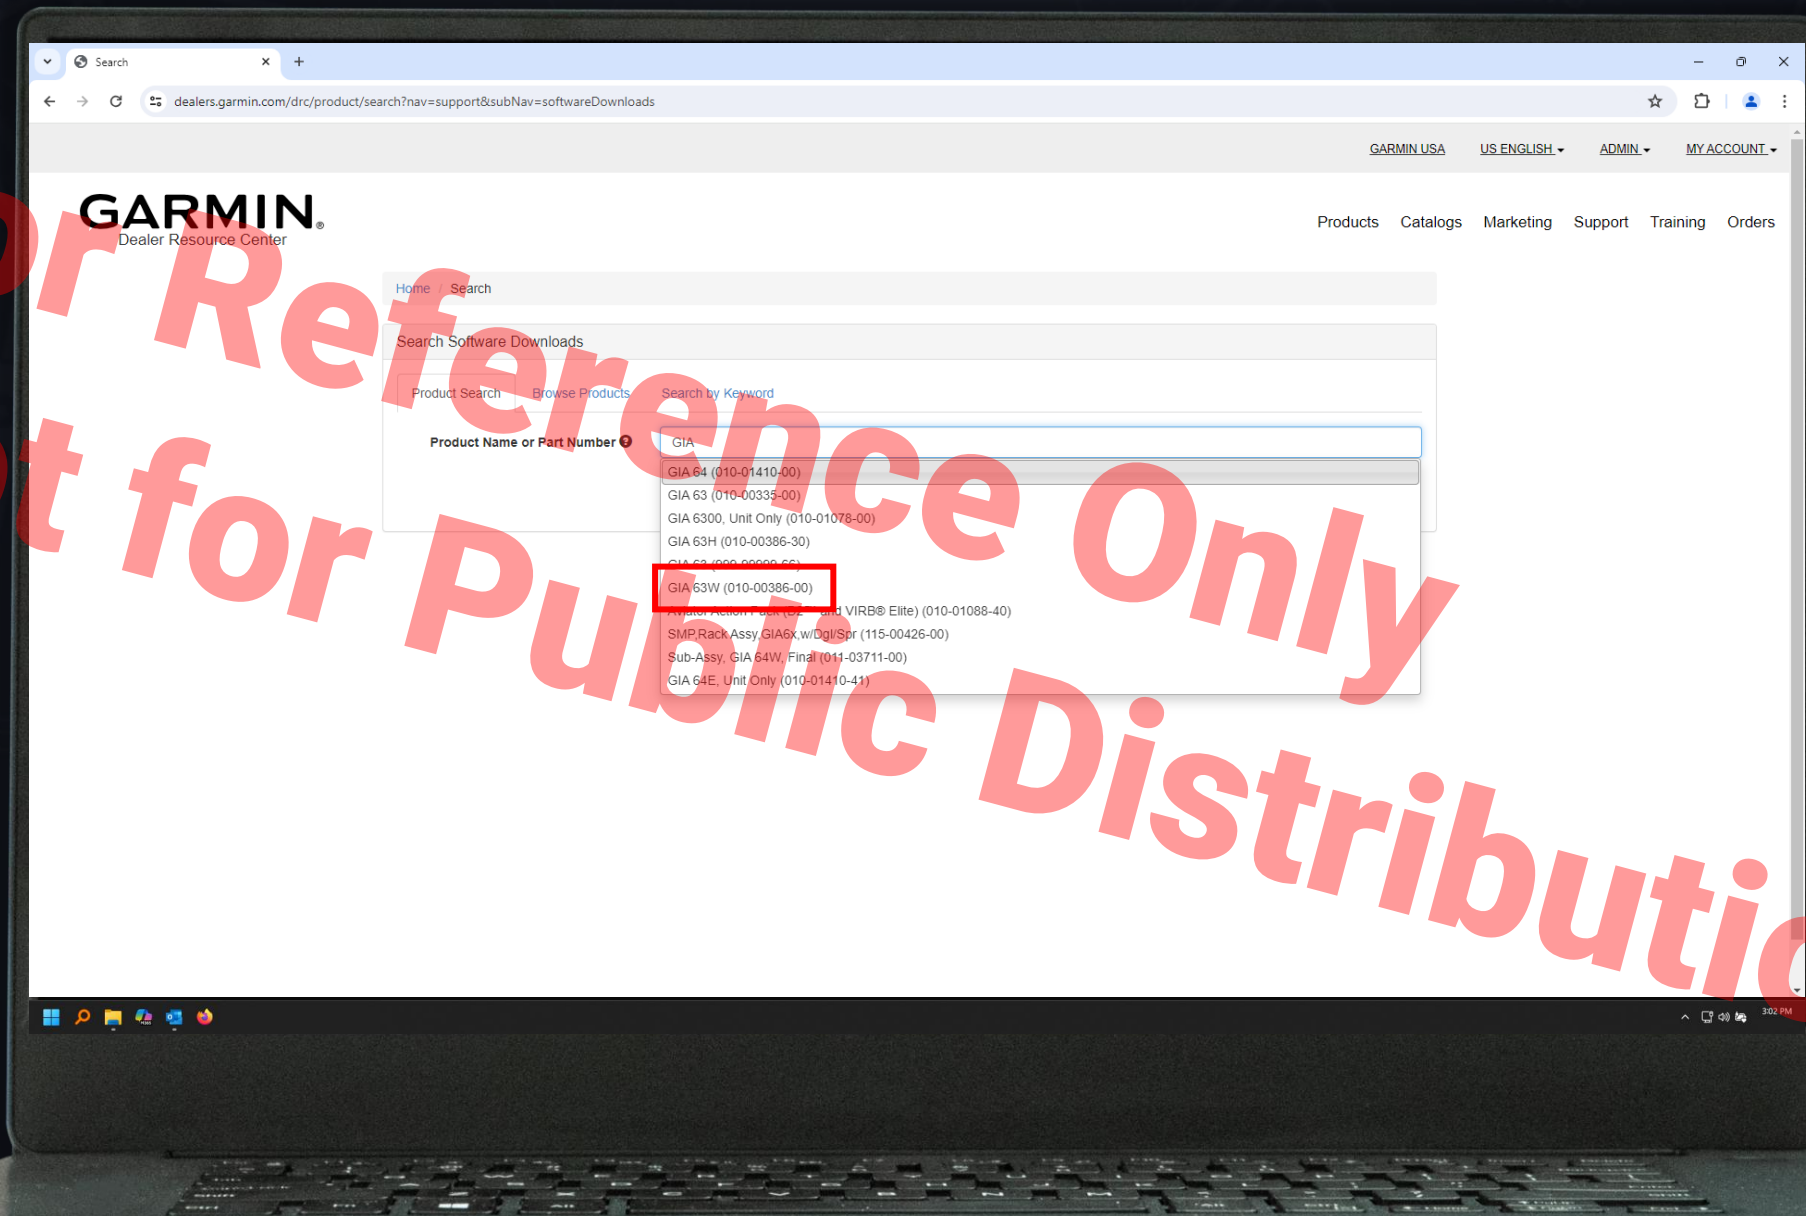

GIA 63W

010-00386-00

Software Downloads Service & Installation Bulletins Engineering Drawings Service Communiqués & Letters

Software Downloads

1 items found.

Type: All Keyword(s) Clear Search Filter

NAME	FILE SIZE	TYPE	PUBLISH DATE	PUBLISH END DATE	STATUS
+ GIA 63W Boot Block Loader Version 6.10	2.29 MB	Software Updates	December 10, 2014		 Select Action

For Reference Only
Not for Public Distribution

The screenshot shows the Garmin Dealer Resource Center (DRC) website. The browser address bar displays the URL: `dealers.garmin.com/drc/support?partNumber=010-00386-00&subNav=softwareDownloads&productName=GIA+63W`. The page header includes the Garmin logo and navigation links for Products, Catalogs, Marketing, Support, Training, and Orders. The main content area is titled 'GIA 63W' with the part number '010-00386-00'. Below this, there are tabs for 'Software Downloads', 'Service & Installation Bulletins', 'Engineering Drawings', and 'Service Communiqués & Letters'. The 'Software Downloads' tab is active, showing a search bar and a table of software items. The table has columns for NAME, FILE SIZE, TYPE, PUBLISH DATE, PUBLISH END DATE, and STATUS. One item is listed: 'GIA 63W Boot Block Loader Version 6.10' with a file size of 2.29 MB, type of Software Updates, and a publish date of December 10, 2014. The 'Download' button for this item is highlighted with a red box.

NAME	FILE SIZE	TYPE	PUBLISH DATE	PUBLISH END DATE	STATUS
➕ GIA 63W Boot Block Loader Version 6.10	2.29 MB	Software Updates	December 10, 2014		✓

Download

- ✈️ Read the service bulletin notes before starting. We see a ton of missed boot block loads that should be accomplished with the old GDU's installed.
- ✈️ Pay attention to part numbers of GIA's installed as compared to what the general arrangement drawing calls out as required.

Not for Reference Only
Not for Public Distribution

ITEM NUMBER	HARDWARE			SOFTWARE			SYSTEM STATUS REPORT
	DESCRIPTION	PART NUMBER	MOD STATUS ⁶	DESCRIPTION	PART NUMBER	VERSION	
----	----	----	----	TEXTRON NAV III SOFTWARE IMAGE	006-B4013-00	4013.00	ITD
1	GIA 63W NO 1	011-01105-00 OR 011-01105-01 OR 011-01105-20	-00 NONE, 1 -01, -20 NONE	SYSTEM	006-B0544-6D	8.07	GIA1
				AUDIO	006-D5278-03	2.03	GIA1 AUDIO
				GPS	006-B0339-21 ⁵	5.1	GPS1
				COM ⁸	006-B0081-XX ⁵	11.10	COM1
				NAV ⁸	006-B0082-12 ⁵	6.02	NAV1
				NAV FPGA	006-C0124-00 ⁵	1.0	NAV1 FPGA
2	GIA 63W NO 2	011-01105-00 OR 011-01105-01 OR 011-01105-20	-00 NONE, 1 -01, -20 NONE	AFCS CERTIFICATION GAINS	006-D0887-03 ¹ 006-D0270-16 ² 006-D0621-15 ³	2.03 2.06 2.05	GFC CERT GIA1
				SYSTEM	006-B0544-6D	8.07	GIA2
				AUDIO	006-D5278-03	2.03	GIA2 AUDIO
				GPS	006-B0339-21	5.1	GPS2
				COM ⁸	006-B0081-XX ⁵	11.10	COM2
				NAV ⁸	006-B0082-12 ⁵	6.02	NAV2
3	GDU 1054B PFD or GDU 1050 PFD ⁴	011-03470-70 or 011-03470-00 ⁴	NONE	AFCS CERTIFICATION GAINS	006-D0887-03 ¹ 006-D0270-16 ² 006-D0621-15 ³	2.03 2.06 2.05	GFC CERT GIA2
				SYSTEM	006-B1177-56	20.05	PRD1
				SYSTEM	006-B1177-56	20.05	MDR1
				SYSTEM	006-B0203-44	4.04	GFA1
				SYSTEM	006-B0193-05	2.07	GFA1
				SYSTEM	006-B0261-19	3.09	GFC1
7	GDC 74A (LEGACY)	011-00882-00 OR 011-00882-10	-00 NONE -10 NONE	FPGA	006-C0055-00	01.05	GDC1 FPGA
				SYSTEM	006-B0223-22	3.02	GFS1
8	GRS 77 (LEGACY)	011-00868-10	1, 2, []	FPGA	006-C0049-00	02.00	GRS1 FPGA
9	GMU 44 MAGNETOMETER	011-00870-00 OR 011-00870-10	-00 [1] -10 NONE	SYSTEM	006-B0224-01	2.05	GMU1
				FPGA	006-C0048-00	2.00	GMU1 FPGA
10	GTX 33 W/ ES (LEGACY)	011-00779-30	NONE, 2	SYSTEM	006-B0172-12	8.02	GTX1
				SYSTEM	006-B1607-0K	2.60	GTX1
	GTX 33SR (OPTIONAL)	011-03301-00	NONE	SYSTEM FPGA	006-C0153-22	2.20	GTX1 FPGA
				SYSTEM	006-B1607-0K	2.60	GTX1
	GTX 34SR (OPTIONAL)	011-03303-00 OR 011-03303-01	NONE	SYSTEM FPGA	006-C0153-22	2.20	GTX1 FPGA
				ADS-B SYSTEM	006-B1797-16	3.21	GTX1 ADS-B SYSTEM
				ADS-B FPGA	006-C0157-21	2.10	GTX1 ADS-B FPGA

ITEM NUMBER	HARDWARE			SOFTWARE			SYSTEM STATUS REPORT
	DESCRIPTION	PART NUMBER	MOD STATUS ⁶	DESCRIPTION	PART NUMBER	VERSION	
11	GTS 800 TAS (OPTIONAL)	011-01356-00	NONE	SYSTEM	006-B0551-30	4.00	GTS
				SYSTEM FPGA	006-C0081-20	2.0	GTS FPGA
				GTS REGION LIST	006-D0725-02	4.00	GTS RGN LIST
12	GDL 69A DATALINK (LEGACY, OPTIONAL)	011-00987-00	NONE	SYSTEM	006-B0317-22	4.02.00	GDL69
				SYSTEM	006-B1902-04	5.10	GDL69
	GDL 69A SXM DATALINK (OPTIONAL)	011-03177-10	NONE	XM SYSTEM	006-B2181-03	1.20	GDL69 FIRMWARE
				APP SYSTEM	006-D5402-02	1.10	GDL69 PACKAGE
13	GSA 81 PITCH SERVO	011-00878-00	NONE	SYSTEM	006-B0398-32	2.30	GSA PITCH CTL
				AFCS CERTIFICATION GAINS	006-D0887-03 ¹ 006-D0270-16 ² 006-D0621-15 ³	2.03 2.06 2.05	GSA PITCH MON
				SYSTEM	006-B0398-32	2.30	GFC CERT P C
14	GSA 81 ROLL SERVO	011-00878-00	NONE	SYSTEM	006-B0398-32	2.30	GFC CERT P M
				AFCS CERTIFICATION GAINS	006-D0887-03 ¹ 006-D0270-16 ² 006-D0621-15 ³	2.03 2.06 2.05	GSA ROLL CTL
				SYSTEM	006-B0398-32	2.30	GSA ROLL MON
15	GSA 81 PITCH TRIM SERVO	011-00878-00	NONE	SYSTEM	006-B0398-32	2.30	GFC CERT R C
				AFCS CERTIFICATION GAINS	006-D0887-03 ¹ 006-D0270-16 ² 006-D0621-15 ³	2.03 2.06 2.05	GFC CERT R M
				SYSTEM	006-B0398-32	2.30	GSA PITCH TRM CTL
16	FLIGHT STREAM 510 (OPTIONAL)	011-03595-00	NONE	SYSTEM	006-B2021-6(X) ⁷	2.6(X)	GSA PITCH TRM MON
				SYSTEM	006-B2021-6(X) ⁷	2.6(X)	GFC CERT PT C
				SYSTEM	006-B2021-6(X) ⁷	2.6(X)	GFC CERT PT M
				SYSTEM	006-B2021-6(X) ⁷	2.6(X)	FSS10

TABLE 1A NOTES:

1. GAINS P/N 006-D0887-03 APPLICABLE ONLY TO MODEL 172R / 172S AIRCRAFT WITH GFC 700 AFCS.
2. GAINS P/N 006-D0270-16 APPLICABLE ONLY TO MODEL 182T / T182T AIRCRAFT.
3. GAINS P/N 006-D0621-15 APPLICABLE ONLY TO MODEL 206H / T206H AIRCRAFT.
4. GDU 1050 PFD AND MFD, P/N 011-03470-00 ONLY APPLICABLE TO MODEL 172 AIRCRAFT NOT EQUIPPED WITH GARMIN GFC 700 AFCS.
5. APPLICABLE TO P/N 011-01105-20 GIA 63W ONLY.
6. A REQUIRED MOD STATUS FOR THE CURRENT REVISION OF THE MDL IS INDICATED IN SQUARE BRACKETS. A MOD STATUS NOT IN BRACKETS ARE OPTIONAL. A MOD STATUS NOT LISTED IS NOT ALLOWED.
7. FLIGHT STREAM 510 FIRMWARE IS NOT LOADED VIA THE VERSION 4013.00 SOFTWARE LOADER IMAGE. CONTACT GARMIN PRODUCT SUPPORT OR REFER TO THE POST INSTALLATION CHECKOUT PROCEDURE (190-02765-00) FOR FLIGHT STREAM FIRMWARE UPDATE PROCEDURES. FLIGHT STREAM SOFTWARE VERSION 2.62 OR HIGHER TO VERSION 2.69 IS APPROVED FOR INSTALLATION.
8. THESE ITEMS ARE FACTORY LOADED TO GIA 63W -00 AND -01 UNITS AND ARE NOT LOADED VIA THE LOADER CARD. THE FACTORY LOADED COM SOFTWARE IS 006-B0081-XX, VERSION 7.00 AND THE FACTORY LOADED NAV SOFTWARE IS 006-B0082-XX, VERSION 5.03.

TABLE 1A - GARMIN EQUIPMENT/SOFTWARE LIST, G1000 NXI

GARMIN®				Garmin Ltd. or its subsidiaries c/o Garmin International, Inc. 1200 E. 151st Street Olathe, Kansas 66062 U.S.A.			
SIZE	DWG. NO.	005-01474-01			REV.	2	
B	SCALE:	NONE			SHT.	2	OF 5

General Arrangement

HARDWARE				SOFTWARE			SYSTEM STATUS	
ITEM								
ITEM NUMBER	DESCRIPTION	PART NUMBER	MOD STATUS ⁶	DESCRIPTION	PART NUMBER	VERSION	SYSTEM STATUS REPORT	
1	GIA 63W NO 1	011-01105-00 OR 011-01105-01 OR 011-01105-20	-00 NONE, 1 -01, -20 NONE	TEXTRON NAV III SOFTWARE IMAGE	006-B4013-00	40	GIA1	
				SYSTEM	006-B0544-6D	3.07	GIA1	
				AUDIO	006-D5278-02	2.03	GIA1 AUDIO	
				GPS	006-B0339-21	5.1	GPS1	
				COM ⁸	006-B0082-15	11.10	COM1	
				NAV ⁸	006-B0082-15	6.02	NAV1	
				NAV FPGA	006-C0124-00	1.0	NAV1 FPGA	
				AFCS CERTIFICATION	006-D0887-03 ¹	2.03	AFCS	
				GAINS	006-D0270-16 ²	2.00	GAINS	
					006-D0621-15 ³	2.05		
2	GIA 63W NO 2	011-01105-00 OR 011-01105-01 OR 011-01105-20	-00 NONE, 1 -01, -20 NONE	SYSTEM	006-B0544-6D	3.07	GIA2	
				AUDIO	006-D5278-02	2.03	GIA2 AUDIO	
				GPS	006-B0339-21	5.1	GPS2	
				COM ⁸	006-B0082-15	11.10	COM2	
				NAV ⁸	006-B0082-15	6.02	NAV2	
				NAV FPGA	006-C0124-00	1.0	NAV2 FPGA	
				AFCS CERTIFICATION	006-D0887-03 ¹	2.03	AFCS	
				GAINS	006-D0270-16 ²	2.00	GAINS	
					006-D0621-15 ³	2.05		

TABLE 1A - GARMIN EQUIPMENT/SOFTWARE LIST, G1000 NXI				SIZE B	DWG. NO. 005-01474-01	REV.
				SCALE: NONE	SHT. 2	OF 5

TABLE 1A - GARMIN EQUIPMENT/SOFTWARE LIST, G1000 NXI

SIZE B	DWG. NO. 005-01474-01	REV. 2
SCALE: NONE	SHT. 2 OF 5	

- ✈ Read the service bulletin notes before starting. We see a ton of missed boot block loads that should be accomplished with the old GDU's installed.
- ✈ Pay attention to part numbers of GIA's installed as compared to what the service bulletin calls out as required.
- ✈ Before removing GDU's please put together a list of items installed on the aircraft. Especially paying close attention to third party non-Garmin LRU's. Check for any aftermarket modifications.




NOTES

Do not trust the equipment list completely.

Double check, and make sure, it is up to date with all modifications and equipment, prior to starting Install.

- ✈️ Read the service bulletin notes before starting. We see a ton of missed boot block loads that should be accomplished with the old GDU's installed.
- ✈️ Pay attention to part numbers of GIA's installed as compared to what the service bulletin calls out as required.
- ✈️ Before removing GDU's please put together a list of items installed on the aircraft. Especially paying close attention to third party non-Garmin LRU's. Check for any aftermarket modifications.
- ✈️ Get all enablement cards together and make sure before enabling a particular option it is still being used by the customer. Chartview, Etc...

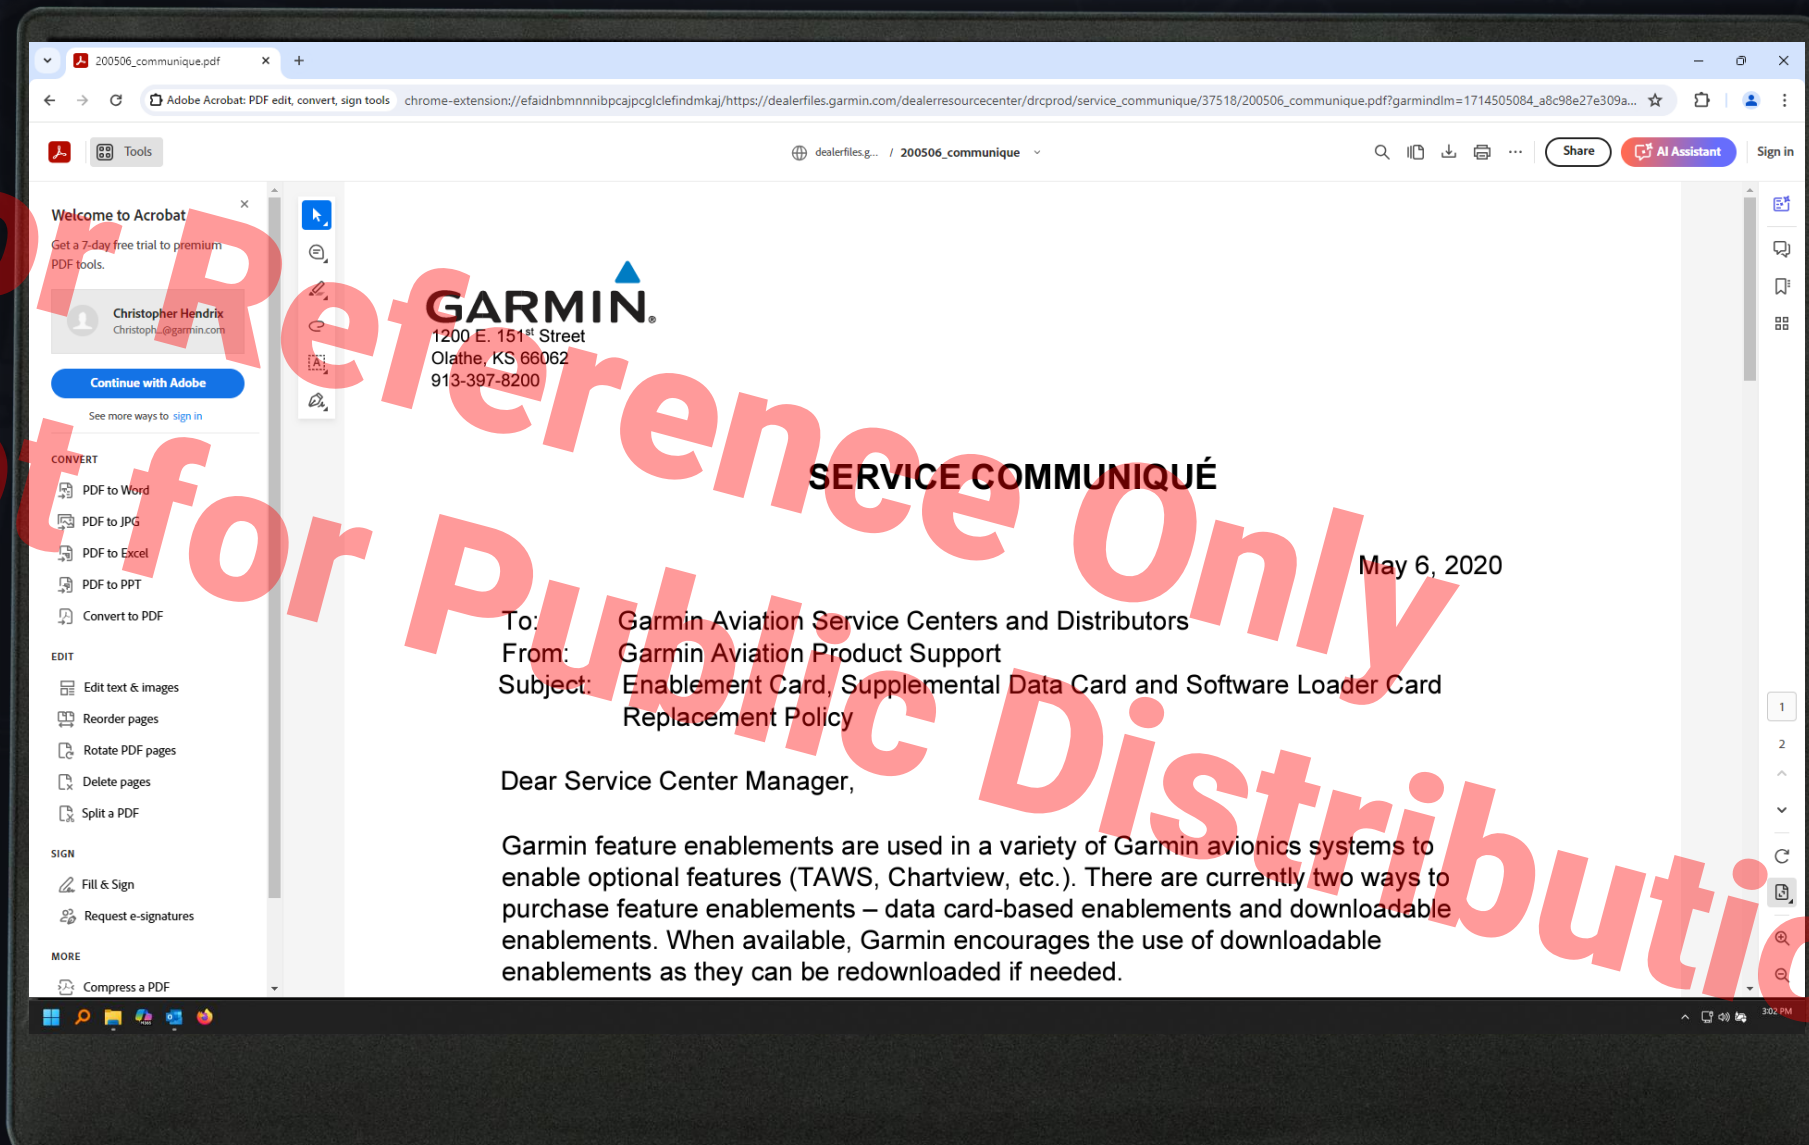

- ✈️ Read the service bulletin notes before starting. We see a ton of missed boot block loads that should be accomplished with the old GDU's installed.
- ✈️ Pay attention to part numbers of GIA's installed as compared to what the service bulletin calls out as required.
- ✈️ Before removing GDU's please put together a list of items installed on the aircraft. Especially paying close attention to third party non-Garmin LRU's. Check for any aftermarket modifications.
- ✈️ Get all enablement cards together and make sure before enabling a particular option it is still being used by the customer. Chartview...!
- ✈️ Call first before loading software if you have any questions.

- For Reference Only**
Not for Public Distribution
- ✈ Dealer Aviation Support:
 - ✈ 888-606-5482
 - aviation.support@garmin.com






✈ Questions we were asked before the STC was issued:

✈ Notes on the STC Drawings:

- ✈ Structural modifications
- ✈ General Arrangement Drawings
- ✈ Beware! Third Party STC Compatibility is a thing...
- ✈ NOTAS LEGERE!
- ✈ Start from the end
- ✈ Screen change?
 - ✈ Size considerations?

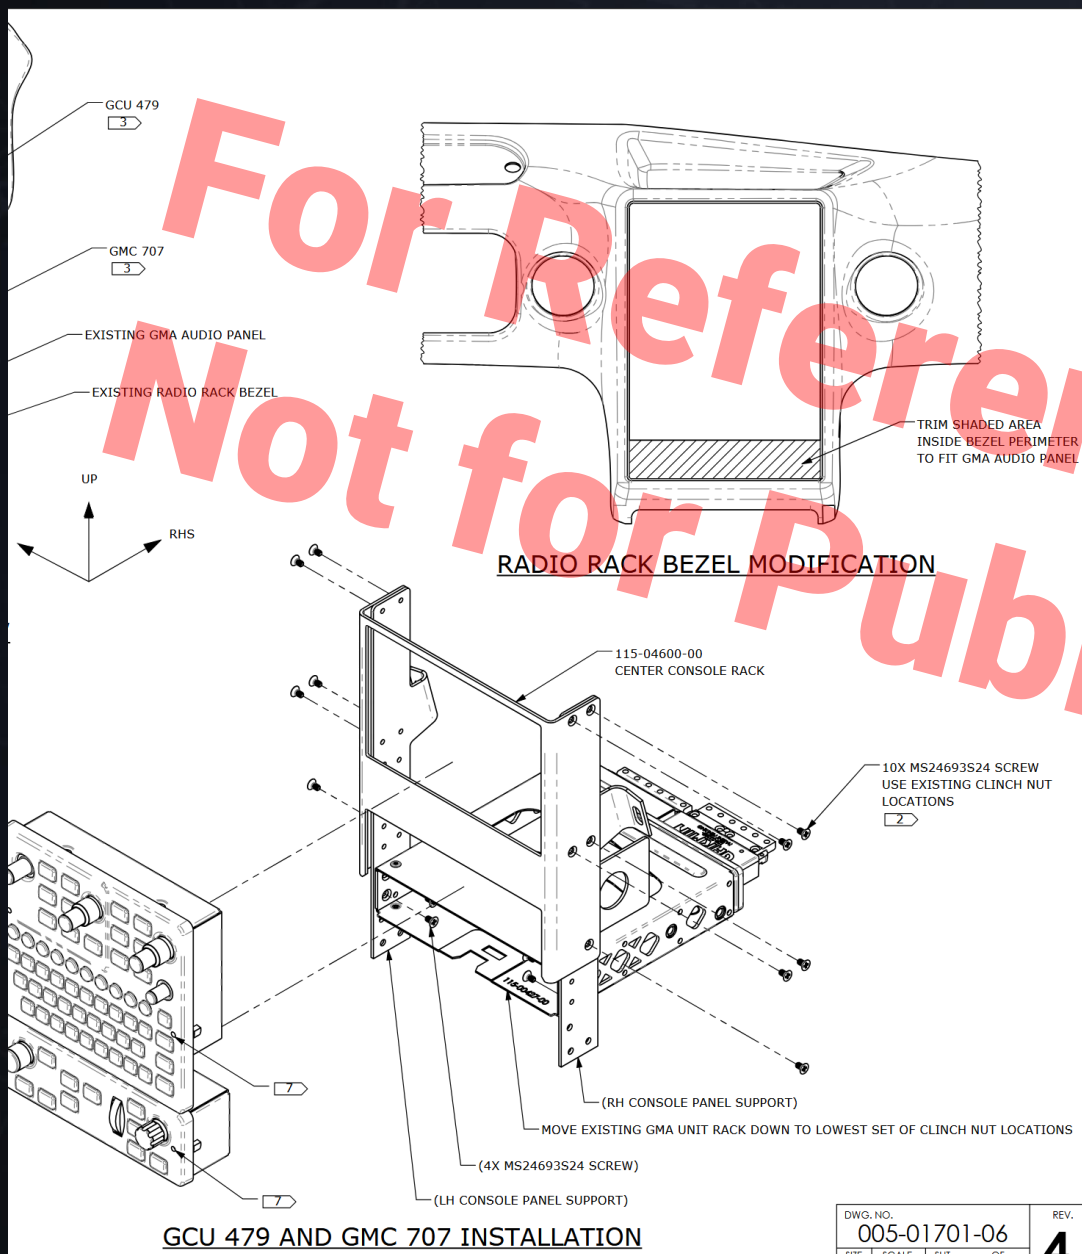

✈️ A center console modification will be required for this upgrade

✈️ A new Radio rack will be installed

Determine Eligibility

↓

NOTES:

1. THIS STC APPROVES G1000 AVIONICS AND HARDWARE UPDATES IN THE CIRRUS SR22 AND IS ELIGIBLE FOR THE FOLLOWING AIRCRAFT AIRCRAFT EQUIPPED WITH PERSPECTIVE (G1000 LEGACY) OR PERSPECTIVE+ (G1000 NXI) AIRCRAFT WITH GSA 63W AND GFC 700 FOR THE FOLLOWING SERIAL NUMBERS:

GENERATION 1 (G1)			GENERATION 2 (G2)			GENERATION 4 (G4)		
MODEL	S/N	ENGINE	MODEL	S/N	ENGINE	MODEL	S/N	ENGINE
SR20	2006-2229 2229-2238	Continental IO-400-40	N/A			SR20	2220, 2339-2434	Lycoming IO-360- C184
SR22 ¹	2992, 0802-2944	Continental IO-350-40	SR22	3315-4434	Continental IO-350-40	SR22	4435-4631	Continental IO-350-40
SR22T	0801-0845	Continental T100-350- 4	SR22T	0442-1476, 1461-1476, 472	Continental T100-350- 4	SR22T	1460-1471, 1479-1749	Continental T100-350- 4

TABLE NOTES:
1. INCLUDES AIRCRAFT EQUIPPED WITH ENGINE TECHNOLOGIES INC (AKA TORONDO ALLEY) STC A2186855 OR CONTINENTAL STC (A2439424) THAT REPLACES THE TORONDO ALLEY ENGINE WITH A CONTINENTAL T100-350-4.

2. REVIEW ALL STC DATA BEFORE PERFORMING UPDATES OF THE G1000 SYSTEM. THE INSTALLER IS RESPONSIBLE FOR ENSURING COMPATIBILITY OF OTHER MODIFICATIONS NOT NOTED.

3. IMPORTANT! - PRIOR TO BEGINNING UPGRADE, PERFORM PRE-MODIFICATION SURVEY OF THE G1000 INSTALLATION AS REQUIRED IN GARMIN DOCUMENT 190-01660-00, POST INSTALLATION CHECKOUT PROCEDURE.

4. THIS DRAWING DEFINES APPROVED G1000 HARDWARE AND SOFTWARE.

5. THIS STC APPROVES INSTALLATION OF NEW PFD AND MFD DISPLAYS, GCU 476 PFD CONTROLLER, AND GNC 707 AFCS CONTROLLER. THIS STC ALSO APPROVES THE FOLLOWING OPTIONAL EQUIPMENT:

- G2 275 STANDBY INDICATOR (G3/G5 AIRCRAFT ONLY)
- GDL 60 LTEMPT DATALINK
- GTX 335B JAMM TRANSPONDERS
- FLIGHTSTREAM 510
- GDL 6945XV DATALINK
- GSR 56 TRIDRUM DATALINK
- GSR 56 DUAL USB CHARGER & G2 275 DATA TRANSFER HUB

6. AFTER INSTALLATION OF THE WARNINGS AND EQUIPMENT, CONFIGURE AND TEST THE SYSTEM IN ACCORDANCE WITH THE POST INSTALLATION CHECKOUT PROCEDURE, GARMIN DOCUMENT 190-02160-00.

7. AFTER INSTALLATION OF THE AVIONICS UPGRADE, THE AIRCRAFT MUST BE WEIGHED TO ESTABLISH THE WEIGHT & BALANCE IN ACCORDANCE WITH APPLICABLE CIRRUS PHOTO OPERATING HANDBOOK. WEIGHT & BALANCE OF LRU'S ARE PROVIDED IN TABLE 6. FOR ADDITIONAL INFORMATION, THESE TABLES DO NOT PROVIDE WEIGHT & BALANCE INFORMATION FOR LRU TRAYS AND ASSOCIATED SYSTEM WEIGHING.

8. ACTIVATION OF THE FEATURES LISTED IN TABLE 2 ARE OPTIONAL INSTALLATIONS THAT ACTIVATE A SPECIFIC FEATURE REQUIRE THE APPLICABLE ENABLE CARD SPECIFIED IN TABLE 2. REFER TO POST INSTALLATION CHECKOUT PROCEDURES, 190-01660-00, FOR INSTRUCTIONS ON HOW TO ACTIVATE THESE OPTIONAL FEATURES.

9. AT COMPLETION OF MODIFICATION, INSTALL 190-02160-02 AIRPLANE FLIGHT MANUAL SUPPLEMENT IN THE PILOT'S OPERATING HANDBOOK.

10. GTX 335B TRANSPONDER IS NOT COMPATIBLE WITH GDL 68 DATALINK INSTALLATIONS.

11. GTX 345B TRANSPONDER IS NOT APPROVED WITH AVIONICS TAG 560 TRAFFIC INSTALLATIONS.

12. GSA 80 P/N 011-00877-00 & GSA 81 P/N 011-00878-10 SERVOS NOT COMPATIBLE WITH A SINGLE GSV 75 ADAMS INSTALLATION.

13. FLIGHT STREAM FIRMWARE IS NOT LOADED VIA THE 4934.00 LOADER IMAGE. CONTACT GARMIN PRODUCT SUPPORT FOR FLIGHT STREAM FIRMWARE UPDATE PROCEDURES. FLIGHT STREAM SOFTWARE VERSION 2.90 OR HIGHER UP TO VERSION 2.99 IS APPROVED FOR INSTALLATION.

14. GDL 69(A) DATALINK P/N 011-00966-00 & 011-00967-00 ARE NOT APPROVED FOR THIS STC.

15. GTX 32 P/N 011-00768-00 & GTX 33 P/N 011-00779-00 TRANSPONDERS ARE NOT APPROVED FOR THIS STC.

16. 006-000938-36 CERTIFICATION GAINS APPLICABLE WITH LOWSPEED ESP INSTALLED.

17. 006-000938-37 CERTIFICATION GAINS APPLICABLE TO THE -00/-10 SERVOS OR THOSE WITHOUT LOWSPEED ESP.

18. 006-80398-21 GSA SYSTEM SOFTWARE APPLICABLE TO THE -00/-10 SERVOS.

19. 006-80398-47 GSA SYSTEM SOFTWARE APPLICABLE TO THE -20 SERVOS.

↑

REVISIONS

REV	DESCRIPTION	DATE	BY
1	INITIAL RELEASE	10/31/25	

GARMIN

GENERAL ARRANGEMENT G1000 NXI
UPGRADE CIRRUS SR22

ENGINE NO. 005-01701-01

SCALE NONE

SHEET 1 OF 5



Determine eligibility



General arrangement Drawing
Verify



Serial Number



Engine Type



Third party STC applicability

✈ Determine eligibility

✈ General arrangement Drawing
Verify

✈ Serial Number

✈ Engine Type

✈ Third party STC applicability

NOTES:

1. THIS STC APPROVES G1000 AVIONICS AND HARDWARE UPDATES IN THE CIRRUS SR2X AND IS ELIGIBLE FOR THE FOLLOWING AIRCRAFT: AIRCRAFT EQUIPPED WITH PERSPECTIVE (G1000 LEGACY) OR PERSPECTIVE+ (G1000 NXI) AIRCRAFT WITH GIA 63W AND GFC 700 FOR THE FOLLOWING SERIAL NUMBERS:

GENERATION 3 (G3) G1000 LEGACY			GENERATION 5 (G5) G1000 LEGACY			GENERATION 6 (G6) G1000 NXI		
MODEL	S/N	ENGINE	MODEL	S/N	ENGINE	MODEL	S/N	ENGINE
SR20	2016-2219 2221-2338	Continental IO-360-ES	N/A			SR20	2220, 2339-2434	Lycoming IO-390- C3B6
SR22 ^A	2992, 3002-3914	Continental IO-550-N	SR22	3915-4434	Continental IO-550-N	SR22	4435-4631	Continental IO-550-N
SR22T	0001-0441	Continental TSIO-550- K	SR22T	0442-1459, 1461-1470, 1472	Continental TSIO-550- K	SR22T	1460, 1471, 1473-1709	Continental TSIO-550- K

✈ Determine eligibility

- ✈ If the aircraft has an STEC Autopilot installed it is not eligible
- ✈ Aircraft with GIA 64's not yet supported

NOTES:

- THIS STC APPROVES G1000 AVIONICS AND HARDWARE UPDATES IN THE CIRRUS SR2X AND IS ELIGIBLE FOR THE FOLLOWING AIRCRAFT: AIRCRAFT EQUIPPED WITH PERSPECTIVE (G1000 LEGACY) OR PERSPECTIVE+ (G1000 NXI) AIRCRAFT WITH GIA 63W AND GFC 700 FOR THE FOLLOWING SERIAL NUMBERS:

GENERATION 3 (G3) G1000 LEGACY			GENERATION 5 (G5) G1000 LEGACY			GENERATION 6 (G6) G1000 NXI		
MODEL	S/N	ENGINE	MODEL	S/N	ENGINE	MODEL	S/N	ENGINE
SR20	2016-2219 2221-2338	Continental IO-360-ES	N/A			SR20	2220, 2339-2434	Lycoming IO-390- C3B6
SR22 ^A	2992, 3002-3914	Continental IO-550-N	SR22	3915-4434	Continental IO-550-N	SR22	4435-4631	Continental IO-550-N
SR22T	0001-0441	Continental TSIO-550- K	SR22T	0442-1459, 1461-1470, 1472	Continental TSIO-550- K	SR22T	1460, 1471, 1473-1709	Continental TSIO-550- K

✈ Determine eligibility

- ✈ If the aircraft has an STEC Autopilot installed it is not eligible
- ✈ Aircraft with GIA 64's not yet supported
- ✈ Legacy GDL 69(A) is not supported
 - ✈ Must be upgraded to retain SXM

12. GSA 80 P/N 011-00877-00 & GSA 81 P/N 011-00878-10 SERVOS NOT COMPATIBLE WITH A SINGLE GSU 75 ADAHRS INSTALLATION.
13. FLIGHT STREAM FIRMWARE IS NOT LOADED VIA THE 4934.00 LOADER IMAGE. CONTACT GARMIN PRODUCT SUPPORT FOR FLIGHT STREAM FIRMWARE UPDATE PROCEDURES. FLIGHT STREAM SOFTWARE VERSION 2.90 OR HIGHER UP TO VERSION 2.99 IS APPROVED FOR INSTALLATION.
14. GDL 69(A) DATALINK P/N 011-00986-00 & 011-00987-00 ARE NOT APPROVED FOR THIS STC.
15. GTX 32 P/N 011-00768-00 & GTX 33 P/N 011-00779-00 TRANSPONDERS ARE NOT APPROVED FOR THIS STC.
16. 006-D00938-36 CERTIFICATION GAINS APPLICABLE WITH LOWSPEED ESP INSTALLED
17. 006-D00938-37 CERTIFICATION GAINS APPLICABLE TO THE -00/-10 SERVOS OR THOSE WITHOUT LOWSPEED ESP.
18. 006-B0398-21 GSA SYSTEM SOFTWARE APPLICABLE TO THE -00/-10 SERVOS.
19. 006-B0398-47 GSA SYSTEM SOFTWARE APPLICABLE TO THE -20 SERVOS.

ECO No. 313849
DATE 02/26/26
DESCRIPTION
INITIAL RELEASE
ADD TAG NOTE 20
CORRECTED REVISION BLOCK

1
2
3

1. THIS STC APPROVES G1000 AVIONICS AND HARDWARE UPDATES IN THE CIRRUSS SR2X AND IS ELIGIBLE FOR THE FOLLOWING AIRCRAFT: AIRCRAFT EQUIPPED WITH PERSPECTIVE (G1000 LEGACY) OR PERSPECTIVE+ (G1000 NXI) AIRCRAFT WITH GSA 63W AND GFC 700 FOR THE FOLLOWING SERIAL NUMBERS:

GENERATION 3 (G3) G1000 LEGACY		GENERATION 3 (G3) G1000 LEGACY		GENERATION 5 (G5) G1000 NXI	
MODEL	ENGINE	MODEL	ENGINE	MODEL	ENGINE
SR20	2016-2319 2224-2338	Continental IO-360-B5	N/A	SR20	2220, 2339-2434
SR22 ¹	2992 3002-3914	Continental IO-550-N	SR22	3915-4634	Continental IO-550-N
SR22T	0005-0441	Continental T100-200-K	SR22T	0462-1495, 1466-1476, 1472	Continental T100-200-K

TYPE NOTES:
A. INCLUDES AIRCRAFT EQUIPPED WITH ENGINE TECHNOLOGIES, INC. (AGA TORNAADO ALLEY) STC SA805836C OR CONTINENTAL STC (SA805824T) THAT REPLACES THE TORNAADO ALLEY ENGINE WITH A CONTINENTAL T100-200-N.
2. REVIEW ALL STC DATA BEFORE PERFORMING UPDATES OF THE G1000 SYSTEM. THE INSTALLER IS RESPONSIBLE FOR ENSURING COMPATIBILITY OF OTHER MODIFICATIONS NOT NOTED.
3. IMPORTANT! - PRIOR TO BEGINNING UPGRADE, PERFORM PRE-MODIFICATION SURVEY OF THE G1000 INSTALLATION AS REQUIRED IN GARMIN DOCUMENT 190-03160-00, POST INSTALLATION CHECKOUT PROCEDURE.
4. THIS DRAWING DEFINES APPROVED G1000 HARDWARE AND SOFTWARE.
5. THIS STC APPROVES INSTALLATION OF NEW PFD AND MFD DISPLAYS, GCU 479 PMS CONTROLLER, AND GNC 707 AWC'S CONTROLLER. THIS STC ALSO APPROVES THE FOLLOWING OPTIONAL EQUIPMENT:

- GI 275 STANDBY INDICATOR (G3/G5 AIRCRAFT ONLY)
- GDL 60 LTE/WIFI DATALINK
- GTX 335R/345R TRANSPONDERS
- FLIGHTSTREAM 850
- GDL 684 SYN DATALINK
- GSB 55 PRODUCE DATALINK
- GSB 15 DUAL USB CHARGER & GI 275 DATA TRANSFER HUB

6. AFTER INSTALLATION OF THE WIRING AND EQUIPMENT, CONFIGURE AND TEST THE SYSTEM IN ACCORDANCE WITH THE POST INSTALLATION CHECKOUT PROCEDURE, GARMIN DOCUMENT 190-03160-00.
7. AFTER INSTALLATION OF THE AVIONICS UPGRADE, THE AIRCRAFT MUST BE WEIGHED TO ESTABLISH THE WEIGHT & BALANCE IN ACCORDANCE WITH APPLICABLE CIRRUSS PILOTS OPERATING HANDBOOK. WEIGHT & BALANCE OF LUGS ARE PROVIDED IN TABLE 3. FOR ADDITIONAL INFORMATION, THESE TABLES DO NOT PROVIDE WEIGHT & BALANCE INFORMATION FOR LUG TRAYS AND ASSOCIATED SYSTEM WIRING.
8. ACTIVATION OF THE FEATURES LISTED IN TABLE 2 ARE OPTIONAL. INSTALLATIONS THAT ACTIVATE A SPECIFIC FEATURE REQUIRE THE APPLICABLE ENABLE CARD SPECIFIED IN TABLE 2. REFER TO POST INSTALLATION CHECKOUT PROCEDURES, 190-03160-00, FOR INSTRUCTIONS ON HOW TO ACTIVATE THESE OPTIONAL FEATURES.
9. AT COMPLETION OF MODIFICATION, INSTALL 190-03160-02 AIRPLANE FLIGHT MANUAL SUPPLEMENT IN THE PILOT'S OPERATING HANDBOOK.
10. GTX 335R TRANSPONDER IS NOT COMPATIBLE WITH GDL 68 DATALINK INSTALLATIONS.
11. GTX 345R TRANSPONDER IS NOT APPROVED WITH AVIDYNE TAS 660 TRAFFIC INSTALLATIONS.
12. GSA 80 P/N 011-00877-00 & GSA 81 P/N 011-00878-10 SERVOS NOT COMPATIBLE WITH A SINGLE G5U 75 ADHRES INSTALLATION.
13. FLIGHT STREAM FIRMWARE IS NOT LOADED VIA THE 4934.00 LOADER IMAGE. CONTACT GARMIN PRODUCT SUPPORT FOR FLIGHT STREAM FIRMWARE UPDATE PROCEDURES. FLIGHT STREAM SOFTWARE VERSION 2.90 OR HIGHER UP TO VERSION 2.99 IS APPROVED FOR INSTALLATION.
14. GDL 68(A) DATALINK P/N 011-00986-00 & 011-00987-00 ARE NOT APPROVED FOR THIS STC.
15. GTX 32 P/N 011-00768-00 & GTX 33 P/N 011-00779-00 TRANSPONDERS ARE NOT APPROVED FOR THIS STC.
16. 006-000938-36 CERTIFICATION GAINS APPLICABLE WITH LOWSPEED ESP INSTALLED
17. 006-000938-37 CERTIFICATION GAINS APPLICABLE TO THE -00/-10 SERVOS OR THOSE WITHOUT LOWSPEED ESP.
18. 006-80398-21 GSA SYSTEM SOFTWARE APPLICABLE TO THE -00/-10 SERVOS.
19. 006-80398-47 GSA SYSTEM SOFTWARE APPLICABLE TO THE -20 SERVOS.
20. FOR AIRCRAFT EQUIPPED WITH EXISTING GTX 345R P/Ns 011-03303-00 OR 011-03303-01 INSTALLED PER STC SA0141790, WIRING MUST BE REVERTED TO CIRRUSS FACTORY CONFIGURATION PER CIRRUSS WIRING DIAGRAM 34-50-05 THEN BE MODIFIED PER WIRING DIAGRAM 005-W0054-05. ADDITIONALLY, FOR INSTALLATIONS WITH EXTERNAL TRAFFIC SYSTEMS, WIRING MUST BE INSTALLED PER CIRRUSS WIRING DIAGRAM 34-40-02 AND MODIFIED PER WIRING DIAGRAM 005-W0054-05. PART NUMBERS OUTSIDE OF THOSE LISTED ARE NOT COVERED UNDER THIS STC.

Garmin, Ltd. of the United States
Garmin, Ltd. of the United States
Garmin, Ltd. of the United States

GARMIN

Garmin, Ltd. of the United States
Garmin, Ltd. of the United States
Garmin, Ltd. of the United States

DATE 10/31/25
DRAWN BY KIEFER HORVNA
CHECKED BY
DATE 10/31/25
DRAWN BY KIEFER HORVNA
CHECKED BY


1
2
3

1
2
3

GENERAL ARRANGEMENT G1000 NXI
UPGRADE CIRRUSS SR2X

DWG. NO. 005-01701-01
SCALE: NONE

SHEET 1 OF 5

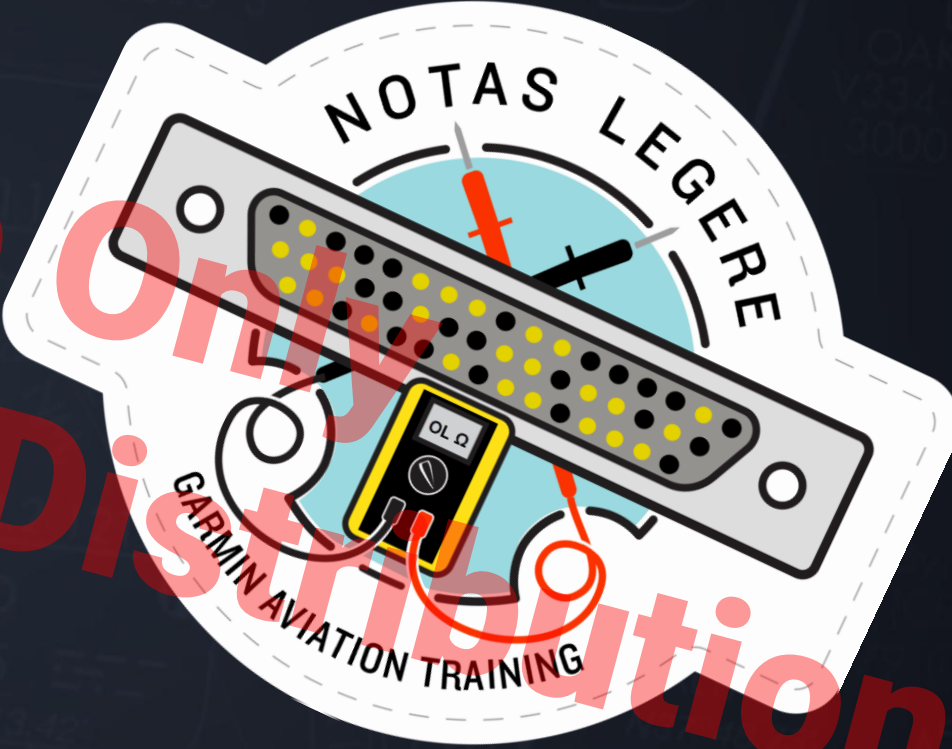

REVISIONS				DESCRIPTION				
REV	1	2	3	INITIAL RELEASE	ADD FLAG NOTE 20	CORRECTED REVISION BLOCK		
	</							

GARMIN		GENERAL ARRAN UPGRADE CIRRU		005-0	
TITLE		SIZE		DWG. NO.	
DATE:		B		SCALE:	
DRAWN BY:		10/31/25		NONE	
KIEFER HORYNA		INCH			
		X ± 0.5			
		XX ± 0.03			
		XXX ± 0.005			
		HOLES ± 0.005			
		ANGLES ± 0.5°			
TOLERANCE		UNLESS NOTED OTHERWISE			

✈ Start From the end

1.6 Pre-Upgrade Aircraft Configuration Survey



CAUTION

Before modifying the aircraft with the G1000 NXi hardware and software, these procedures must be carried out.

Conduct a pre-modification aircraft survey as follows. Record the information on the Configuration Worksheet, Figure 1-3.

1. Pull the following circuit breakers:

- STARTER
- FUEL PUMP
- PFD #1 and PFD #2
- MFD #1 and MFD #2

2. Set BAT 2, BAT 1, and AVIONICS switches to ON positions.

3. While holding the rightmost soft key on the PFD and MFD, restore power by closing the PFD and MFD Circuit Breakers to boot the displays in 'Config Mode.'

4. On the PFD, rotate the outer [FMS] knob to select the GMA group.

Serials w/ GMA 350, GMA 350c:

- a) Rotate the outer [FMS] knob to select the GMA Marker Beacon Configuration page.

G1000 NXi Post Installation Checkout Procedures Cirrus SR2X
190-03160-00

Page 18
Rev. 4



In the MARKER BEACON field, note current ACTIVE values for 'HI SENSITIVITY OFFSET,' 'LO SENSITIVITY OFFSET, and VOLUME' and record these values on the worksheet.

Serials w/ GMA 347:

- a) Rotate the inner [FMS] knob to select the GMA Configuration page.
- b) Press [LEVELS] softkey.
- c) In the MARKER BEACON window, note current ACTIVE values for "HI SENSE

10. Press softkeys 12, 11, 10, and 9 in order to unlock this page.

11. For both left and right tanks, review and record in Figure 2-2 below the 'CALIBRATED VALUE' corresponding to each 'ACTUAL QUANTITY' entry shown on the CALIBRATION TABLE window on the PFD display.



Figure 1-3, Configuration Worksheet

Date: _____

Aircraft S/N: _____

Aircraft Registration: _____


ACTIVE VALUE	Marker Beacon Threshold
	HI SENSITIVITY OFFSET
	LO SENSITIVITY OFFSET
	VOLUME
ACTIVE VALUE	Weight and Balance
	Empty Weight (lb)
	Arm (inches)
FUEL TANK CALIBRATION	
CALIBRATED VALUE	ACTUAL QUANTITY, Left Tank
	0.00GL
	5.00GL
	30.00GL
	40.00GL
	46.00GL
CALIBRATED VALUE	ACTUAL QUANTITY, Right Tank
	0.00GL
	5.00GL
	30.00GL
	40.00GL
	46.00GL

How do I start

✈ Start From the end

REVISIONS				DESCRIPTION				
REV	1	2	3	INITIAL RELEASE				
				ADD FLAG NOTE 20				
				CORRECTED REVISION BLOCK				
				SR22T	0001-0441	Continental TSIO-550-K	SR22T	0442-1459, 1461-1470, 1472
						Continental TSIO-550-K		
							SR22T	1460, 1471, 1473-1709
								Continental TSIO-550-K
TABLE NOTES; A. INCLUDES AIRCRAFT EQUIPPED WITH ENGINE TECHNOLOGIES, INC (AKA TORNADO ALLEY) STC SA10588SC OR CONTINENTAL STC (SA03962AT) THAT REPLACES THE TORNADO ALLEY ENGINE WITH A CONTINENTAL TSIO-550-N								
2. REVIEW ALL STC DATA BEFORE PERFORMING UPGRADES OF THE G1000 SYSTEM. THE INSTALLER IS RESPONSIBLE FOR ENSURING COMPATIBILITY OF OTHER MODIFICATIONS NOT NOTED.								
3. IMPORTANT! - PRIOR TO BEGINNING UPGRADE, PERFORM PRE-MODIFICATION SURVEY OF THE G1000 INSTALLATION AS REQUIRED IN GARMIN DOCUMENT 190-03160-00, POST INSTALLATION CHECKOUT PROCEDURE.								
4. THIS DRAWING DEFINES APPROVED G1000 HARDWARE AND SOFTWARE.								
5. THIS STC APPROVES INSTALLATION OF NEW PFD AND MFD DISPLAYS, GCU 479 FMS CONTROLLER, AND GMC 707 AFCS CONTROLLER. THIS STC ALSO APPROVES THE FOLLOWING OPTIONAL EQUIPMENT: - GI 275 STANDBY INDICATOR (G3/G5 AIRCRAFT ONLY) - GDL 60 LTE/WIFI DATALINK - GTX 335R/345R TRANSPONDERS - FLIGHTSTREAM 510 - GDL 69A SXM DATALINK - GSR 56 IRIDIUM DATALINK - GSB 15 DUAL USB CHARGER & GI 275 DATA TRANSFER HUB								
6. AFTER INSTALLATION OF THE WIRING AND EQUIPMENT, CONFIGURE AND TEST THE SYSTEM IN ACCORDANCE WITH THE POST INSTALLATION CHECKOUT PROCEDURE, GARMIN DOCUMENT 190-03160-00.								
7. AFTER INSTALLATION OF THE AVIONICS UPGRADE, THE AIRCRAFT MUST BE WEIGHED TO ESTABLISH THE WEIGHT & BALANCE IN ACCORDANCE WITH APPLICABLE CIRRUS PILOT'S OPERATING HANDBOOK. WEIGHT & BALANCE OF LRU'S ARE PROVIDED IN TABLE 3, FOR ADDITIONAL INFORMATION. THESE TABLES DO NOT PROVIDE WEIGHT & BALANCE INFORMATION FOR LRU TRAYS AND ASSOCIATED SYSTEM WIRING.								
8. ACTIVATION OF THE FEATURES LISTED IN TABLE 2 ARE OPTIONAL. INSTALLATIONS THAT ACTIVATE A SPECIFIC								

GARMIN		TITLE		DWG. NO.	
		GENERAL ARRAN		005-0	
		UPGRADE CIRRU		SCALE:	
		NONE			
		SIZE			
		B			
		DATE:			
		10/31/25			
		DRAWN BY:			
		KIEFER HORYNA			
		TOLERANCE			
		UNLESS NOTED OTHERWISE			
		INCH			
		X ± 0.5			
		XX ± 0.03			
		XXX ± 0.005			
		HOLES ± 0.005			
		ANGLES ± 0.5°			

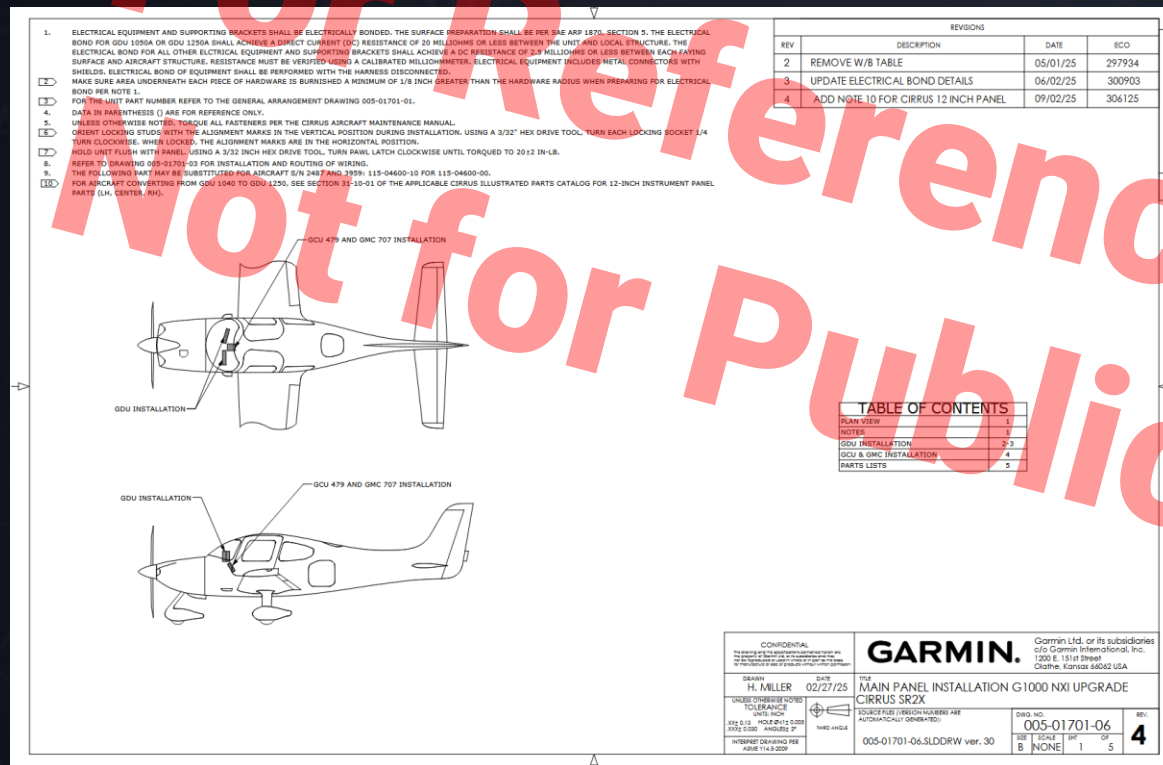

✈ Often those with 10" Displays
Ask if they can Upgrade to the
12" Displays

✈ Note 10 Explains how



✈ Often those with 10" Displays
Ask if they can Upgrade to the
12" Displays

✈ Note 10 Explains how

1. ELECTRICAL EQUIPMENT AND SUPPORTING BRACKETS SHALL BE ELECTRICALLY BONDED. THE SURFACE PREPARATION SHALL BE PER SAE ARP 1870, SECTION 5. THE ELECTRICAL BOND FOR GDU 1050A OR GDU 1250A SHALL ACHIEVE A DIRECT CURRENT (DC) RESISTANCE OF 20 MILLIOHMS OR LESS BETWEEN THE UNIT AND LOCAL STRUCTURE. THE ELECTRICAL BOND FOR ALL OTHER ELECTRICAL EQUIPMENT AND SUPPORTING BRACKETS SHALL ACHIEVE A DC RESISTANCE OF 2.5 MILLIOHMS OR LESS BETWEEN EACH MOUNTING SURFACE AND AIRCRAFT STRUCTURE. RESISTANCE MUST BE VERIFIED USING A CALIBRATED MILLIOHMMETER. ELECTRICAL EQUIPMENT INCLUDES METAL CONNECTORS WITH SHIELDS. ELECTRICAL BOND OF EQUIPMENT SHALL BE PERFORMED WITH THE HARNESS DISCONNECTED.
2. MAKE SURE AREA UNDERNEATH EACH PIECE OF HARDWARE IS BURNISHED A MINIMUM OF 1/8 INCH GREATER THAN THE HARDWARE RADIUS WHEN PREPARING FOR ELECTRICAL BOND PER NOTE 1.
3. FOR THE UNIT PART NUMBER REFER TO THE GENERAL ARRANGEMENT DRAWING 005-01701-01.
4. DATA IN PARENTHESIS () ARE FOR REFERENCE ONLY.
5. UNLESS OTHERWISE NOTED, TORQUE ALL FASTENERS PER THE CIRRUS AIRCRAFT MAINTENANCE MANUAL.
6. ORIENT LOCKING STUDS WITH THE ALIGNMENT MARKS IN THE VERTICAL POSITION DURING INSTALLATION. USING A 3/32" HEX DRIVE TOOL, TURN EACH LOCKING SOCKET 1/4 TURN CLOCKWISE. WHEN LOCKED, THE ALIGNMENT MARKS ARE IN THE HORIZONTAL POSITION.
7. HOLD UNIT FLUSH WITH PANEL. USING A 3/32 INCH HEX DRIVE TOOL, TURN PAWL LATCH CLOCKWISE UNTIL TORQUED TO 20±2 IN-LB.
8. REFER TO DRAWING 005-01701-03 FOR INSTALLATION AND ROUTING OF WIRING.
9. THE FOLLOWING PART MAY BE SUBSTITUTED FOR AIRCRAFT S/N 2487 AND 3959: 115-04600-10 FOR 115-04600-00.
10. FOR AIRCRAFT CONVERTING FROM GDU 1040 TO GDU 1250, SEE SECTION 31-10-01 OF THE APPLICABLE CIRRUS ILLUSTRATED PARTS CATALOG FOR 12-INCH INSTRUMENT PANEL PARTS (LH, CENTER, RH).



What must be accomplished before returning your Legacy G1000 displays?

- A. Load GIA Boot Block Software using Service Documentation
- B. The Rain Dance of 10,000 Tears
- C. Install new GDU System Software
- D. Reconfigure the Aircraft



What must be accomplished before returning your Legacy G1000 displays?

- A. Load GIA Boot Block Software using Service Documentation
- B. The Rain Dance of 10,000 Tears
- C. Install new GDU System Software
- D. Reconfigure the Aircraft



True or False: Perspective+ Upgrade Customers can convert their aircraft from 10 inch displays to 12 inch displays?

- A. True
- B. False



True or False: Perspective+ Upgrade Customers can convert their aircraft from 10 inch displays to 12 inch displays?

- A. True
- B. False



I attended the Upgrading GI000 Technician Fundamentals Seminar in the RED Room at AEA Nationals

- A. True
- B. False

Recap

Monday, March 30, 2026

- ✈️ G1000 NXi Upgrade Pro Tips from Field Service Engineering
- ✈️ Assessed importance of reading the notes 'Notas Legere'
- ✈️ Covered the most frequently asked questions for the newest addition to the 'NXi Upgrade Family' Cirrus SR 22





Any Questions?

For Reference Only
Not for Public Distribution



Thank You!

✈ Chris Hendrix

✈ Senior Aviation Maintenance Instructor

✈ Garmin Aviation Training

✈ Aviation.training@garmin.com