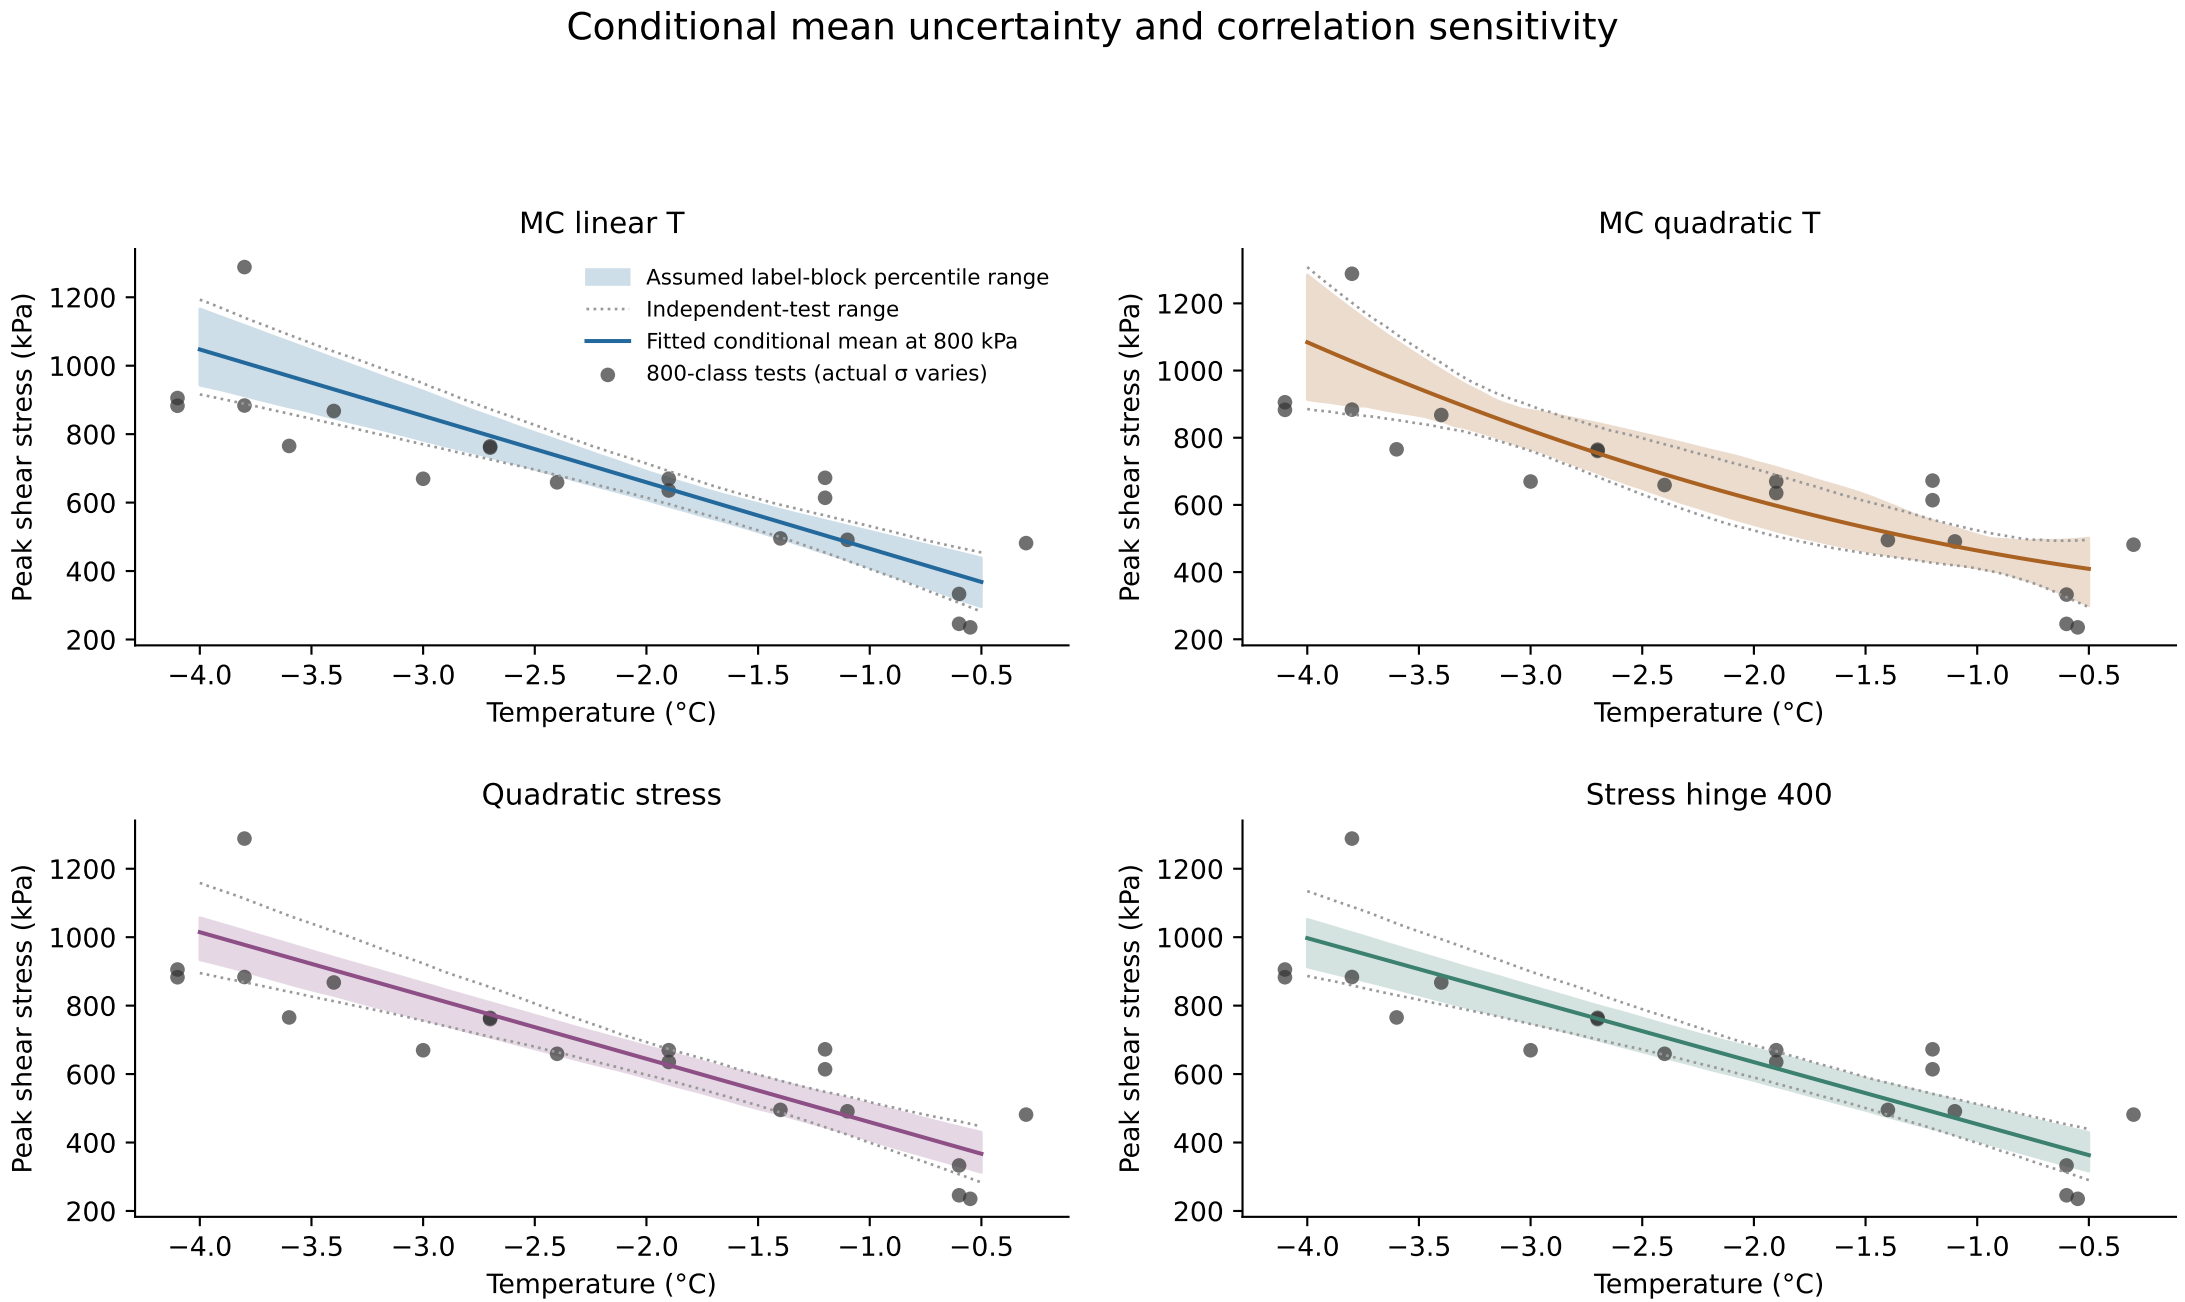
Conditional mean uncertainty and correlation sensitivity
MC linear T
MC quadratic T
Quadratic stress
Stress hinge 400
Assumed label-block percentile range
Independent-test range
Fitted conditional mean at 800 kPa
800-class tests (actual σ varies)
Peak shear stress (kPa)
Temperature (°C)
200
400
600
800
1000
1200
−4.0
−3.5
−3.0
−2.5
−2.0
−1.5
−1.0
−0.5
Bands are 2.5/97.5 percentiles of 1000 conditional bootstrap fits. Eight labels are not verified physical specimen UIDs.
Mean bands exclude individual-test scatter and field-transfer error; they do not imply 95% event coverage or local probability.