

Troubleshooting First Layer Print Failure

This SOP describes how to troubleshoot and adjust first layer print failures on FibreSeeker 3. Its purpose is to safely and effectively resolve first layer printing issues.

1. Tools :

None

2. Precautions :

None

1




Step 1 Model Warping Step 1.1

No adhesive has been applied to the print bed.




2

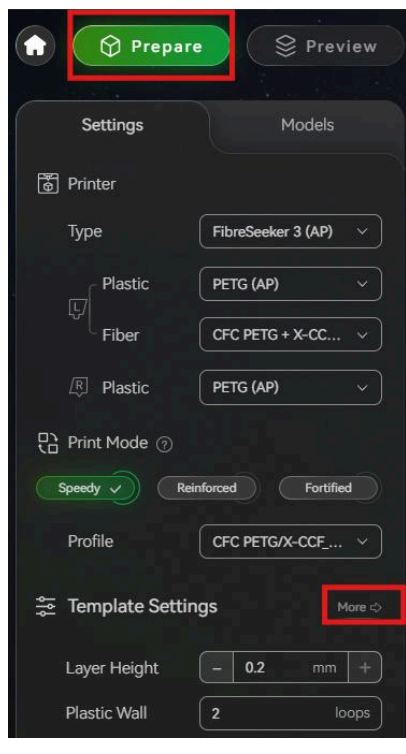


Step 1.2

Insufficient heatedbed temperature:

In the slicer, check if the temperature is too low and adjust it.

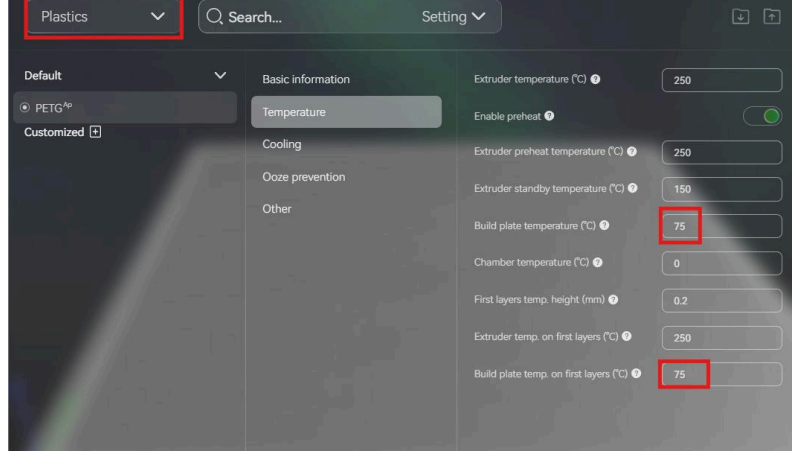

3

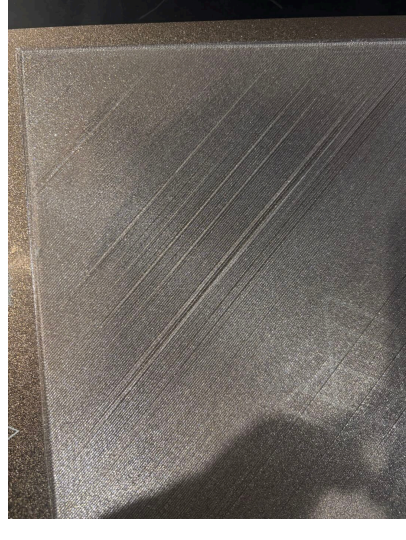

Step 2

If the gap between the platform and nozzle is too large, enable Auto Bed Leveling before printing. If the issue persists, replace the piezoelectric ceramic (see the Replacement Guide).



Step 3

If the gap between the platform and nozzle is too small, enable Auto Bed Leveling before printing. If the issue persists, replace the piezoelectric ceramic (see the Replacement Guide).

4