

APOLLO 13	
CSM ENTRY CHECKLIST	
PART NO.	S / N
SKB32100082- 305	1001

APOLLO 13

CSM ENTRY CHECKLIST

March 27, 1970

PREPARED BY:

Dennis L. Bentley

DENNIS L. BENTLEY
BOOK MANAGER
SPACECRAFT SYSTEMS BRANCH

APPROVED BY:

M. E. Dement

M. E. DEMENT
CHIEF, SPACECRAFT SYSTEMS BRANCH

It is requested that any organization having comments, questions, or suggestions concerning this document contact Dennis L. Bentley, Spacecraft Systems Branch, Building 4, Room 253, telephone 483-4371.

This document is under the configuration control of the Crew Procedures Control Board (CPCB). All proposed changes should be submitted to the Apollo Flight Data File Manager, Mr. T. W. Holloway, CF34, Room 230, telephone HU3-4271.

Distribution of this document is controlled by Mr. J. W. O'Neill, Chief, Flight Planning Branch, Flight Crew Support Division.

APOLLO FLIGHT DATA FILE **CSM ENTRY CHECKLIST**

Basic Date 3/9/70 Change Date 3/27/70

LIST OF EFFECTIVE PAGES

* INDICATES CURRENT CHANGE

PAGE NUMBER

ISSUE

Title	Basic
E/TC-1	Basic
E/1-1 and E/1-2	Basic
*E/1-3	3/27/70
E/1-4	Basic
*E/1-5	3/27/70
E/1-6 thru E/1-8	Basic
E/2-1	Basic
*E/2-2	3/27/70
E/2-3 thru E/2-5	Basic
*E/2-6 and E/2-7	3/27/70
E/3-1	Basic
*E/3-2	3/27/70
E/3-3 and E/3-4	Basic

Basic Date 3/9/70
 Changed 3/27/70

ENTRY TABLE OF CONTENTS

1. VEHICLE PREPARATION	1-1
2. SUPERCIRCULAR ENTRY	2-1
3. EARTH/POST LANDING	3-1
4. EMERGENCY PROCEDURES	EMER/1-1

Basic Date 3/9/70
Changed

LUNAR RETURN VEHICLE PREPARATION

- 1 INITIAL STOWAGE COMPLETED
- 2 CMC & ISS START UP pg G/2-1 & 2
- 3 SCS POWER UP pg G/2-4
- 4 P51 - IMU ORIENTATION pg G/6-1
- 5 LOAD DAP
V48E 11102, 01111, PRO, PRO, PRO
- 6 -06:00h LAST MCC DECISION
- 7 -05:35h NO COMM - P52 & NAV SIGHTINGS
- 8 DON MAE WESTS & FOOT RESTRAINTS
- 9 ACTIVATE VHF FOR COMM CHECKS
- 10 VERIFY DSE POWERED
cb S BD FM XMTR/DSE (2) - close (verify)
- 11 -04:30h P27 (SV,REFSMMAT), MNVR
& ENTRY PAD UPDATES
- 12 -04:15h P52 - IMU REALIGN pg G/6-2
(__:__:__) (OPTION 1)
- 13 P37 (NO COMM ONLY)
- 14 ECS CKS
02 SUPPLY REFILL pg S/1-7
PGA verification, (if suited)S/1-11
ECS Monitor Ck pg S/1-5
(382) EVAP H2O CONT PRI vlv - AUTO
EVAP H2O CONT SEC vlv - AUTO
SUIT HEAT EXCH SEC GLY - FLOW
- 15 EPS CKS #1, 3, 4 (5 if req'd) pg S/1-2

Basic Date 3/9/70
Changed

CSM 109

16 SPS CK (If req'd) pg S/1-1

17 RCS CKS
SM RCS Monit Ck pg S/1-1
CM RCS Monit Ck pg S/1-1

18 C&W SYS CK pg S/1-17

19 CMC SELF CK pg G/2-3

20 DSKY COND LT TEST pg G/1-23

21 -03:45h MIDCOURSE MANEUVER
P30 - EXT ΔV
-03:15h P40/41 - SPS/RCS THRUSTING
-03:00h MIDCOURSE (#7) BURN
Key V66E

-02:00h LOGIC SEQUENCE CK
(8) cb SECS LOGIC (2) - close (verify)
cb SECS ARM (2) - close
cb ELS (2) - close
ELS LOGIC - on (up)
ELS - AUTO
Coordinate next 3 steps with MSFN
SECS LOGIC (2) - on (up)
MSFN confirm GO for PYRO ARM as req'd
SECS LOGIC (2) - OFF
cb SECS ARM (2) - open
ELS LOGIC - OFF
ELS - MAN
cb ELS (2) - open

22 NO COMM NAV SIGHTINGS

23 MNVR TO SUPERCIRCULAR ENTRY ATT _____ ° PITCH
V62E

24 V49E

25 F 06 22 DESIRED FINAL GMBL ANGLES (.01°)
LOAD ENTRY ATT PAD ANGLES
PRO

Basic Date 3/9/70
Changed _____

26 F 50 18 REQ MNVR TO FDAI RPY ANGLES (.01°)
(AUTO) SC CONT - CMC
BMAG MODE (3) - RATE 2
CMC MODE - AUTO

PRO
(MAN) SC CONT - SCS
MNVR to 28

27 06 18 AUTO MNVR TO FDAI RPY ANGLES (.01°)

28 F 50 18 REQUEST TRIM (.01°)
(TRIM) Go to 26
(BYPASS) ENTR

S BD Omni Ant - B

29 BORESIGHT & SXT STAR CHECK
OPT MODE - CMC
OPT ZERO - OFF

V41 N91E

F 21 92 SHAFT, TRUN (.01°, .001°)
Load SXTS angles

41 OPTICS DRIVE

CHECK SXT STAR
OPT ZERO - ZERO
CHECK BORESIGHT STAR (If avail)

30 -01:35h P52 - IMU REALIGN pg G/6-2 (OPTION 3)
Record gyro torquing angles

R _____
P _____
Y _____

*If > 1°, recycle P52 *
If confirmed, use SCS for EMS Entry
Drive Optics to 90° shaft angle
OPTICS PWR - OFF

31(__:__:__) GDC ALIGN
If drift >10°/hr, change rate source

Basic Date 3/9/70
Changed 3/27/70

32 -01:15h

EMS ENTRY CHECK

EMS FUNC - OFF

(8) cb EMS (2) - close

EMS MODE - STBY

EMS FUNC - EMS TEST 1 (wait 5 sec)

EMS MODE - NORMAL (wait 10 sec)

Check ind lts - off

RANGE ind - 0.0

Slew hairline over notch
in self-test pattern

EMS FUNC - EMS TEST 2 (wait 10 sec)

.05G lt - on (all others out)

EMS FUNC - EMS TEST 3

.05G lt - on

RSI lower lt - on (10 sec later)

Set RANGE counter to 58 nm+0.0

EMS FUNC - EMS TEST 4

.05G lt - on (all others out)

G-V trace within pattern to lwr rt
corner @9G

RANGE ind counts down to 0+0.2

EMS FUNC - EMS TEST 5

.05G lt - on

RSI upper lt - on (10 sec later)

RANGE ind - 0.0

Scribe traces vertical line 9g to
0.28+0.1

ALIGN SCROLL TO ENTRY PATTERN (on
37K ft sec line)

EMS FUNC - RNG SET

G-V scroll assy traces vert. line
0.28g to 0+0.1

EMS MODE - STBY

33

PRIMARY WATER EVAP ACTIVATION

GLY EVAP H2O FLOW - AUTO

GLY EVAP STM PRESS - AUTO

PRI ECS GLY PUMP - AC1 (verify)

33A

SET UP CAMERA

CM4/DAC/18/CIN - BRKT, MIR

(f16,250,7) 6 fps, 8 min, MAG K

Basic Date 3/9/70
Changed

CSM 109

34

SEC WATER EVAP ACTIVATION

ECS IND sel - SEC
SEC COOL LOOP PUMP - AC2
GLY DISCH SEC PRESS - 39-51 psig
SEC COOL LOOP EVAP - EVAP
SEC GLY EVAP OUT TEMP - 38 - 50.5°F

SUIT CKT HT EXCH - BYPASS 20 sec, OFF
ECS IND sel - PRIM

35 (-01:10h)

CM RCS PREHEAT

Note: If sys test mtr 5c,d,6a,b,c,d
all read 3.9 vdc (28°F) or more,
omit preheat

- (8) cb RCS LOGIC (2) - close
CM RCS LOGIC - on (up)
- (8) cb CM RCS HTRS (2) - close
- (101) CM RCS HTRS - ON (LMP Confirm)
(20 min or til lowest rdg is 3.9 vdc)
(Monitor Manf press for press drop)

36

FINAL STOWAGE

- OPTICS
- ORDEAL
- (377) GLY TO RAD SEC vlv - BYPASS (verify)
Verify EVA COUCH STRUT disengaged
- (382) Cool pnl installed
Y-Y struts (2) extended
WASTE MGMT vlv - OFF
Stow Data Box R-12
Remove & Stow URA, urine transfer
hose and urine filter
Attach both strut unlock lanyards
Check for water in tunnel area
Stow gas separator & C1 injector (A1)

37 (-00:50m)

TERM. CM RCS PREHEAT

- (101) CM RCS HTRS - OFF
CM RCS LOGIC - OFF
- (8) cb CM RCS HTR (2) - open

38

SYSTEMS TEST PANEL CONFIGURATION

- SYS TEST METER - 4B (BAT RLY BUS
3.4-4.1 vdc)
- (101) CM RCS HTRS - OFF (verify)
WASTE H2O DUMP HTR - OFF

Basic Date 3/9/70
Changed 3/27/70

CSM 109

(101) URINE DUMP HTR - OFF

(100) LEB FLOOD & INTGL LIGHTING - OFF

39

PYRO BATT CK

(250) cb PYRO A SEQ A - close (verify)
cb PYRO B SEQ B - close (verify)

DC IND - PYRO BAT A(B)

*If PYRO BAT A(B) < 35 vdc *

(250) *cb PYRO A(B) seq A(B) - open *

cb PYRO A(B)BAT BUS A(B)TO PYRO

* BUS TIE - close *

(275) cb MNA BAT C - close

cb MNB BAT C - close

DC IND - MNB

PNL 8 - All cb's closed except:

EDS BAT (3) - open (verify)

PL VENT - open (verify)

FLOAT BAG (3) - open (verify)

SPS P&Y (4) - open

CM RCS HTRS (2) - open (verify)

DOCKING PROBE (2) - open (verify)

DIRECT ULLAGE (2) - open

40 (_ : _ : _)

FINAL GDC DRIFT CK (if req'd)

If drift >10°/hr, Suspect GDC, Do not
use RSI & FDAI #2

41

CM RCS ACTIVATION

(8) cb SECS ARM (2) - close (verify)

SECS LOGIC (2) - on(up)

MSFN confirm GO for PYRO ARM

SECS PYRO ARM (2) - ARM

CM RCS PRPLNT 1&2 tb(2) - gray (verify)

CM RCS PRESS - ON

RCS IND sw - CM1, then 2

He PRESS stabilizes at 3300 - 3500

psia after 15 minutes

MANF PRESS 287-302 psia

SECS PYRO ARM (2) - SAFE

42 -00:45m

P27 & ENTRY PAD UPDATE

Basic Date 3/9/70
Changed

CSM 109

Basic Date 3/9/70
 Changed

CSM 109

E/1-7						LUNAR ENTRY					
											AREA
X	X	X				X	X	X			R 0.05 G
X	X	X				X	X	X			P 0.05 G
X	X	X				X	X	X			Y 0.05 G
		.		.			.		.		GET HOR
X	X	X				X	X	X			P CK
	0		.				0		.		LAT N61
			.						.		LONG
X	X	X		.		X	X	X		.	MAX G
+						+					V _{400K} ^{N60}
-	0	0	.			-	0	0	.		Y _{400K}
+				.		+				.	RTGO EMS
+						+					VIO
		.		.			.		.		RRT
X	X		.	.		X	X		.	.	RET 0.05 G
+	0	0	.			+	0	0	.		DL MAX ^{N69}
+	0	0	.			+	0	0	.		DL MIN
+						+					VL MAX
+						+					VL MIN
X	X	X	.			X	X	X	.		DO
X	X		.			X	X		.		RET V _{CIRC}
X	X		.			X	X		.		RETBBO
X	X		.			X	X		.		RETEBO
X	X		.			X	X		.		RETDRO
X	X	X	X			X	X	X	X		SXTS
+			.		0	+			.	0	SFT
+		.		0	0	+		.	0	0	TRN
X	X	X				X	X	X			BSS
X	X			.		X	X			.	SPA
X	X	X		.		X	X	X		.	SXP
X	X	X	X			X	X	X	X		LIFT VECTOR

LUNAR ENTRY PAD

LUNAR ENTRY PAD

E/1-8

								AREA			
X	X	X		X	X	X		R	0.05	G	
X	X	X		X	X	X		P	0.05	G	
X	X	X		X	X	X		Y	0.05	G	
		.	.		.	.	.	GET	HOR		
X	X	X		X	X	X		P	CK		
	0		.		0		.	LAT	N61		
			.				.	LONG			
X	X	X	.	X	X	X	.	MAX	G		
+				+				V _{400K} ^{N60}			
-	0	0	.	-	0	0	.	γ _{400K}			
+			.	+			.	RTGO	EMS		
+				+				VIO			
	.	.	.		.	.	.	RRT			
X	X		.	X	X		.	RET	0.05	G	
+	0	0	.	+	0	0	.	DL	MAX		
+	0	0	.	+	0	0	.	DL	MIN ^{N69}		
+				+				V _L	MAX		
+				+				V _L	MIN		
X	X	X	.	X	X	X	.	DO			
X	X		.	X	X		.	RET	V _{CIRC}		
X	X		.	X	X		.	RETBBO			
X	X		.	X	X		.	RETEBO			
X	X		.	X	X		.	RETDRO			
X	X	X	X	X	X	X	X	SXTS			
+			.	+			.	SFT			
+		.	0	+		.	0	TRN			
X	X	X		X	X	X		BSS			
X	X		.	X	X		.	SPA			
X	X	X	.	X	X	X	.	SXP			
X	X	X	X	X	X	X	X	LIFT VECTOR			

Basic Date 3/9/70
Changed

CSM 109

SUPERCIRCULAR ENTRY

1 Set DET (up, to EI)

2 EMS INITIALIZATION

Scroll not on 37K:
EMS FUNCT - TEST 5
Slew scroll to 37K

EMS FUNCT - RNG SET (verify)
SET RNG TO PAD DATA RNG
EMS FUNC - Vo SET
Slew Scroll to Pad Data VIO
EMS MODE - STBY (verify)
EMS FUNC - ENTRY

3 RSI ALIGNMENT

FDAI SOURCE - ATT SET
ATT SET - GDC
EMS ROLL - on (up)
GDC ALIGN pb - push & hold
YAW THUMBWHEEL - Position RSI thru
45° & back to LIFT UP
GDC ALIGN pb - release
EMS ROLL - OFF
Align GDC to IMU

4 CM RCS CHECK

AUTO RCS A/C ROLL (4) - OFF (verify)
cb RCS LOGIC (2)-close (verify)
SC CONT - SCS
MAN ATT (3) - MIN IMP
RCS TRANSFER - CM
AUTO RCS SEL (RING 1) - MNA
AUTO RCS SEL (RING 2) - MNB
cb SCS B/D ROLL, P&Y MNA (3) - open
TEST RING 2 THRUSTERS
cb SCS B/D ROLL, P&Y MNA (3) - close
cb SCS B/D ROLL, P&Y MNB (3) - open
TEST RING 1 THRUSTERS
cb SCS B/D ROLL, P&Y MNB (3) - close
RCS TRANS - SM
MAN ATT (3) - RATE CMD
SC CONT - CMC/AUTO

SUPERCIRCULAR ENTRY

Basic Date 3/9/70
Changed

CSM 109

5 30:00m MN BUS TIE (2) - ON
(-30:00) TAPE RCDR - REWIND

6 35:00m SEPARATION CK LIST
(-25:00)

cb ELS BAT (2) - close (verify)
PRIM GLY TO RAD - BYPASS (pull)
REPRESS PKG vlv - FILL to 865-935,
then ON
O2 SM SUPPLY vlv - OFF
SURGE TK - ON (verify)
CAB PRESS REL vlv (2) - NORM
ABORT SYS PRPLNT - RCS CMD (verify)
SM RCS SEC PRPLNT FUEL PRESS (4) - ON
VHF AM A&B - off (ctr)
HI GAIN ANT PWR - OFF
FC PUMPS (3) - OFF
FC 2 MNA - OFF
Verify Loads Balanced
S BD PWR AMP - LOW
cb ECS RAD CONT/HTR (2) - open
cb WASTE H2O/URINE DUMP HTR (2) - open
cb RAD HTRS OVLD (2) - open
POT H2O HTR - OFF
GLY EVAP TEMP IN - MAN

7 MNVR TO HORIZON CHECK ATT

MNVR TO PAD ATT
R _____ (0°)
P _____ (265°)
Y _____ (0°)

S BD Omni Ant - C

P61 - ENTRY PREP

1 V37E 61E (AVE G ON)

05 09 01427 - ROLL REVERSED
*05 09 01426 - IMU UNSAT *

SUPERCIRCULAR ENTRY

Basic Date 3/9/70
Changed 3/27/70

CSM 109

2 F 06 61 IMPACT LAT, LONG, HDS UP/DN (+/-)
41:30m (.01°, .01°, +00001)
(-18:30) PRO

3 F 06 60 GMAX, V400K, GAMMA EI (.01G, fps, .01°)
Record
GMAX _____
V400K _____
GAMMA EI _____
PRO

4 F 16 63 RTOGO (.1nm) _____ PAD _____
VIO (fps) _____ PAD _____
TFE(min-sec) _____
If NO COMM, Set RTOGO & VIO in EMS
& initialize
(ACCEPT) PRO
(RECYCLE) V32E to 3

P62 - CM/SM SEP & PRE-ENTRY MNVR

5 F 50 25 00041 REQUEST CM/SM SEP
43:00m COMPARE PITCH ATT WITH PAD DATA _____
(-17:00) If not +5°, G&N NO GO
YAW - 45° OUT-OF-PLANE (LEFT) (315°)
RATE - HIGH
ATT DB - MIN
MAN ATT(3) - RATE CMD
SC CONT - SCS/FREE
BMAG MODE (3) - ATT1/RATE 2
MN BUS TIE (2) - ON (verify)
PRIM GLY TO RAD - BYPASS (verify)
EMS MODE - STBY (verify)
CM RCS LOGIC - on (up)
SECS LOGIC (2) - on(up)(verify)
SECS PYRO ARM (2) - on (up)


45:00m CM/SM SEP (2) - ON
(-15:00) If docking ring still on:
CSM/LM FNL SEP (2) - on(up)(verify)

Basic Date 3/9/70
Changed _____

(258°P)

50:00m
(-10:00)
(236°P)

(__:__:__)



(__:__:__)

MAN ATT (3) - MIN IMP
BMAG MODE (3) - RATE 2
C&W MODE - CM
RCS TRNFR - CM
CM RCS MANF PRESS - 287-302 psia
CM RCS LOGIC - OFF
SECS PYRO ARM (2)-SAFE
Monitor VMA/B:

If <25 vdc go to EMERG

POWERDOWN pg

AUTO RCS SEL A/C ROLL (4) - OFF (verify)
cb SCS B/D ROLL, P & Y MNB (3) - open
AUTO RCS SEL CM 1(6)-MNA (verify)
YAW back to 0°

PITCH TO HORIZ TRACK ATT

ROLL - 0° (LIFT UP)

PITCH - 400K Horiz Mark (31.7°)

YAW - 0°

ATT DB - MAX

EMS DATA - Verify

EMS FUNC - ENTRY (verify)

EMS MODE - NORMAL

MAINT HORIZ TRK

MAN ATT (3) - RATE CMD

PRO (Act ENTRY DAP Att Hold)

6 F 06 61 IMPACT LAT, LONG, HDS/DN (.01°, .01°, -00001)
PRO (CMC Guidance)
MAN ATT (3) - MIN IMP (if desired)

7 POSS 06 22 FINAL ATT DISP, RPY (.01°)
(Only if X-axis beyond 45° of Vel vector)

P63 - ENTRY INIT

8 06 64 G, VI, RTOGO (.01G, fps, .1nm)
FDAI SCALE - 5/5
ROT CONTR PWR DIR (2) - MNA/MNB
TAPE RCDR - HBR/RCD/FWD

Basic Date 3/9/70
Changed

CSM 109

E
2-5

58:00m
(-02:00)
(177°P)

HORIZ CHECK
Pitch error needle goes toward
zero approaching .05G time
If CMC is GO:
MAN ATT (3) - RATE CMD (verify)
SC CONT - CMC/AUTO

*If DAP NO GO: *
* SC CONT - SCS*
* FLY BETA *
*If CMC NO GO: *
* SC CONT - SCS*
* FLY EMS *

P64 - ENTRY POST .05G

(If no P64 at .05G +5 sec & .05G Lt - on,
GNCS NO GO)

Start DAC

9 (158°P at 400K) RTOGO AT .05G AGREES WITH EMS-verify
(RRT=0:00) HORIZ CHECK
.05G lt - on (EMS START)

.05G time

(+0__:__)

(__:__:__)

(152°P at .05G)

* No EMS START within 3 sec: *
* EMS MODE - BACKUP/VHF RNG *

.05G sw - on (up)

EMS ROLL - on (up)

06 74 BETA, VI, G (.01°,fps,.01G)

NOTE: To monitor N68, (BETA,VI,HDOT)

Key V16 N68E

Compare RSI & FDAI

If CMC or PAD cmds Lift DN,

MNVR Lift DN (Lift UP at 1.5 G)

EMS GO/NO GO

G-V Plot within limits

Monitor G-meter for

convergence with pad data (Do)

CMC is NO GO if commanding

>90° when G >6.52

Go to 13 (P67) or continue

3/9/70
Basic Date
Changed

CSM 109

E
2-6

P65 - ENTRY - UP CONT (VL>18K fps)

10 F 16 69 BETA (.01°) _____
DL (.01G) _____ PAD _____
VL (fps) _____ PAD _____

IF NO AGREEMENT:
*SC CONT - SCS *
*FLY EMS *

PRO

11 06 74 BETA,VI,G (.01°,fps,.01G)
(V<VL+500 fps & RDOT Neg) Go to 13

P66 - ENTRY - BALLISTIC (D<DL)

12 06 22 DESIRED GMBL ANGLES RPY (.01°)
Monitor horiz +12° of 31.7° mark

P67 - ENTRY - FINAL PHASE (AUTO AT .2G)


13 06 66 BETA,CRSRNG ERR,DNRNG ERR
(.01°, .1nm, .1nm)
BETA will be +15° until R3 > -45nm
Monitor lift vector on RSI & FDAI
CM RCS: change rings when HE PRESS <1150 psia

F 16 67 RTOGO,LAT, LONG (Vrel=1000fps)
(.1nm, .01°, .01°)

SC CONT - SCS
RTOGO NEG - LIFT UP
RTOGO POS - LIFT DOWN
Monitor altimeter
Record LAT, LONG & VOICE TO RECY at 10K'
Record EMS RTGO
EMS MODE - STBY
EMS FUNC - OFF
DAC - f11

3/9/70
Basic Date
3/27/70
Changed

CSM 109

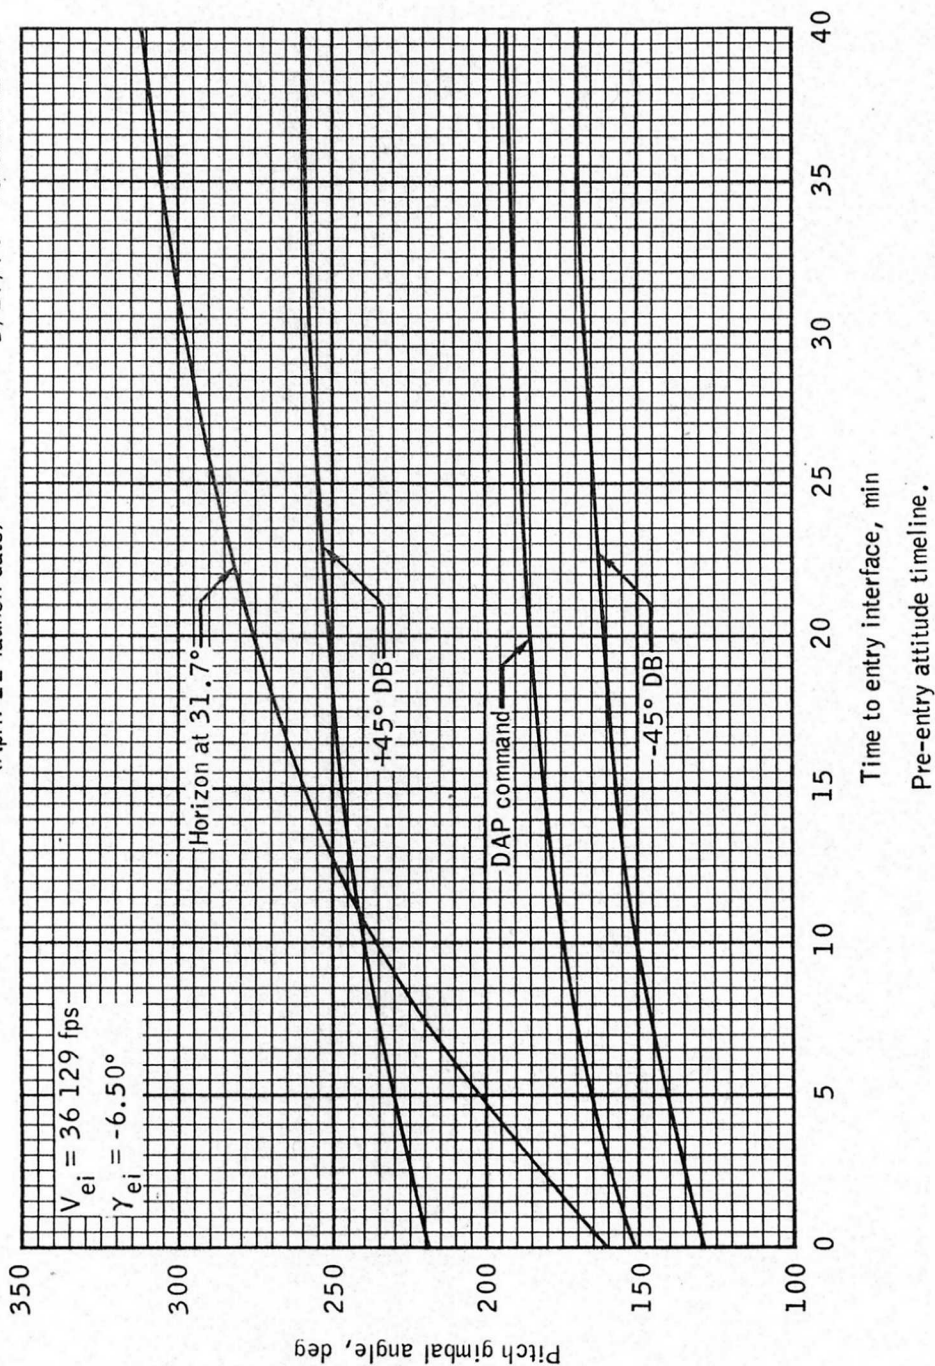

EARTH/POST LANDING

Start Watch

RRT (06:30) STEAM PRESS - pegged at 90K (00:00)
50K' (07:24) CABIN PRESS REL vlv (2) - BOOST/ENTRY (00:54)
SECS PYRO ARM (2) - ARM
Check Altimeter

40K' (07:38) * CM UNSTABLE *(01:08)
*RCS CMD - OFF *
* 40K' APEX COVER JETT PB-PUSH *
DROGUE DEPLOY PB - PUSH (2 sec
*after apex cover jett) *

30K' ELS LOGIC - on (up) (01:26)
ELS - AUTO

24K' (08:10) RCS disable (auto) (01:40)
RCS CMD - OFF

Apex cover jett (auto)
APEX COVER JETT PB - PUSH
(WAIT 2 SECS)
Drogue parachutes deployed (auto)
DROGUE DEPLOY PB - PUSH

If Both Drogues Fail:
*ELS - MAN *
*Stabilize CM *
5K' MAIN DPLY PB - PUSH
*ELS - AUTO *

23.5K' Cabin Pressure increasing
*If not increasing by 17K': *
CABIN PRESS REL vlv (RH) - DUMP

10K' (09:01) Main parachutes deployed (Drogues +49s) (02:31)
MAIN DEPLOY PB - PUSH (within 1 sec)
SURGE TK 02 vlv -OFF (if unsuited)
REPRESS PKG vlv -OFF (if unsuited)
DIRECT 02 vlv -OPEN
VHF ANT - RECY
VHF AM A - SIMPLEX
VHF BCN - ON

Basic Date _____
3/9/70
Changed _____

E
3-2

CABIN PRESS REL vlv (2) - CLOSE
CM RCS LOGIC - on (up)
If main or pyro bus
lost, use RHC's for
*burn, not DUMP sw *

CM PRPLNT - DUMP (burn audible)
Monitor CM RCS 1&2 for He press decrease
NO BURN or PRESS DECREASE
* USE BOTH RHC's *

*DO NOT FIRE PITCH JETS *

CM PRPLNT-PURGE
CM RCS He DUMP PB - PUSH
RHC (2) - 30 secs, No PITCH

Stow DAC

STRUT LOCKS (4) - UNLOCK

If night landing:

cb FLOAT BAG #3, FLT/PL (1 cb)-close

PL BCN LT - LOW

cb FLT & PL BAT BUS A,B,&BAT C (3)-close

cb FLT & PL MNA & B (2) - open

cb RAD HTR OVLD (2) - open (verify)

cb SPS P&Y (4) - open (verify)

cb BAT RELAY BUS (2) - open

3K' CM RCS PRPLNT (2) - OFF (terminates purge)
CABIN PRESS REL vlv (RH) - DUMP
ELS AUTO (verify)
ELS LOGIC - ON (verify)
FLOOD Lts - POST LDG

800' CAB PRESS RELF vlv - CLOSE (latch off)
MN BUS TIE (2) - OFF

POSTLANDING STABILIZATION, VENTILATION, COMMUNICATIONS

1 Stabilization after landing
cb MAIN REL PYRO (2) - close
MAIN RELEASE - on (up)
SECS PYRO ARM (2) - SAFE
SECS LOGIC (2) - OFF

No contact with recovery forces

*VHF AM A&B - off (ctr) *

*VHF AM RCV ONLY - A *

cb PL VENT - close

cb FLOAT BAG (3) - close

cb UPRIGHT SYS COMPRESS (2) - close

Basic Date 3/9/70
Changed 3/27/70

CSM 109

If Stable II:

FLOAT BAG(3)-FILL till 2 min after
upright, then - OFF

VHF AM A/B & BCN - OFF while inverted

If Stable I:

After 10 Min Cooling Period,

FLOAT BAG (3) - FILL 7 min, then OFF

2

Post Stabilization And Ventilation

PL BCN LT - BCN LT LOW

PL VENT vlv - UNLOCK (Pull)

Remove PL VENT Exh Cover

PL VENT - HIGH or LOW

If req'd:

PL DYE MARKER - ON

*Deploy auxiliary dye marker *

Release restraints

cb MNA BAT BUS A & BAT C (2) - open

cb MNB BAT BUS B & BAT C (2) - open

cb FLT & PL BAT C - open

cb PYRO A SEQ A - open

cb PYRO B SEQ B - open

*EACH HR - CHECK DC VOLTS $\geq$ 27.5 V *

*If Not: *

* cb FLT & PL-BAT BUS A&B (2) -open*

* cb FLT & PL BAT C (1) - close *

* GO TO LOW POWER CHECKLIST *

Unstow and install PLV DISTRIB DUCT

Deploy grappling hook and line if req'd

UNAIDED EGRESS PROCEDURES

PREPARATION

Disconnect umbilicals

Neck dams on (if suited)

Configure couch(s) - 270°

Armrests stowed

Unstow survival kits

Connect lanyards, (green to S/C, white to crew)

STABLE I

PL VENT - OFF

cb Pnl 250 (all) - open

Basic Date 3/9/70
Changed

Charge hatch counterbalance
Open side hatch
ACTR HNDL SEL - N
Remove raft from kit No. 2
Put raft overboard & pull inflation lanyard
Pass kits to raft
Egress, inflate life vest, board raft
 If no ventilation - CM 02 supply ~1 hr

STABLE II

cb CREW STA AUDIO (3) open
 PWR (3) - OFF
 SUIT PWR (3) - OFF
PRESS EQUAL vlv - OPEN
Remove & stow hatch
Put survival rucksacks down tunnel
Exit feet first; when clear of S/C inflate
 water wings
Remove life raft from kit No. 2 and inflate
 If no ventilation - CM 02 supply ~1 hr

POST LANDING COMMUNICATIONS

VHF ANT-RECY (verify)
VHF BCN - ON (verify)
 If no contact with recovery forces
 perform VHF BEACON Check
MONITOR VHF BEACON transmission with
 VHF AM B Rcvr and/or Survival Transceiver
 *VHF Beacon not operating *
 *connect Survival Transceiver to ant *
 cable conn P112 behind VHF ant access pnl
 *and place radio in BCN mode *

LOW POWER CHECKLIST

VHF BCN - OFF
VHF AM (3) - RCV
FLOOD LTS - OFF
VHF AM A&B - off (ctr)
VHF AM RCV ONLY - A (verify)
COUCH LIGHTS - OFF
POSTLANDING VENT SYS: minimize use
SURV RADIO - plug into VHF BCN ANT cable
 conn P112 behind VHF ant access pnl & turn
 radio on in BCN mode

3/9/70
Basic Date _____
Changed _____

CSM 109

EMER
1-1

EMERGENCY PROCEDURES
(Flight copies only)

see CSM SYSTEMS CHECKLIST

EMERGENCY PROCEDURES

Basic Date 3/9/70
Changed

CSM 109

