

HARDWARE DOCUMENTATION FOR OSHWA CERTIFICATION

HOS Trigonometry 1.5

*Humanoid Operating System · robotic-arm Cartesian layer only · physical joystick command**Arduino Uno · CNC Shield V3 · A4988 drivers · analog joystick · NEMA 17 steppers*

Name: **HOS Trigonometry 1.5**. Version: **1.5**. Scope: the robotic-arm Cartesian layer only. It is not the mobile base, not the vision stack, and not Shell 1.5. It belongs to the Humanoid Operating System published at github.com/Aarav-111/Humanoid-Operating-System by Prolabs Robotics (project lead Aarav Jaisingh, co-lead Siyona Chicker). HOS splits a robotic arm (the worker) from a mobile base (the mover). Trigonometry 1.5 is only the arm: a three-axis Cartesian mechanism that carries the tool through X, Y and Z.

This file is the hardware document for that version. It is written so another builder can study, modify, and reproduce the arm. It is not itself an OSHWA certificate. Certification is a separate submission at certification.oshwa.org once this document and the design files are public.

What is original, and what is not. Arduino Uno, CNC Shield V3, A4988 modules, the analog joystick breakout, NEMA 17 motors, the metal 10 A supply, belts, pulleys, and the leadscrew are third-party modules with public datasheets. The creator contribution is the Cartesian integration, the lid-mounted physical command console, the hybrid belt/leadscrew drive, and Trigonometry 1.5, the firmware that resolves a joystick vector or an HOS grid cell into step pulses.

1. What HOS Trigonometry 1.5 is

HOS separates a robotic arm from a mobile base. This document covers the arm only. Trigonometry 1.5 is that arm in Cartesian form: belts on X and Y, a leadscrew on Z, a tool motor on the carriage, and a joystick that jogs those three axes. Locomotion, navigation, and the camera planner are other HOS layers and are out of scope here.

X and Y are belt-driven on aluminium V-slot. Z is a leadscrew with parallel smooth-rod guidance. Motion electronics are an Arduino Uno, a CNC Shield V3, and A4988 drivers, fed by a separate 10 A metal supply. An HOS plan can ask this arm for a grid move — `goto_coordinate(T,8)`, `pickup()`, `keep()` — but the trigonometry that executes it lives on this stage: column and row become millimetres, a joystick deflection becomes a vector, and the vector becomes STEP/DIR on the arm axes only.

The operator does not have to sit at a laptop to move the arm. The analog joystick on the controller lid is the hand control for teach and jog of X, Y and Z.

2. What is different

A stock GRBL plotter or mini-mill is a PC peripheral. This build adds a command layer that lives on the machine.

Physical software. The joystick is not a decoration. Its two potentiometers and switch are read by the Arduino. Deflection becomes a signed step rate on X and Y; the switch selects Z, enables the drivers, or latches a mode. The same STEP/DIR pins the shield already wires to the A4988s carry those pulses. One firmware owns both the human command and the motor timing. That is the “physical software command” layer: the control law is software, the affordance is a hand control.

Hybrid axes, on purpose. Belts on X and Y give speed and low moving mass for jogging across the table. The Z leadscrew gives holding torque and finer pitch when the tool is loaded vertically. A pure-belt Z would back-drive. A pure-screw XY would be slow to teach. The split matches the job.

Console on the power brick. The controller is not a loose breadboard. The Uno and shield sit in a white printed (or foam-board) bay, the joystick is fixed to the lid, and that bay sits on the metal supply. Power, logic, and the hand control are one station at the corner of the frame.

A tool motor on the carriage. A horizontal NEMA 17 on the Z carriage, separate from the vertical leadscrew motor, carries the end effector. That actuator is part of the arm, not a fourth positioning axis. The shield’s A socket drives it.

3. What is well made

The frame is commodity 2020-class V-slot, joined by white printed brackets rather than machined plates. That is the right call for a reproducible student or farm-lab machine: a builder with a printer and a hacksaw can copy the nodes. Motor mounts, belt anchors, and the Z upright are the same family of parts, so a broken bracket is a reprint, not a shop job.

Motor power and logic power are split. The metal supply (label: 10 A, Keenonic-class enclosed SMPS) feeds the shield's VMOT. The Uno is powered over USB. A4988 modules are socketed, so a cooked driver is a swap. Z is constrained by the screw and two smooth rods, which keeps the carriage from twisting when the horizontal tool motor and its cable weight hang off the front.

Cable looms are zip-tied at the carriage and taped in bundles at the console. It is a working prototype, not a harnessed product: Dupont jumpers are still visible at the end effector, and the console bay is open at the front for probing. That openness is useful while tuning current limits. For a released version, the same pinout should move to a short shielded cable and a closed lid with a strain-relieved exit.

4. The innovation, stated plainly

The innovation is not a new motor or a new board. It is the closed loop between a hand and a three-axis Cartesian stage without a host PC in the command path. Teach, jog, and hold are physical. A later G-code or vision mode can sit on the same shield, because the joystick only occupies analog pins the shield already breaks out. The machine can be driven by a person standing at the table — useful for a robotics challenge cell, a farm fixture, or a teach-pendant workflow — and the entire command path is open: potentiometer, ADC, dead-zone, step timer, A4988, NEMA 17.

5. Hardware views

The views below are the HOS Trigonometry 1.5 hardware: the Cartesian stage, the joystick console on the 10 A supply, the Z carriage with the tool motor, and the printed-part family.

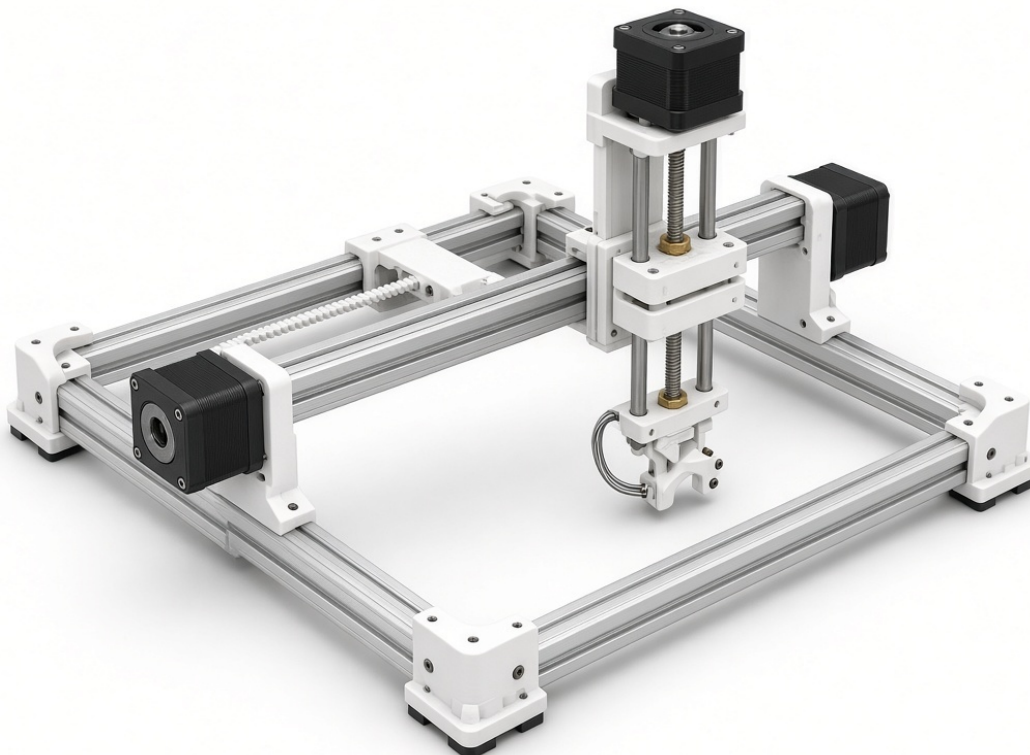


Figure 1. HOS Trigonometry 1.5 stage: belt X/Y, leadscrew Z, NEMA 17s, printed nodes.

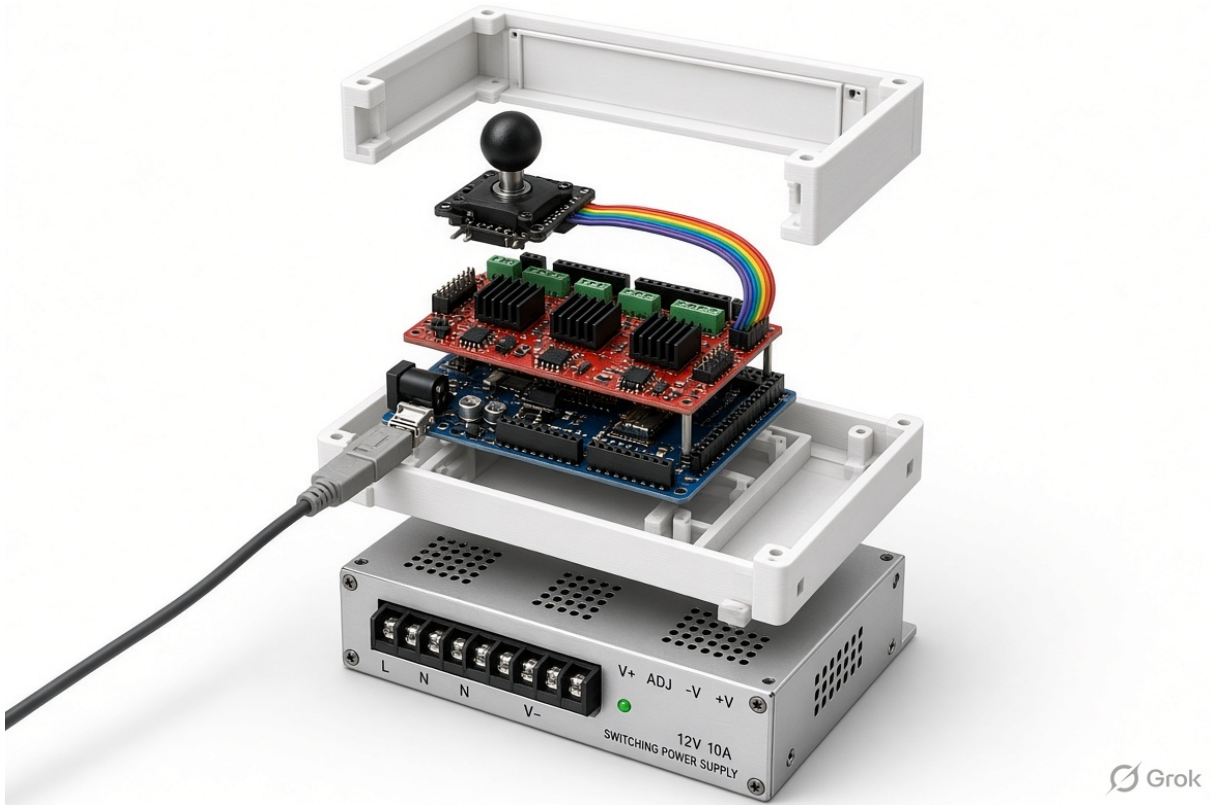


Figure 2. Command console: joystick lid, CNC Shield V3, Arduino Uno, 12 V 10 A supply.

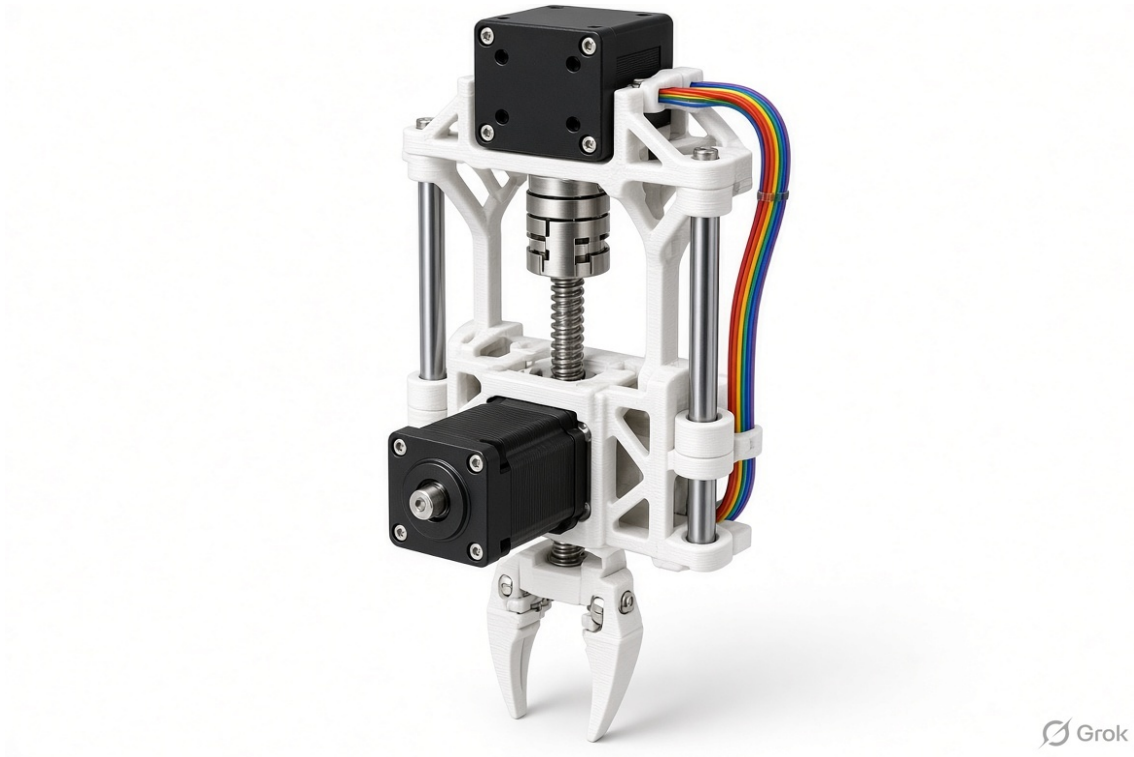


Figure 3. Z carriage: leadscrew motor, coupling, twin rods, tool motor, end effector.

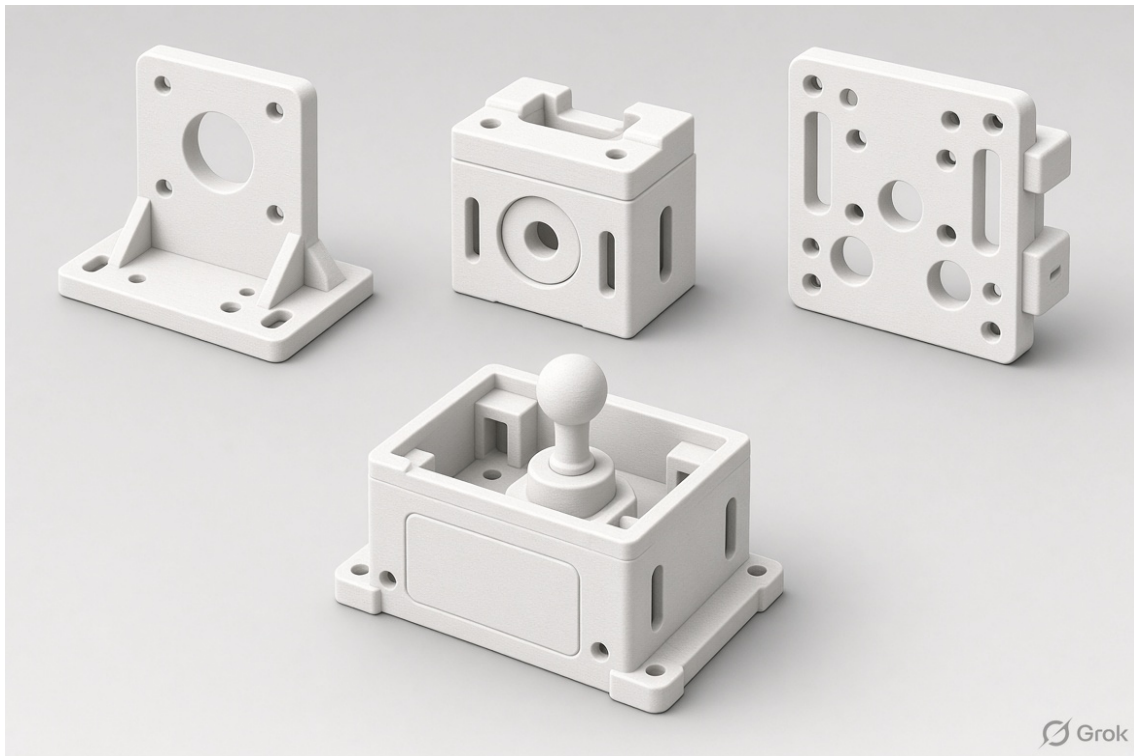


Figure 4. Printed parts: motor foot, idler block, carriage plate, joystick bay.

6. Machine record

The record below is the Trigonometry 1.5 arm: extrusion table, belt span, Z screw and smooth rod, and the joystick console at the corner of the frame.



Figure 5. HOS Trigonometry 1.5 arm. Extrusion table, belt span, Z screw and rod, joystick console.



Figure 6. Z upright, leadscrew, carriage with horizontal NEMA 17, end-effector loom.

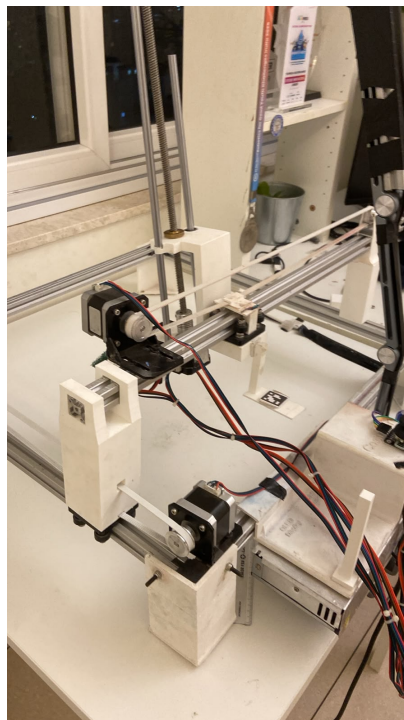


Figure 7. Belt axes. Two NEMA 17s with pulleys, printed feet and idlers, GT2 belt.

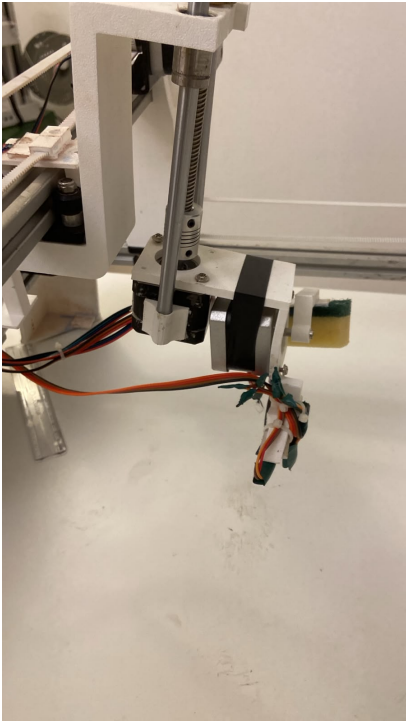


Figure 8. Carriage. Screw coupling, printed clamp, horizontal tool motor, tool loom.

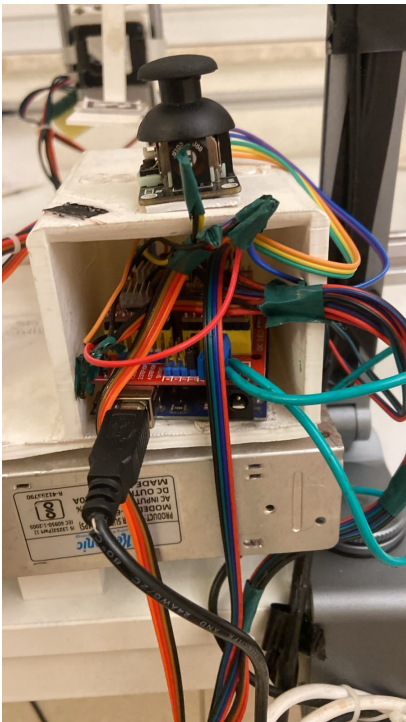


Figure 9. Command console. Joystick on the lid, Uno under the CNC shield, USB, 10 A supply.

7. Bill of materials

Quantities follow the named stack. Confirm before ordering. Third-party lines are not relicensed by this document.

Item	Qty	Role	Status
Arduino Uno (ATmega328P)	1	Command MCU, ADC, step timing	Third-party module, public datasheet
CNC Shield V3	1	STEP/DIR/EN breakout, VMOT, driver sockets	Third-party; open Gerbers exist from several makers
A4988 stepper driver	3 or 4	X, Y, Z, and optional A / tool	Third-party module, Allegro datasheet
Analog joystick module	1	Physical X/Y command and mode switch	Third-party breakout
NEMA 17 stepper, 4-wire	3 or 4	X, Y, Z, optional tool axis	Third-party actuator

Item	Qty	Role	Status
Enclosed SMPS, 12 V class, 10 A	1	VMOT only. Label reads 10 A, Keenonic	Third-party. Do not copy the supply internals
2020 V-slot extrusion	frame	Table and gantry rails	Commodity. Cut list is creator design
GT2 belt, 6 mm, and pulleys	2 axes	X and Y transmission	Commodity
T8 leadscrew, nut, coupling	1	Z transmission	Commodity
Smooth rod, 8 mm class, and bearings	2	Z anti-rotation	Commodity
Printed brackets, bay, carriage	set	Creator structure	Original. Release STL/STEP
USB cable, Dupont, ferrules	lot	Logic and motor wiring	Commodity

A 10 A, 12 V supply is enough for three or four NEMA 17s if each A4988 Vref is set for about 1 A or less. Do not run the motors from the Arduino 5 V pin.

8. Electronics and pin map

The shield plugs onto the Uno. A4988 boards sit in the X, Y, Z sockets, and in A if the carriage tool motor is used. Orient each driver so the enable pin matches the shield silkscreen. Set the current-limit potentiometer before the first move: $V_{ref} \approx I_{max} \times 8 \times R_{sense}$, with R_{sense} typically 0.1 ohm on clone boards, so 1 A wants about 0.8 V. Confirm the sense resistor on the module in hand.

Signal	Uno / shield	Connects to
X STEP / DIR	D2 / D5	A4988 X, then X NEMA 17
Y STEP / DIR	D3 / D6	A4988 Y, then Y NEMA 17
Z STEP / DIR	D4 / D7	A4988 Z, then Z NEMA 17
A STEP / DIR	D12 / D13	Optional tool motor on carriage
Enable (active low)	D8	All A4988 EN, tied on the shield
Joystick VRx	A3	X deflection. A3 is free of GRBL limits
Joystick VRy	A4	Y deflection, or Z when switch held
Joystick SW	D0 or A5	Mode: jog XY / jog Z / disable. Use INPUT_PULLUP
VMOT / GND	Shield power term.	12 V supply. Logic GND common with Uno
5 V / GND	Shield 5 V header	Joystick VCC and GND only

Stock GRBL claims D2–D13 and A0–A2 for limits and feed-hold. This jog layer is a separate sketch, not a GRBL patch. If both modes are wanted later, put the joystick on A3/A4/A5 and bit-bang steps only while a panel switch holds the GRBL serial port idle. Do not drive STEP from two firmwares at once.

9. Trigonometry 1.5 command layer

This layer accepts two arm commands and nothing else. A grid step `goto_coordinate(column, row)` maps onto this Cartesian arm: X = column pitch, Y = row pitch, Z = tool height. A hand on the stick is the teach input for the same three axes. The two potentiometers are a vector in the arm plane. Magnitude is the hypotenuse, $r = \sqrt{v_x^2 + v_y^2}$, and that magnitude sets the step interval. Direction is the sign of each component. Holding the switch replaces Y with Z, so the arm rises or lowers on the leadscrew. The resolver does not drive a mobile base. That resolver is Trigonometry 1.5.

Behaviour as designed for this machine:

- Stick X deflects the X belt. Stick Y deflects the Y belt. Rate grows with deflection, direction follows the sign.
- Switch held: stick Y drives Z on the leadscrew instead of Y. X can stay live or lock, builder's choice; the as-documented default locks X while Z is selected, so a vertical move does not walk the gantry.
- Switch double-click, or a separate enable jumper: D8 releases the drivers. Released drivers hold position only by detent torque. Use that as the E-stop behaviour until a real mushroom switch is added in series with VMOT.
- No host is required to jog. USB is for power and for uploading the sketch.

Reference jog loop, released with this document:

```
center = 512; dead = 40
vx = analogRead(A3) - center
vy = analogRead(A4) - center
if (abs(vx) < dead) vx = 0
if (abs(vy) < dead) vy = 0
zMode = (digitalRead(Sw) == LOW)
intervalX = map(abs(vx), dead, 512, 4000, 250) // microseconds
dirX = (vx > 0)
same pattern for Y, or for Z when zMode
on each elapsed interval: DIR pin, then STEP high 5 us, then low
```

Tune the 250 μ s floor against the motor. A NEMA 17 on a GT2 belt will skip if the interval collapses too far, especially with the carriage cable drag visible in the photos. Start slower, then raise rate.

10. Mechanical notes from the build

X and Y. Each axis is a NEMA 17, a toothed pulley, a belt, a printed motor foot, and a printed idler or belt clamp. The belt runs along the extrusion. Direction is whatever the pulley winding makes it; swap one coil pair or the DIR invert in firmware if the stick and the table disagree.

Z. A vertical trapezoidal screw, coupling, and brass or POM nut carry the carriage. Two smooth rods stop the nut from spinning. The Z motor is mounted on the moving carriage rather than at the top of a fixed screw — a valid arrangement if the screw is fixed to the upright and the motor-nut unit climbs it. Match the coupling style in Figure 8 before copying the printed clamp.

Tool. The horizontal motor and the yellow compliant pad are the arm’s end effector. Treat the pad as a consumable. The Dupont plug is the tool-motor cable; loom it to the carriage before any fast jog so it cannot reach a pulley.

Console bay. White open box, joystick PCB screwed to the lid, shield inside, USB leaving the front, bay resting on the supply. Leave VMOT wires short and ferruled. Mains stays inside the supply enclosure. This document does not open or modify the supply.

11. Bring-up order

1. Unplug VMOT. Upload the jog sketch. Confirm joystick raw values sit near 512 at rest and swing toward 0 and 1023.
2. Set every A4988 Vref with the motor unplugged. Fit drivers. Common GND between supply and Uno.
3. Connect one motor. Apply 12 V. Jog that axis only. If it chatters, lower Vref or lengthen the step interval. If it runs backward, swap DIR.
4. Repeat for Y, then Z, then the tool motor. Do not enable all four at full current on the first power-up.
5. With the stick released, the table must not creep. Widen the dead zone if it does.
6. Add a series emergency switch on the 12 V feed before any unattended move. The joystick switch is a mode control, not a safety rated stop.

12. What to publish for certification

OSHA certification needs the design files, not only this narrative. Minimum set to put in a public repository, then submit:

- This document (CC BY-SA 4.0).
- STL or STEP of every printed bracket, the carriage, and the joystick bay, plus the original CAD if it exists (CERN-OHL-S-2.0).
- The jog sketch (.ino) and a one-page pin map.
- This bill of materials.
- The machine record in Section 6.
- A short note listing third-party modules and linking their datasheets (Arduino Uno, A4988, CNC Shield V3).

Recommended mark, once a UID is issued: “Open Source Hardware, CERN-OHL-S-2.0, certified open source hardware — [UID]”. Do not put the OSHWA mark on the machine before certification.

13. Safety and scope

Steppers and the 12 V feed can pinch and can overheat a mis-set driver. Mains wiring stays inside the listed supply. No claim is made of conformity to any product-safety standard. This is prototype documentation of one machine, version 0.1, for study and reproduction.

14. Certification checklist

Design files and this narrative allow study, modification, making, and sale. Non-commercial and no-derivatives terms are not used.

Original contribution is identified separately from third-party modules that already have public datasheets.

Bill of materials, machine record, pin map, bring-up order, and `hos_trigonometry_1_5.ino` are included.

Publish the STL or STEP of the printed nodes next to this document. Suggested repo path: Hardware/Trigonometry-1.5 in github.com/Aarav-111/Humanoid-Operating-System.

Suggested certification name: HOS Trigonometry 1.5. Submit only after the repo copy is public. Do not apply the OSHWA mark before a UID is issued.

Documentation licence: CC BY-SA 4.0. Hardware contribution licence: CERN-OHL-S-2.0. Upstream project: github.com/Aarav-111/Humanoid-Operating-System. HOS Trigonometry 1.5.