Set up AXORA. Work comfortably.

A simple guide to your first setup and everyday use.



From connection to confident control

02 Start here
04 Calibration
13 Quick help

Calibrator 1.1.10 • English • November 2026

Connect.
Release. Check.

You need AXORA, a USB cable and the calibrator application on your computer.

01

Install the driver first

For CAD, install **3Dconnexion 3DxWare**. Drivers for **Windows and macOS** are available here:
3dconnexion.com/us/drivers/

02

Prepare AXORA and the calibrator

Place the base on a stable surface. Extract all application files from the archive, then run AxoraCalibrator.exe.

03

Connect AXORA

Plug in the USB cable. Click “Refresh ports”, select the port and click “Connect”. Release the handle and all buttons.

WHAT TO DO NEXT

Already set up?

Open “Motion test”. You do not need to run full calibration every time you connect.


First-time setup

Open “Calibration” and run “Full calibration”. Start on page 4.

The calibrator in this guide runs on Windows. For CAD on macOS, download the matching driver using the link above.

Everything you need in one window

Sections are on the left. Connection controls and the CAD button stay at the top.

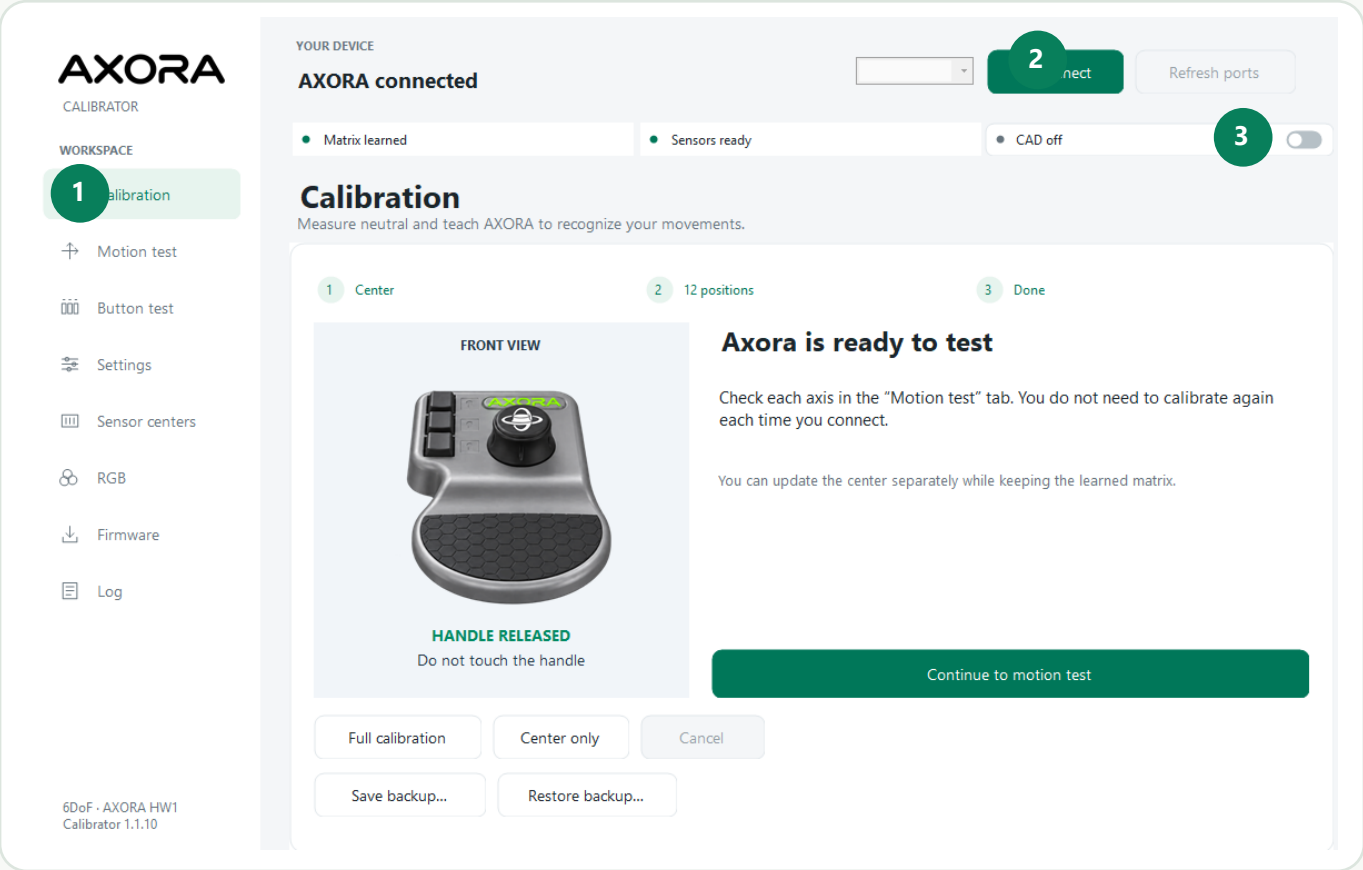

Example interface from version 1.1.10. Values are shown for illustration.

1 **Section menu**

Calibration, tests, settings and lighting.

2 **Connection**

Choose a USB port and connect to AXORA.

3 **CAD button**

Turn model control on or off from any section.

Choose your language at the bottom left of the window. Select “English”.

Teach AXORA your movements

Calibration helps the device recognise each direction and stop when you release the handle.

Center only

Use this if AXORA is already calibrated but its resting position is not confirmed. Release the handle and click “Center only”.

Full calibration

Use this for your first setup or after changes to the device. The application measures the resting position and guides you through 12 movements.

FULL CALIBRATION: THREE SIMPLE STEPS

01

Release the handle

Click “Full calibration”. Do not touch the device while the center is measured. Click “Cancel” to stop.

02

Make the movement shown

In the application: click “Measure this position”, then move the handle into position during the 3-second countdown.
Or use button 1: first move the handle in the required direction. Hold that position, then press and release button 1 on AXORA. Keep the handle still until the result appears.

03

Wait for the result

Once accepted, continue with the next movement. After all 12, wait for confirmation that calibration has been saved.

Center only without the calibrator

Close the calibrator and release the handle. Hold all three buttons together for 3-5 seconds, then release them. Leave the handle untouched until the measurement finishes. Full calibration is preserved.

Slide in four directions

Positions 1-4. Slide the handle parallel to the desk, keeping it upright.

01 / 12

Right



Slide the handle to the right. Keep it upright.

02 / 12

Left



Slide the handle to the left without tilting it.

03 / 12

Away from you



Slide the handle forwards, away from you, without tilting it.

04 / 12

Towards you



Slide the handle backwards, towards you, without tilting it.

Every movement: use the application button or button 1 on AXORA (page 4). Hold the position until the measurement finishes.

Up, down and two tilts

Positions 5-8. First move the handle vertically, then tilt its top.

05 / 12

Up



Gently lift the handle. Keep the base on the desk.

06 / 12

Down



Press the handle straight down without forcing it to its limit.

07 / 12

Tilt away



Tilt the top of the handle away from you. Do not slide the whole handle.

08 / 12

Tilt towards you



Tilt the top of the handle towards you. Keep the base still.

Every movement: use the application button or button 1 on AXORA (page 4). Hold the position until the measurement finishes.

Sideways tilts and turns

Positions 9-12. For the turns, twist the handle around its vertical axis.

09 / 12

Tilt right



Tilt the top of the handle to the right without twisting it.

10 / 12

Tilt left



Tilt the top of the handle to the left without twisting it.

11 / 12

Clockwise



Looking from above, turn the handle clockwise.

12 / 12

Counterclockwise



Looking from above, turn the handle counterclockwise.

Every movement: use the application button or button 1 on AXORA (page 4). Hold the position until the measurement finishes.

Make sure everything works

After calibration, release the handle and open “Motion test”.

01

Check the resting position

With the handle released, all six axis readings should be zero.

02

Try every direction

Try the three sliding movements and three rotations in both directions. Release the handle after each movement.

03

Try controlling a model

Click the CAD button at the top so it reads “CAD enabled”. Release the handle, then check model control in your CAD application.

Check the three buttons too

Open “Button test” and click “Start test”. Press and release each button in turn. The “Working” label confirms the test.

Click “Finish test”, then turn CAD on again.

CAD use requires **3Dconnexion 3DxWare** installed on your computer and device support in your CAD application. Download the driver from the official website.

Make control feel right for you

Open “Settings”. Change one setting at a time and check the result after each change.

01

Sensitivity

Model moving too fast? Lower the value. Too slowly? Increase it a little.

02

Dead zone

A small area around the resting position where movement is ignored. Increase it gradually if the model reacts to very light touches.

03

Reverse direction

If the opposite direction feels more natural, enable “Reverse sign” for that axis.

Changed a setting? Save it.

Click “Apply and save to Axora”, then return to the motion test.

If movements are noticeably mixed, or the model moves without a touch, first check the center and calibration.

Set it up once.
Keep a backup.

A backup lets you restore your settings after an unwanted change.

AFTER A SUCCESSFUL SETUP

“Save backup…”

Click this button in “Calibration”. Choose a clear file name and save it somewhere easy to find.

Need your previous settings back?

01 **Choose your backup**

Click “Restore backup…” and select the file you saved.

02 **Wait until it finishes**

Confirm the restore. Do not unplug USB while settings are being written.


03 **Check the result**

Release the handle, check the movements and turn CAD on again.

Use a backup only for the same AXORA with no changes to its construction. Lighting settings are saved separately.

Your comfort.
Your brightness.

Open the RGB section to adjust the device lighting.

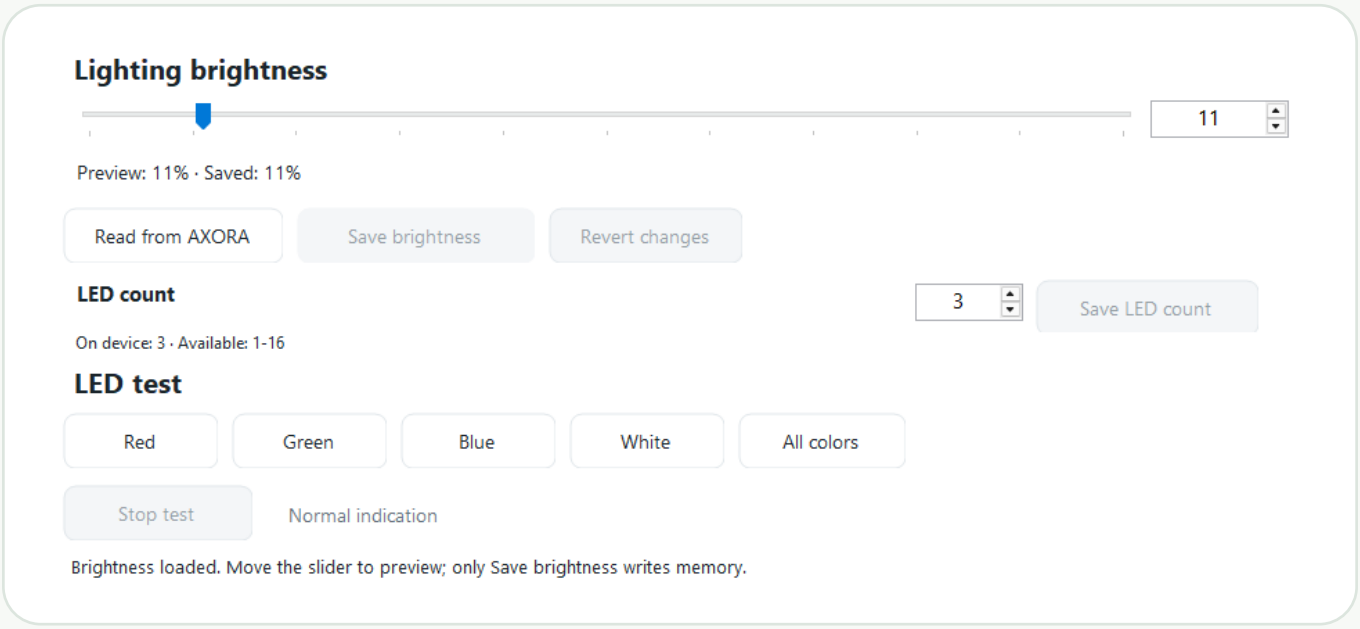

Brightness

Move the slider or enter a value. 0% turns the lights off. Click “Save brightness” to keep the setting after reconnecting.

Colours

Click a colour name or “All colors”. The test stops automatically after 10 seconds; you can stop it sooner.

Number of lights

Set this to match your device and click “Save LED count”. Brightness has its own save button.

Update your device from the application

Firmware is the software inside AXORA. The calibrator helps you check for updates and install them.

01

Back up your settings

Connect AXORA and make sure all other tests and setup tasks have finished.

02

Check for an update

Open “Firmware” and click “Check GitHub”. You need an internet connection, but no GitHub sign-in or password.

03

Click “Update firmware”

If a newer compatible version is available, start the update. Keep USB connected and the application open until it confirms completion.

04

Check AXORA after the update

Release the handle, then check the movements and buttons. Turn CAD on again to control your model.

Seeing a master password field?

This is a separate service mode for installation or reflashing. You do not need it for a normal update. If you need an installation, contact the person who set up your AXORA.

If something does not work

Start with these simple checks. Messages in the application will guide your next step.

The application cannot find AXORA

Check the cable and USB connection, then click “Refresh ports”. Close other applications that may be using the device.

“Center not confirmed”

Release the handle and buttons, then wait a few seconds. If the message remains, run “Center only”.

A measurement is rejected

Read the red advice. Hold the handle steadily without forcing it to its limit. Adjust the amount of movement if needed, then retry.

The model does not move

Check that the top button reads “CAD enabled”. Make sure 3Dconnexion 3DxWare is installed and running, then check your CAD application settings.

A button is unavailable or an update will not start

Wait for the current task to finish. For an update, check your internet connection. If the application requests another tool, share that message with the person who set up AXORA.

Need help?

Send your support contact a screenshot of the message and explain when it happened. For stuttering, open “Motion test”, click “Record motion 12 s”, save the recording and attach the file.