


A16-R101 BASE ADAPTER

PETG / PA12 trial; planar plate. Bottom datum A at assembly Z58. OD134 +/-0.15 after coupon compensation.

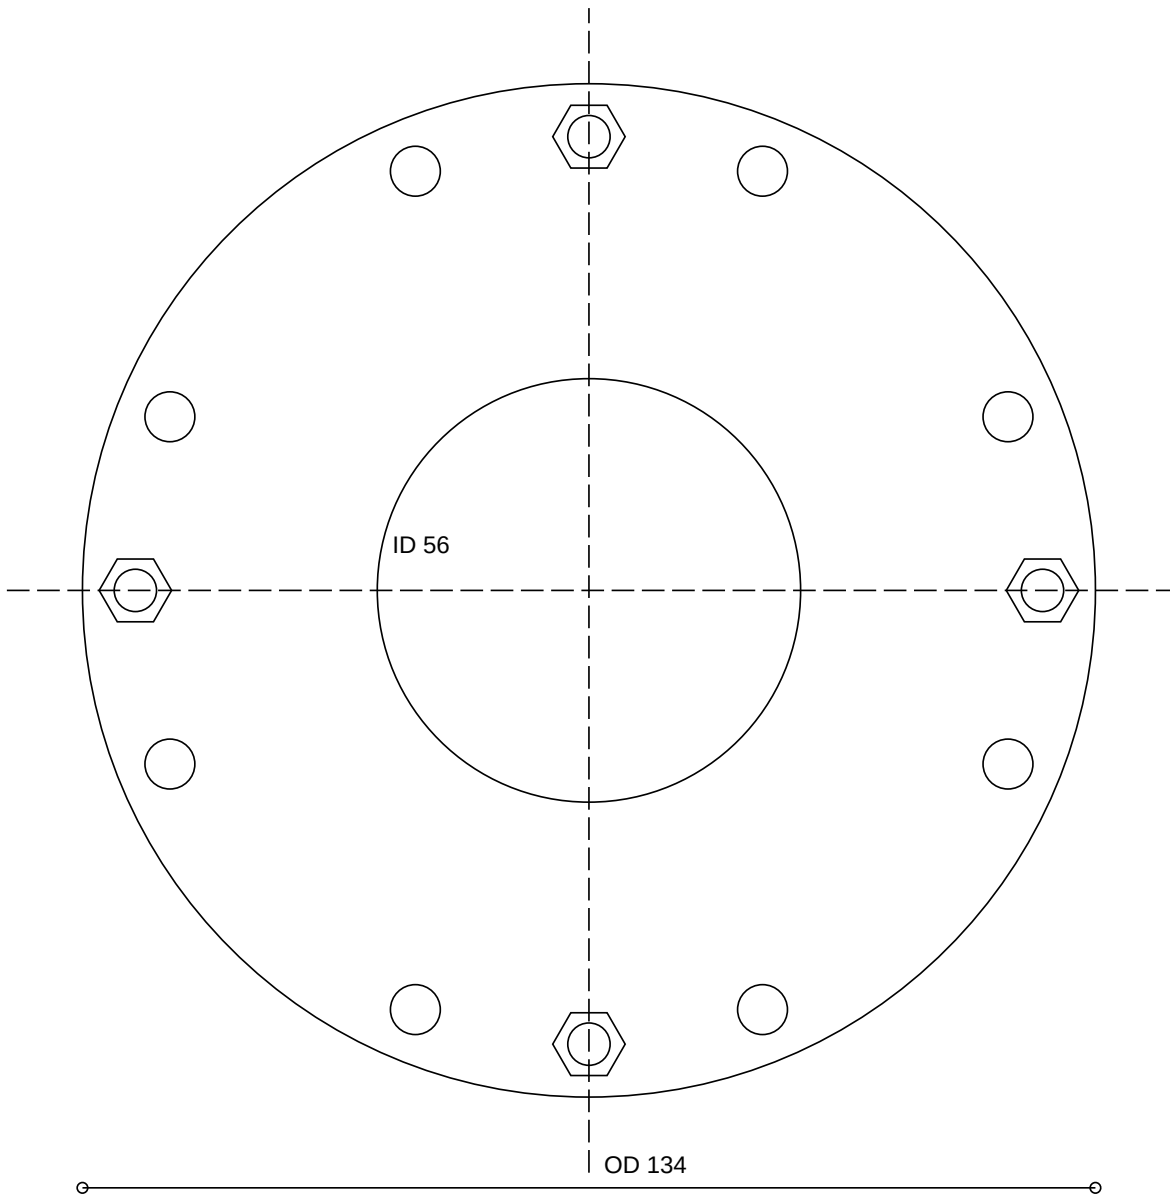

Hole coordinates in local XY; datum B at centre

01	X	55.433	Y	22.961
02	X	22.961	Y	55.433
03	X	-22.961	Y	55.433
04	X	-55.433	Y	22.961
05	X	-55.433	Y	-22.961
06	X	-22.961	Y	-55.433
07	X	22.961	Y	-55.433
08	X	55.433	Y	-22.961

8x D6.6 THRU / PCD120 /22.5 +45*k deg

4x D5.6 THRU at (+/-60,0), (0,+/-60)

4x AF8.3 hex nut pockets,5 deep FROM TOP

M5 nut4.7 high;0.3 recess; pocket bottomZ61




8

Bore D56 +0.2/0; general printed linear tolerance +/-0.2.

Break sharp edges0.3; clear brim from datum A. No finishing on B06.

A16-R102 J1 FRONT HOLDER

PETG / PA12 trial; flat plate. Bottom datum A at J1local Z-2.5. Ring ID72.4 +0.2/0.

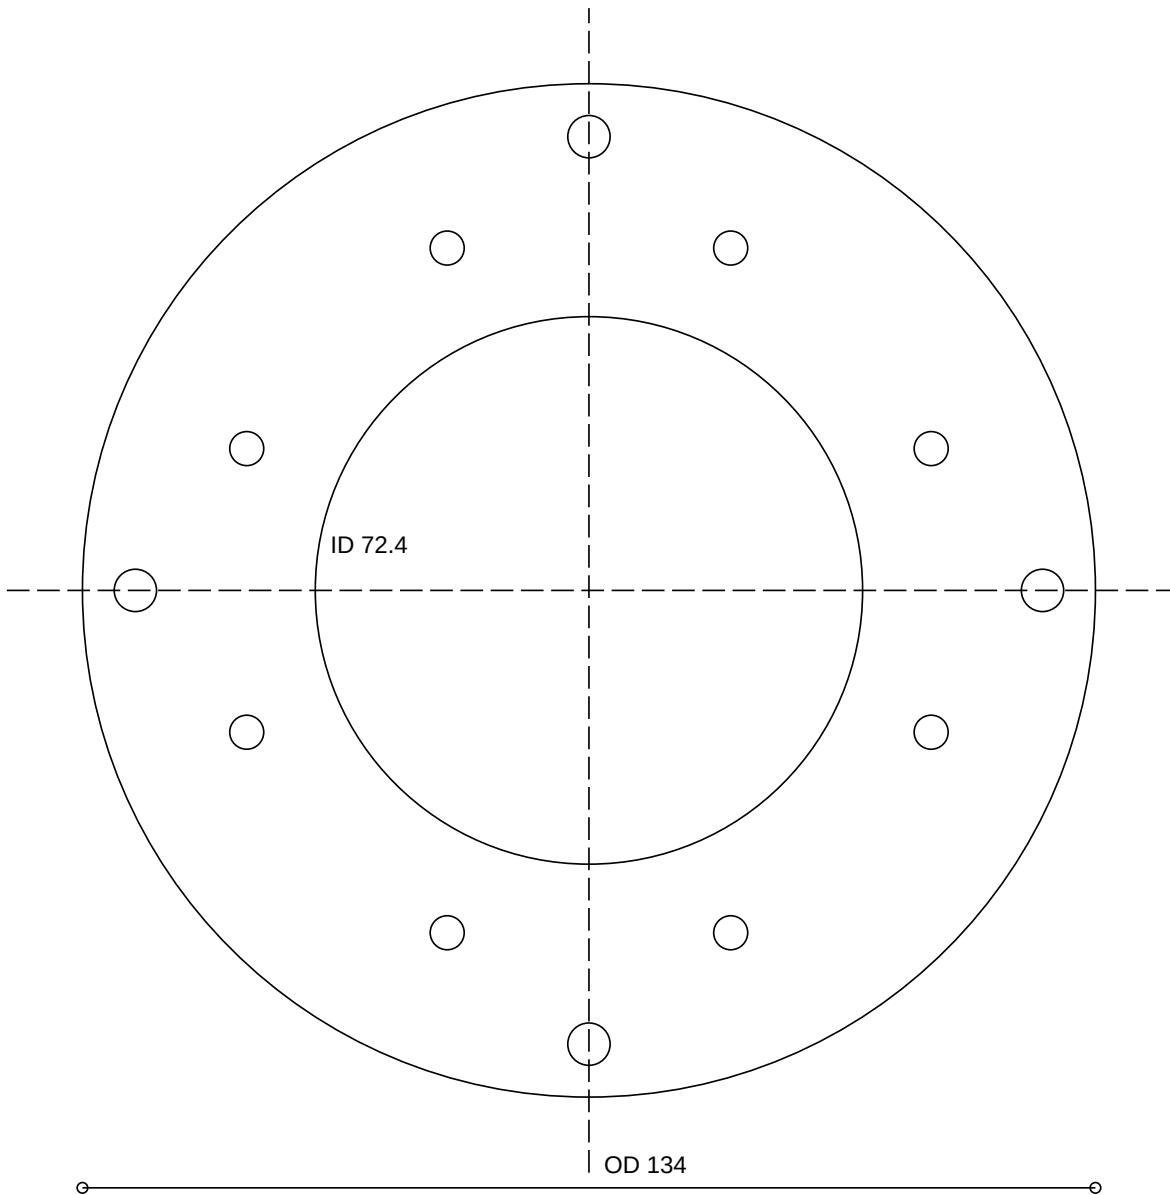

Hole coordinates in local XY; datum B at centre


- 01 X -45.270 Y -18.751
- 02 X -45.270 Y 18.751
- 03 X -18.751 Y -45.270
- 04 X -18.751 Y 45.270
- 05 X 18.751 Y -45.270
- 06 X 18.751 Y 45.270
- 07 X 45.270 Y -18.751
- 08 X 45.270 Y 18.751

8x D4.5 THRU / native RS03 front PCD98

4x D5.6 THRU at (+/-60,0), (0,+/-60)

8x M4x12 +0.8 washer: nominal insertion5.2

Source front depth8; do NOT use rear-hole datum




6

OD134 +/-0.15; print flat. Hole positions retained from native STEP.

Check RS03 actual output register;1.2mm nominal radial running gap.

A16-R103 J1 OUTPUT PEDESTAL

PETG / PA12 trial; conventional coaxial turned/milled form. Bottom datum A at J1 rotorZ0.

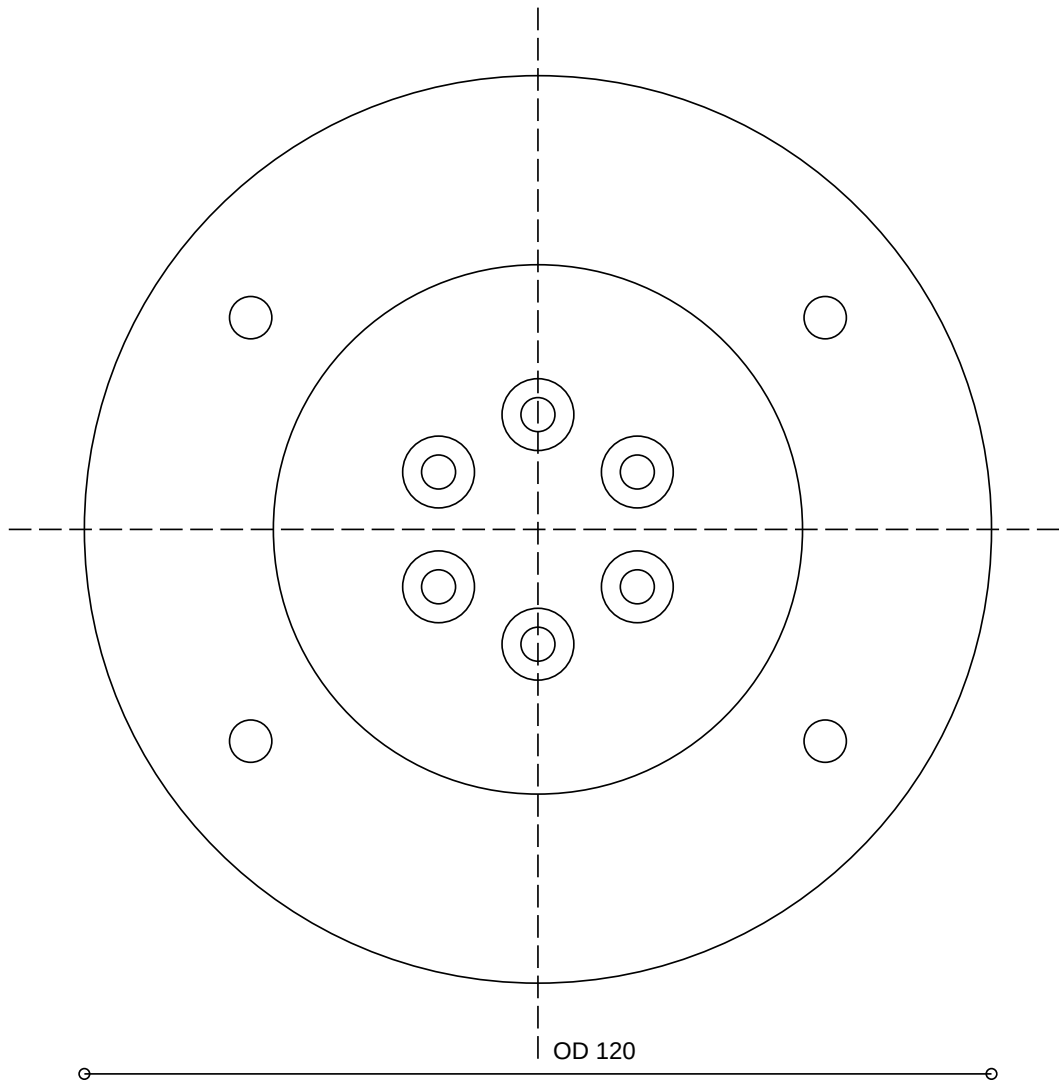


Hole coordinates in local XY; datum B at centre

- 01 X -13.146 Y -7.590
- 02 X -13.146 Y 7.590
- 03 X 0.000 Y -15.180
- 04 X -0.000 Y 15.180
- 05 X 13.146 Y -7.590
- 06 X 13.146 Y 7.590

6x D4.5 THRU / source output PCD30.36

6x counterbore D9.5 x10 FROM TOP

4x D5.6 through upper plate at X+/-38,Y+/-28

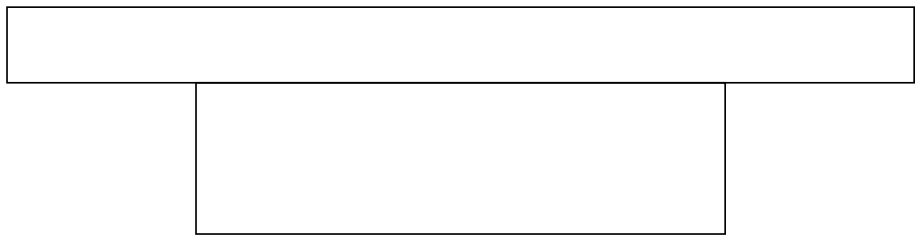


M4x25 +0.8 washer:20 grip /4.2 insertion /source blind depth6

Overall30; D70 +/-0.15 stem /D120 plate. Print upper plate DOWN; motor face UP.

A16-R104 SPACERS / ASSEMBLY STACK

Purchased steel spacers; do not print as loaded columns. Four equal lengths; saw-cut then square/deburr.

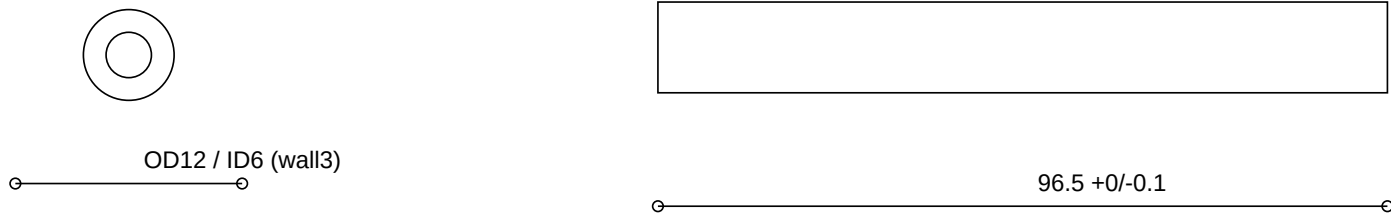

4x spacers at PCD120 cardinal phase.4x M5x110 +washer1.0 + nut4.7 in upper-entry pockets.

Nominal stack: holder6 + spacer96.5 + pocket roof gap0.3 + washer1 + nut4.7 + tip1.5 =110.

Bolt head bearingZ169.5; tipZ59.5. B06 unchanged mating planeZ58:1.5mm nominal clearance.

Base8x M6x20 +washer1.6:8mm grip,10.4 insertion into THRU; verify underside against actual base.

Prototype assembly first: no motor power, no real gas spring, external support; clear all connectors.

Production metal plates, preload, material, bearing loads and fatigue require separate drawings/qualification.