



JDR Restoration & Remodeling

JDR Restoration & Remodeling
- Home Re-Imagined -
E: jdrrestoration.com

Insured: [REDACTED]
Property: [REDACTED]
[REDACTED]

Home: [REDACTED]

Contractor: [REDACTED]
Company: JDR Restoration & Remodeling
Business: [REDACTED]
[REDACTED]

Business: (972) 584-7961
E-mail: info@jdrremodeling.com



Claim Number: Policy Number: Type of Loss: Water Damage

Date of Loss:
Date Inspected: 7/2/2024 12:00 PM

Date Received:
Date Entered: 7/5/2024 8:25 AM

Price List: TXDF8X_JUL24
Restoration/Service/Remodel
Estimate: [REDACTED]




Main Level

Main Level

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
Job setup, safety and administration							
1. Residential Supervision/Project Management - per hour	20.00 HR		0.00	72.29	0.00	289.16	1,734.96
Estimated 2 hrs/day, 5 days/wk, for 2 weeks. Supervisor is responsible for budget creating and management, trade scheduling, ordering materials, working with named insured to select finishes, ensuring timely completion of project, and overall job quality.							
From Xactimate:							
Includes: Hourly labor rate for residential supervision/project management.							
Note: This is for a Superintendent/Proj. Manager used to manage residential jobs where formal Supervision/Proj. Management is needed to coordinate the work of subcontractors, or to perform other project management duties. This item should not be used for a working crew leader. The GC, estimator and/or parties involved will determine whether or not the use of a formal Superintendent/Proj. Manager is warranted, as well as the number of hours required to perform these tasks. A Superintendent/Proj. Manager generally manages multiple jobs at once. Generally, a typical single-family detached rebuild or new build would have a minimal amount of hours per weekday. In some cases, such as large multi-family/multi-unit/multi-bldg projects a full-time formal supervisor may be warranted. A Superintendent/Proj. Manager may complete tasks such as, but not limited to, creating/maintaining project schedules, coordinating/meeting trades, ordering materials, inspecting job sites, obtaining permits, meeting with inspectors, etc.							
2. Megohmmeter check electrical circuits - average residence	1.00 EA		0.00	973.87	0.00	194.78	1,168.65
Necessary to check electrical system to insure it is safe for occupants							
3. Respirator - 1/2" face - multi-purpose resp. (per day)	2.00 DA		0.00	1.67	0.00	0.66	4.00
2 concrete grinders for 2 days - one grinding concrete and one HEPA vacuuming							
4. Respirator cartridge - A only (per pair)	2.00 EA		0.00	16.92	2.79	7.32	43.95
2 concrete grinders for 2 days - one grinding concrete and one HEPA vacuuming							
5. Add for 1" filter (for canister/backpack vacuums)	1.00 EA		0.00	89.91	6.02	19.18	115.11
Total: Main Level					8.81	511.10	3,066.67

Bathroom

Height: 9'

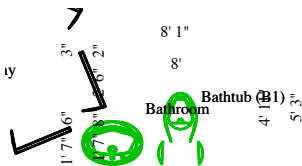

150.50 SF Walls
189.83 SF Walls & Ceiling
2.48 SY Flooring
25.83 LF Ceil. Perimeter

39.33 SF Ceiling
22.28 SF Floor
11.50 LF Floor Perimeter

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
6. Batt insulation replacement per LF - 4" - up to 2' tall	5.42 LF		0.00	3.30	0.93	3.76	22.58
Allowance to replace insulation on exterior-facing walls							

CONTINUED - Bathroom

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
7. 1/2" - d [redacted] all per LF - up to 2' tall	11.50 LF		0.00	12.79	1.40	29.70	178.19
8. R&R 1/2" d [redacted] all - hung, taped, floated, ready for paint	8.00 SF		0.46	3.14	0.44	5.84	35.08
Replace drywall that was damaged while tile tub surround was being removed during mitigation							
9. R&R Drywall [redacted] w return - up to 6"	4.00 LF		0.46	11.18	0.42	9.38	56.36
Repair drywall return on both sides of window							
10. Texture drywall [redacted] hand texture	38.75 SF		0.00	1.25	0.26	9.74	58.44
Additional SF needed to blend in with surrounding texture							
11. Seal/prime (1 d [redacted] then paint (2 coats) the walls	150.50 SF		0.00	1.76	3.97	53.78	322.63
12. Vanity	2.58 LF		0.00	236.97	41.66	130.62	783.66
13. Seal & p [redacted] vanity - inside and out	4.58 LF		0.00	51.32	1.87	47.40	284.32
Includes exposed end of vanity							
14. Vanity top [redacted] sink - cultured marble	2.58 LF		0.00	95.21	13.13	51.74	310.51
15. Backsplash [redacted] surface - Unattached	4.58 LF		0.00	14.97	4.03	14.52	87.11
16. Sink [redacted] - Reset	1.00 EA		0.00	106.42	0.06	21.30	127.78
17. Sink faucet [redacted] t	1.00 EA		0.00	147.74	0.00	29.54	177.28
18. P-trap assembly [redacted] (plastic)	1.00 EA		0.00	72.39	0.69	14.62	87.70
19. Plumbing fixture [redacted] line	2.00 EA		0.00	24.01	1.19	9.84	59.05
20. Angle stop [redacted]	2.00 EA		0.00	44.49	2.06	18.22	109.26
21. Detach & [redacted] Mirror - framed	8.59 SF	6.33	0.00	0.00	0.00	10.88	65.25
22. Concrete grinding [redacted]	22.28 SF		0.00	3.80	0.00	16.94	101.60
Allowance to remove mortar residue and prep concrete substrate for new tile flooring installation							
23. HEPA Vacuuming [redacted] - (PER SF)	22.28 SF		0.00	0.49	1.08	2.18	14.18
HEPA vacuum as required by OSHA							
https://www.osha.gov/laws-regs/regulations/standardnumber/1926/1926.1153 (xiii) Walk-behind milling machines and floor grinders Use machine equipped with integrated water delivery system that continuously feeds water to the cutting surface Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions OR Use machine equipped with dust collection system recommended by the manufacturer Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions Dust collector must provide the air flow recommended by the manufacturer, or greater, and have a filter with 99% or greater efficiency and a filter-cleaning mechanism When used indoors or in an enclosed area, use a HEPA-filtered vacuum to remove loose dust in between passes							
24. Mortar bed [redacted] floors	22.28 SF		0.00	4.69	4.26	21.76	130.51


CONTINUED - Bathroom

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
25. Tile floor	22.28 SF		0.00	10.98	9.82	50.88	305.33
26. Grout sealer	22.28 SF		0.00	1.21	0.35	5.48	32.79
27. Baseboard - 3 1/4"	11.50 LF		0.00	3.94	1.79	9.42	56.52
28. Seal (1 coat) & paint (1 coat) baseboard	11.50 LF		0.00	2.08	0.13	4.80	28.85
29. Door stop - for floor mounted	1.00 EA		0.00	14.52	0.52	3.00	18.04
30. Door opening (casing) - 32" to 36" wide - paint grade	1.00 EA		0.00	179.14	10.40	37.90	227.44
31. Seal & paint floor/window trim & jamb - (per side)	2.00 EA		0.00	43.19	0.92	17.46	104.76
32. Door hinges (3) and slab - Detach & reset	1.00 EA		0.00	29.94	0.00	5.98	35.92
Door hinges will need to be detached and reset to allow replacement of jamb							
33. On site prep. for full mortised hinges - Labor only	1.00 EA		0.00	102.27	0.00	20.46	122.73
34. Interior door - slab only	1.00 EA		0.00	13.77	0.00	2.76	16.53
35. Paint door - 2 coats (per side)	1.00 EA		0.00	50.56	0.73	10.26	61.55
36. Mask wall - paper, tape (per LF)	25.83 LF		0.00	1.74	0.58	9.10	54.62
37. Floor protection - 10 mil	22.28 SF		0.00	0.38	0.22	1.74	10.43
38. Toilet -	1.00 EA		0.00	176.33	0.72	35.40	212.45
39. Plumbing fixture - line	1.00 EA		0.00	24.01	0.60	4.92	29.53
40. Angle stop	1.00 EA		0.00	44.49	1.03	9.10	54.62
BATHTUB							
41. Batt insulation - R15 - paper / foil faced	82.64 SF		0.00	1.54	6.41	26.74	160.42
42. 1/2" Cement	82.64 SF		0.00	5.14	13.57	87.68	526.02
43. Waterproof membrane - tile underlayment	69.44 SF		0.00	6.16	15.01	88.56	531.32
44. Bathtub -	1.00 EA		0.00	438.52	0.00	87.70	526.22
45. Tile tub surround - 60 to 75 SF	1.00 EA		0.00	1,485.81	41.65	305.50	1,832.96
46. Tile -	1.00 EA		0.00	26.75	0.89	5.54	33.18
47. Seal grout	69.44 SF		0.00	1.31	1.09	18.42	110.48
48. Tile -	1.00 EA		0.00	33.92	1.05	7.00	41.97
49. R&R Window - on 2" x 4" wall	4.33 LF		2.34	10.38	1.41	11.30	67.79
50. Tub/shower faucet - & reset	1.00 EA		0.00	249.06	0.00	49.82	298.88

MISCELLANEOUS

CONTINUED - Bathroom

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
51. Detach & reset towel bar	1.00 EA	17.34	0.00	0.00	0.00	3.46	20.80
52. Towel ring - detach & reset	1.00 EA		0.00	18.30	0.00	3.66	21.96
53. Toilet paper holder - Detach & reset	1.00 EA		0.00	18.30	0.00	3.66	21.96
54. Detach & reset light bar - 4 lights	1.00 EA	63.37	0.00	0.00	0.00	12.68	76.05
55. Content Manipulation - per hour	0.50 HR		0.00	57.21	0.00	5.72	34.33
56. Final cleaning - Residential	22.28 SF		0.00	0.37	0.82	1.64	10.70
Totals: Bathroom					187.16	1,449.50	8,698.64

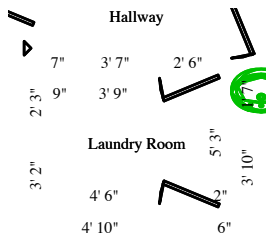

Laundry Room

Height: 9'

223.50 SF Walls
261.13 SF Walls & Ceiling
4.18 SY Flooring
24.83 LF Ceil. Perimeter

37.63 SF Ceiling
37.63 SF Floor
24.83 LF Floor Perimeter


DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
57. Batt insulation - 4" - up to 2' tall	9.75 LF		0.00	3.30	1.68	6.78	40.64
58. 1/2" - 1" insulation - up to 2' tall	24.83 LF		0.00	12.79	3.03	64.12	384.73
59. Texture drywall - hand texture	62.08 SF		0.00	1.25	0.41	15.60	93.61
Additional SF needed to blend in with surrounding texture							
60. Seal/prime (1 coat) then paint (2 coats) the walls	223.50 SF		0.00	1.76	5.90	79.86	479.12
61. Concrete grinding	37.63 SF		0.00	3.80	0.00	28.60	171.59
Allowance to remove mortar residue and prep concrete substrate for new tile flooring installation							
62. HEPA Vacuuming - (PER SF)	37.63 SF		0.00	0.49	1.82	3.68	23.94

JDR Restoration & Remodeling
- Home Re-Imagined -
E: jdrrestoration.com

CONTINUED - Laundry Room

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
HEPA vacuum as required by OSHA							
https://www.osha.gov/laws-regs/regulations/standardnumber/1926/1926.1153 (xiii) Walk-behind milling machines and floor grinders Use machine equipped with integrated water delivery system that continuously feeds water to the cutting surface Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions OR Use machine equipped with dust collection system recommended by the manufacturer Operate and maintain tool in accordance with manufacturer's instructions to minimize dust emissions Dust collector must provide the air flow recommended by the manufacturer, or greater, and have a filter with 99% or greater efficiency and a filter-cleaning mechanism When used indoors or in an enclosed area, use a HEPA-filtered vacuum to remove loose dust in between passes							
63. Mortar bed for tile floors	37.63 SF		0.00	4.69	7.20	36.74	220.42
64. Tile floor	37.63 SF		0.00	10.98	16.58	85.96	515.72
65. Grout sealer	37.63 SF		0.00	1.21	0.59	9.22	55.34
66. Baseboard - 3 1/4"	24.83 LF		0.00	3.94	3.87	20.34	122.04
67. Seal (1 coat) & paint (1 coat) baseboard	24.83 LF		0.00	2.08	0.29	10.40	62.34
68. Door stop for floor mounted	1.00 EA		0.00	14.52	0.52	3.00	18.04
69. Door opening (casing) - 32"to36"wide - paint grade	1.00 EA		0.00	179.14	10.40	37.90	227.44
70. Seal & paint floor/window trim & jamb - (per side)	2.00 EA		0.00	43.19	0.92	17.46	104.76
71. Door hinges (3) and slab - Detach & reset	1.00 EA		0.00	29.94	0.00	5.98	35.92
Door hinges will need to be detached and reset to allow replacement of jamb							
72. On site prep. for full mortised hinges - Labor only	1.00 EA		0.00	102.27	0.00	20.46	122.73
73. Interior door - slab only	1.00 EA		0.00	13.77	0.00	2.76	16.53
74. Paint doors - 2 coats (per side)	2.00 EA		0.00	50.56	1.45	20.52	123.09
75. Mask wall - plastic, paper, tape (per LF)	24.83 LF		0.00	1.74	0.55	8.76	52.51
76. Floor protection - plastic and tape - 10 mil	37.63 SF		0.00	0.38	0.37	2.94	17.61
77. Washer/Washing machine - Remove & reset	1.00 EA		0.00	59.71	0.00	11.94	71.65
78. Dryer - Remove & reset	1.00 EA		0.00	46.04	0.00	9.20	55.24
79. Content Manipulation - per hour	1.00 HR		0.00	57.21	0.00	11.44	68.65
80. Final cleaning - Residential	37.63 SF		0.00	0.37	1.38	2.78	18.08
Totals: Laundry Room					56.96	516.44	3,101.74

JDR Restoration & Remodeling
- Home Re-Imagined -
E: jdrrestoration.com

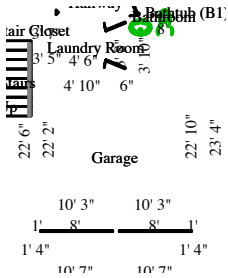


Garage

Height: 9'

814.50 SF Walls
1,221.74 SF Walls & Ceiling
45.25 SY Flooring
90.50 LF Ceil. Perimeter

407.24 SF Ceiling
407.24 SF Floor
90.50 LF Floor Perimeter

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
81. Batt insulation replacement per LF - 4" - up to 2' tall	14.25 LF		0.00	3.30	2.46	9.90	59.39
82. 1/2" - d...ll per LF - up to 2' tall	14.25 LF		0.00	12.79	1.74	36.80	220.80
83. Texture drywall - hand texture	35.63 SF		0.00	1.25	0.24	8.94	53.72
Additional SF needed to blend in with surrounding texture							
84. Seal/prime (1 d...hen paint (2 coats) the walls	814.50 SF		0.00	1.76	21.50	291.00	1,746.02
85. Baseboard - 3 1/4"	14.25 LF		0.00	3.94	2.22	11.68	70.05
86. Seal (1 d... & paint (1 coat) baseboard	90.50 LF		0.00	2.08	1.05	37.86	227.15
87. Door opening (d... & casing) - 32" to 36" wide - paint grade	1.00 EA		0.00	179.14	10.40	37.90	227.44
88. Seal & p... floor/window trim & jamb - (per side)	2.00 EA		0.00	43.19	0.92	17.46	104.76
89. Door hinges (d... 3) and slab - Detach & reset	1.00 EA		0.00	29.94	0.00	5.98	35.92
Door hinges will need to be detached and reset to allow replacement of jamb							
90. On site d... prep. for full mortised hinges - Labor only	1.00 EA		0.00	102.27	0.00	20.46	122.73
91. Interior door - d...t - slab only	1.00 EA		0.00	13.77	0.00	2.76	16.53
92. Paint door s... only - 2 coats (per side)	2.00 EA		0.00	50.56	1.45	20.52	123.09
93. Mask wall - d...ic, paper, tape (per LF)	90.50 LF		0.00	1.74	2.02	31.90	191.39
94. Floor protection - d...ic and tape - 10 mil	407.24 SF		0.00	0.38	4.03	31.76	190.54
95. Content Manipulation d... - per hour	2.00 HR		0.00	57.21	0.00	22.88	137.30
96. Final cleaning - d...struction - Residential	407.24 SF		0.00	0.37	14.92	30.14	195.74
Totals: Garage					62.95	617.94	3,722.57

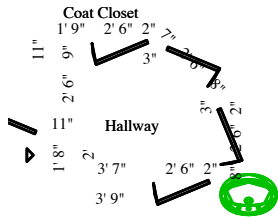

Hallway

Height: 9'

205.17 SF Walls
242.23 SF Walls & Ceiling
4.12 SY Flooring
24.61 LF Ceil. Perimeter


37.05 SF Ceiling
37.05 SF Floor
22.11 LF Floor Perimeter

Missing Wall - Goes to Floor

2' 6" X 6' 8"

Opens into LIVING_ROOM2

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
97. 1/2" - 1" drywall per LF - up to 2' tall	17.28 LF		0.00	12.79	2.11	44.62	267.74
98. Texture drywall - 1/2" hand texture	43.20 SF		0.00	1.25	0.29	10.86	65.15
Additional SF needed to blend in with surrounding texture							
99. Seal/prime (1 coat) then paint (2 coats) the walls	205.17 SF		0.00	1.76	5.42	73.30	439.82
100. Cold air return cover - Detach & reset	1.00 EA		0.00	21.10	0.00	4.22	25.32
101. Baseboard - 1/2" x 3" x 6"	7.28 LF		0.00	3.94	1.14	5.96	35.78
102. Seal (1 coat) & paint (1 coat) baseboard	22.11 LF		0.00	2.08	0.26	9.26	55.51
103. Paint door/window jamb - 2 coats (per side)	1.00 EA		0.00	43.15	0.46	8.74	52.35
Paint door trim for Coat Closet in order to achieve a uniform repair with baseboard							
104. Carpet pad	37.05 SF		0.00	0.67	1.65	5.30	31.77
105. Carpet	42.61 SF		0.00	3.88	10.48	35.16	210.97
15 % waste added for Carpet.							
106. Final cleaning - Residential	37.05 SF		0.00	0.37	1.36	2.74	17.81
Totals: Hallway					23.17	200.16	1,202.22

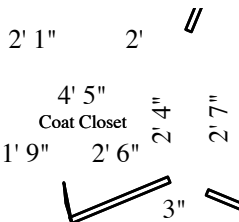

Coat Closet

Height: 9'


121.50 SF Walls
131.81 SF Walls & Ceiling
1.15 SY Flooring
13.50 LF Ceil. Perimeter

10.31 SF Ceiling
10.31 SF Floor
13.50 LF Floor Perimeter

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
107. R&R Carpet	10.31 SF		0.13	0.67	0.46	1.74	10.45

CONTINUED - Coat Closet

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
108. Remove Carpet	10.31 SF		0.30	0.00	0.00	0.62	3.71
109. Carpet	11.85 SF		0.00	3.88	2.91	9.78	58.67
Carpet is continuous with Hallway							
15 % waste added for Carpet.							
110. Content Manipulation - per hour	1.00 HR		0.00	57.21	0.00	11.44	68.65
Totals: Coat Closet					3.37	23.58	141.48

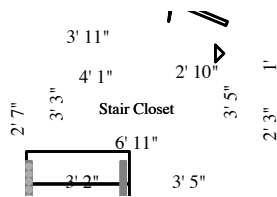

Stair Closet


108.76 SF Walls
134.48 SF Walls & Ceiling
2.55 SY Flooring
19.00 LF Ceil. Perimeter

Height: Sloped

25.72 SF Ceiling
22.95 SF Floor
17.67 LF Floor Perimeter

Subroom: Room5 (1)

Height: 8'

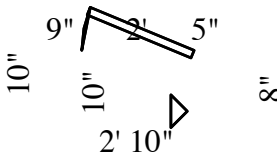

34.61 SF Walls
36.50 SF Walls & Ceiling
0.21 SY Flooring
4.33 LF Ceil. Perimeter

1.88 SF Ceiling
1.88 SF Floor
4.33 LF Floor Perimeter

Missing Wall


2' 9 15/16" X 8'

Opens into STAIR_CLOSET

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
111. 1/2" - d wall per LF - up to 2' tall	4.67 LF		0.00	12.79	0.57	12.06	72.36
112. Texture drywall - hand texture	11.68 SF		0.00	1.25	0.08	2.94	17.62
Additional SF needed to blend in with surrounding texture							
113. Seal/prime (1 d) then paint (2 coats) the walls	143.37 SF		0.00	1.76	3.79	51.22	307.34
114. Baseboard -	4.67 LF		0.00	3.94	0.73	3.82	22.95
115. Seal (1 d) & paint (1 coat) baseboard	22.00 LF		0.00	2.08	0.25	9.22	55.23
116. Door opening (1 d) & casing) - 32" to 36" wide - paint grade	1.00 EA		0.00	179.14	10.40	37.90	227.44
117. Seal & floor/window trim & jamb - (per side)	2.00 EA		0.00	43.19	0.92	17.46	104.76

CONTINUED - Stair Closet

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
118. Door hinges (3) and slab - Detach & reset	1.00 EA		0.00	29.94	0.00	5.98	35.92
Door hinges will need to be detached and reset to allow replacement of jamb							
119. On site prep. for full mortised hinges - Labor only	1.00 EA		0.00	102.27	0.00	20.46	122.73
120. Interior door slab - slab only	1.00 EA		0.00	13.77	0.00	2.76	16.53
121. Paint door slab - 2 coats (per side)	2.00 EA		0.00	50.56	1.45	20.52	123.09
122. Mask wall - paper, tape (per LF)	23.33 LF		0.00	1.74	0.52	8.22	49.33
123. Floor protection - 10 mil - 10 mil	24.83 SF		0.00	0.38	0.25	1.94	11.63
124. Carpet pad	24.83 SF		0.00	0.67	1.11	3.54	21.29
125. Carpet	28.56 SF		0.00	3.88	7.02	23.56	141.39
15 % waste added for Carpet.							
126. Content Manipulation - per hour	1.00 HR		0.00	57.21	0.00	11.44	68.65
127. Final cleaning - Residential	24.83 SF		0.00	0.37	0.91	1.84	11.94
Totals: Stair Closet					28.00	234.88	1,410.20

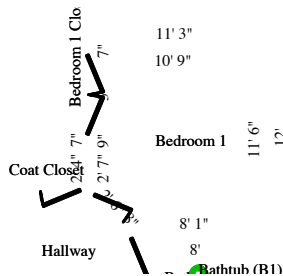

Bedroom 1

Height: 9'


386.52 SF Walls
506.62 SF Walls & Ceiling
13.35 SY Flooring
42.95 LF Ceil. Perimeter

120.11 SF Ceiling
120.11 SF Floor
42.95 LF Floor Perimeter

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
128. Batt insulation - 4" - up to 2' tall	2.67 LF		0.00	3.30	0.46	1.86	11.13
129. 1/2" - 1/2" - up to 2' tall	11.00 LF		0.00	12.79	1.34	28.40	170.43
130. Seal/prime (1 coat) then paint (2 coats) the walls	386.52 SF		0.00	1.76	10.20	138.10	828.58
131. Outlet or switch cover	1.00 EA		0.00	3.69	0.08	0.76	4.53
132. Baseboard - 1/2" - 1/2"	11.00 LF		0.00	3.94	1.72	9.00	54.06
133. Seal (1 coat) & paint (1 coat) baseboard	42.95 LF		0.00	2.08	0.50	17.96	107.80
134. Door stop - door or floor mounted	1.00 EA		0.00	14.52	0.52	3.00	18.04

CONTINUED - Bedroom 1

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
135. Paint door/window jamb - Large - 2 coats (per side)	1.00 EA		0.00	50.75	0.54	10.26	61.55
Paint closet door trim in order to achieve a uniform repair with baseboard							
136. Door opening (& casing) - 32"to36"wide - paint grade	1.00 EA		0.00	179.14	10.40	37.90	227.44
137. Seal & paint door/window trim & jamb - (per side)	2.00 EA		0.00	43.19	0.92	17.46	104.76
138. Door hinges (3) and slab - Detach & reset	1.00 EA		0.00	29.94	0.00	5.98	35.92
Door hinges will need to be detached and reset to allow replacement of jamb							
139. On site prep. for full mortised hinges - Labor only	1.00 EA		0.00	102.27	0.00	20.46	122.73
140. Interior door - slab only	1.00 EA		0.00	13.77	0.00	2.76	16.53
141. Paint door - 2 coats (per side)	2.00 EA		0.00	50.56	1.45	20.52	123.09
142. Mask wall - paper, tape (per LF)	42.95 LF		0.00	1.74	0.96	15.14	90.83
143. Floor protection - 10 mil - 42.95 SF	42.95 SF		0.00	0.38	0.42	3.34	20.08
144. Cold air return cover - Detach & reset	1.00 EA		0.00	21.10	0.00	4.22	25.32
Cold air return cover will need to be detached and reset to allow for painting of walls							
145. Remove Carpet	98.61 SF		0.30	0.00	0.00	5.92	35.50
Remove carpet that was not torn out during mitigation							
146. Remove Carpet	98.61 SF		0.13	0.00	0.00	2.56	15.38
Remove carpet pad that was not torn out during mitigation							
147. Carpet pad	120.11 SF		0.00	0.67	5.35	17.18	103.00
148. Carpet	138.12 SF		0.00	3.88	33.96	113.98	683.85
Includes 15% waste							
149. Content Manipulation - per hour	2.00 HR		0.00	57.21	0.00	22.88	137.30
150. Final cleaning - Residential	120.11 SF		0.00	0.37	4.40	8.88	57.72
Totals: Bedroom 1					73.22	508.52	3,055.57

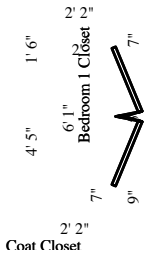


Bedroom 1 Closet

Height: 9'

145.50 SF Walls
157.67 SF Walls & Ceiling
1.35 SY Flooring
16.17 LF Ceil. Perimeter

12.17 SF Ceiling
12.17 SF Floor
16.17 LF Floor Perimeter

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
151. R&R Carpet	12.17 SF		0.13	0.67	0.54	2.06	12.33
152. Remove Carpet	12.17 SF		0.30	0.00	0.00	0.74	4.39
153. Carpet	13.99 SF		0.00	3.88	3.44	11.54	69.26
Carpet is continuous with Bedroom 1							
15 % waste added for Carpet.							
154. Content Manipulation - per hour	1.00 HR		0.00	57.21	0.00	11.44	68.65
Totals: Bedroom 1 Closet					3.98	25.78	154.63

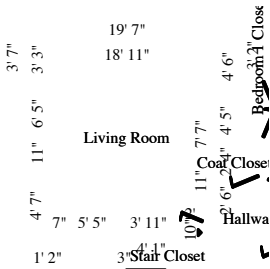

Living Room

Height: 9'

482.95 SF Walls
762.18 SF Walls & Ceiling
31.03 SY Flooring
57.18 LF Ceil. Perimeter


279.23 SF Ceiling
279.23 SF Floor
55.68 LF Floor Perimeter

Missing Wall	4' 6 13/16" X 9'	Opens into Exterior
Missing Wall	2' 8 1/2" X 9'	Opens into Exterior
Missing Wall - Goes to Ceiling	6' 5" X 6'	Opens into Exterior
Missing Wall - Goes to Floor	2' 6" X 6' 8"	Opens into HALLWAY
Missing Wall - Goes to Floor	5' 5" X 6' 8"	Opens into ENTRY

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
155. 1/2" - 1" wall per LF - up to 2' tall	1.17 LF		0.00	12.79	0.14	3.02	18.12
156. Seal/prime (1 coat) then paint (2 coats) the walls	482.95 SF		0.00	1.76	12.75	172.56	1,035.30
157. Baseboard - 1" x 4" x 4'	1.17 LF		0.00	3.94	0.18	0.96	5.75
158. Seal (1 coat) & paint (1 coat) baseboard	55.68 LF		0.00	2.08	0.64	23.28	139.73
159. Mask wall - 1" x 4" x 4' (per LF)	57.18 LF		0.00	1.74	1.27	20.16	120.92

CONTINUED - Living Room

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
160. Floor Protection - 10 mil poly and tape	55.68 SF		0.00	0.38	0.55	4.36	26.07
161. Window drapery hardware - Detach & reset	3.00 EA		0.00	35.25	0.00	21.16	126.91
162. R&R Carpet	279.23 SF		0.13	0.67	12.44	47.16	282.98
163. Remove Carpet	279.23 SF		0.30	0.00	0.00	16.76	100.53
164. Carpet	321.11 SF		0.00	3.88	78.95	264.98	1,589.84
Carpet is continuous with Hallway							
15 % waste added for Carpet.							
165. Content Manipulation - per hour	2.00 HR		0.00	57.21	0.00	22.88	137.30
166. Content Manipulation (item)	1.00 EA		0.00	0.00	0.00	0.00	0.00
Bid item to remove and reset piano							
167. Final cleaning - Residential	279.23 SF		0.00	0.37	10.22	20.66	134.20
Totals: Living Room					117.14	617.94	3,717.65

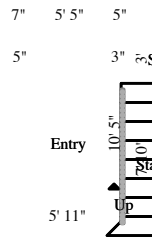

Entry

Height: 9'

160.64 SF Walls
223.64 SF Walls & Ceiling
7.00 SY Flooring
26.93 LF Ceil. Perimeter

63.00 SF Ceiling
63.00 SF Floor
21.51 LF Floor Perimeter

Missing Wall

5' 11 3/16" X 9'


Opens into Exterior

Missing Wall - Goes to Floor

5' 5" X 6' 8"

Opens into LIVING_ROOM2

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
168. R&R Carpet	63.00 SF		0.13	0.67	2.81	10.64	63.85
169. Remove Carpet	63.00 SF		0.30	0.00	0.00	3.78	22.68
170. Carpet	72.45 SF		0.00	3.88	17.81	59.78	358.70
Carpet is continuous with Living Room							
15 % waste added for Carpet.							
171. Content Manipulation - per hour	1.00 HR		0.00	57.21	0.00	11.44	68.65
Totals: Entry					20.62	85.64	513.88

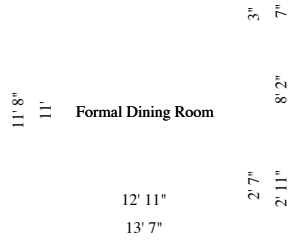

Formal Dining Room

Height: 9' 

379.51 SF Walls
521.59 SF Walls & Ceiling
15.79 SY Flooring
47.83 LF Ceil. Perimeter

142.08 SF Ceiling
142.08 SF Floor
39.67 LF Floor Perimeter

Missing Wall - Goes to Floor

8' 2" X 6' 8"

Opens into Exterior

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
172. R&R Carpet 	142.08 SF		0.13	0.67	6.33	24.00	143.99
173. Remove Carpet 	142.08 SF		0.30	0.00	0.00	8.52	51.14
174. Carpet	163.40 SF		0.00	3.88	40.17	134.84	809.00
Carpet is identical with that which is installed in Living Room, Hallway and Bedroom 1							
15 % waste added for Carpet.							
175. Content Manipulation  - per hour	1.00 HR		0.00	57.21	0.00	11.44	68.65
Totals: Formal Dining Room					46.50	178.80	1,072.78
Total: Main Level					631.88	4,970.28	29,858.03

Debris Removal

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
176. Tandem axle  trailer - per load - including dump fees	1.00 EA		385.00	0.00	0.00	77.00	462.00
Totals: Debris Removal					0.00	77.00	462.00

Labor Minimums Applied

DESCRIPTION	QTY	RESET	REMOVE	REPLACE	TAX	O&P	TOTAL
177. Insulation labor  minimum	1.00 EA		0.00	130.72	0.00	26.14	156.86
178. Cabinetry labor  minimum	1.00 EA		0.00	67.15	0.00	13.44	80.59
179. Mirror/shower door  minimum	1.00 EA		0.00	93.59	0.00	18.72	112.31
180. Heat, vent,  cond. labor minimum	1.00 EA		0.00	216.03	0.00	43.20	259.23
181. Window treatment 	1.00 EA		0.00	42.21	0.00	8.44	50.65
Totals: Labor Minimums Applied					0.00	109.94	659.64



JDR Restoration & Remodeling

JDR Restoration & Remodeling
- Home Re-Imagined -
E: jdrrestoration.com

Line Item Totals:

631.88

5,157.22

30,979.67

Grand Total Areas:

3,300.97	SF Walls	1,202.89	SF Ceiling	4,503.86	SF Walls and Ceiling
1,209.29	SF Floor	134.37	SY Flooring	370.19	LF Floor Perimeter
0.00	SF Long Wall	0.00	SF Short Wall	402.17	LF Ceil. Perimeter
1,209.29	Floor Area	1,311.28	Total Area	3,094.93	Interior Wall Area
1,934.03	Exterior Wall Area	214.39	Exterior Perimeter of Walls		
0.00	Surface Area	0.00	Number of Squares	0.00	Total Perimeter Length
0.00	Total Ridge Length	0.00	Total Hip Length		






JDR Restoration & Remodeling

JDR Restoration & Remodeling
- Home Re-Imagined -
E: jdrrestoration.com

Summary for Dwelling

Line Item Total	25,190.57
Material Sales Tax	586.16
Cleaning Mtl Tax	8.81
Subtotal	25,785.54
Overhead	2,578.61
Profit	2,578.61
Cleaning Sales Tax	36.91
Replacement Cost Value	\$30,979.67
Net Claim	\$30,979.67



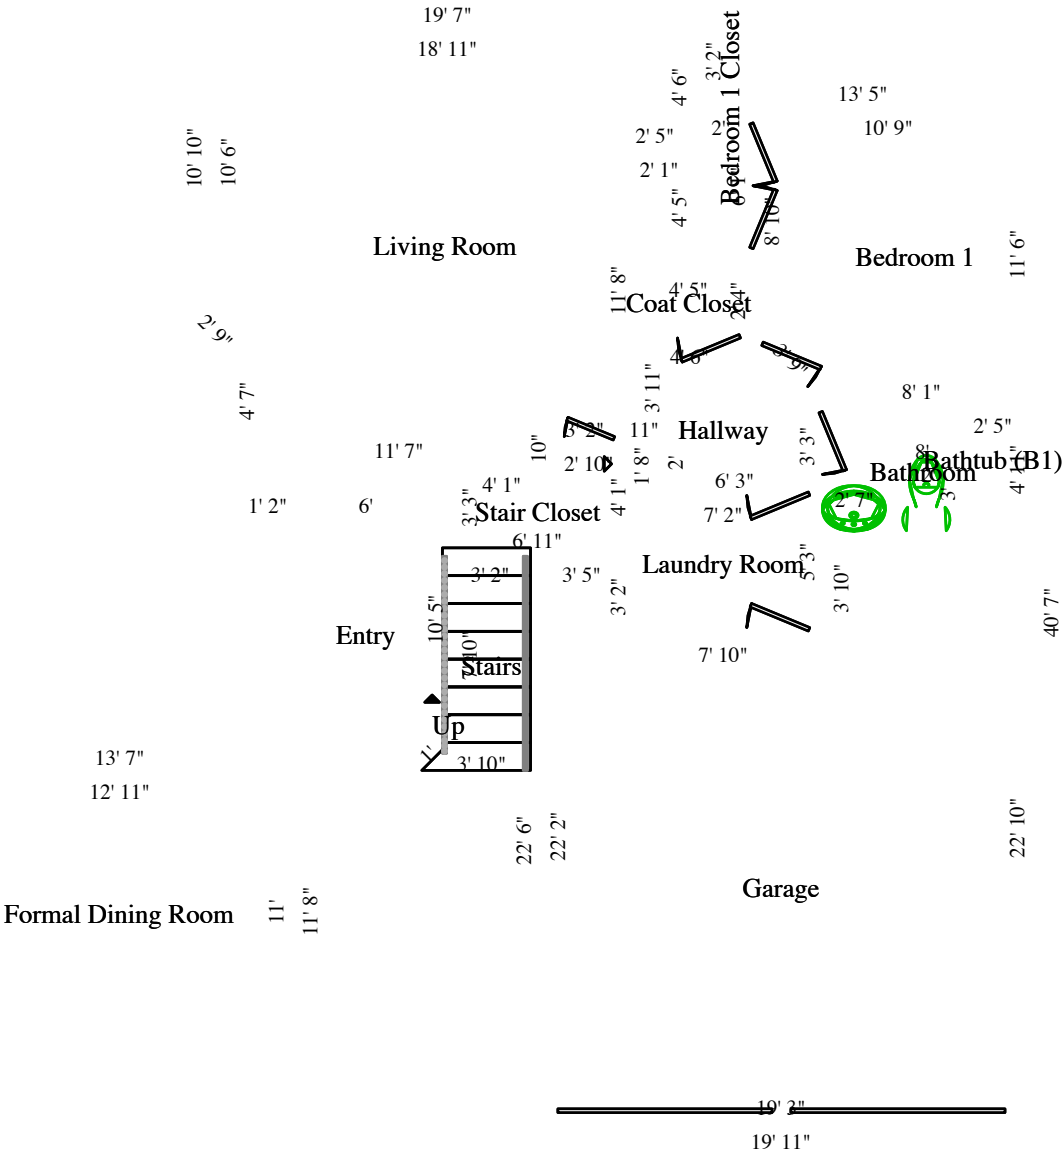

Main Level

Ciridae — Comparison Summary

Status	Count	Meaning
Green	6	Exact match (scope + metadata within $\pm 2\%$)
Orange	73	Same scope; metadata differs beyond $\pm 2\%$
Blue	98	JDR-only: not found in insurance estimate
Nuggets	83	Insurance-only: present in insurer's scope, not in JDR
Dollar gap	\$5,328.80	JDR total \$13,122.86 vs Insurance \$18,451.66

Insurance-Only Items (Nuggets)

These items appear in the insurance estimate but are absent from the JDR. JDR can often add them directly since the insurer has already agreed to them.

Room (Insurance)	Description	Amount
* 41. Ceramic/porcelain til...	42. Tape joint for new to existing drywall - per LF	\$263.26
amount may be eligible for ...	5. Deductible – The insurer will pay for losses, up to the policy limits, in excess of ...	-
Building Estimate Summary G...	2. General Contractor's Overhead and Profit – General contractor's charge for coordinat...	-
Building Estimate Summary G...	6. Net Actual Cash Value Payment (ACV) – The repair or replacement cost of the damaged ...	-
CARPET	70. Carpet - per specs from independent carpet analysis	\$45.74
CARPET	79. Carpet pad - per specs from independent pad analysis	\$6.20
CARPET	80. Carpet - per specs from independent carpet analysis	\$270.51
CARPET	88. Carpet pad - per specs from independent pad analysis	\$27.83
CARPET	89. Carpet - per specs from independent carpet analysis	\$395.56
CARPET	92. Carpet - per specs from independent carpet analysis	\$1,021.27
CONDITION DEP %	1. Haul debris - per pickup truck load - including dump fees	\$288.60
CONDITION DEP %	10. Door opening (jamb & casing) - 32"to36"wide - paint grade	\$194.01
CONDITION DEP %	12. Paint baseboard - one coat	\$17.67
CONDITION DEP %	14. Interior door - Reset - slab only	\$16.51
CONDITION DEP %	15. Paint door slab only - 2 coats (per side)	\$12.26
CONDITION DEP %	16. Final cleaning - construction - Residential	\$17.63
CONDITION DEP %	17. Detach & Reset Washer/Washing Machine - Front-loading	\$71.64
CONDITION DEP %	2. Contents - move out then reset - Large room	\$151.10
CONDITION DEP %	3. Freezer - Remove & reset	\$73.64
CONDITION DEP %	33. Tile floor covering	\$502.13
CONDITION DEP %	34. Final cleaning - construction - Residential	\$20.81
CONDITION DEP %	35. Install Toilet	\$293.26

CONDITION DEP %	36. Install Bathtub	\$631.71
CONDITION DEP %	77. Contents - move out then reset - Small room	\$75.62
CONDITION DEP %	82. Texture drywall - light hand texture Picture-frame method used up to 4 ' tall to te...	\$42.22
CONDITION DEP %	83. 1/2" - drywall per LF - up to 2' tall Includes the drywall around the water heater ...	\$108.14
CONDITION DEP %	84. Paint the walls - one coat	\$217.03
CONDITION DEP %	9. Baseboard - 3 1/4" MDF w/profile	\$69.43
CONDITION DEP %	90. Contents - move out then reset	\$100.75
CONDITION DEP %	93. Insulation labor minimum	\$216.51
CONDITION DEP %	94. Cleaning labor minimum	\$152.87
CONDITION DEP %	95. Cabinetry labor minimum	\$83.35
CONTENT MANIPULATION	Contents - move out then reset - Large room (Grand Piano is in Living Room)	\$151.10
CONTENT MANIPULATION	Contents - move out then reset - Small room	\$75.62
D = Do Not Apply	3. Replacement Cost Value (RCV) – Estimated cost to repair or replace damaged property.	-
damaged property.	4. Depreciation – The decrease in the value of property over a period of time due to we...	-
DRYWALL	1/2" water rock (greenboard) hung, taped ready for texture (Tub Surround)	\$224.11
DRYWALL	Tape joint for new to existing drywall - per LF	\$1,116.72
FLOOR COVERING - CERAMIC TILE	Floor leveling cement - Average	\$257.65
FLOOR COVERING - CERAMIC TILE	Tile floor covering	\$1,095.43
FLOORING	52. Floor leveling cement - Average	\$139.55
FLOORING	53. Tile floor covering	\$593.30
Garage	* 11. Paint baseboard - two coats (For replace baseboard)	\$8.20
Hall Bathroom	* 40. 1/2" water rock (greenboard) hung, taped ready for texture (Tub Surround)	\$224.11
Hall Closet	* 71. Remove Carpet (Some carpet and pad was removed by mitigation company)	\$3.12
INSULATION	Insulation labor minimum	\$216.51
Less Non - recoverable Depr...	8. Total Maximum Additional Amount if Incurred – Total amount of recoverable depreciati...	-
Living Room	* 73. Contents - move out then reset - Large room (Grand Piano is in Living Room)	\$151.10
of the damaged part of the ...	7. Non Recoverable Depreciation – Depreciation applied to items that are not eligible f...	-
PAINTING	Paint baseboard - one coat	\$179.12
PAINTING	Paint baseboard - one coat (Undamaged baseboards)	\$23.51
PAINTING	Paint baseboard - two coats (For replace baseboard)	\$187.22
PAINTING	Paint door or window opening - 2 coats (per side)	\$208.32
PAINTING	Paint door slab only - 2 coats (per side)	\$245.04
PAINTING	Paint {V} - one coat	\$2,480.48

PAINTING	Seal & paint wood shelving, 12"- 24" width	\$52.46
repair or replacement of th...	9. Total Amount of Claim If Incurred – Total amount of the claim, including net actual ...	-
Stair Closet	* 78. Remove Carpet (Some carpet and pad was removed by mitigation company)	\$5.43
TILE	Ceramic/porcelain tile (Tub Surround)	\$1,008.74
TRIM/DOORS	* 27. Paint baseboard - two coats (For replace baseboard)	\$59.59
TRIM/DOORS	* 48. Paint baseboard - two coats (For replace baseboard)	\$35.84
TRIM/DOORS	* 86. Paint baseboard - two coats (For replace baseboard)	\$16.91
TRIM/DOORS	* 87. Paint baseboard - one coat (Undamaged baseboards)	\$23.51
TRIM/DOORS	25. Baseboard - 3 1/4" MDF w/profile	\$118.03
TRIM/DOORS	26. Door opening (jamb & casing) - 32"to36"wide - paint grade	\$227.36
TRIM/DOORS	28. Paint baseboard - one coat	\$39.63
TRIM/DOORS	46. Baseboard - 3 1/4" MDF w/profile	\$68.57
TRIM/DOORS	59. Baseboard - 3 1/4" MDF w/profile	\$57.19
TRIM/DOORS	60. Door opening (jamb & casing) - 32"to36"wide - paint grade	\$194.01
TRIM/DOORS	62. Paint baseboard - one coat	\$10.22
TRIM/DOORS	85. Baseboard - 3 1/4" MDF w/profile	\$33.49
WALLS	21. Tape joint for new to existing drywall - per LF	\$335.97
WALLS	22. Texture drywall - light hand texture Picture-frame method used up to 4 ' tall to te...	\$147.79
WALLS	23. 1/2" - drywall per LF - up to 2' tall Includes the drywall around the water heater ...	\$381.05
WALLS	38. Batt insulation - 4" - R11- unfaced batt	\$49.83
WALLS	4. Batt insulation - 4" - R11- unfaced batt	\$6.66
WALLS	5. Tape joint for new to existing drywall - per LF	\$231.51
WALLS	54. Batt insulation - 4" - R11- unfaced batt	\$5.69
WALLS	55. Tape joint for new to existing drywall - per LF	\$162.70
WALLS	56. Texture drywall - light hand texture Picture-frame method used up to 4 ' tall to te...	\$72.07
WALLS	58. Paint the walls and ceiling - one coat	\$107.51
WALLS	6. Texture drywall - light hand texture Picture-frame method used up to 4 ' tall to tex...	\$102.55
WALLS	81. Tape joint for new to existing drywall - per LF	\$95.32