



Roof Management Summary

The Roof Management Program for Brecksville-Broadview Heights City Schools was established to identify and prioritize replacement of roof sections based on condition analysis and life cycle expectancy. Budgets for roof replacement were developed and phased into a 10-Year Plan with annual expenditures of approximately 500,000+ annually.

The current roof inventory for Brecksville-Broadview Heights City Schools comprises 6 buildings, 61 individual roof sections, and represents roof assets of approximately \$17,227,409.00. The phased roof replacement total in the 10-Year Roof Management Plan (2023-2032) is \$9,546,569 and represents approximately 55% of total roof assets.

The 10-Year Plan (2023-2032) encompasses roof sections with a poor condition analysis rating indicating they are close, or beyond, life cycle expectancy and no longer under warranty. These roof sections are located primarily at Brecksville-Broadview Heights High School, Middle School, and Hilton Elementary School, require replacement to avoid unexpected emergencies, costly interior damage, and classroom disruption.

The remaining roof inventory listed beyond or outside of the 10-Yr. Plan is rated in fair to good condition, with various roof sections having a warranty status extending beyond 2032. Proper, long-term maintenance of these roof systems will ensure roof sustainability and life cycle performance.

Brecksville-Broadview Hts. City School District
Roof Management Program



ROOF MANAGEMENT PROGRAM (10-YEAR PLAN)

BBHCSD	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	Outside 10-Yr. Plan	TOTAL
Roof Replacement	\$ 774,007.50	\$ 1,947,750.00	\$ 505,869.00	\$ 580,965.00	\$ 679,350.00	\$ 715,680.00	\$ 665,700.00	\$ 688,800.00	\$ 1,150,380.00	\$ 1,090,180.00	\$ 7,079,115.00	\$ 15,877,796.50
Consultant Fee	\$ 65,790.64	\$ 165,558.75	\$ 42,998.87	\$ 49,382.05	\$ 57,744.75	\$ 60,832.80	\$ 56,584.50	\$ 58,548.00	\$ 97,782.30	\$ 92,665.30	\$ 601,724.78	\$ 1,349,612.74
TOTAL:	\$ 839,798.14	\$ 2,113,308.75	\$ 548,867.87	\$ 630,347.05	\$ 737,094.75	\$ 776,512.80	\$ 722,284.50	\$ 747,348.00	\$ 1,248,162.30	\$ 1,182,845.30	\$ 7,680,839.78	\$ 17,227,409.24
Board of Education												TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 228,900.00	\$ 228,900.00
Consultant Fee	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 19,456.50	\$ 19,456.50
TOTAL:	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 248,356.50	\$ 248,356.50
Bus Garage												TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 642,400.00	\$ 642,400.00
Consultant Fee	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 54,604.00	\$ 54,604.00
TOTAL:	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 697,004.00	\$ 697,004.00
BBH High School												TOTAL
Roof Replacement	\$ 774,007.50	\$ 1,947,750.00	\$ 505,869.00	\$ 328,965.00	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 2,140,320.00	\$ 5,696,911.50
Consultant Fee	\$ 65,790.64	\$ 165,558.75	\$ 42,998.87	\$ 27,962.05	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 181,927.20	\$ 484,237.51
TOTAL:	\$ 839,798.14	\$ 2,113,308.75	\$ 548,867.87	\$ 356,927.05	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 2,322,247.20	\$ 6,181,149.01
Hilton Elementary School												TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 665,700.00	\$ 688,800.00	\$ 700,560.00	\$ -	\$ -	\$ 2,055,060.00
Consultant Fee	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 56,584.50	\$ 58,548.00	\$ 59,547.60	\$ -	\$ -	\$ 174,680.10
TOTAL:	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 722,284.50	\$ 747,348.00	\$ 760,107.60	\$ -	\$ -	\$ 2,229,740.10
BBH Middle School												TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ 252,000.00	\$ 679,350.00	\$ 715,680.00	\$ -	\$ -	\$ 449,820.00	\$ 973,140.00	\$ 3,815,595.00	\$ 6,885,585.00
Consultant Fee	\$ -	\$ -	\$ -	\$ 21,420.00	\$ 57,744.75	\$ 60,832.80	\$ -	\$ -	\$ 38,234.70	\$ 82,716.90	\$ 324,325.58	\$ 585,274.73
TOTAL:	\$ -	\$ -	\$ -	\$ 273,420.00	\$ 737,094.75	\$ 776,512.80	\$ -	\$ -	\$ 488,054.70	\$ 1,055,856.90	\$ 4,139,920.58	\$ 7,470,859.73
Stadium Building												TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 117,040.00	\$ 251,900.00	\$ 368,940.00
Consultant Fee	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 9,948.40	\$ 21,411.50	\$ 31,359.90
TOTAL:	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 126,988.40	\$ 273,311.50	\$ 400,299.90

Brecksville-Broadview Hts. City School District
Roof Management Program

Board of Education		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	Outside 10-Yr. Plan	TOTAL
Roof Replacement		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 228,900.00	\$ 228,900.00
Consultant Fee		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 19,456.50	\$ 19,456.50
TOTAL:		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 248,356.50	\$ 248,356.50
Roof Section 1		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL	
Roof Replacement		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 228,900.00	\$ 228,900.00
Consultant Fee		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 19,456.50	\$ 19,456.50
TOTAL:		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 248,356.50	\$ 248,356.50

- ROOF LEGEND
- CHIMNEY
 - CURB
 - DOWNSPOUT
 - DUCTWORK
 - SATELLITE DISH
 - GRAVITY VENTS
 - ACCESS HATCH
 - HVAC
 - MECHANICAL VENT
 - PIPE PENETRATION
 - PITCH POCKET
 - RAIL CURB
 - ROOF DRAIN
 - SCUPPER
 - SOIL STACK

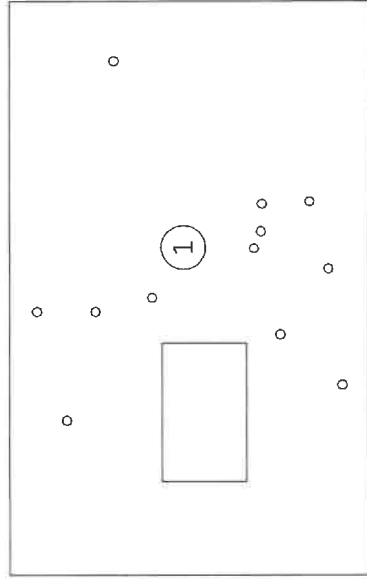

ROOF EVALUATION REPORT



Brecksville-Broadview Heights Board of Education
6638 Mill Road
Brecksville, OH 44141

Date of Inspection: 9/26/22
Inspected By: Greg Taylor
Bryan Ice
Joe Taylor
Taylor Consulting Group

Roof Sections	Condition	Sq. Ft.	Deck Type	Roof System	Insulation	Surfacing	Perimeter
1	Fair	5,450	Metal	Reinforced PVC	Polyisocyanurate	Smooth	Metal Fascia

Roof System Observation:

Brecksville – Broadview Heights Board of Education is comprised of one roof section. The roof system in place is a Duro-Last reinforced PVC roof system. The current roof is in fair condition, with areas of standing water and deterioration along the roof membrane seams. Additionally, the flashings are beginning to bridge as the roof shrinks due to normal aging. The roof, however, does not currently have any leaks to the interior of the building.

Taylor Consulting Group, LLC
PO Box 1570
Mentor, OH 44061

Phone: 440-840-9019
Fax: 440-209-9841
Email: gtaylor@tcgroupdesign.com



Roof System Recommendation:

The Board Office and Bus Garage roof systems will require regular maintenance and an ongoing maintenance program to maintain a watertight condition.. Roof Section 1 has been classified outside the 10-Year Plan.

**BBHCSD
Board of Education Overview**

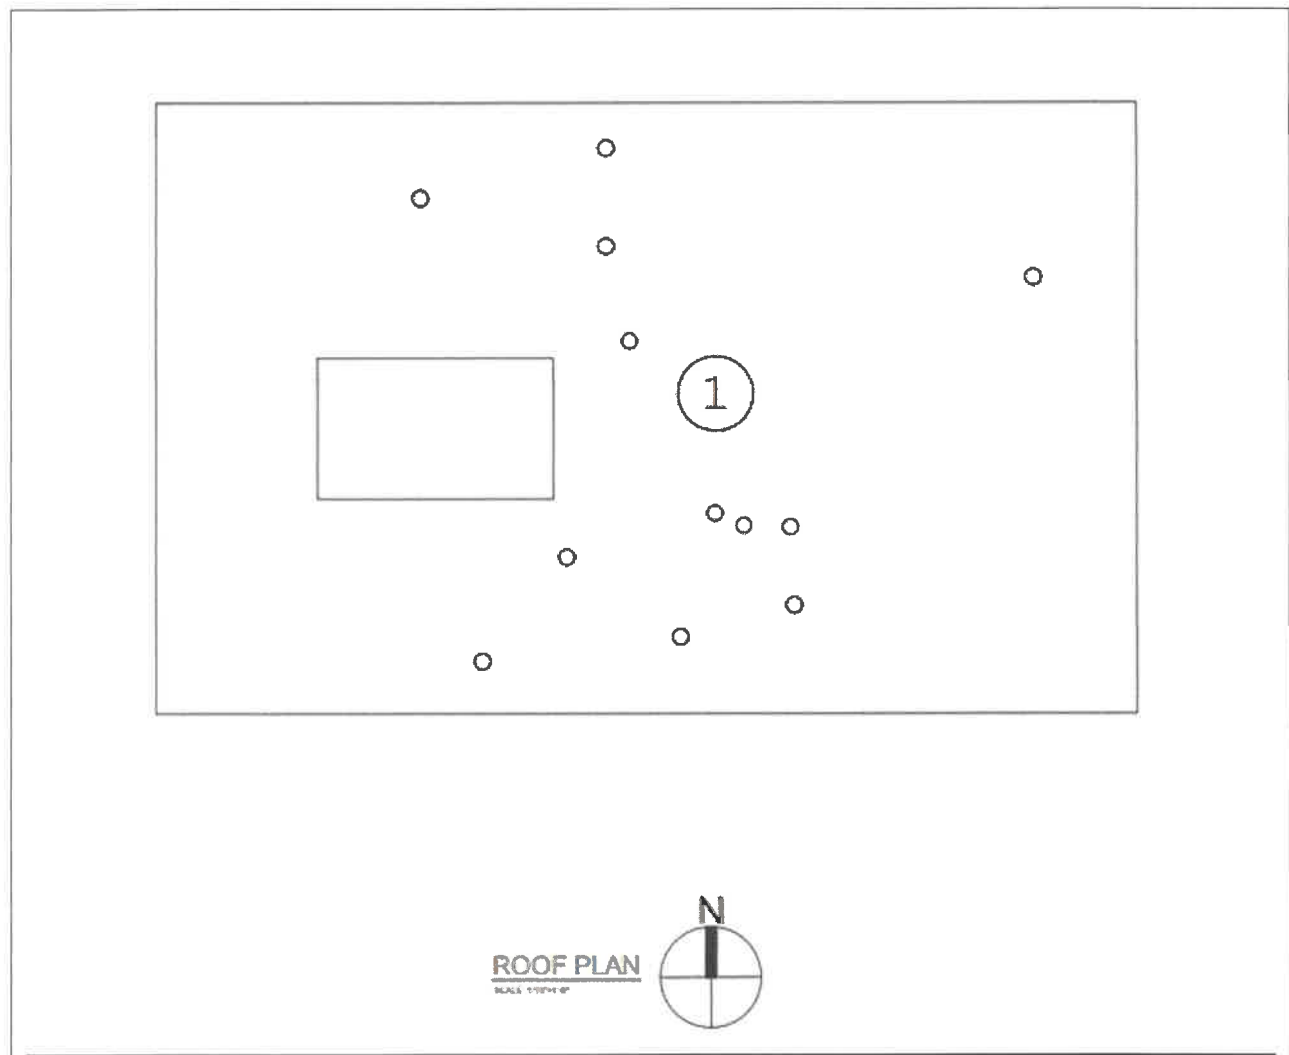


Photo Documentation:



Photo 1: BBHCSD Board of Education



Photo 2: Roof Section 1: Reinforced PVC roof holding water in several locations.



Photo 3: Roof Section 1: reinforced PVC roof system in fair condition.



Photo 4: Roof Section 1: reinforced PVC roof system in fair condition.



Photo 5: Roof Section 4: Reinforced PVC roof system in fair condition.





Photo 6: Roof Section 1: chimney masonry joints in poor condition, requires tuckpointing.

Brecksville-Broadview Hts. City School District
Roof Management Program

Bus Garage	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	Outside 10-Yr. Plan	TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 642,400.00	\$ 642,400.00
Consultant Fee	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 54,604.00	\$ 54,604.00
TOTAL:	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 697,004.00	\$ 697,004.00
Roof Section 1	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL	TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 151,250.00	\$ 151,250.00
Consultant Fee	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 12,856.25	\$ 12,856.25
TOTAL:	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 164,106.25	\$ 164,106.25
Roof Section 2	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL	TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 202,400.00	\$ 202,400.00
Consultant Fee	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 17,204.00	\$ 17,204.00
TOTAL:	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 219,604.00	\$ 219,604.00
Roof Section 3	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL	TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 288,750.00	\$ 288,750.00
Consultant Fee	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 24,543.75	\$ 24,543.75
TOTAL:	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 313,293.75	\$ 313,293.75

- ROOF LEGEND**
- CHIMNEY
 - CURB
 - DOWNSPOUT
 - DUCTWORK
 - SATELLITE DISH
 - GRAVITY VENTS
 - ACCESS HATCH
 - HVAC
 - MECHANICAL VENT
 - PIPE PENETRATION
 - PITCH POCKET
 - RAIL CURB
 - ROOF DRAIN
 - SCULPER
 - SOL STACK

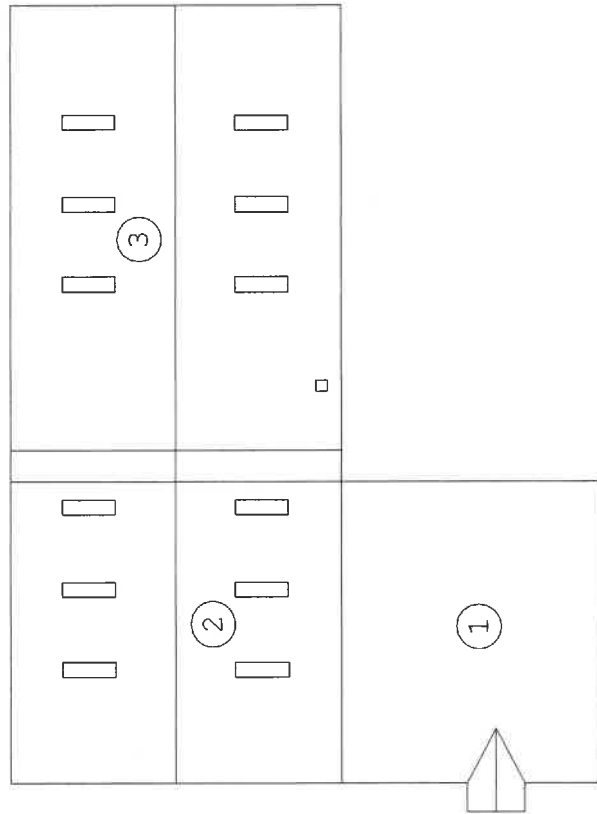


Brecksville-Broadview Hts. City School District
Roof Management Program

BBH High School		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	Outside 10-Yr. Plan	TOTAL
Roof Replacement		\$ 774,007.50	\$ 1,947,750.00	\$ 505,869.00	\$ 328,965.00	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 2,140,320.00	\$ 5,696,911.50
Consultant Fee		\$ 65,790.64	\$ 165,558.75	\$ 42,998.87	\$ 27,962.05	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 181,927.20	\$ 484,237.51
TOTAL:		\$ 839,798.14	\$ 2,113,308.75	\$ 548,867.87	\$ 356,927.05	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 2,322,247.20	\$ 6,181,149.01
Roof Section 1		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL	
Roof Replacement		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 465,864.00	\$ 465,864.00
Consultant Fee		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 39,598.44	\$ 39,598.44
TOTAL:		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 505,462.44	\$ 505,462.44
Roof Section 2		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL	
Roof Replacement		\$ 152,197.50	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 152,197.50
Consultant Fee		\$ 12,936.79	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 12,936.79
TOTAL:		\$ 165,134.29	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 165,134.29	\$ 165,134.29
Roof Section 2-A		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL	
Roof Replacement		\$ 90,300.00	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 90,300.00
Consultant Fee		\$ 7,675.50	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 7,675.50
TOTAL:		\$ 97,975.50	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 97,975.50	\$ 97,975.50
Roof Section 3		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL	
Roof Replacement		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 146,160.00	\$ 146,160.00
Consultant Fee		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 12,423.60	\$ 12,423.60
TOTAL:		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 158,583.60	\$ 158,583.60
Roof Section 4		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL	
Roof Replacement		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 867,216.00	\$ 867,216.00
Consultant Fee		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 73,713.36	\$ 73,713.36
TOTAL:		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 940,929.36	\$ 940,929.36
Roof Section 5		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL	
Roof Replacement		\$ 333,060.00	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 333,060.00
Consultant Fee		\$ 28,310.10	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 28,310.10
TOTAL:		\$ 361,370.10	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 361,370.10	\$ 361,370.10
Roof Section 5-A		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL	
Roof Replacement		\$ 198,450.00	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 198,450.00
Consultant Fee		\$ 16,868.25	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 16,868.25
TOTAL:		\$ 215,318.25	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 215,318.25	\$ 215,318.25
Roof Section 6		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL	
Roof Replacement		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 282,660.00	\$ 282,660.00
Consultant Fee		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 24,026.10	\$ 24,026.10
TOTAL:		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 306,686.10	\$ 306,686.10
Roof Section 7		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL	
Roof Replacement		\$ -	\$ -	\$ -	\$ 58,695.00	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 58,695.00
Consultant Fee		\$ -	\$ -	\$ -	\$ 4,989.08	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 4,989.08
TOTAL:		\$ -	\$ -	\$ -	\$ 63,684.08	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 63,684.08	\$ 63,684.08
Roof Section 8		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL	
Roof Replacement		\$ -	\$ -	\$ -	\$ 20,475.00	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 20,475.00
Consultant Fee		\$ -	\$ -	\$ -	\$ 1,740.38	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 1,740.38
TOTAL:		\$ -	\$ -	\$ -	\$ 22,215.38	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 22,215.38	\$ 22,215.38

**Brecksville-Broadview Hts. City School District
Roof Management Program**

Roof Section 9		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL
Roof Replacement		\$ -	\$ -	\$ -	\$ 51,870.00	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
Consultant Fee		\$ -	\$ -	\$ -	\$ 4,408.95	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
TOTAL:		\$ -	\$ -	\$ -	\$ 56,278.95	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
Roof Section 10		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL
Roof Replacement		\$ -	\$ -	\$ -	\$ 20,475.00	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
Consultant Fee		\$ -	\$ -	\$ -	\$ 1,740.38	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
TOTAL:		\$ -	\$ -	\$ -	\$ 22,215.38	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
Roof Section 11		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL
Roof Replacement		\$ -	\$ 1,911,000.00	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
Consultant Fee		\$ -	\$ 162,435.00	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
TOTAL:		\$ -	\$ 2,073,435.00	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
Roof Section 11-A		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL
Roof Replacement		\$ -	\$ 36,750.00	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
Consultant Fee		\$ -	\$ 3,123.75	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
TOTAL:		\$ -	\$ 39,873.75	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
Roof Section 12		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL
Roof Replacement		\$ -	\$ -	\$ -	\$ 64,155.00	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
Consultant Fee		\$ -	\$ -	\$ -	\$ 5,453.18	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
TOTAL:		\$ -	\$ -	\$ -	\$ 69,608.18	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
Roof Section 13		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL
Roof Replacement		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
Consultant Fee		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
TOTAL:		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
Roof Section 14		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL
Roof Replacement		\$ -	\$ -	\$ 99,645.00	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
Consultant Fee		\$ -	\$ -	\$ 8,469.83	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
TOTAL:		\$ -	\$ -	\$ 108,114.83	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
Roof Section 15		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL
Roof Replacement		\$ -	\$ -	\$ 54,054.00	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
Consultant Fee		\$ -	\$ -	\$ 4,594.59	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
TOTAL:		\$ -	\$ -	\$ 58,648.59	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
Roof Section 16		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL
Roof Replacement		\$ -	\$ -	\$ 352,170.00	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
Consultant Fee		\$ -	\$ -	\$ 29,934.45	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
TOTAL:		\$ -	\$ -	\$ 382,104.45	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
Roof Section 17		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL
Roof Replacement		\$ -	\$ -	\$ -	\$ 113,295.00	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
Consultant Fee		\$ -	\$ -	\$ -	\$ 9,630.08	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
TOTAL:		\$ -	\$ -	\$ -	\$ 122,925.08	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -

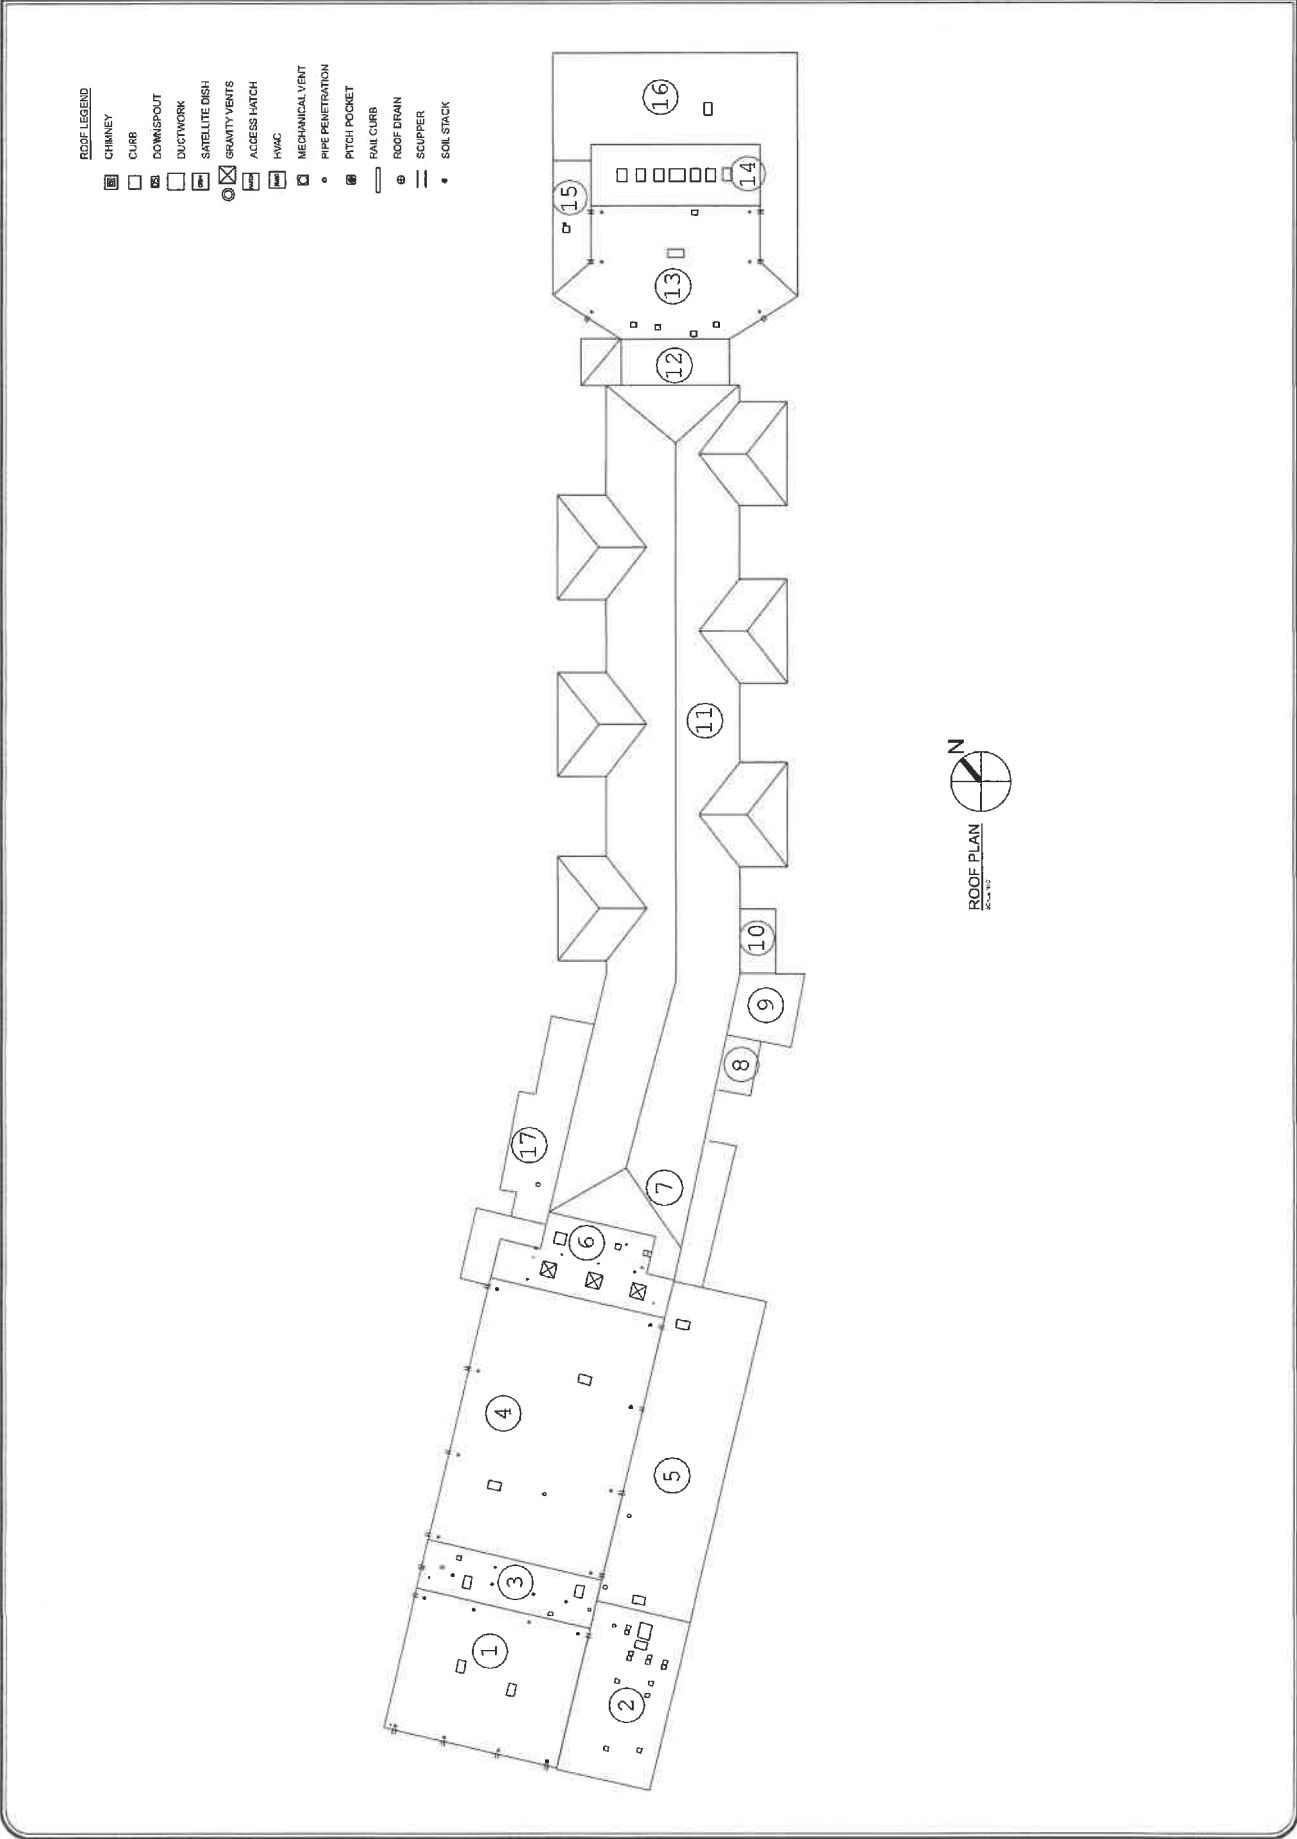

ROOF EVALUATION REPORT



BBHCSD
High School
6380 Mill Road
Broadview Hts., OH 44147

Date of Inspection: 9/26/22
Inspected By: Greg Taylor
Bryan Ice
Joe Taylor
Taylor Consulting Group

Roof Sections	Condition	Sq. Ft.	Deck Type	Roof System	Insulation	Surfacing	Perimeter
1	Good	11,092	Metal	.060 Fully Adhered EPDM	Polyisocyanurate	Smooth	Metal Fascia
2	Poor	5,575	Metal	Ballasted EPDM	Polyisocyanurate	Gravel	Metal Fascia
3	Good	3,480	Metal	.060 Fully Adhered EPDM	Polyisocyanurate	Smooth	Metal Fascia
4	Good	20,648	Metal	.060 Fully Adhered EPDM	Polyisocyanurate	Smooth	Metal Fascia
5	Poor	12,200	Metal	Ballasted EPDM	Polyisocyanurate	Gravel	Metal Fascia
6	Good	5,384	Metal	Modified Bitumen	Polyisocyanurate	Granulated	Metal Fascia
7	Poor	2,150	Metal	Ballasted EPDM	Polyisocyanurate	Gravel	Metal Fascia
8	Poor	750	Metal	Ballasted EPDM	Polyisocyanurate	Gravel	Metal Fascia
9	Poor	1,900	Metal	Ballasted EPDM	Polyisocyanurate	Gravel	Metal Fascia
10	Poor	750	Metal	Ballasted EPDM	Polyisocyanurate	Gravel	Metal Fascia
11	Poor	65,000	Metal	Shingles	Polyisocyanurate	Granulated	Gutter
11-A	Poor	700	Metal	Ballasted EPDM	Polyisocyanurate	Gravel	Metal Fascia
12	Poor	2,350	Metal	Ballasted EPDM	Polyisocyanurate	Gravel	Metal Fascia
13	Good	9,010	Metal	.060 Fully Adhered EPDM	Polyisocyanurate	Smooth	Metal Fascia
14	Poor	3,650	Metal	Ballasted EPDM	Polyisocyanurate	Gravel	Metal Fascia
15	Poor	1,980	Metal	Ballasted EPDM	Polyisocyanurate	Gravel	Metal Fascia
16	Poor	12,900	Metal	Ballasted EPDM	Polyisocyanurate	Gravel	Metal Fascia
17	Poor	4,150	Metal	Ballasted EPDM	Polyisocyanurate	Smooth	Metal Fascia

Taylor Consulting Group, LLC
PO Box 1570
Mentor, OH 44061

Phone: 440-840-9019
Fax: 440-209-9841
Email: gtaylor@tcgroupdesign.com



Roof System Observation:

Brecksville-Broadview Heights High School comprises 17 roof sections (labeled 1-17). The .060 fully adhered EPDM and modified bitumen roof sections are newer and in good condition. The older ballasted EPDM roof sections in in poor condition, with roof sections 2, masonry wall 2A, roof section 5, and masonry wall 5A having intermittent leaks into the cafeteria and kitchen areas. Roof construction during 2022 on roof sections 1, 3, 4, and 13 revealed that the existing ballasted EPDM roof sections have deteriorated EPDM roof membrane. The membrane is brittle and has shrunk significantly from exposure to the elements.

Roof System Recommendation:

Due to the poor condition of several roof sections at BBHCSD High School TCG recommends replacement of The ballasted EPDM and shingle roof sections within the 10-year roof management timeframe. TCG recommends replacement of roof sections 2 and 5 in, with tuckpointing and waterproofing on walls 2A and 5A in 2023. Replacement of roof sections 11 and 11A in 2024. Replacement of roof sections 14, 15, and 16 in 2025. Roof sections 7, 8, 9, 10, and 17 should be considered for replacement in 2026.

BBHCSD High School Roof Overview

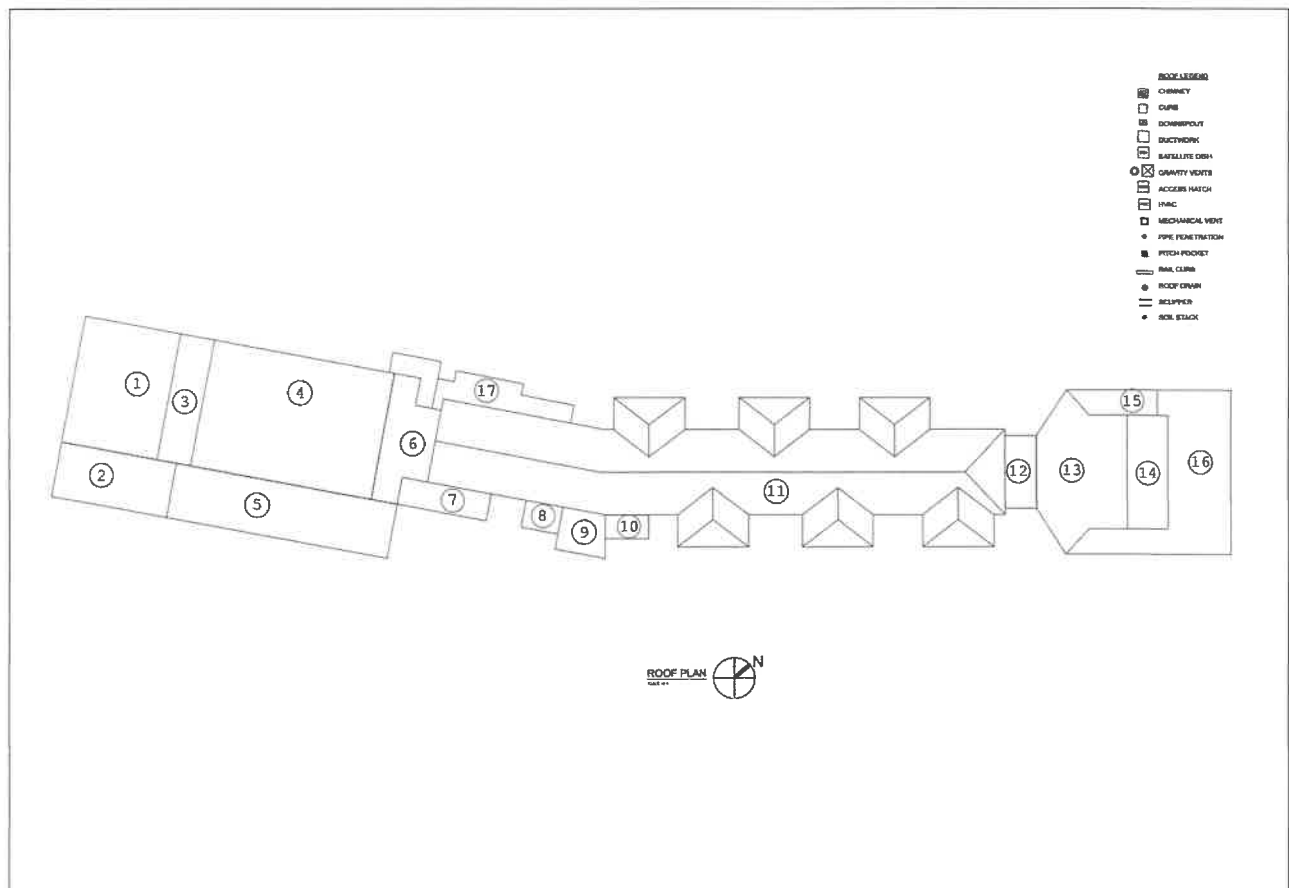


Photo Documentation:



Photo 1: BBHCSD High School.



Photo 2: Roof Section 1: Roof Replaced with .060 EPDM in 2022.



Photo 3: Roof Section 2: Areas with gravel cleared out indicate previous leaks and temporary repairs.



Photo 4: Roof Section 3: Roof replaced with .060 EPDM in 2022.



Photo 5: Roof Section 4: Roof replaced with .060 EPDM in 2022.



Photo 6: Roof Section 5: Ballasted EPDM roof system in poor condition. The roof and adjacent wall have had leaks into the cafeteria and kitchen areas.



Photo 7: Roof Section 6: Roof replaced in 2021 with modified bitumen.



Photo 8: Roof Section 7: Ballasted EPDM roof section in poor condition.



Photo 9: Roof Section 8 (foreground)



Photo 10: Roof Section 9: Ballasted EPDM roof section in poor condition.



Photo 11: Roof Section 10: Ballasted EPDM roof section in poor condition.



Photo 12: Roof Section 11: Shingled roof section in poor condition. Shingles have begun cracking and curling, showing signs of end of life.



Photo 13: Roof Section 11: Shingled roof section in poor condition.



Photo 14: Roof Section 11: Shingled roof section in poor condition. Photo shows a broken shingle tab which has begun to curl upwards.



Photo 15: Roof Section 12:



Photo 16: Roof Section 13: Roof section replaced with .060 EPDM in 2022.



Photo 17: Roof Section 14: Ballasted EPDM theater roof in poor condition. Roof has had leaks and shows signs of deterioration.



Photo 18: Roof Section 15: Ballasted EPDM roof section in poor condition.



Photo 19: Roof Section 16: Ballasted EPDM roof section in poor condition. Areas free of gravel indicate temporary repairs.





Photo 20: Roof Section 17: Ballasted EPDM roof section in poor condition.

Brecksville-Broadview Hts. City School District
Roof Management Program

Hilton Elementary School	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	Outside 10-Yr. Plan	TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 665,700.00	\$ 688,800.00	\$ 700,560.00	\$ -	\$ -	\$ 2,055,060.00
Consultant Fee	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 56,584.50	\$ 58,548.00	\$ 59,547.60	\$ -	\$ -	\$ 174,680.10
TOTAL:	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 722,284.50	\$ 747,348.00	\$ 760,107.60	\$ -	\$ -	\$ 2,229,740.10
Roof Section 1	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032		TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 504,000.00	\$ -	\$ -	\$ -	\$ 504,000.00
Consultant Fee	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 42,840.00	\$ -	\$ -	\$ -	\$ 42,840.00
TOTAL:	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 546,840.00	\$ -	\$ -	\$ -	\$ 546,840.00
Roof Section 2	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032		TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 489,300.00	\$ -	\$ -	\$ 489,300.00
Consultant Fee	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 41,590.50	\$ -	\$ -	\$ 41,590.50
TOTAL:	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 530,890.50	\$ -	\$ -	\$ 530,890.50
Roof Section 3	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032		TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 665,700.00	\$ -	\$ -	\$ -	\$ -	\$ 665,700.00
Consultant Fee	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 56,584.50	\$ -	\$ -	\$ -	\$ -	\$ 56,584.50
TOTAL:	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 722,284.50	\$ -	\$ -	\$ -	\$ -	\$ 722,284.50
Roof Section 4	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032		TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 100,800.00	\$ -	\$ -	\$ -	\$ 100,800.00
Consultant Fee	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 8,568.00	\$ -	\$ -	\$ -	\$ 8,568.00
TOTAL:	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 109,368.00	\$ -	\$ -	\$ -	\$ 109,368.00
Roof Section 5	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032		TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 84,000.00	\$ -	\$ -	\$ -	\$ 84,000.00
Consultant Fee	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 7,140.00	\$ -	\$ -	\$ -	\$ 7,140.00
TOTAL:	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 91,140.00	\$ -	\$ -	\$ -	\$ 91,140.00
Roof Section 6	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032		TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 108,360.00	\$ -	\$ -	\$ 108,360.00
Consultant Fee	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 9,210.60	\$ -	\$ -	\$ 9,210.60
TOTAL:	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 117,570.60	\$ -	\$ -	\$ 117,570.60
Roof Section 7	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032		TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 84,000.00	\$ -	\$ -	\$ 84,000.00
Consultant Fee	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 7,140.00	\$ -	\$ -	\$ 7,140.00
TOTAL:	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 91,140.00	\$ -	\$ -	\$ 91,140.00
Roof Section 8	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032		TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 18,900.00	\$ -	\$ -	\$ 18,900.00
Consultant Fee	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 1,606.50	\$ -	\$ -	\$ 1,606.50
TOTAL:	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 20,506.50	\$ -	\$ -	\$ 20,506.50

- ROOF LEGEND
- CHIMNEY
 - CLUB
 - DOWNSPUT
 - DUCTWORK
 - SATELLITE DISH
 - GRAVITY VENTS
 - ACCESS HATCH
 - HVAC
 - MECHANICAL VENT
 - PIPE PENETRATION
 - PITCH POCKET
 - RAIL CURB
 - ROOF DRAIN
 - SCUPPER
 - SOIL STACK

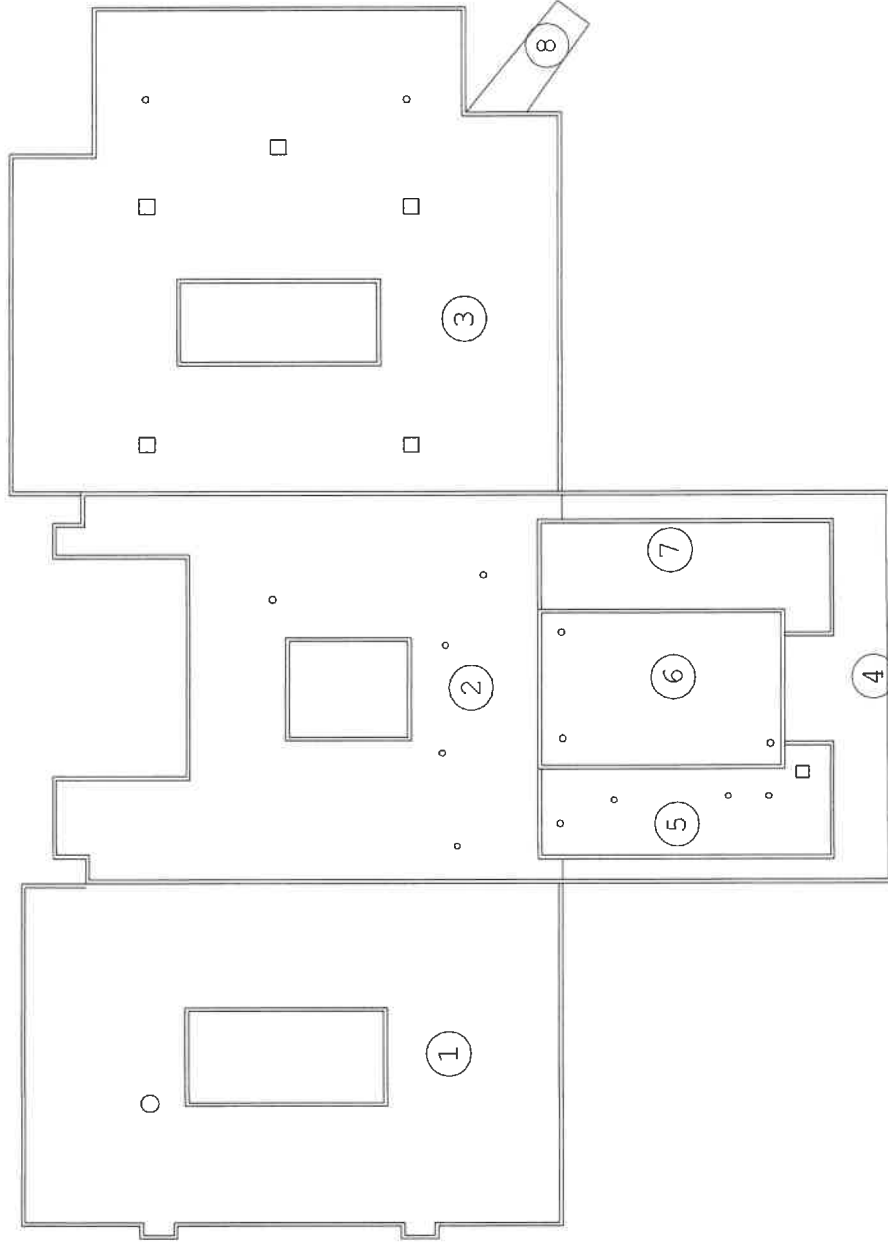

ROOF EVALUATION REPORT



BBHCSD
Hilton Elementary School
6812 Mill Road
Brecksville, OH 44141

Date of Inspection: 9/26/22
Inspected By: Greg Taylor
Bryan Ice
Joe Taylor
Taylor Consulting Group

Roof Sections	Condition	Sq. Ft.	Roof System	Insulation	Surfacing	Perimeter
1	Poor	12,000	Reinforced PVC	Polyisocyanurate	Smooth	Metal Fascia
2	Poor	11,650	Reinforced PVC	Polyisocyanurate	Smooth	Metal Fascia
3	Poor	15,850	Reinforced PVC	Polyisocyanurate	Smooth	Metal Fascia
4	Poor	2,400	Reinforced PVC	Polyisocyanurate	Smooth	Metal Fascia
5	Poor	2,000	Reinforced PVC	Polyisocyanurate	Smooth	Metal Fascia
6	Poor	2,580	Reinforced PVC	Polyisocyanurate	Smooth	Metal Fascia
7	Poor	2,000	Reinforced PVC	Polyisocyanurate	Smooth	Metal Fascia
8	Poor	450	Reinforced PVC	Polyisocyanurate	Smooth	Metal Fascia

Roof System Observation:

Hilton Elementary comprises 8 roof sections (labeled 1-8). All roof sections are Duro-Last reinforced PVC and are in Poor condition. The roof sections hold water in several low spots, show deterioration along the field seams, and flashings have begun to pull away as the roof shrinks with time. Additionally, intermittent leaks have been reported by maintenance staff.

Taylor Consulting Group, LLC
PO Box 1570
Mentor, OH 44061

Phone: 440-840-9019
Fax: 440-209-9841
Email: gtaylor@tcgroupdesign.com



Roof System Recommendation:

Hilton Elementary school roof systems will require replacement within the 10 year roof management timeframe. TCG recommends replacement of roof section 3 in 2029, roof sections 1, 4, and 5 in 2030, and roof sections 2, 6, 7, 8 in 2031.

Hilton Elementary School Overview

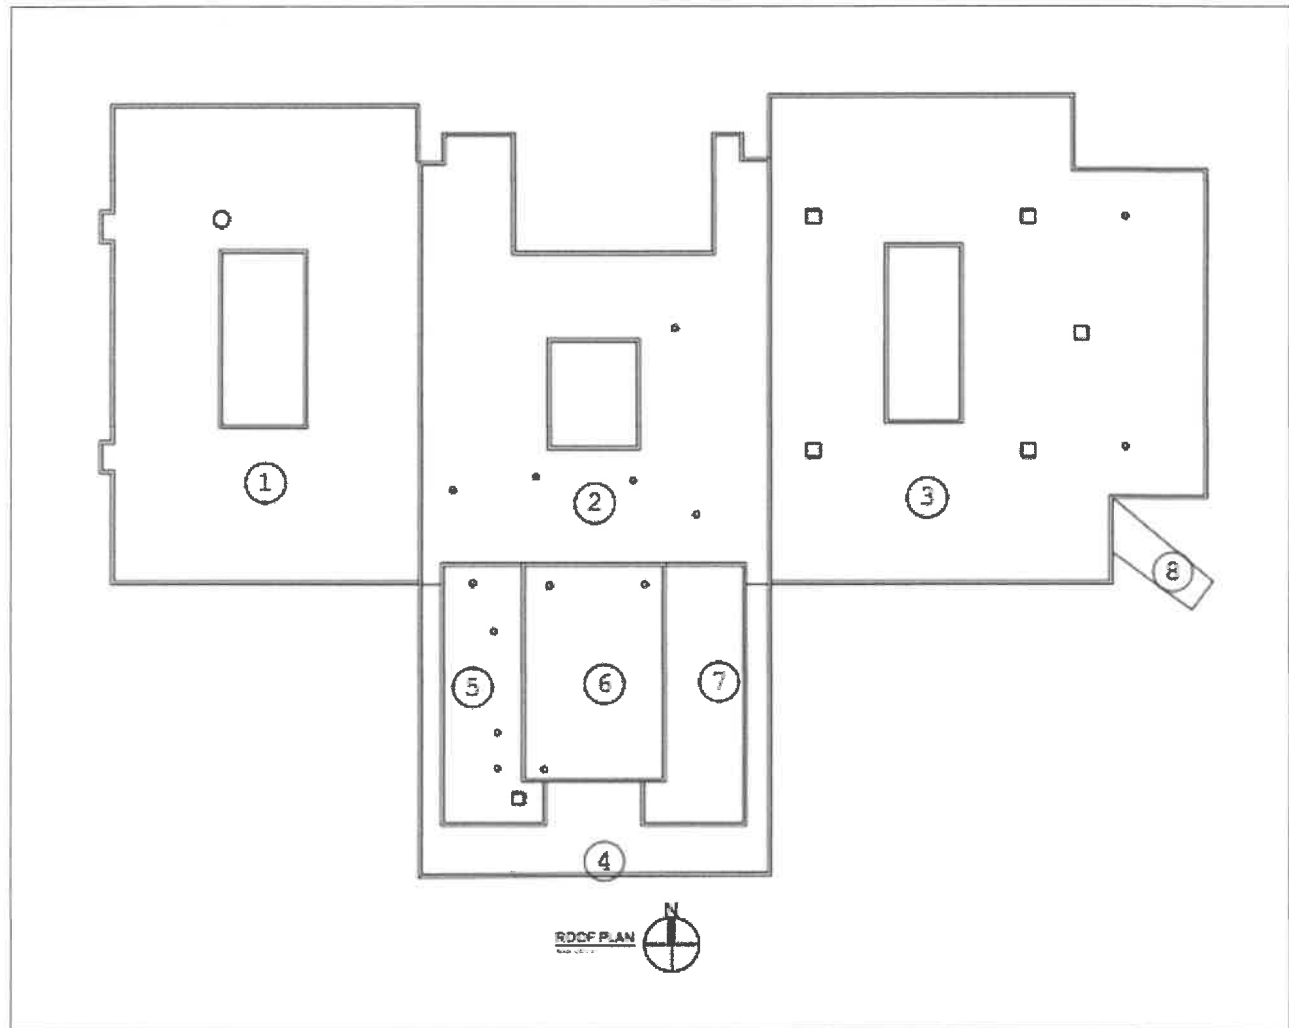


Photo Documentation:



Photo 1: Hilton Elementary School



Photo 2: Roof Section 1: Reinforced PVC roof system. Staining shows areas of ponding water.



Photo 3: Roof Section 2: Reinforced PVC roof system.



Photo 4: Roof Section 3: Reinforced PVC roof system. Large areas of standing water



Photo 5: Roof Section 4: Reinforced PVC roof system. Seams are beginning to delaminate and there are several areas of ponding water.



Photo 6: Roof Section 4: Reinforced PVC roof system. Metal fascia from roof section 6 (above) is beginning to pull away from the wall as the membrane shrinks.



Photo 7: Roof Section 5: Reinforced PVC roof system.



Photo 8: Roof Section 6: Reinforced PVC roof system.



Photo 9: Roof Section 7: Reinforced PVC roof system.



Photo 10: Roof Section 8: Reinforced PVC roof system.

Brecksville-Broadview Hts. City School District
Roof Management Program

BBH Middle School	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	Outside 10-Yr. Plan	TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ 252,000.00	\$ 679,350.00	\$ 715,680.00	\$ -	\$ -	\$ 449,820.00	\$ 973,140.00	\$ 3,815,595.00	\$ 6,885,585.00
Consultant Fee	\$ -	\$ -	\$ -	\$ 21,420.00	\$ 57,744.75	\$ 60,832.80	\$ -	\$ -	\$ 38,234.70	\$ 82,716.90	\$ 324,325.58	\$ 585,274.73
TOTAL:	\$ -	\$ -	\$ -	\$ 273,420.00	\$ 737,094.75	\$ 776,512.80	\$ -	\$ -	\$ 488,054.70	#####	\$ 4,139,920.58	\$ 7,470,859.73
Roof Section 1	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL	TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 215,040.00	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 215,040.00
Consultant Fee	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 18,278.40	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 18,278.40
TOTAL:	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 233,318.40	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 233,318.40
Roof Section 2	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL	TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 246,750.00	\$ 246,750.00
Consultant Fee	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 20,973.75	\$ 20,973.75
TOTAL:	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 267,723.75	\$ 267,723.75
Roof Section 3	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL	TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 107,625.00	\$ 107,625.00
Consultant Fee	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 9,148.13	\$ 9,148.13
TOTAL:	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 116,773.13	\$ 116,773.13
Roof Section 4	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL	TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 435,120.00	\$ -	\$ -	\$ 435,120.00
Consultant Fee	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 36,985.20	\$ -	\$ -	\$ 36,985.20
TOTAL:	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 472,105.20	\$ -	\$ -	\$ 472,105.20
Roof Section 5	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL	TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 92,400.00	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 92,400.00
Consultant Fee	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 7,854.00	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 7,854.00
TOTAL:	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 100,254.00	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 100,254.00
Roof Section 6	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL	TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 14,700.00	\$ -	\$ -	\$ 14,700.00
Consultant Fee	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 1,249.50	\$ -	\$ -	\$ 1,249.50
TOTAL:	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 15,949.50	\$ -	\$ -	\$ 15,949.50
Roof Section 7	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL	TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 73,500.00	\$ 73,500.00
Consultant Fee	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 6,247.50	\$ 6,247.50
TOTAL:	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 79,747.50	\$ 79,747.50
Roof Section 8	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL	TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 344,400.00	\$ -	\$ 344,400.00
Consultant Fee	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 29,274.00	\$ -	\$ 29,274.00
TOTAL:	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 373,674.00	\$ -	\$ 373,674.00
Roof Section 9	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL	TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 341,250.00	\$ 341,250.00
Consultant Fee	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 29,006.25	\$ 29,006.25
TOTAL:	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 370,256.25	\$ 370,256.25

Brecksville-Broadview Hts. City School District
Roof Management Program

Roof Section 10		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL
Roof Replacement		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 411,600.00
Consultant Fee		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 34,986.00
TOTAL:		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 446,586.00
Roof Section 11		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL
Roof Replacement		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 222,600.00
Consultant Fee		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 18,921.00
TOTAL:		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 241,521.00
Roof Section 12		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL
Roof Replacement		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 302,400.00
Consultant Fee		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 25,704.00
TOTAL:		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 328,104.00
Roof Section 13		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL
Roof Replacement		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 179,550.00
Consultant Fee		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 15,261.75
TOTAL:		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 194,811.75
Roof Section 14		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL
Roof Replacement		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 478,800.00
Consultant Fee		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 40,698.00
TOTAL:		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 519,498.00
Roof Section 15		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL
Roof Replacement		\$ -	\$ -	\$ -	\$ -	\$ 4,410.00	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
Consultant Fee		\$ -	\$ -	\$ -	\$ -	\$ 374.85	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 374.85
TOTAL:		\$ -	\$ -	\$ -	\$ -	\$ 4,784.85	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 4,784.85
Roof Section 16		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL
Roof Replacement		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 319,200.00
Consultant Fee		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 27,132.00
TOTAL:		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 346,332.00
Roof Section 17		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL
Roof Replacement		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 185,850.00
Consultant Fee		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 15,797.25
TOTAL:		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 201,647.25
Roof Section 18		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL
Roof Replacement		\$ -	\$ -	\$ -	\$ 252,000.00	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 252,000.00
Consultant Fee		\$ -	\$ -	\$ -	\$ 21,420.00	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 21,420.00
TOTAL:		\$ -	\$ -	\$ -	\$ 273,420.00	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 273,420.00
Roof Section 19		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL
Roof Replacement		\$ -	\$ -	\$ -	\$ -	\$ -	\$ 408,240.00	\$ -	\$ -	\$ -	\$ -	\$ 408,240.00
Consultant Fee		\$ -	\$ -	\$ -	\$ -	\$ -	\$ 34,700.40	\$ -	\$ -	\$ -	\$ -	\$ 34,700.40
TOTAL:		\$ -	\$ -	\$ -	\$ -	\$ -	\$ 442,940.40	\$ -	\$ -	\$ -	\$ -	\$ 442,940.40
Roof Section 20		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL
Roof Replacement		\$ -	\$ -	\$ -	\$ -	\$ 201,600.00	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 201,600.00
Consultant Fee		\$ -	\$ -	\$ -	\$ -	\$ 17,136.00	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 17,136.00
TOTAL:		\$ -	\$ -	\$ -	\$ -	\$ 218,736.00	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 218,736.00

Brecksville-Broadview Hts. City School District
Roof Management Program


Roof Section 21	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 186,900.00
Consultant Fee	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 15,886.50
TOTAL:	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 202,786.50
Roof Section 22	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 247,800.00
Consultant Fee	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 21,063.00
TOTAL:	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 268,863.00
Roof Section 23	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 338,520.00
Consultant Fee	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 28,774.20
TOTAL:	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 367,294.20
Roof Section 24	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 173,250.00
Consultant Fee	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 14,726.25
TOTAL:	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 187,976.25
Roof Section 25	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ -	\$ 473,340.00	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 473,340.00
Consultant Fee	\$ -	\$ -	\$ -	\$ -	\$ 40,233.90	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 40,233.90
TOTAL:	\$ -	\$ -	\$ -	\$ -	\$ 513,573.90	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 513,573.90
Roof Section 26	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 472,500.00	\$ 472,500.00
Consultant Fee	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 40,162.50	\$ 40,162.50
TOTAL:	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 512,662.50	\$ 512,662.50
Roof Section 27	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL
Roof Replacement	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 156,240.00	\$ 156,240.00
Consultant Fee	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 13,280.40	\$ 13,280.40
TOTAL:	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 169,520.40	\$ 169,520.40

DATE	
JOB NUMBER:	
DATE DRAWN: 12-14-20	
DRAWN BY: M.J.F.	

BRECKSVILLE-BROADVIEW HEIGHTS
MIDDLE SCHOOL
ROOF REPLACEMENT PROJECTS
ROOF PLAN

TAYLOR CONSULTING GROUP
BUILDING ENVELOPE ENGINEERS & CONSULTANTS
440-840-9019
EMAIL: glaylor@tcgroupdesign.com

- ROOF LEGEND**
- | | | | |
|---|-----------------|---|------------------|
|  | CHIMNEY |  | CURB |
|  | DOWNSPOUT |  | DUCTWORK |
|  | SATELLITE DISH |  | GRAVITY VENTS |
|  | ACCESS HATCH |  | HVAC |
|  | MECHANICAL VENT |  | PIPE PENETRATION |
|  | PITCH POCKET |  | RAOF CURB |
|  | RAIN DRAIN |  | SCOOPER |
|  | SOLE STACK | | |

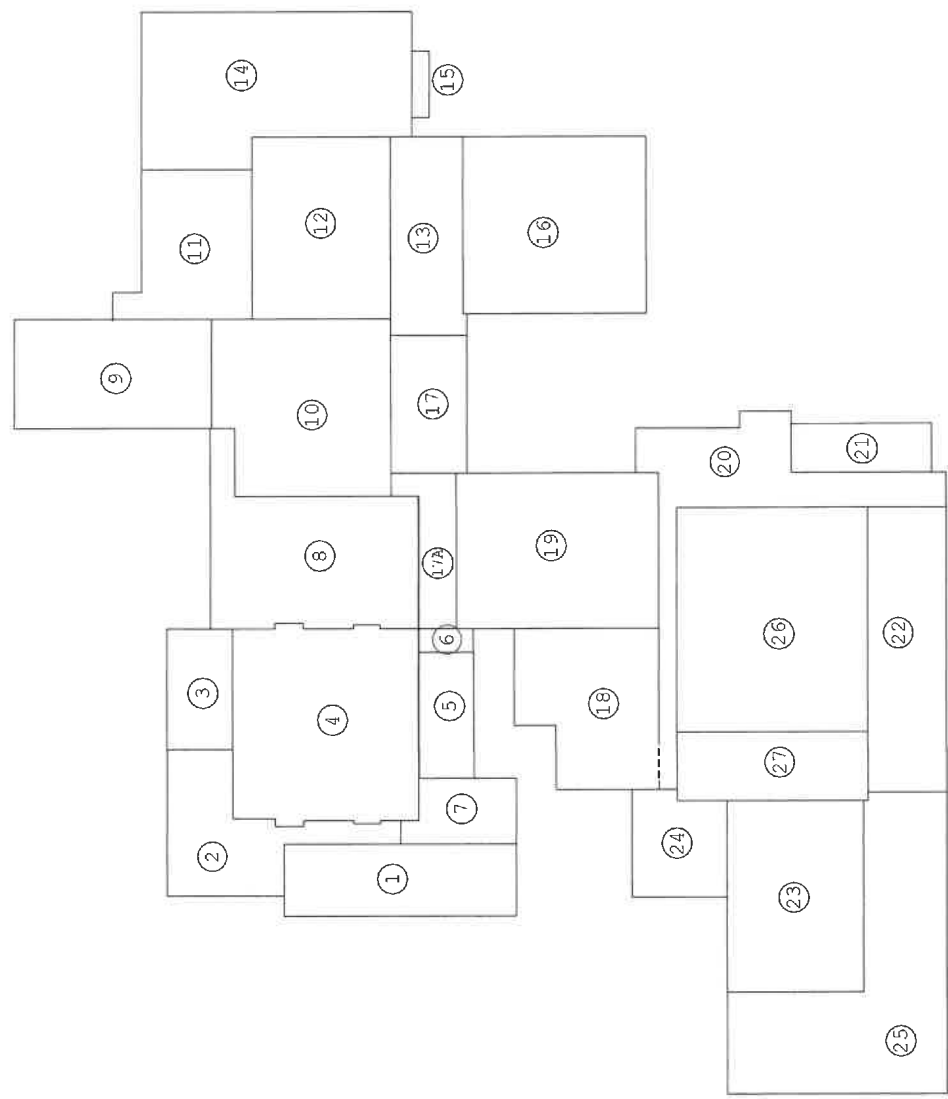

ROOF SECTION 10
 $30^{\circ} \times 112^{\circ} \times 12'$



ROOF EVALUATION REPORT



**BBHCSD
Middle School
6376 Mill Road
Broadview Heights, OH 44147**

Date of Inspection: 9/26/22

**Inspected By: Greg Taylor
Bryan Ice
Joe Taylor
Taylor Consulting Group**

Roof Sections	Condition	Sq. Ft.	Deck Type	Roof System	Insulation	Surfacing	Perimeter
1	Poor	5,120	N/A	BUR	Polyisocyanurate	Gravel	Metal Fascia
2	Good	4,700	N/A	Modified Bitumen	Polyisocyanurate	Granulated	Metal Fascia
3	Good	2,050	N/A	Modified Bitumen	Polyisocyanurate	Granulated	Metal Fascia
4	Poor	10,360	N/A	Reinforced PVC	Polyisocyanurate	Smooth	Metal Fascia
5	Poor	2,200	N/A	BUR	Polyisocyanurate	Gravel	Metal Fascia
6	Fair	350	N/A	EPDM	Polyisocyanurate	Smooth	Metal Fascia
7	Good	1,750	N/A	EPDM	Polyisocyanurate	Granulated	Metal Fascia
8	Fair	8,200	N/A	EPDM	Polyisocyanurate	Smooth	Metal Fascia
9	Good	6,500	N/A	Modified Bitumen	Polyisocyanurate	Granulated	Metal Fascia
10	Good	9,800	N/A	EPDM	Lightweight Fill	Smooth	Metal Fascia
11	Good	5,300	N/A	EPDM	Lightweight Fill	Smooth	Metal Fascia
12	Good	7,200	N/A	EPDM	Lightweight Fill	Smooth	Metal Fascia
13	Good	4,275	N/A	EPDM	Lightweight Fill	Smooth	Metal Fascia
14	Fair	11,400	N/A	EPDM	Polyisocyanurate	Smooth	Metal Fascia
15	Poor	105	N/A	EPDM	Polyisocyanurate	Smooth	Metal Fascia
16	Fair	7,600	N/A	EPDM	Polyisocyanurate	Smooth	Metal Fascia
17	Good	4,425	N/A	EPDM	Polyisocyanurate	Smooth	Metal Fascia
18	Poor	6,000	N/A	EPDM	Polyisocyanurate	Smooth	Metal Fascia

**Taylor Consulting Group, LLC
PO Box 1570
Mentor, OH 44061**

**Phone: 440-840-9019
Fax: 440-209-9841
Email: gtaylor@tcgroupdesign.com**



Roof Sections	Condition	Sq. Ft.	Deck Type	Roof System	Insulation	Surfacing	Perimeter
19	Poor	9,720	N/A	Reinforced PVC	Polyisocyanurate	Smooth	Metal Fascia
20	Poor	4,800	N/A	EPDM	Polyisocyanurate	Smooth	Metal Fascia
21	Poor	4,450	N/A	EPDM	Polyisocyanurate	Smooth	Metal Fascia
22	Poor	5,900	N/A	EPDM	Polyisocyanurate	Smooth	Metal Fascia
23	Poor	8,060	N/A	EPDM	Polyisocyanurate	Smooth	Metal Fascia
24	Good	3,300	N/A	Modified Bitumen	Polyisocyanurate	Smooth	Metal Fascia
25	Poor	11,270	N/A	BUR	Polyisocyanurate	Gravel	Metal Fascia
26	Poor	11,250	N/A	Reinforced PVC	Polyisocyanurate	Smooth	Metal Fascia
27	Poor	3,720	N/A	Reinforced PVC	Polyisocyanurate	Smooth	Metal Fascia

Roof System Observation:

Brecksville – Broadview Heights Middle School comprises twenty-seven roof sections (labeled 1-27). Older EPDM roof sections are in poor condition, exhibiting signs of deterioration with ponding water, shrinking membrane around the perimeters, and debonding of adhesives along seams in the EPDM roof membranes. Reinforced PVC roof systems (Roof sections 4, 19, 26, and 27) are also in poor condition, with severe shrinking around the perimeters, causing bridging which leads to moisture accumulation between the membrane and insulation systems.

Roof System Recommendation:

Due to the afore mentioned existing conditions on the older EPDM and Reinforced PVC roof systems, TCG recommends replacement of several roof sections within the 10-year roof management plan. Roof section 18 should be considered for replacement in 2026. Roof Sections 15, 20, and 25 (EPDM roof systems) require replacement by 2027. Roof sections 1, 5, and 19 will require replacement by 2028. Roof sections 4 and 6 should be considered for replacement by 2031. Lastly, Roof sections 8, 26, and 27 should be considered for roof replacement in 2032.

Brecksville–Broadview Heights Middle School Roof Overview

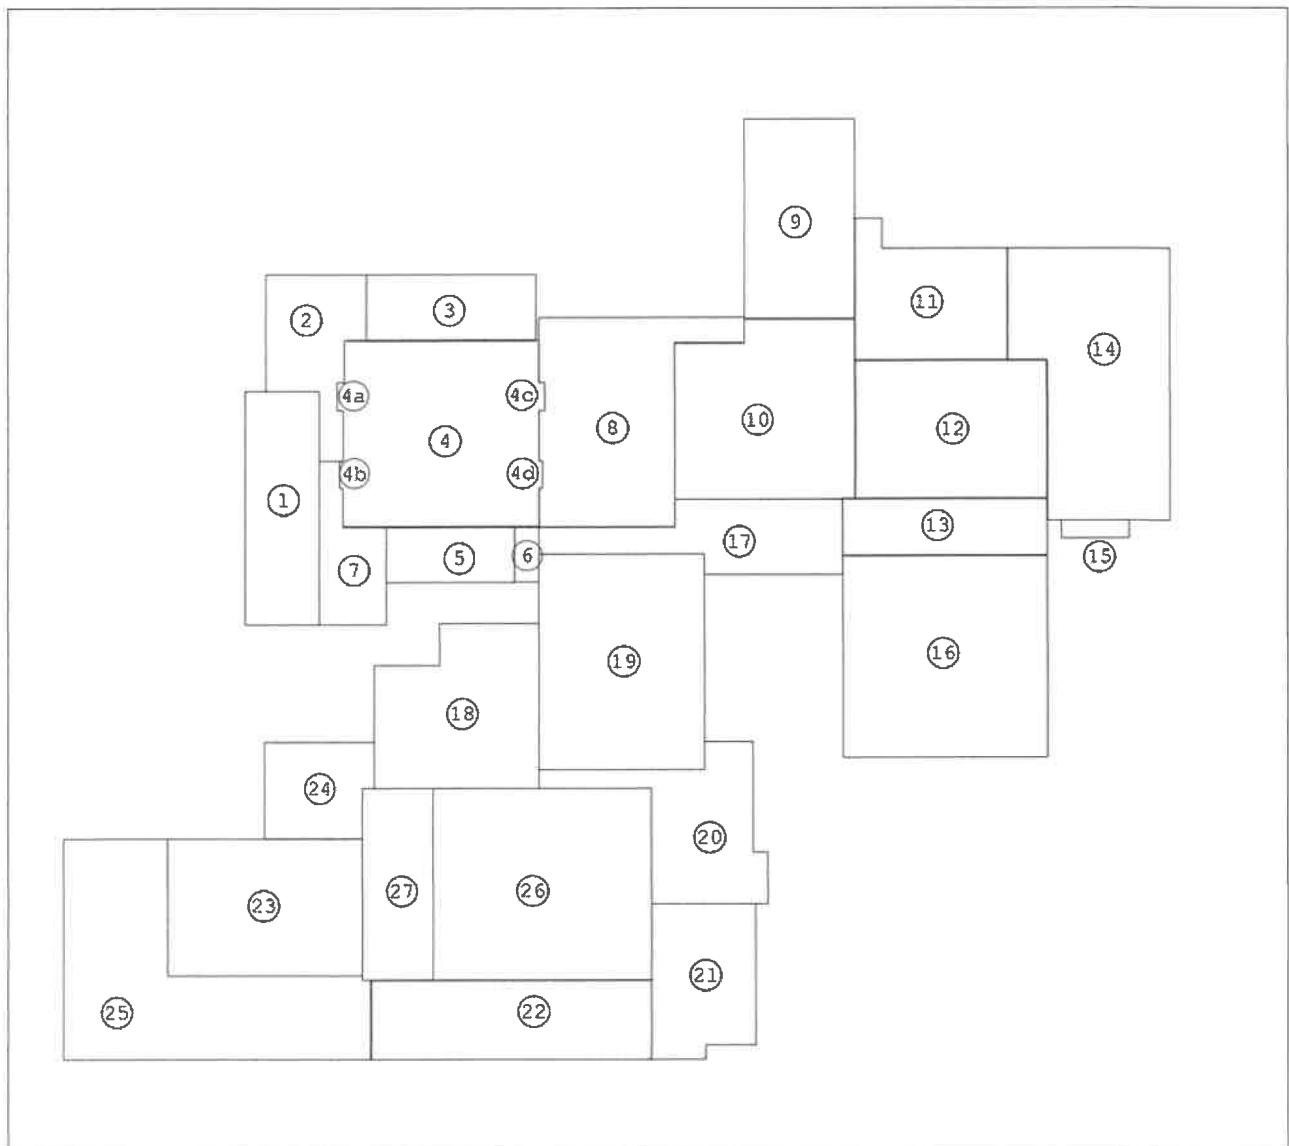


Photo Documentation:



Photo 1: Brecksville Broadview Heights Middle School.



Photo 2: Roof Section 1: Gravel surface built up roof in poor condition.



Photo 3: Roof Section 2: Modified bitumen roof system in good condition.



Photo 4: Roof Section 3: Modified bitumen roof system in good condition.



Photo 5: Roof Section 4: Reinforced PVC roof system in poor condition.



Photo 6: Roof Section 5: Gravel surface Built Up Roof in poor condition.



Photo 7: Roof Section 6: EPDM roof system in fair condition.



Photo 8: Roof Section 7. EPDM roof system in poor condition. Several large areas of ponding water exist.



Photo 9: Roof Section 8. EPDM roof section in fair condition.



Photo 10: Roof Section 9: Modified bitumen roof section in good condition.



Photo 11: Roof Section 10: EPDM roof system in good condition. Roof replaced in 2021



Photo 12: Roof section 11: EPDM roof system in good condition. Roof replaced in 2021.



Photo 13: Roof section 12: EPDM roof system in good condition. Roof replaced in 2021.



Photo 14: Roof Section 13: EPDM roof system in good condition. Roof replaced in 2021.



Photo 15: Roof Section 14: EPDM roof system in fair condition.



Photo 16: Roof Section 15: EPDM roof system over canopy in poor condition.



Photo 17: Roof Section 16: EPDM roof system in fair condition.



Photo 18: Roof Section 17: EPDM roof system in good condition.



Photo 19: Roof Section 18: EPDM roof system in poor condition



Photo 20: Roof section 19: Reinforced PVC roof system in poor condition.



Photo 21: Roof Section 20: EPDM roof system in poor condition.



Photo 22: Roof Section 21: EPDM roof system in poor condition



Photo 23: Roof Section 22: EPDM roof system in poor condition.



Photo 24: Roof Section 23: EPDM roof system in poor condition.



Photo 25: Roof Section 24: Modified bitumen roof system in good condition.



Photo 26: Roof Section 25: Built up roof system in poor condition.



Photo 27: Roof section 26: Reinforced PVC roof system in poor condition.



Photo 28: Roof section 27. Reinforced PVC roof system in poor condition.

Brecksville-Broadview Hts. City School District
Roof Management Program


Stadium Building		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	Outside 10-Yr. Plan	TOTAL
Roof Replacement		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 117,040.00	\$ 251,900.00	\$ 388,940.00
Consultant Fee		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 9,948.40	\$ 21,411.50	\$ 31,359.90
TOTAL:		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 126,988.40	\$ 273,311.50	\$ 400,299.90
Roof Section 1		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL	TOTAL
Roof Replacement		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 154,000.00	\$ 154,000.00
Consultant Fee		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 13,090.00	\$ 13,090.00
TOTAL:		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 167,090.00	\$ 167,090.00
Roof Section 2		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL	TOTAL
Roof Replacement		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 42,900.00	\$ 42,900.00
Consultant Fee		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 3,646.50	\$ 3,646.50
TOTAL:		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 46,546.50	\$ 46,546.50
Roof Section 3		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL	TOTAL
Roof Replacement		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 55,000.00	\$ 55,000.00
Consultant Fee		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 4,675.00	\$ 4,675.00
TOTAL:		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 59,675.00	\$ 59,675.00
Roof Section 4		2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	TOTAL	TOTAL
Roof Replacement		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 117,040.00	\$ -	\$ 117,040.00
Consultant Fee		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 9,948.40	\$ -	\$ 9,948.40
TOTAL:		\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ 126,988.40	\$ -	\$ 126,988.40

DATA	REVISIONS
JOB NUMBER:	
DATE DRAWN: 09-20-22	
DRAWN BY: M.J.F.	

BRECKSVILLE-BROADVIEW HEIGHTS
STADIUM
ROOF REPLACEMENT PROJECT
ROOF PLAN

TAYLOR CONSULTING GROUP
BUILDING ENVELOPE ENGINEERS & CONSULTANTS
440-840-9019
EMAIL: taylor@tcgroupdesign.com

- ROOF LEGEND
- CHIMNEY
 - CURB
 - DOWNSPOUT
 - DUCTWORK
 - SATELLITE DISH
 - GRAVITY VENTS
 - ACCESS HATCH
 - HVAC
 - MECHANICAL VENT
 - PIPE PENETRATION
 - PITCH POCKET
 - RAIL CURB
 - ROOF DRAIN
 - SQUIPPER
 - SOIL STACK

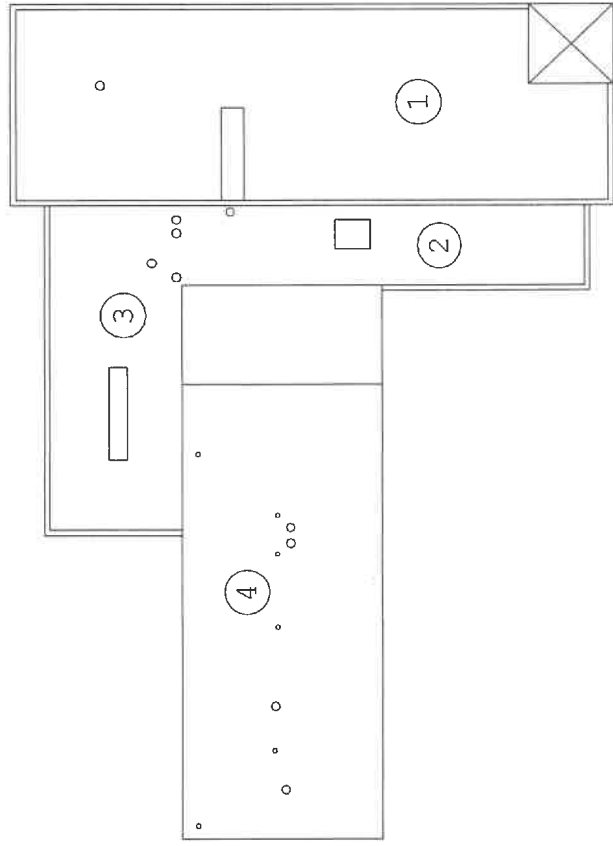

ROOF EVALUATION REPORT



**BBHCSD
Stadium Building
6380 Mill Rd
Broadview Heights, OH 44133**

**Date of Inspection: 9/26/22
Inspected By: Greg Taylor
Bryan Ice
Joe Taylor
Taylor Consulting Group**

Roof Sections	Condition	Sq. Ft.	Deck Type	Roof System	Insulation	Surfacing	Perimeter
1	Fair	3,500	N/A	BUR	Polyisocyanurate	Smooth	Metal Fascia
2	Fair	975	N/A	BUR	Polyisocyanurate	Smooth	Metal Fascia
3	Fair	1,250	N/A	BUR	Polyisocyanurate	Smooth	Metal Fascia
4	Poor	2,660	N/A	Reinforced PVC	Polyisocyanurate	Smooth	Gravel Stop

Roof System Observation:

BBHCSD stadium building comprises 4 roof sections labeled 1-4. Sections 1-3 are smooth surface built up roof systems in fair condition. Portions of these roof sections are beginning to show the fiberglass felt below the top layer of the BUR system, and are a viable option for a roof coating system. Roof section 4 is a Duro-Last reinforced PVC roof system in poor condition. The field seams are showing signs of deterioration, and the field of the roof has several low points holding water. Additionally, the edges of the roof are bridging as the membrane shrinks over time.

**Taylor Consulting Group, LLC
PO Box 1570
Mentor, OH 44061**

**Phone: 440-840-9019
Fax: 440-209-9841
Email: gtaylor@tcgroupdesign.com**



Roof System Recommendation:

TCG considers the life expectancy of roof sections 1-3 to extend beyond the timeframe of the 10 year roof management plan. Roof section 4 however, is in poor condition and should be considered for replacement in 2032.

BBHCSD Stadium Roof Overview

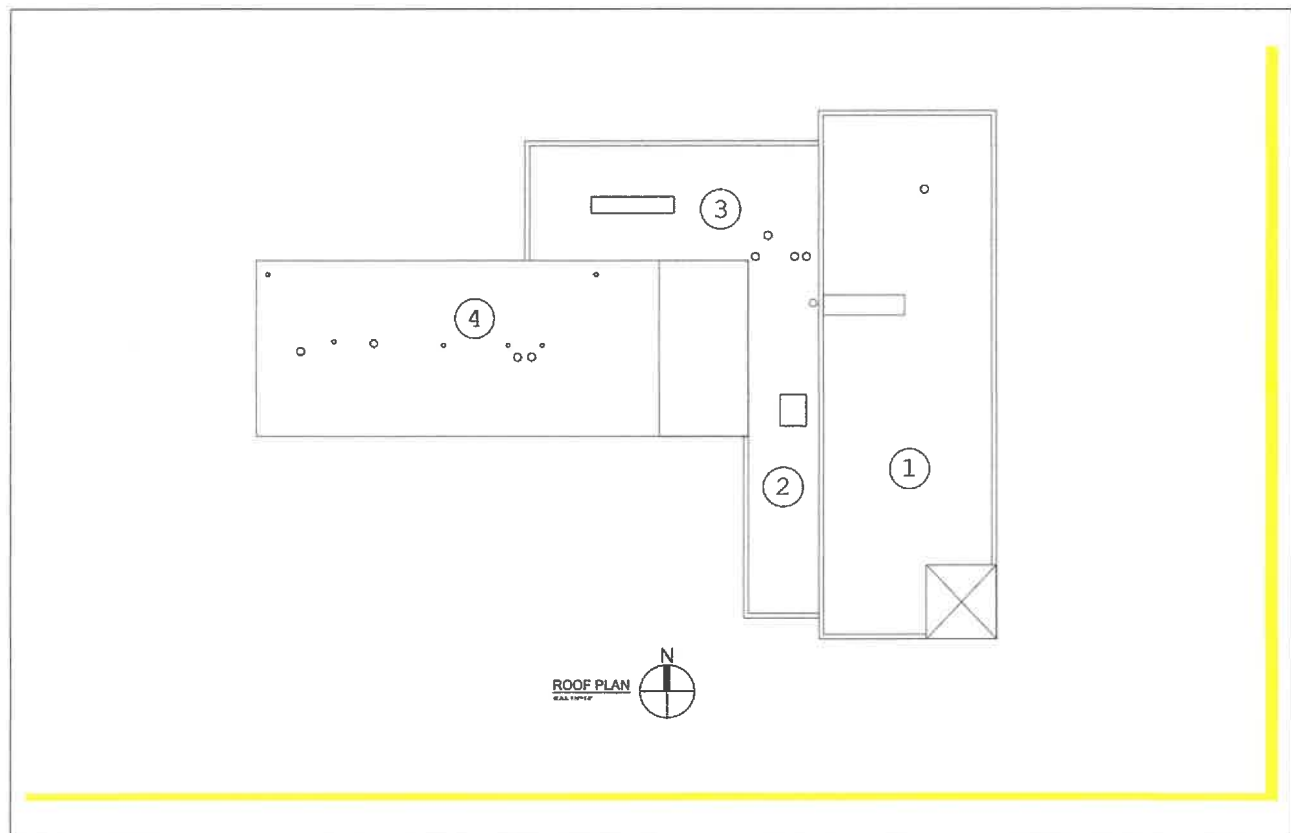


Photo Documentation:



Photo 1: BBHCSD Stadium building



Photo 2: Roof Section 1: BUR in fair condition. Fiberglass felts beginning to show.



Photo 3: Roof Section 2: BUR system in fair condition. Fiberglass felts beginning to show.



Photo 4: Roof Section 3: BUR system in fair condition. Fiberglass felts beginning to show.



Photo 5: Roof Section 3: BUR system in fair condition. Fiberglass felts beginning to show



Photo 6: Roof Section 4: Reinforced PVC system in poor condition. Multiple low spots with standing water.