

## TERMO DE ACEITE TÉCNICO


Solicitante: PRODEMGE / SEE

NOC/Operadora: Pedro Bernardes Operadora/Cliente: Gilvan Junior

GRE/Prodemge: João Antinossi Responsável/cliente: Nelma Lucia Neto

> Porta kbps Plataforma Consórcio **VSAT-ID** EMC/Vodanet SEE-TAIM-23166 2Mbps VSAT

## Port eth0 on SEE-TAIM-23166 (10.213.172.1)

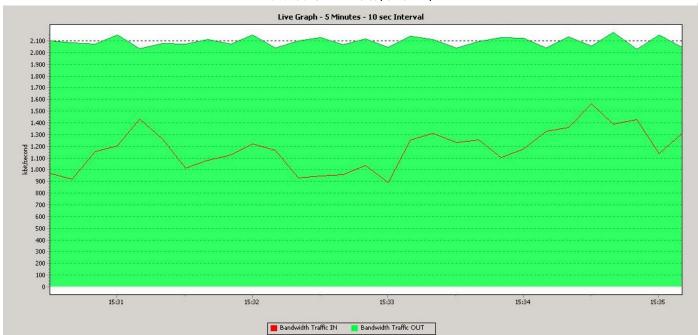

## Satellite (DVB) RX Configuration \_\_\_\_\_

Auto start : Enabled

Max Traffic MODCOD : 23 16APSK-9/10

RX watchdog : 15 minute

Idx Pri SymbRate[Msps] Freq[GHz] Mode PopId SatId Pos SatName Name

Enable

12.176420 DVB-S2 104 0 0.0 E \* 0 0 4.883300

Yes

16.667000 11.962753 DVB-S2 2 0 0.0 E 1 1

Yes

## Satellite (DVB) Receiver Status \_\_\_\_\_

Rx State : On

DVB State : Forward link up

Network : 65281, Prodemge@Vodanet

: 03201, : 12.176484 GHz : 4.883034 Msps Frequency Symbol Rate

S2 ModCod

- receiving : 4 QPSK-1/2 - current max : 21 16APSK-5/6

Pilot : On Frame length DVB S2 Mode : Short : ACM DVB S2 Stream type : MPEG-TS Roll off : 0.20 SNR : 15.6 dB Input Power : -34 dBm

```
Satellite (DVB) TX Configuration
 ______
Auto start
                                          : Enabled
IDU Output Power : -20 dBm
IDU Max Output Power: 0.0 dBm
ODU Output Power : 33.2 dBm
EIRP
                                          : 46.5 dBW
Default CW Frequency: 0.000000 GHz
ATM mode : VC-Mux
Header Compression : UDP/IP
Satellite (DVB) Transmitter Status
: On (DVB-RCS2)

IDU Output Power : -16.6 dBm

ODU Output Power : 33.6 dBm

EIRP
_____
Es/No
                                           : 13.5 dB
\hbox{{\tt Header Compression}} \quad \hbox{{\tt :}} \quad \hbox{{\tt Disabled}} \quad \hbox{{\tt - HC for RCS2 not supported by HUB}}
Timing correction : -244 us (281189 us)
Frequency correction: 140 Hz
System Information:
        Name
                                                  : SEE-TAIM-23166
         Location
                                                    : Tarumirim - MG
         Contact
        System Up time : 0 days, 00:07:18 CPU Load : 14%
         System time(UTC) : 30 November 2017 17:10:15
         Broadcast Message : not set
HW:
        Model
                                                   : SatLink 2000
         HW ID
                                                   : 120033
         Main board ID
                                                  : 120026 R6.2
        converse convence converse converse converse converse converse converse convers
MAC addresses:
        Ethernet (LAN)
NetAddr
                      State MacAddr
       10.214.172.2 Dynamic e8:9a:8f:b7:bd:4a 1
Pinging 10.213.172.1 with 32 bytes of data:
Reply from 10.213.172.1: bytes=32 time=537ms TTL=56
Reply from 10.213.172.1: bytes=32 time=640ms TTL=56
Reply from 10.213.172.1: bytes=32 time=547ms TTL=56
Reply from 10.213.172.1: bytes=32 time=544ms TTL=56
Reply from 10.213.172.1: bytes=32 time=570ms TTL=56
Reply from 10.213.172.1: bytes=32 time=538ms TTL=56
Reply from 10.213.172.1: bytes=32 time=581ms TTL=56
Reply from 10.213.172.1: bytes=32 time=563ms TTL=56
Reply from 10.213.172.1: bytes=32 time=540ms TTL=56
Reply from 10.213.172.1: bytes=32 time=552ms TTL=56
Ping statistics for 10.213.172.1:
         Packets: Sent = 10, Received = 10, Lost = 0 (0% loss),
Approximate round trip times in milli-seconds:
         Minimum = 537ms, Maximum = 640ms, Average = 561ms
```

Lista de sites acessados:
www.globo.com - ok
www.yahoo.com – ok
www.hotmail.com - ok
www.google.com – ok
www.educacao.mg.gov.br – ok
<u>www.prodemge.gov.br</u> – ok
Desmansával mala tasta de mayrageaño.
Responsável pelo teste de navegação:
Nome: Nelma Lucia Neto
Função: Secretaria MASP: 972986-4
Telefone: 33-99978-1765
Telefolie: 33-99978-1703
Funcionamento: 07:00h às 17:00h
Tuncionamento. 07.00m as 17.00m