prodemge

TERMO DE ACEITE TÉCNICO

Solicitante: PRODEMGE / SEE

NOC/Operadora: Pedro Bernardes	**Operadora/Cliente:** Gilvan Junior
GRE/Prodemge: João Antinossi	**Responsável/cliente:** Janaina Freitas de O. Correia

Consórcio	**VSAT-ID**	**Porta kbps**	**Plataforma**
EMC/Vodanet	SEE-TAIM-23167	2Mbps	VSAT

Port eth 0 SEE-TAIM-23167 (10.214.173.1
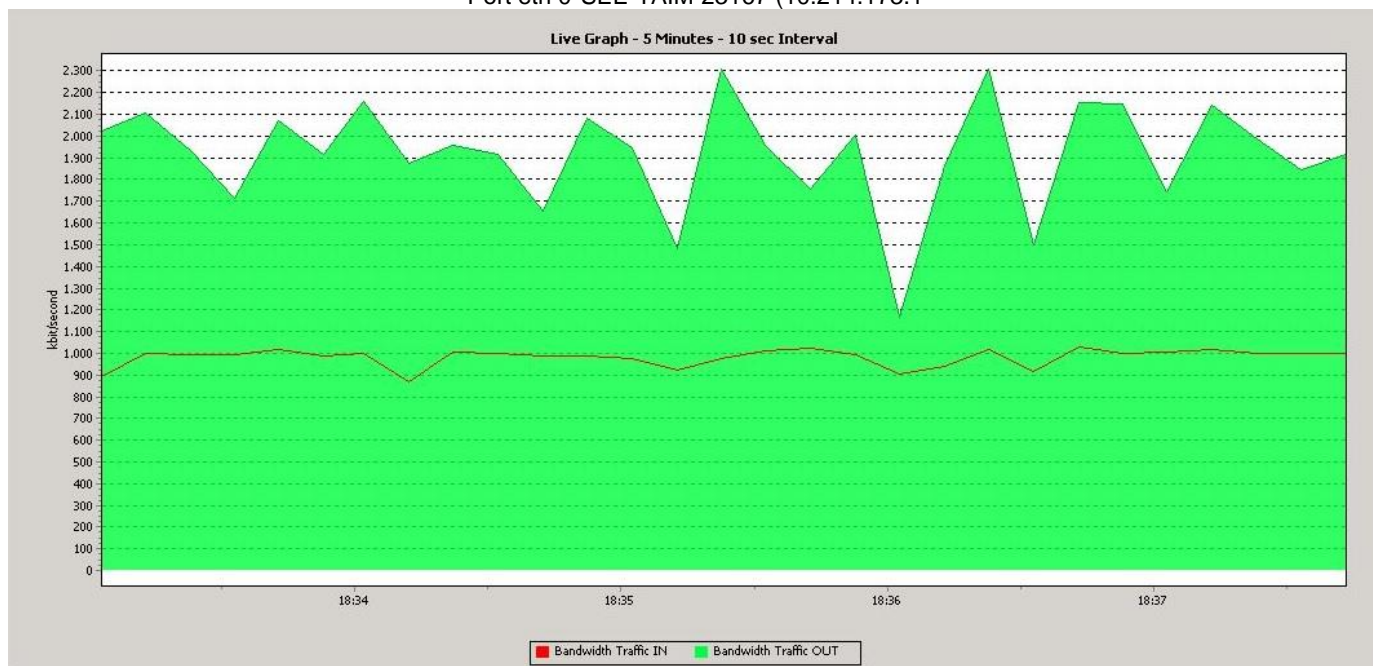
Satellite (DVB) RX Configuration

Auto start   : Enabled
Max Traffic MODCOD   : 23   16APSK-9/10
RX watchdog   : 15 minute

Idx	Pri	SymbRate[Msps]	Freq[GHz]	Mode	PopId	SatId	Pos	SatName	Name	Enable
* 0	0	8.883000	12.176420	DVB-S2	104	0	0.0 E			Yes
1	1	4.883300	12.176420	DVB-S2	104	0	0.0 E			Yes

Satellite (DVB) Receiver Status

Rx State   : On
DVB State   : Forward link up
Network   : 65281, Prodemge@Vodanet
Frequency   : 12.175998 GHz
Symbol Rate   : 8.882904 Msps
S2 ModCod
    - receiving   : 21   16APSK-5/6
    - current max : 22   16APSK-8/9
Pilot   : On
Frame length   : Short
DVB S2 Mode   : ACM
DVB S2 Stream type : MPEG-TS
Roll off   : 0.20
SNR   : 16.1 dB
Input Power   : -26 dBm

```
Satellite (DVB) TX Configuration
-------------------------------
Auto start         : Enabled
IDU Output Power    : -20 dBm
IDU Max Output Power: 0.0 dBm
ODU Output Power    : 33.2 dBm
EIRP              : 46.5 dBW
Default CW Frequency: 0.000000 GHz
ATM mode           : VC-Mux
Header Compression  :  UDP/IP


Satellite (DVB) Transmitter Status
-------------------------------
State              : On  (DVB-RCS2)
IDU Output Power    : -19.7 dBm
ODU Output Power    : 33.5 dBm
EIRP              : 46.8 dBW
Es/No             : 14.0 dB
Header Compression  : Disabled  - HC for RCS2 not supported by HUB
Timing correction   : -305 us (266044 us)
Frequency correction: 100 Hz



System Information:
   Name            : SEE-TAIM-23167
   Location         : Tarumirim - MG
   Contact          :
   System Up time    : 0 days, 07:47:50
   CPU Load         : 21%
   System time(UTC)   : 10 January 2018 16:56:24
   Broadcast Message  : not set

HW:
   Model           : SatLink 2000
   HW ID           : 120033
   Main board ID      : 120026 R6.2

MAC addresses:
   Ethernet (LAN)    : 00:20:0e:10:5b:41
   Satellite (DVB)    : 00:20:0e:10:5b:41


Pinging 10.214.173.1 with 32 bytes of data:

Reply from 10.214.173.1: bytes=32 time=624ms TTL=56
Reply from 10.214.173.1: bytes=32 time=638ms TTL=56
Reply from 10.214.173.1: bytes=32 time=565ms TTL=56
Reply from 10.214.173.1: bytes=32 time=525ms TTL=56
Reply from 10.214.173.1: bytes=32 time=531ms TTL=56
Reply from 10.214.173.1: bytes=32 time=521ms TTL=56
Reply from 10.214.173.1: bytes=32 time=522ms TTL=56
Reply from 10.214.173.1: bytes=32 time=540ms TTL=56
Reply from 10.214.173.1: bytes=32 time=565ms TTL=56
Reply from 10.214.173.1: bytes=32 time=539ms TTL=56

Ping statistics for 10.214.173.1:
   Packets: Sent = 10, Received = 10, Lost = 0 (0% loss),
Approximate round trip times in milli-seconds:
   Minimum = 521ms, Maximum = 638ms, Average = 557ms
```

Resp: Janaina Freitas de O. Correia
Cargo: Secretária
Masp: 376739-9
Telefone: xxx
Horário: xxx

www.hotmail.com
www.google.com
www.prodemge.gov.br
www.globo.com
www.youtube.com