

TERMO DE ACEITE TÉCNICO

Solicitante: PRODEMGE / SEE


NOC/Operadora: Ermínio Junior Operadora/Cliente Ederson Martins


GRE/Prodemge: João Antinossi

Responsável/cliente HERON VIEIRA DOS SANTOS

ConsórcioVSAT-IDEMC/VodanetSEE-LAHA-23662

Porta kbps 2Mbps **Plataforma** VSAT

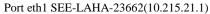

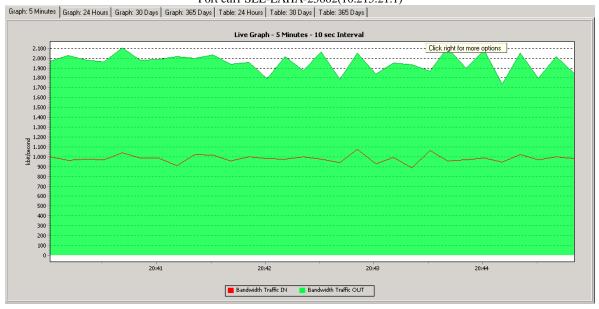

dvb tx show

Satellite (DVB) TX Configuration

Auto start : Enabled IDU Output Power : -18 dBm IDU Max Output Power: 0.0 dBm Default CW Frequency: 0.000000 GHz

ATM mode : VC-Mux Header Compression : UDP/IP

Satellite (DVB) Transmitter Status

State : On (DVB-RCS2) IDU Output Power : -17.8 dBm

Es/No : 17.0 dB

Header Compression: Disabled - HC for RCS2 not supported by HUB

Timing correction : -331 us (266050 us)

Frequency correction: 30 Hz

dvb rx show

Satellite (DVB) RX Configuration

Auto start : Enabled

Max Traffic MODCOD : 23 16APSK-9/10

RX watchdog : 15 minute

Idx Pri SymbRate[Msps] Freq[GHz] Mode PopId SatId Pos SatName Name Enable

* 0 0 8.883000 12.176420 DVB-S2 104 0 0.0 E Yes
1 1 4.883300 12.176420 DVB-S2 2 0 0.0 E Yes

Satellite (DVB) Receiver Status

Rx State : On

```
DVB State
               : Forward link up
              : 65281, Prodemge@Vodanet
Network
Frequency
               : 12.176486 GHz
Symbol Rate
                : 8.883062 Msps
S2 ModCod
   - receiving : 4 QPSK-1/2
   - current max : 22 16APSK-8/9
Pilot
            : On
Frame length
               : Short
                 : ACM
DVB S2 Mode
DVB S2 Stream type: MPEG-TS
Roll off
             : 0.20
SNR
             : 16.7 dB
Input Power
               : -35 dBm
# arp show
             State MacAddr
 NetAddr
  10.215.21.2 Dynamic 1c:39:47:5b:e2:48 1
# devicem show
No Such Command
# device show
System Information:
  Name
               : SEE-LAHA-23662
  Location
                : Lajinha - MG
  Contact
  System Up time
                   : 0 days, 00:06:25
  CPU Load
                 : 26%
  System time(UTC) : 11 January 2018 12:48:16
  Broadcast Message : not set
HW:
  Model
                : SatLink 2000
  HW ID
                : 120033
  Main board ID
                  : 120026 R6.2
MAC addresses:
  Ethernet (LAN)
                   : 00:20:0e:10:7c:8b
  Satellite (DVB) : 00:20:0e:10:7c:8b
Pinging 10.215.21.1 with 32 bytes of data:
Reply from 10.215.21.1: bytes=32 time=596ms TTL=56
Reply from 10.215.21.1: bytes=32 time=723ms TTL=56
Reply from 10.215.21.1: bytes=32 time=519ms TTL=56
Reply from 10.215.21.1: bytes=32 time=555ms TTL=56
Reply from 10.215.21.1: bytes=32 time=547ms TTL=56
Reply from 10.215.21.1: bytes=32 time=579ms TTL=56
Reply from 10.215.21.1: bytes=32 time=517ms TTL=56
Reply from 10.215.21.1: bytes=32 time=543ms TTL=56
Reply from 10.215.21.1: bytes=32 time=536ms TTL=56
Reply from 10.215.21.1: bytes=32 time=539ms TTL=56
Ping statistics for 10.215.21.1:
  Packets: Sent = 10, Received = 10, Lost = 0 (0% loss),
Approximate round trip times in milli-seconds:
  Minimum = 517ms, Maximum = 723ms, Average = 565ms
Responsável; HERON VIEIRA DOS SANTOS
CARGO: ATENDENTE TÉCNICO
MASP:1327998-9
TEL: 033-3344-3000
Onde ficou :CONECTADO NO COMPUTADOR DA SECRETARIA
HORÁRIO DAS 07 AS 18:00 hr
```

www.hotmail.com

www.google.com

www.prodemge.gov.br

www.globo.com

www.youtube.com