



FAULT INPUTS / pulled high; any asserted fault removes PERMIT

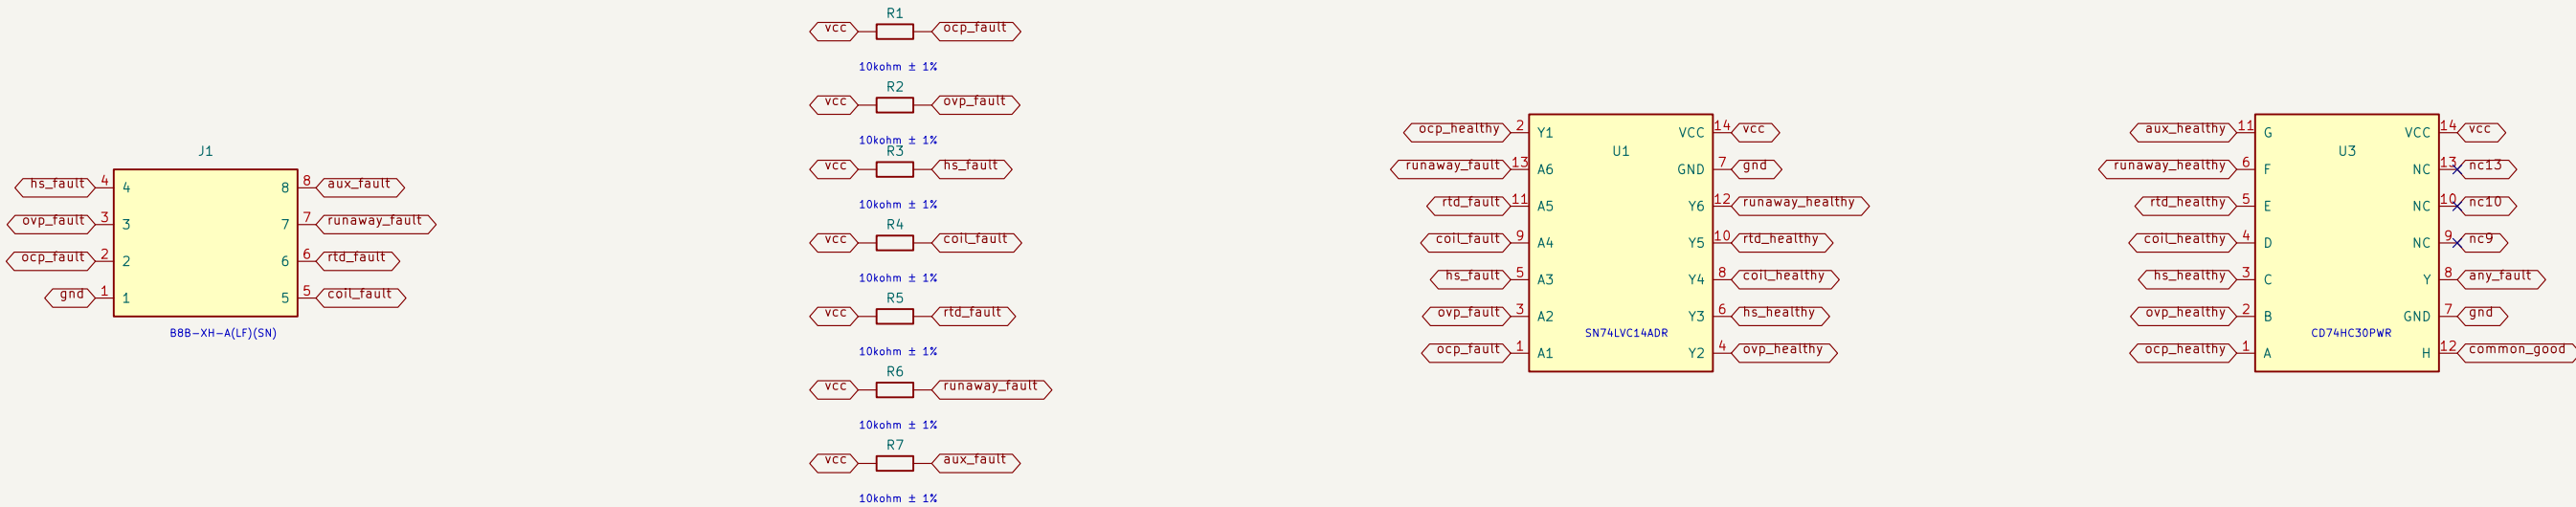

WATCHDOG + LATCH / qualified RESET_N edge required to restart

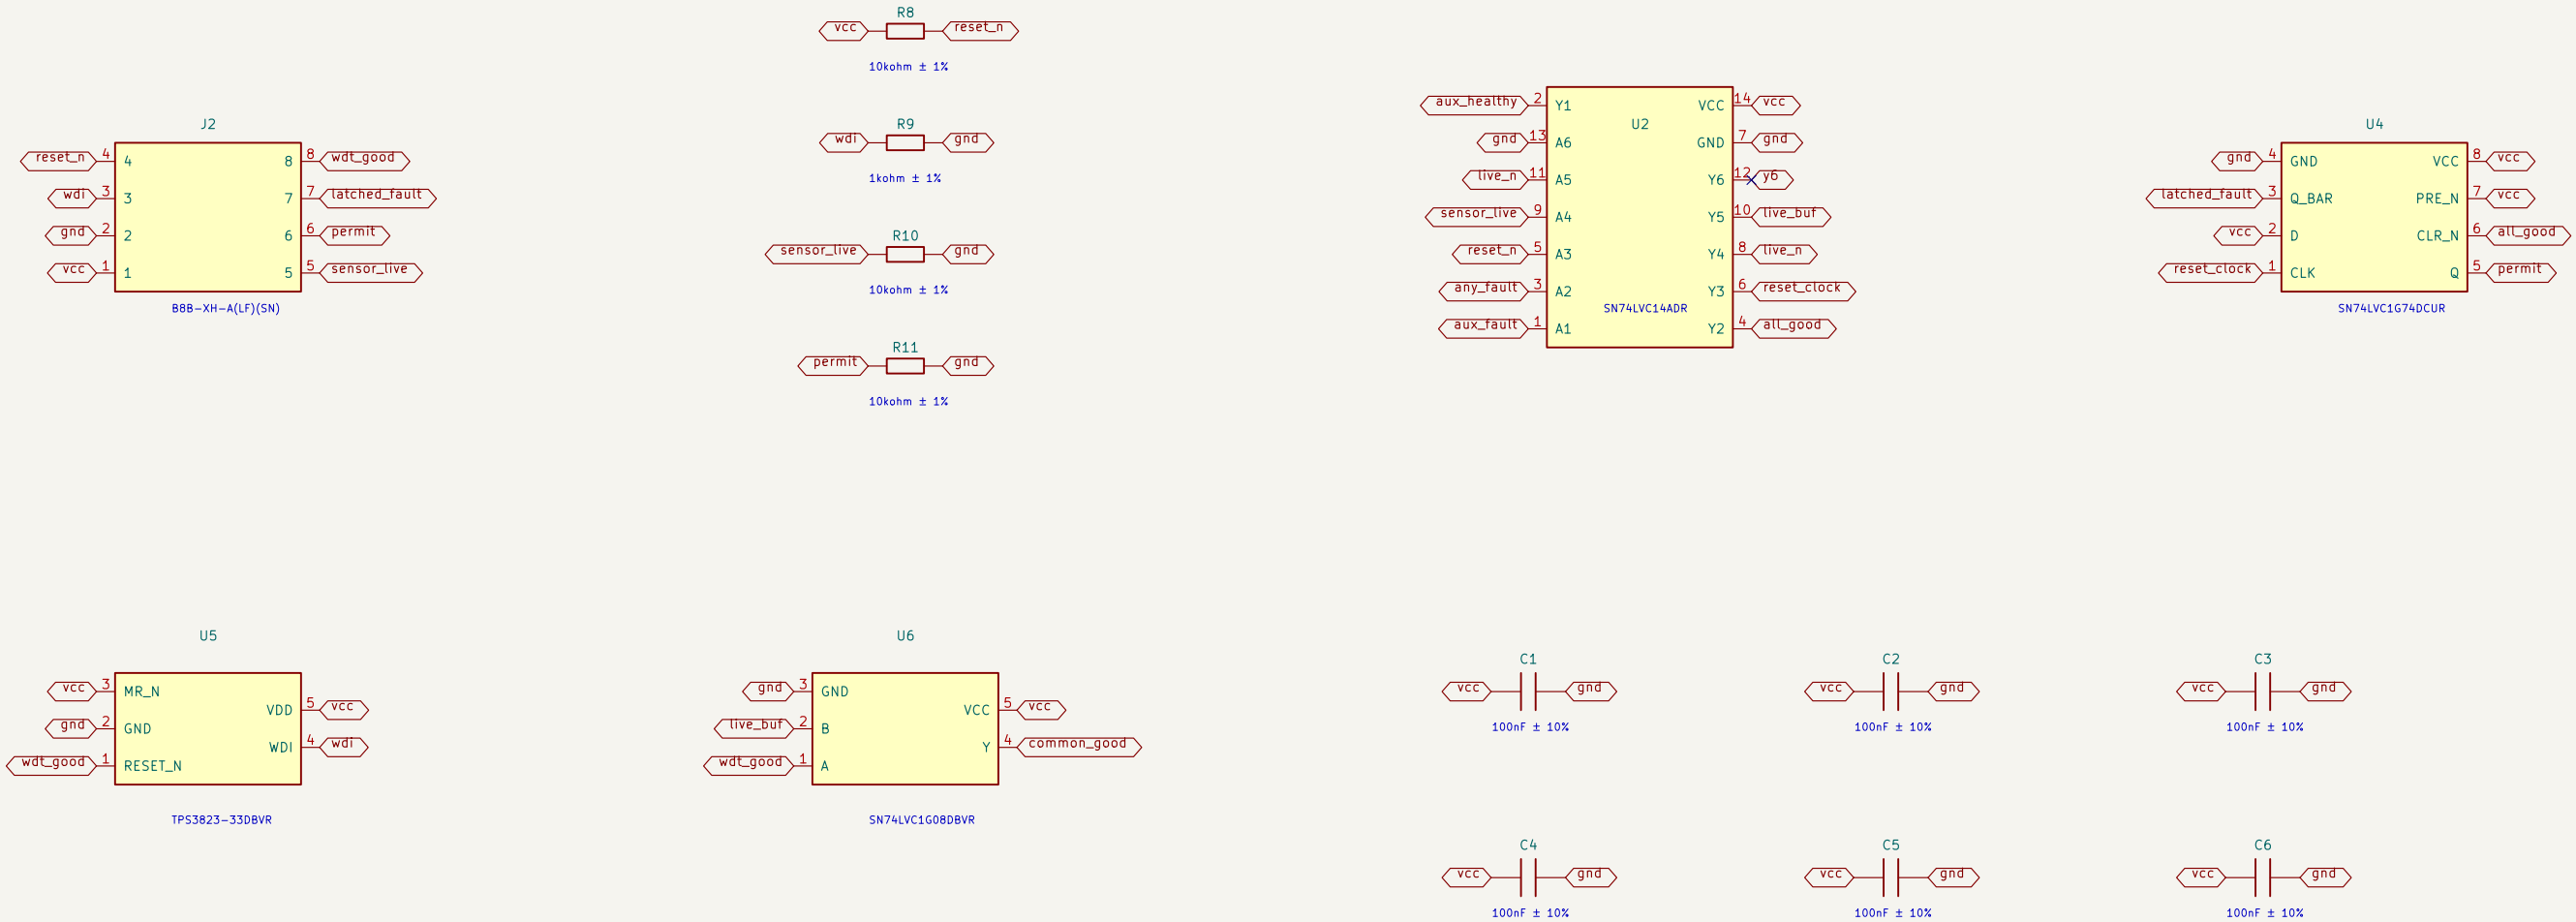

J1: GND + seven active-high fault inputs. J2: +3V3, GND, WDI, RESET_N, SENSOR_LIVE, PERMIT, LATCHED_FAULT, WDT_RESET_N.

U4 Q pin 5 = PERMIT; Q-bar pin 3 = LATCHED_FAULT. U5 RESET_N pin 1, GND pin 2. NC pads are explicitly marked.