

Basic Wire Welding



Read the **ENTIRE IMPORTANT SAFETY INFORMATION** section at the beginning of this manual including all text under subheadings therein before welding.

⚠ WARNING

TO PREVENT SERIOUS INJURY:

Protective gear must be worn when using the Welder; minimum shade number 10 full face shield (or welding mask), ear protection, welding gloves, sleeves and apron, NIOSH-approved respirator, and fire resistant work clothes without pockets should be worn when welding. Light from the arc can cause permanent damage to the eyes and skin. Do not breathe arc fumes.

Flux-cored wire welding is used to weld mild steel and stainless steel without shielding gas.

MIG welding uses solid wire and shielding gas, and is used to weld mild steel and stainless steel. MIG welding can also be used to weld thinner workpieces than flux-cored welding can.

Aluminum welding can be performed with an optional Spool Gun (sold separately) using aluminum wire and shielding gas.

Good welding takes a degree of skill and experience. Practice a few sample welds on scrap before welding your first project. Additional practice periods are recommended whenever you weld:

- a different thickness of material
- a different type of material
- a different type of connection
- using a different process


Make practice welds on pieces of scrap to practice technique before welding anything of value.




⚠ WARNING



TO PREVENT SERIOUS INJURY, FIRE AND BURNS:
Keep welding tip clear of grounded objects whenever unit is plugged in and turned on.

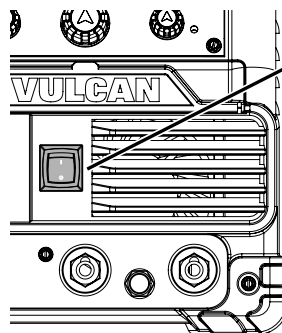

Power Switch

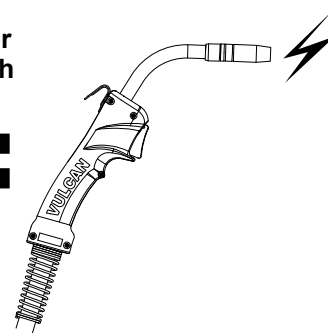

Practice your welding technique on scrap pieces before welding anything of value.