

1. Download the ECHO series upgrade tool, drivers, and the programming files for the corresponding product.

Tool:

[https://fiio-](https://fiio-firmware.fiio.net/ECHO%20NANO/%E7%83%A7%E5%BD%95%E5%B7%A5%E5%85%B7%E4%B8%8E%E7%83%A7%E5%BD%95%E5%8C%85/ECHO%20Series%20firmware_upgrade%E5%8D%95%E6%9C%BA%E5%8D%87%E7%BA%A7%E5%B7%A5%E5%85%B7.zip)

[firmware.fiio.net/ECHO%20NANO/%E7%83%A7%E5%BD%95%E5%B7%A5%E5%85%B7%E4%B8%8E%E7%83%A7%E5%BD%95%E5%8C%85/ECHO%20Series%20firmware_upgrade%E5%8D%95%E6%9C%BA%E5%8D%87%E7%BA%A7%E5%B7%A5%E5%85%B7.zip](https://fiio-firmware.fiio.net/ECHO%20NANO/%E7%83%A7%E5%BD%95%E5%B7%A5%E5%85%B7%E4%B8%8E%E7%83%A7%E5%BD%95%E5%8C%85/ECHO%20Series%20firmware_upgrade%E5%8D%95%E6%9C%BA%E5%8D%87%E7%BA%A7%E5%B7%A5%E5%85%B7.zip)

Driver :

[https://fiio-file.oss-cn-shanghai.aliyuncs.com/Gan/Driver\(2\).zip](https://fiio-file.oss-cn-shanghai.aliyuncs.com/Gan/Driver(2).zip)

ECHO burning firmware file:

[https://fiio-](https://fiio-firmware.fiio.net/ECHO/HT9099(ECHO)BT53_HW_V1.7_SW_V1.2.0_HIFIDAC43198_6KEY_20260204_1130.img)

[firmware.fiio.net/ECHO/HT9099\(ECHO\)BT53_HW_V1.7_SW_V1.2.0_HIFIDAC43198_6KEY_20260204_1130.img](https://fiio-firmware.fiio.net/ECHO/HT9099(ECHO)BT53_HW_V1.7_SW_V1.2.0_HIFIDAC43198_6KEY_20260204_1130.img)

ECHO MINI burning firmware file:

8G:

[https://fiio-](https://fiio-firmware.fiio.net/ECHO%20MINI/ECHO%20MINI%E7%83%A7%E5%BD%95%E5%B7%A5%E5%85%B7%E5%92%8C%E5%9B%BA%E4%BB%B6%E6%96%87%E4%BB%B6/HT9093BT53_%E4%BA%94%E5%A5%97UI_HW_V1.3_SW_V3.2.0_HIFIDAC43131_LCD%E8%AF%BBID%E8%AF%86%E5%88%A)

[firmware.fiio.net/ECHO%20MINI/ECHO%20MINI%E7%83%A7%E5%BD%95%E5%B7%A5%E5%85%B7%E5%92%8C%E5%9B%BA%E4%BB%B6%E6%96%87%E4%BB%B6/HT9093BT53_%E4%BA%94%E5%A5%97UI_HW_V1.3_SW_V3.2.0_HIFIDAC43131_LCD%E8%AF%BBID%E8%AF%86%E5%88%A](https://fiio-firmware.fiio.net/ECHO%20MINI/ECHO%20MINI%E7%83%A7%E5%BD%95%E5%B7%A5%E5%85%B7%E5%92%8C%E5%9B%BA%E4%BB%B6%E6%96%87%E4%BB%B6/HT9093BT53_%E4%BA%94%E5%A5%97UI_HW_V1.3_SW_V3.2.0_HIFIDAC43131_LCD%E8%AF%BBID%E8%AF%86%E5%88%A)
[B_6KEY_20260211_1043.img](https://fiio-firmware.fiio.net/ECHO%20MINI/ECHO%20MINI%E7%83%A7%E5%BD%95%E5%B7%A5%E5%85%B7%E5%92%8C%E5%9B%BA%E4%BB%B6%E6%96%87%E4%BB%B6/HT9093BT53_%E4%BA%94%E5%A5%97UI_HW_V1.3_SW_V3.2.0_HIFIDAC43131_LCD%E8%AF%BBID%E8%AF%86%E5%88%A)

512 MB:

[https://fiio-file.oss-cn-](https://fiio-file.oss-cn-shanghai.aliyuncs.com/Gan/NANO_F512M_HW_V1.0_SW_V1.5.0_HIFIDAC43131_3KEY_20260714_1725.img)

[shanghai.aliyuncs.com/Gan/NANO_F512M_HW_V1.0_SW_V1.5.0_HIFIDAC43131_3KEY_20260714_1725.img](https://fiio-file.oss-cn-shanghai.aliyuncs.com/Gan/NANO_F512M_HW_V1.0_SW_V1.5.0_HIFIDAC43131_3KEY_20260714_1725.img)

ECHO NANO burning firmware file:


[https://fiio-](https://fiio-firmware.fiio.net/ECHO%20NANO/%E7%83%A7%E5%BD%95%E5%B7%A5%E5%85%B7%E4%B8%8E%E7%83%A7%E5%BD%95%E5%8C%85/NANO_F512M_HW_V1.0_SW_V1.4.0_HIFIDAC43131_3KEY_20260623_1024.img)

[firmware.fiio.net/ECHO%20NANO/%E7%83%A7%E5%BD%95%E5%B7%A5%E5%85%B7%E4%B8%8E%E7%83%A7%E5%BD%95%E5%8C%85/NANO_F512M_HW_V1.0_SW_V1.4.0_HIFIDAC43131_3KEY_20260623_1024.img](https://fiio-firmware.fiio.net/ECHO%20NANO/%E7%83%A7%E5%BD%95%E5%B7%A5%E5%85%B7%E4%B8%8E%E7%83%A7%E5%BD%95%E5%8C%85/NANO_F512M_HW_V1.0_SW_V1.4.0_HIFIDAC43131_3KEY_20260623_1024.img)

2. Install the driver.

Install the driver on the computer. Right-click "**My Computer**" → select "**Properties**" → select "**Device Manager**" → expand "**Other devices**" and find the item with a yellow exclamation mark → click "**Update driver.**" Follow the prompts, select manual installation location, and choose the **Driver** folder under the tool directory. Select the corresponding driver based on your system parameters. Installation is now complete.

Note: If it does not work on a win10 computer, you can also try win8. On "My Computer," it is located in the area shown in the image.

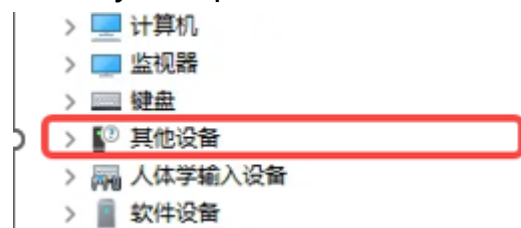

3. Open the RKDevelopTool program in the firmware upgrade tool and re-flash the firmware.

For international users: open the config configuration file and change "selected" from 1 to 2, as indicated by the arrow in the image. This will make the RKDevelopTool display in English.

```
#选择工具语言:Selected=1(中文);Selected=2(英文)
[Language]
Kinds=2
Selected=2
LangPath=Language\
```



After completing Step 1, the following will appear:

```
Loading firmware...
Loading firmware Finished.
```

Then, pay attention to the lower-left corner of the image. When the computer connects to the device, it may display "Found one MSC device." In Step 2, click the switch button. If the driver is installed successfully, this area will then display "Found one MASKROM device" or "Found one Loader device" — either one is fine. If the driver installation fails, it will display "No devices found." Note: At this point, the device will power off and the computer will not be able to recognize or connect to the device. If this happens, the computer needs to have the driver reinstalled. The device needs to be restarted by long-pressing the Reset button, then powering it back on.

Found One MASKROM Device

If the first two steps are completed without any issues, then you can proceed to follow the remaining steps shown in the figure. The final interface will appear as shown in the image, and the data in the lower-right corner will begin loading gradually.

```
<Layer 1-9> Download IDB Success  
<Layer 1-9> Mutex Reset Device Start  
<Layer 1-9> Reset Device Start  
<Layer 1-9> Reset Device Success  
<Layer 1-9>—><Layer 1-9> Mutex Reset Device Success  
<Layer 1-9> Test Device Start  
<Layer 1-9> Test Device Success  
<Layer 1-9> Download Firmware Start  
<Layer 1-9> Download Image Total(77824K),Current(18432K)
```

Once the loading is complete, the following will appear:

```
<Layer 1-9> Check Image Total(77824K),Current(77824K)  
<Layer 1-9> Download Firmware Success  
<Layer 1-9> Reset Device Start  
<Layer 1-9> Reset Device Success  
<Layer 1-9> Wait For MSC Start  
<Layer 1-9> Wait For MSC Success  
<Layer 1-9> Find User Disk Start  
<Layer 1-9> Find User Disk Pass  
<Layer 1-9> Format Disk Start
```

4. Error Message Description

- **"Failed to load configuration information, operation cannot proceed."** — This occurs due to an error loading the Config.ini file. You can obtain the correct Config.ini file from the release package and replace it.
- **"Failed to load firmware, operation cannot proceed!"** — This is caused by the firmware not being selected or the file being unreadable. Please verify that the firmware file is correct.
- **"Another operation is in progress, please wait!"** — Another operation is currently running. Please wait for it to finish before proceeding.
- **"Operation mismatch, operation cannot proceed!"** — Please ensure that the chip supported by the firmware matches the currently selected chip tab. Note: For both RK28 and RK281X, select the RK28 tab.
- **"No device found, operation cannot proceed!"** — Please verify that the device is connected and is in Rockusb state.
- **"Multiple devices found, operation cannot proceed!"** — The tool has detected multiple devices connected to the PC. Please keep only one device connected and try again.
- **"Failed to obtain device information, operation cannot proceed!"** — Please unplug and reconnect the device, then try again.
- **"Failed to create operation workflow, operation cannot proceed!"** — Please restart the program and try again.
- **"Failed to create operation object, operation cannot proceed!"** — Please restart the program and try again.
- **"Unsupported device type, operation cannot proceed!"** — Please confirm that the device has entered Rockusb state. If it is currently in USB mass storage (U-disk) mode, please switch it first before proceeding.

5. Important Notes

- If the process gets stuck at "Download Boot Start," please disconnect the device and restart the upgrade process.
- After modifying the configuration file, you need to restart the program.
- On Vista or Windows 7 systems, the program must be run with administrator privileges.