
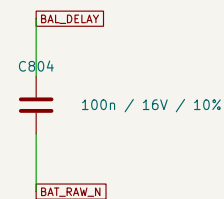
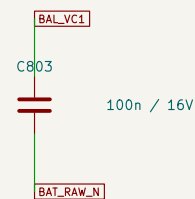
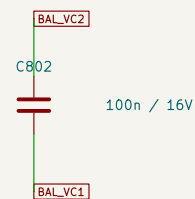
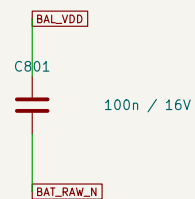
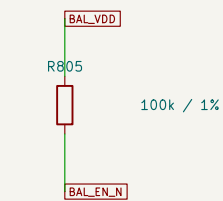
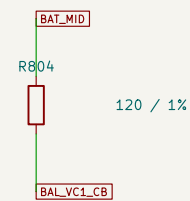
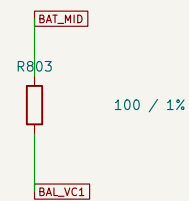
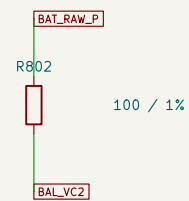
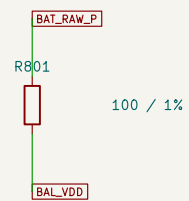
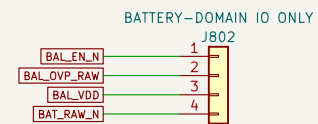
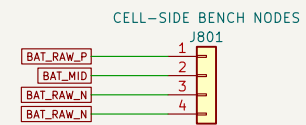


BAT_RAW_N is cell negative BEFORE a low-side protection switch. Never equate it with USB_GND/PACK_MINUS. BAL_EN_N defaults OFF. External enable/OVP interfaces need battery-domain isolation/level translation.

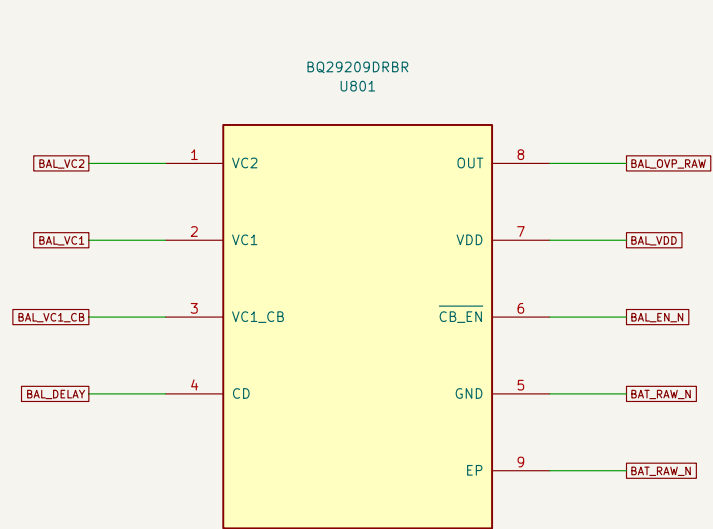

OUT is active HIGH (up to 9.5V in specified conditions), not open drain. No direct FAULT_BUS_N connection.
OVP is secondary 4.30V, not a 4.20V cell regulator. BQ25886+A is still incomplete.
No fuse/FET actuator, low-voltage enable policy, PCB, physical balancing or LW charge performed.