



REV	DESCRIPTION	DATE	BY
P1	Making sketch for the prototype build plan	2026-10-01	AC



TOP VIEW
Scale 2:1; looking down (along -Z)

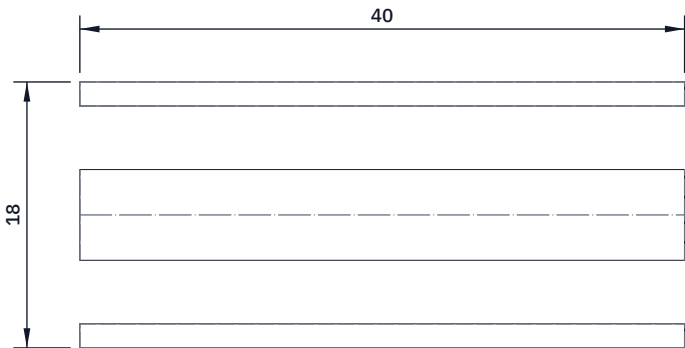

FRONT VIEW
Scale 2:1; looking at the front (along +Y)



RIGHT VIEW
Scale 2:1; looking at the right side (along -X)



WHERE IT GOES
This part in colour, its neighbours in grey

HOW TO MAKE IT AND HOW IT FITS

Indicator: cut 40 mm of clear polycarbonate tube, 6 mm outside, 4 mm bore. Seal one end with a 3 mm plug of the epoxy; cure.

Warm the grade's PCM just above its melting point and fill the tube with a syringe, leaving a 2 mm bubble; seal the other end with 3 mm of epoxy. Solid PCM is white, liquid PCM is clear.

Guards: two 40 mm lengths of the fin bar.

Fit: bond the indicator to the painted top with the epoxy, along the cartridge, 30 mm toward the back from the centre line, between 16 and 56 mm from the handle end of the tube.

Bond a guard on edge 8 mm each side of it; the guards are as tall as the fins and take knocks.

The label is notched round them.

Check: no PCM weeps at the plugs when warmed by hand.

THERMACART

github.com/BoujeeEnjinia1701/thermacart

ThermaCart melt indicator and guards: making sketch

DRAWING NO. TCT-DWG-109		REV P1	SHEET 1 of 1	SIZE ANSI B
SCALE 2:1	UNITS mm	PROJECTION 	DATE 2026-10-01	DRAWN Amish Chadha
MATERIAL / NOTES Clear polycarbonate tube 6 x 4 mm; fin bar 6.35 x 1.59 mm				
Licensed CERN-OHL-S-2.0 · Design Molecule Lab · designmolecule.com			Generated from cad/src; do not edit by hand	