Summit Asset Maintenance Pty Ltd
ABN 37 702 153 222
summitassetmaintenance.com.au

SUMMIT ASSET MAINTENANCE

What we offer, in a snapshot

Planned kitchen-exhaust maintenance, certified with the measurements on the page. This pack shows the four documents behind it: what Summit is, what a visit leaves you with, and the safe-work paperwork that comes before a job.

In this pack

1 **Capability statement** p. 2–3
What Summit does, the measured survey, what every visit delivers, and what is held: insurance, safe work and licences.

2 **Certificate of service (specimen)** p. 4–5
The record issued after every visit: outcome, readings at every access point, deficiency register, what was not reached.

3 **Photographic works report (specimen)** p. 6–8
The photographs behind the certificate: before-and-after pairs by access point, component condition, recommendations.

4 **Safe work method statement (specimen)** p. 9–17
The site-specific SWMS issued before a job: risk register, roof and isolation controls, confined-space entry under permit, emergency procedures.

How it works

01 **Request a site survey.** A 15 to 30 minute walk of the system with the instruments the certificate uses. Free for commercial kitchens in metro Adelaide, with no obligation.

02 **Written condition report.** Within two business days, and it is yours to keep whether or not you engage Summit.

03 **Planned program.** Canopy, filters, duct access points and fan serviced on an interval set from your kitchen's measured load. The next service is set before we leave site.

04 **Certificate and report after every visit.** Readings in microns, photographs, a numbered deficiency register, and every section not reached listed with the reason.

INSURED AND DOCUMENTED

Public liability insurance of $20 million is held. A certificate of currency is supplied at every program start and renewal, and before any attendance. A site-specific safe work method statement is issued for every job, and copies of every certificate and report are retained for 7 years.

Request a site survey

enquiries@summitam.au
0411 854 283
summitassetmaintenance.com.au

The certificate, report and SWMS here are specimens: a fictional venue and illustrative values. Issued documents carry the site's own measurements, photographs and named personnel. Aligned to AS 1851-2012; grease-depth readings are benchmarked to the AIRAH Commercial Kitchen Exhaust Management Best Practice Guide (2022) and attributed to the guide, never to the standard.

Summit Asset Maintenance Pty Ltd
ABN 37 702 153 222
summitassetmaintenance.com.au

CAPABILITY STATEMENT

Commercial kitchen-exhaust compliance · Adelaide, South Australia

Summit maintains commercial kitchen-exhaust systems on a planned interval program, and certifies every visit with the measurements on the page. The compliance record is the deliverable; the service behind it is how it gets made.

What we do

Planned exhaust program

Canopy, filters, duct access points and fan serviced on an interval set from your kitchen's measured load, not a table. The year's schedule is issued up front and the next service is set before we leave site.

Measured site survey

A 15–30 minute walk of the system with the same instruments the certificate uses. A written condition report follows within two business days, and the venue keeps it whether or not it engages Summit.

Multi-site programs

One schedule, one invoice and one consolidated register across every venue in a group, so a landlord's or insurer's request is answered from one place.

Alongside the program. Pressure cleaning of the surrounds and front of house, discharge containment units, filter exchange and replacement filters, and soak tanks, each scoped at the same survey. Drone façade work is in readiness and not yet offered.

What every visit delivers

THE SUMMIT CERTIFICATE OF SERVICE	SPECIMEN ON REQUEST
STANDARD	Aligned to AS 1851-2012 (Section 13). Grease-depth readings are benchmarked to AIRAH's *Commercial Kitchen Exhaust Management – Best Practice Guide* (2022), including its 50 µm post-clean limit, and attributed to the guide, never to the standard.
READINGS	Grease depth in microns at every access point, before and after the works.
PHOTOGRAPHS	Before-and-after pairs from identical positions, referenced to each access point.
REGISTER	A numbered deficiency register: location, severity, recommended action and owner.
DISCLOSURE	Every section not reached is listed with the reason. A certificate that cannot show its readings is not issued.
STATUS	Exactly two outcomes: Compliant, or Compliant with limitations, with the limitations listed on the certificate itself.

How we work

Our team works to a site-specific safe work method statement on every job. We measure before we touch anything, we say what we could not reach, and we never imply that an unviewed section is clean. Ownership of a building's compliance obligations stays with the owner; our certificate is the maintenance evidence that sits behind it.

Summit Asset Maintenance Pty Ltd
ABN 37 702 153 222
summitassetmaintenance.com.au

ASSURANCE, STATED PLAINLY

What Summit holds, and how each visit is documented.

ENTITY	Summit Asset Maintenance Pty Ltd · ABN 37 702 153 222 · Adelaide, South Australia
PUBLIC LIABILITY	Public liability insurance of $20 million is held. A certificate of currency is supplied at every program start and renewal, and before any attendance.
SAFE WORK	Safe work method statements for kitchen-exhaust service, pressure washing and depot filter cleaning; a site-specific SWMS issued for every job.
CONFINED SPACE	Confined-space entry is planned before the day, under permit and with a standby person.
LICENCES AND CLEARANCES	White Card, Working at Heights, EWP licence and confined-space entry. NSSIC clearance and a National Police Check for defence and secure sites.
STANDARD FLUENCY	AS 1851-2012 (Section 13) and AIRAH's Commercial Kitchen Exhaust Management – Best Practice Guide (2022), demonstrated in the specimen documents available on request.
RECORDS	Copies of every certificate and report retained for 7 years; the client owns its records.

Where the work sits

Hospitality groups

Many kitchens, one file: accreditation and insurer renewal read from a single consolidated record.

Clubs and venues

A dated, measured record a committee and an insurer can read without calling anyone.

Building owners and agents

The kitchen-exhaust line on an essential-safety-provisions verification, with evidence behind it.

Government and defence

Base messes, canteens, hospital, correctional and council kitchens, with visits planned to the site's access and escort requirements and a record ready for audit.

How to start

Request a site survey. It typically takes 15 to 30 minutes for a single kitchen, you receive a written condition report within two business days, and it is yours to keep. A program proposal is built from the findings only if you want one. The measured survey is free for commercial kitchens in metro Adelaide, single venues included, with no obligation, and available as a paid condition report elsewhere.

Request a site survey

enquiries@summitam.au
0411 854 283
summitassetmaintenance.com.au

SUMMIT
ASSET MAINTENANCE & COMPLIANCE

Summit Asset Maintenance Pty Ltd
ABN 37 702 153 222
summitassetmaintenance.com.au

SPECIMEN. Fictional venue and illustrative values. An issued document carries the site's own measurements, dates and names.

KITCHEN EXHAUST SYSTEM

Certificate of service

SAM-CERT-0000-SPEC · Revision 0 · Issued DD Mmm YYYY · Service DD Mmm YYYY

SERVICE OUTCOME

Compliant with limitations

Derived, not chosen: any item not completed, any recorded limitation and any defect of any class qualifies this outcome.

Completed 4 of 5 scheduled · Not completed 1 · Limitations 1 · Critical 1 Non-Critical 1 Non-Conformance 1

Compliance with the building's Essential Safety Provisions obligation is the owner's determination, made on their own annual verification. This document is evidence toward it.

Site and asset

VENUE

Specimen Bistro (fictional)
1 Example Street, Adelaide SA 5000

BUILDING OWNER / RESPONSIBLE PERSON

Example Property Holdings Pty Ltd (fictional)
Issued to: venue manager

Kitchen exhaust system including grease filters — MBS 002 §9.6(e) prescribes maintenance of this asset to AS 1851-2012, sections 1 and 13.

Work completed · 4 of 5 scheduled

- Canopy plenum and internal surfaces cleaned to bare metal
- Grease filters removed, soaked, rinsed and refitted
- Vertical riser cleaned via access panels
- Roof-mounted fan housing and impeller cleaned

Not completed · 1

- Horizontal duct run above the ceiling void — no access panel fitted

Access and scope limitations · 1

- Roof plant deck wet at attendance; fan scroll inspected but not dismantled. Re-attendance offered at no charge.

Grease deposition readings

POINT	LOCATION	Pre (µm)	Post (µm)	METHOD
AP-1	Canopy plenum, left bay	420	12	Depth gauge
AP-2	Riser, first access panel	310	16	Depth gauge
AP-3	Horizontal duct run, mid (ceiling void)	—	not measurable	No access panel
AP-4	Fan scroll	180	22	Depth gauge

Maximum 22 µm · mean 16.7 µm · measured 3 of 4 points · not measurable 1

Acceptance criterion 50 µm, per the AIRAH Best Practice Guide. Readings are attributed to AIRAH, not to AS 1851-2012.

Summit Asset Maintenance Pty Ltd
ABN 37 702 153 222
summitassetmaintenance.com.au

Deficiency register · 3

ID	CLASS	LOCATION	FINDING	RECTIFICATION / STATUS
D1	**Critical**	Ceiling void, kitchen to riser	No access panel — the section cannot be cleaned or inspected.	Fit two hinged access panels. Quote SAM-Q-0000-SPEC issued. Not rectified.
D2	Non-Critical	Filter bank, positions 4 and 9	Two grease filters distorted.	Replace at or before next service. Not rectified.
D3	Non-Conformance	Roof plant deck	Fan isolator not labelled.	Referred to owner — owner's electrical contractor.

Critical defects notified in writing to the venue manager on DD Mmm YYYY at HH:MM. MBS 002 Appendix C1 requires notification within 24 hours of identification; this certificate records that notice, it is not that notice.

Evidence produced for this service

DOCUMENT	REFERENCE	EXTENT
Certificate of service	SAM-CERT-0000-SPEC	this document
Photographic works report	SAM-WR-0000-SPEC	12 frames · 6 before/after pairs
Grease deposition readings	in this document	3 of 4 points measured
Critical defect notice	SAM-NOT-0000-SPEC	issued on the day of service
Rectification quotation	SAM-Q-0000-SPEC	issued on the day of service

Anything not listed above was not produced for this service.

Certified by

Specimen Technician — Team Leader

Routine performed by: Specimen Technician A and Specimen Technician B

Signature

Date signed DD Mmm YYYY

I certify that the routine described above was carried out and assessed to AS 1851-2012 on the date shown, to the extent stated, and that the findings recorded above are a true record of the system's condition as at that date.

This is Summit's own service record. It is not a statutory Essential Safety Provisions Form 2 or Form 3 under South Australia's Ministerial Building Standard MBS 002. Form 2 is the installer's, issued once on installation or alteration; Form 3 is the building owner's own annual lodgement. This document is the service-record and condition evidence the owner uses toward that obligation, which remains theirs.

Retained by Summit Asset Maintenance Pty Ltd and reproducible on request.

AS 1851-2012 · Readings in microns · Certified every visit

Summit Asset Maintenance Pty Ltd
ABN 37 702 153 222
summitassetmaintenance.com.au

SPECIMEN. Fictional venue and illustrative values. An issued document carries the site's own measurements, dates and names.

PHOTOGRAPHIC RECORD OF A KITCHEN EXHAUST SERVICE

Photographic works report

SAM-WR-0000-SPEC · Certificate SAM-CERT-0000-SPEC · Specimen Bistro

STANDARD	SERVICE PERFORMED	DATE COMPLETED	NEXT SERVICE DUE
AS 1851-2012	Full kitchen exhaust clean	DD Mmm YYYY	DD Mmm YYYY (set on site)

OVERALL STATUS AFTER SERVICE

Compliant with limitations

One section could not be cleaned or inspected and is listed on the certificate. Detail in Section 3.

Job details


SITE	Specimen Bistro (fictional), 1 Example Street, Adelaide SA 5000
ON-SITE CONTACT	Venue manager (named on an issued report)
DATE AND TIME OF WORKS	DD Mmm YYYY — night works
COOKING INTENSITY	Heavy-use kitchen — sets the service interval
SERVICE SCOPE	Canopy and hood, grease filters, accessible ductwork, exhaust fan and housing, access panels
TECHNICIANS	Specimen Technician A and Specimen Technician B

This report documents the service carried out at Specimen Bistro, completed to AS 1851-2012. It records the work performed, the condition of each component and the photographs behind the certificate. Every photograph is taken from the same position before and after, and is referenced to its access point.

1. Works completed

Canopy and hood interior, grease filters, the vertical riser through its access panels, and the roof fan housing and impeller were cleaned and degreased. Readings were taken at each access point before and after (certificate, readings table).

Pair 1 · Canopy plenum, left bay (AP-1)

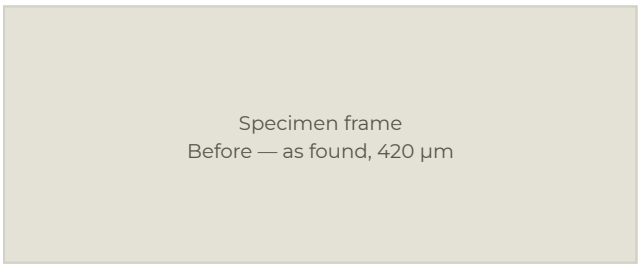



Pair 2 · Grease filters, bank positions 4 and 9 (D2)

Specimen frame Before — two filters distorted	Specimen frame After — cleaned; distorted filters flagged

Pair 3 · Riser, first access panel (AP-2)

Specimen frame Before — as found, 310 µm	Specimen frame After — after clean, 16 µm

Pair 4 · Ceiling void, kitchen to riser (AP-3, D1)

Specimen frame Before — no access panel, section not reachable	Specimen frame After — panel positions marked for the quote

Pair 5 · Fan scroll (AP-4)

Specimen frame Before — as found, 180 µm	Specimen frame After — after clean, 22 µm

Pair 6 · Roof fan housing and impeller

Specimen frame Before — as found	Specimen frame After — after clean

Specimen frames: an issued report carries the actual photographs, 12 frames in 6 before-and-after pairs here, each from identical positions.

2. System condition assessment

Each component was inspected during servicing and rated below, so the record shows the system was assessed in full and not only cleaned.

COMPONENT	CONDITION	NOTE / ACTION
Canopy and hood	GOOD	Cleaned to bare metal; no defects observed.
Grease filters	MONITOR	Cleaned; two filters distorted (D2). Replace at or before the next service.
Accessible ductwork	GOOD	Riser cleaned via access panels; reading at AP-2 within criteria.
Duct run above ceiling void	ATTENTION	No access panel: the section cannot be cleaned or inspected (D1, Critical).
Exhaust fan and housing	MONITOR	Housing and impeller cleaned; scroll inspected, not dismantled (roof deck wet). Re-attendance offered at no charge.
Access panels	GOOD	Removed and refitted with tools; seals checked.
Roof and discharge point	MONITOR	Discharge clear; fan isolator not labelled (D3), referred to the owner's electrical contractor.

GOOD = no action. MONITOR = serviceable, recheck next visit. ATTENTION = needs rectification.

3. Observations and recommendations

D1 · CRITICAL · CEILING VOID, KITCHEN TO RISER

The horizontal run above the ceiling void has no access panel, so it cannot be cleaned or inspected and is listed as not completed. Left uncleaned, grease accumulates out of sight in the part of the system closest to the cooking line. Recommendation: fit two hinged access panels; quote SAM-Q-0000-SPEC issued.

D2 · NON-CRITICAL · FILTER BANK, POSITIONS 4 AND 9

Two filters are distorted and no longer seat flat, which lets grease bypass the filter bank. Recommendation: replace at or before the next service.

D3 · NON-CONFORMANCE · ROOF PLANT DECK

The fan isolator is not labelled, so the circuit cannot be identified at a glance during isolation. This is outside Summit's scope: referred to the owner's electrical contractor.

4. Summary and next service

The kitchen exhaust system at Specimen Bistro has been serviced to AS 1851-2012 and is recorded as compliant with limitations: one section could not be cleaned or inspected (D1) and is listed on the certificate. The next service is set before we leave site: DD Mmm YYYY.

If you would like Summit to action the recommended corrective works, or need additional photographs or detail for your insurer, tell us and we will provide them.

Specimen Technician
Summit Asset Maintenance

Safe Work Method Statement — Kitchen Exhaust System (KES) Cleaning

Including roof access and work at heights for exhaust fan servicing, electrical isolation (LOTO), and alkaline chemical application above cooking equipment, and confined-space entry into ductwork under permit where the site plan provides for it

Document number	SWMS-KES-SPEC — Rev 1.0 (specimen)
Client	Specimen Bistro Pty Ltd (fictional)
Site	1 Example Street, Adelaide SA 5000 (fictional)
Scope of works	Cleaning of the kitchen exhaust system to AS 1851-2012: canopy, grease filters and gutters, exhaust plenum, accessible ductwork, kitchen exhaust fan (KEF), cowling and discharge point, including roof access.
Client contact	Site manager (fictional)
Method reference	Summit SOP-KES-001 v1.1 — this SWMS cross-references its phases and hold points (H1–H5)
Prepared by	Summit Asset Maintenance
Date prepared / next review	30 Oct 2026 / 30 Apr 2027

1. Legislative and standards framework

- **Work Health and Safety Act 2012 (SA) — ss 16, 19, 28, 46–49**
- **Work Health and Safety Regulations 2012 (SA) — confined spaces (Part 4.3), falls (Part 4.4), electrical safety, hazardous chemicals (Ch 7)**
- **SafeWork SA Code of Practice: Managing the risk of falls at workplaces**
- **SafeWork SA Code of Practice: Confined spaces — where entry is planned**
- **SafeWork SA Code of Practice: Work near overhead power lines — where roof work approaches services**
- **AS 1851-2012** — Routine service of fire protection systems and equipment (kitchen exhaust systems)
- **AS/NZS 1891 series** — fall-arrest systems, where harness systems are used
- **AS/NZS 1892** — portable ladders, selection and use
- **AIRAH Best Practice Guideline: Commercial Kitchen Exhaust Management** — grease thickness benchmarks

2. WHS commitment and duty of care

Summit Asset Maintenance Pty Ltd accepts its primary duty of care under s 19 of the WHS Act 2012 (SA) and its s 46 duty to consult, cooperate and coordinate with Specimen Bistro and other duty holders at the site. Summit maintains direct accountability for risks arising from its work, applies the hierarchy of controls per RISK-001, participates in the client's induction and permit systems, and pauses work immediately where conditions change or controls become ineffective.

3. Personnel and competency

3.1 All personnel

- Client site induction where required; Summit WHS induction and toolbox sign-on
- Familiarity with this SWMS and SOP-KES-001 — evidenced by sign-on (Appendix B)
- Training and sign-off per SOP-KES-001: minimum five supervised cleans per phase before unsupervised work

3.2 Roof work (Technician B role)

- Working-at-heights training (AS/NZS 1891.1 where harness systems are used): selection, inspection, fitting, anchorage
- Ladder competency per AS/NZS 1892; EWP licence (WP class) where the site access plan requires a boom ≥11 m — see SWMS-PW-001 Section 8 for full MEWP controls if a MEWP is mobilised
- LOTO trained: personal lock and tag discipline, zero-energy verification

3.3 Team Leader

Team Leader named on the job record — responsible for implementation and enforcement of this SWMS on site; holds all 3.1–3.2 competencies plus first aid (HLTAID011 or equivalent).

4. Consultation, cooperation and coordination

- SWMS developed in consultation with the technicians performing the work; provided to the client before commencement
- Pre-start briefing each visit: scope, isolations (cook line and KEF), roof access plan, weather, exclusion areas below roof work
- Service windows coordinated with the venue (chef/manager) — no work above active cooking (SOP H1)
- Any worker may stop the job; resumption only when the Team Leader (and client representative where relevant) confirms controls

5. Risk assessment framework

Risk assessed per Summit RISK-001; matrix reproduced so this SWMS stands alone.

Consequence ↓ / Likelihood →	Likely	Moderate	Unlikely
High	**Class 1 — High**	**Class 1 — High**	Class 2 — Medium
Medium	**Class 1 — High**	Class 2 — Medium	Class 3 — Low
Low	Class 2 — Medium	Class 3 — Low	Class 3 — Low

Class	Required action
1 — High	Detailed pre-planning; director approval before work commences; isolations and access arrangements verified; continuous supervision. In Summit SOPs these appear as mandatory hold points.
2 — Medium	Documented controls in place (SOP holds and run-sheet controls); ongoing monitoring; control failure stops the affected scope.
3 — Low	Standard controls and PPE; monitor for change.

6. Elevated-risk activities in this scope

- Work where there is a risk of a person falling more than 2 metres — roof access for KEF servicing
- Electrical work adjacent: isolation of the KEF circuit (LOTO)
- Use of hazardous chemicals — alkaline degreasers applied overhead
- Confined-space entry into ductwork — only where the site plan provides for it; the default is no entry
- Work above commercial cooking equipment — burn and fall hazard controlled by isolation, cooling and rated platforms
- Manual tasks — filters, tools and waste moved to/from roof and through service areas

7. Risk register — job step analysis

Steps mirror the SOP-KES-001 v1.1 run sheet; each row cites the SOP phase and hold point that delivers the control. Classes per Section 5.

Job step / SOP ref	Hazards	Pre	Controls	Post
7.1 Arrival, isolation confirmation SOP Phase 1 / Hold H1 Team Leader	Live/hot cook line; unfamiliar site; access constraints	**1**	– Cook line isolated (gas/electric OFF) and cooled before any overhead work — Hold H1; mid-shift work only within a coordinated safe window – Joint walk-through; KEF, isolator and roof route located; access concerns logged – Pre-clean photos and grease depth readings recorded (QA1)	**2**
7.2 Kitchen set-up and platform SOP Phase 2 / Hold H5 Technician A	Falls from improvised access; equipment damage; slips	**1**	– Rated hop-up/plank platform positioned and stable before canopy access — Hold H5; standing on cooking equipment prohibited – Appliances and surfaces sheeted; heat-resistant mat over the line – Housekeeping maintained; walkways kept clear	**2**
7.3 Chemical application (fan-assisted) SOP Phase 3 / Hold H4 Technician A	Alkaline chemical to eyes/skin (overhead spraying); aerosol inhalation; drips onto persons	**1**	– PPE before application: splash goggles/face shield, PVC gauntlets, apron/coveralls — Hold H4 – KEF deliberately running during application to draw aerosol and mitigate drips; foaming applicator reduces airborne mist – Wipe-down pass before technicians climb; rinse pass before residue dries; SDS on site; eye-wash in kit	**2**
7.4 Roof access and staging SOP Phases 2–3 / Hold H3 Technician B	Fall >2 m; ladder failure; dropped objects; weather	**1**	– Access per site plan: ladder tied off or footed per AS/NZS 1892; anchor/harness where no parapet; EWP escalation where ladders cannot reach safely (SWMS-PW-001 §8 applies if MEWP mobilised) — Hold H3 – Two-person rule — no solo roof work; B maintains contact with A – Exclusion below the work/drop zone; tools staged and contained (magnetic tray); weather assessed — no roof work in high wind, rain or lightning	**2**
7.5 KEF electrical isolation (LOTO) SOP Phase 3 / Hold H2 Technician B	Electrocution; unexpected start-up; entanglement with rotating blades	**1**	– Personal lockout lock and danger tag fitted to the KEF isolator BEFORE any physical fan work — Hold H2; lock removed only by the technician who fitted it – Zero-energy verified by test start before touching blades or housing – Sequencing: LOTO fitted only after Technician A confirms spraying complete (logged job note) — the fan runs during application by design	**2**
7.6 Canopy, filter and gutter strip/clean SOP Phase 4 Technician A	Sharp baffle edges; hot residue; manual handling; slips on grease	**2**	– Cut-resistant handling gloves; filters removed one at a time; damaged baffles flagged, never refitted – Gutters vacuumed (wet/dry) and decanted to sealed pails — no scooping to venue bins – Drip control and immediate spill wipe-up; platform repositioned rather than over-reaching	**3**

Job step / SOP ref	Hazards	Pre	Controls	Post
7.7 Plenum and duct cleaning SOP Phase 4 Both	Restricted access; sharps at access plates; chemical contact in confined sections	**2**	– Access via panels only — no body entry into ductwork; inaccessible runs recorded as limitations with remediation recommendation – Gauntlets and eye protection maintained; access plates removed/refitted with tools, edges deburred where practicable – Photographic record at each access point (QA2)	**3**
7.8 KEF strip, clean and reassembly SOP Phases 4–5 / Holds H2, H3 Technician B	Falls; sharps (blades); fastener loss leading to return roof visits; reassembly error	**1**	– H2 and H3 remain in force throughout; cowling fasteners contained in magnetic tray; corroded fasteners replaced from spares – Reassembly checked against removal sequence; lock removed by fitter only after reassembly complete – Function test recorded on video (QA3) confirming safe operation	**2**
7.9 Finish, sticker and reinstatement SOP Phase 5 Technician A	Slips during rinse; chemical residue on food surfaces	**2**	– Hot-water-only rinse pass; food-grade paraffin oil finish; dated service sticker fitted beside QR tag – Sheeting removed; surfaces wiped; cook line reinstated only when dry and clear	**3**
7.10 Waste handling and removal SOP Phase 6 Both	Environmental discharge; manual handling; contamination of venue areas	**1**	– All grease waste leaves site in sealed pails/bags — none to venue bins, sewer or stormwater – Disposal via Summit's licensed trade-waste stream; disposal note recorded on the job – Two-person carries for heavy loads; routes through back-of-house agreed with venue	**2**
7.11 Close-out and demobilisation SOP Phase 6 Team Leader	Trips from gear; incomplete isolation reinstatement; documentation gaps	**3**	– Site walk with venue contact; sign-off obtained – Service report completed on site (QA4): six-component condition table, grease depths, limitations, waste note – Cross-director photo review queued per SOP QC	**3**

8. Roof access and work at heights — detailed controls

The site roof access method is by ladder (specimen site). Controls by method:

- Ladder: industrial-rated per AS/NZS 1892, 4:1 angle, extended ≥1 m above the step-off, tied off or footed; three points of contact; tools raised by line or pack — never carried in hand on the ladder
- No parapet or edge protection at the work area: anchor and harness system per AS/NZS 1891 used within 2 m of an unprotected edge; anchor selection by trained person; equipment inspected and in date
- EWP required: full SWMS-PW-001 Section 8 control set applies (licensing, spotter, rescue plan, pre-start checklist)
- Weather: no roof work in rain, lightning, or wind that affects stability or handling of cowling panels; reassess at pre-start and on change
- Exclusion zone below the work area and any drop line; signage where the public or staff could enter

9. Electrical isolation (LOTO) — detailed controls

- Each technician fits their own personal lock and danger tag to the KEF isolator — one lock per person working on the fan; multi-hasp where required
- Zero-energy verification by attempted start before any contact with blades, housing or wiring
- Locks removed only by the technician who fitted them, only after reassembly is complete and all persons are clear
- Unidentifiable or shared isolators, or isolators that cannot be locked: work does not proceed — recorded as a limitation and raised with the client (electrician engagement recommended)

10. Confined-space entry into ductwork — detailed controls

This section applies only where the site plan provides for entry into a duct, riser, plenum or fan housing. The default is no entry: extendable tools through access panels. Entry is high risk, and the Director approves the entry plan before the day.

10.1 Deciding whether entry is needed

- Working test: entry is when a person's head or upper body passes the opening of the space. Reaching in with arms or extendable tools is not entry
- The survey records why extendable tools, rotary or camera-assisted methods or additional access panels will not achieve the required clean, and how a person would be retrieved
- Entry is planned only where non-entry retrieval from the access point is practicable. Where a bend, offset or damper prevents it, the section is recorded as a limitation and not entered

10.2 Roles and competency

- Entrant: confined-space entry competency held by each person who enters, trained in this procedure and the non-entry rescue plan, and confirmed fit to enter at sign-on
- Standby person: competent in the standby role, trained on the retrieval equipment, first aid and CPR current. Stays outside at the access point in continuous contact, performs no other task while anyone is inside, and never enters to rescue
- Team Leader: holds the permit, checks every line before entry and stops the job if any line cannot be completed

10.3 Entry permit and isolation

- A permit is signed before every entry, kept on site and cancelled when everyone is out and isolation is restored. No verbal permits, and none carried over a break or a shift
- The permit records the space, the entrant and standby, isolation, ventilation, the rescue rig, communications and time limits
- KEF and dampers locked out, tagged and tested dead (Section 9). Cook line isolated and cooled before any entry. No hot work on or near the duct. Fire dampers and suppression linkage are not interfered with

10.4 Ventilation, chemicals and ignition sources

- With the KEF isolated there is no airflow, so portable ventilation is provided as the entry plan requires. Entry stops on heat or discomfort, and maximum continuous entry time is set in the entry plan
- Grease is combustible: no ignition sources, and tools and lighting suitable for the space. No degreaser is used inside the space unless its SDS allows it with the ventilation provided

10.5 Communication and non-entry rescue

- Continuous voice contact through the access opening, with retrieval-line signals agreed at the pre-entry briefing. If contact is lost for 30 seconds the entry stops and the standby starts retrieval
- Tripod or davit with winch and retrieval line, and the entrant's full-body harness, are rigged and tested before anyone enters. The standby retrieves from outside and calls 000, never entering. Retrieval begins within 60 seconds of an emergency

10.6 Entry limits, stop work and handback

- One entrant at a time, limited to the retrieval line length and the entry plan. Stop and exit immediately on loss of contact, an instruction from the standby, heat or discomfort, fire, any change from the plan, or a near miss
- A stopped entry is not resumed until the Team Leader re-checks and re-signs the permit. At handback everyone is out and counted, tools counted, access plates refitted and the permit cancelled with time and name

11. Emergency procedures

Call 000 for emergencies; notify the site contact. Muster point: as set out at the site induction.

Emergency	Potential impacts	Immediate actions	Responsible
Fall from height / fall through roof	Serious or fatal injury	Call 000. Do not move the casualty except to prevent further immediate danger. Control bleeding; monitor airway; keep warm. Preserve scene.	Other technician
Chemical contact — eyes or skin (alkaline)	Serious eye damage; chemical burns	Flush with running water for 15 minutes minimum (eye-wash in kit); remove contaminated clothing; seek medical advice — Poisons Information 13 11 26; take SDS to treatment.	Both
Electric shock	Cardiac arrest, burns	Do not touch casualty until supply isolated. Isolate at switchboard, call 000, commence DRSABCD. No resumption until cause identified.	Both
Burns (hot surfaces/water)	Tissue damage	Cool running water 20 minutes; remove jewellery/clothing not stuck; cover loosely; 000 for serious burns.	Both
Gas smell at the cook line	Fire/explosion	Stop work; no ignition sources; ventilate; evacuate kitchen; notify venue to isolate gas and engage their emergency process.	Team Leader
Dropped object from roof	Strike injury below	Render first aid; 000 if injured; review exclusion zone before any resumption; incident logged.	Team Leader

12. Equipment register

Equipment	Purpose	Inspection / certification
Battery sprayer with foaming attachment	Chemical application	Pre-start visual; charge check

Equipment	Purpose	Inspection / certification
Rated hop-up / plank platform + heat mat	Work above cook line	Pre-start visual; rating label legible
Ladder(s) per AS/NZS 1892 (+ tie-off)	Roof access	Pre-start inspection; tagged industrial rating
Harness + lanyard (AS/NZS 1891.1) where required	Edge protection on roof	User inspection each use; 6-monthly competent-person inspection; tagged
LOTO kit — personal locks, hasps, danger tags	KEF isolation	Pre-start completeness check
Impact driver, sockets, magnetic tray	KEF strip/reassembly	Pre-start visual; batteries charged
Wet/dry vacuum + sealed grease pails	Gutter and waste handling	Pre-start visual; pails sealed and labelled
Wet-film comb / grease depth gauge	AS 1851 condition evidence	Visual; cleaned between uses
First aid kit incl. eye-wash	First aid response	Monthly stock check
PPE — goggles/face shield, PVC gauntlets, aprons/coveralls, knee pads	Personal protection	Issued and inspected each shift

13. Chemical register

Edit to the products actually carried; attach SDS at issue. SDS current within 5 years; accessible on site.

Product	Type	Primary risks	Controls
Alkaline degreaser	Foaming KES degreaser	Corrosive/irritant — eye and skin damage; never mix with acids	Hold H4 PPE set; fan-assisted application; rinse pass; eye-wash in kit
Food-grade paraffin oil	Finish/shine	Slip hazard on overspray; low toxicity	Applied by dedicated head; floors protected; surfaces wiped
Sanitiser / wipes	Frame and contact-surface clean	Mild irritant	Gloves; ventilation

14. Environmental management

- All grease and chemical waste leaves site sealed — nothing to venue bins, sewer or stormwater
- Disposal via Summit's licensed trade-waste stream; records retained and noted on the service report
- Spills contained and absorbed immediately — never hosed toward a drain

15. Review triggers

Re-issued immediately on: change in scope, site or method; new plant or chemicals; change of personnel; any incident, near miss or hazard report; client or regulator request; otherwise six-monthly. Reviews documented below and re-communicated through sign-on.

Appendix A — Pre-start checklist (per visit)

Check item	Result
Date / site / technicians	
Cook line isolated and cooling confirmed (H1)	Pass / Fail
Safe service window agreed with venue (if mid-shift)	Pass / Fail
Platform positioned and stable (H5)	Pass / Fail
PPE fitted — both technicians (H4)	Pass / Fail
Roof access method confirmed per site plan (H3)	Pass / Fail
Ladder inspected, tied off / footed; harness inspected if required	Pass / Fail
Weather acceptable for roof work	Pass / Fail
Exclusion area below roof work established	Pass / Fail
KEF isolator located and lockable	Pass / Fail
Radios / phones checked between A and B	Pass / Fail
SDS on site for all chemicals carried	Pass / Fail
Before photos + grease depth readings taken (QA1)	Pass / Fail
“Spray complete — isolate” confirmation logged before LOTO (Phase 3→4)	Pass / Fail
LOTO fitted and zero-energy verified before fan work (H2)	Pass / Fail
Team Leader signature	

Appendix B — Worker review and sign-off

All Summit personnel performing work under this SWMS must read and understand it and SOP-KES-001, attend the pre-start briefing, and sign below.

Name	Role	Date	Signature

Revision history

Version	Date	Author	Change
1.0 (T)	June 2026	Summit (C.R.)	Specimen issued; cross-referenced to SOP-KES-001 v1.1 holds H1–H5 and QA points
1.0	30 Oct 2026	Director	Specimen issue