
HYDRAULIC LASH ADJUSTER (HLA) INSPECTION

id011000805000

1. Visually inspect the HLA surface where it contacts the rocker arm for wear or damage.
   - If there is any malfunction, replace the HLA.

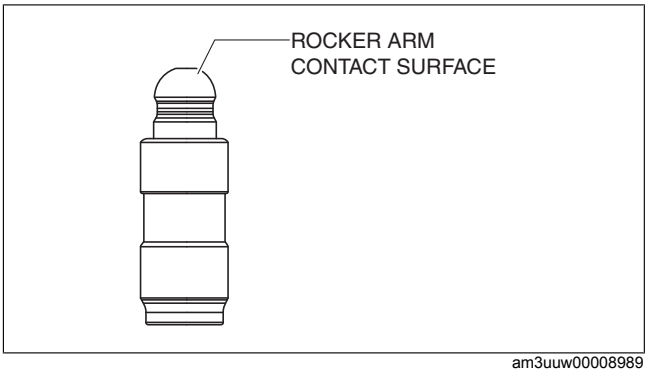

am3uuw00008989

cardiagn.com