
DESCRIPTION	Fuel trim system too rich

POSSIBLE
CAUSE

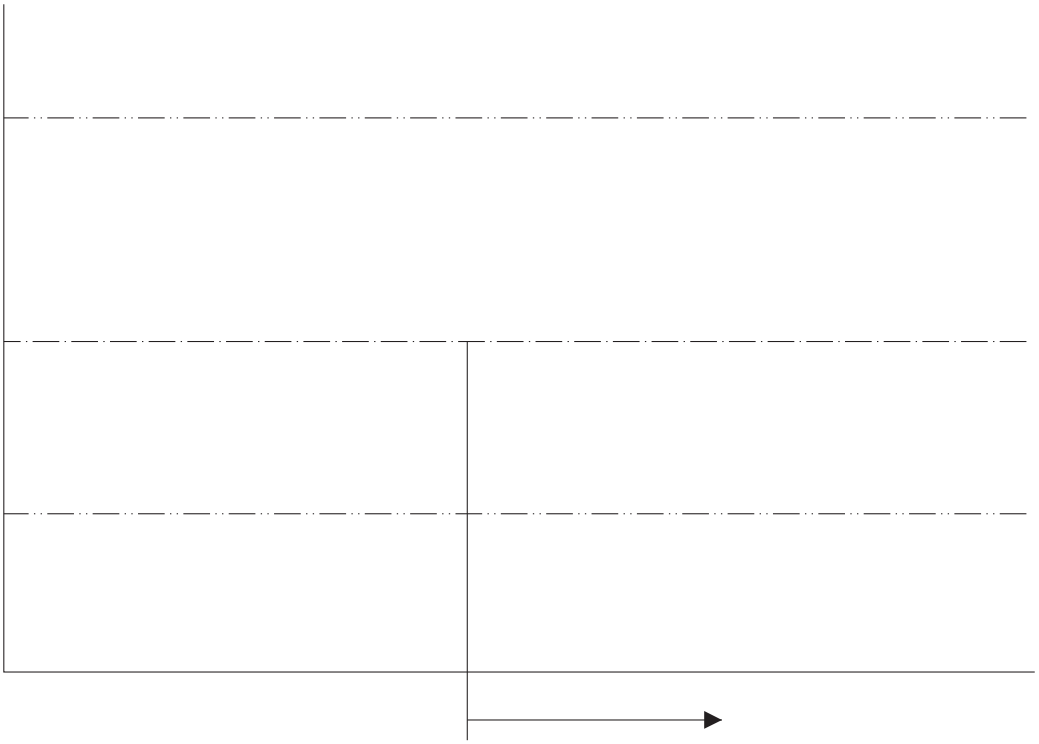

STEP

STEP

STEP

STEP

STEP