
DRIVE BELT INSPECTION [SKYACTIV-G 1.3, SKYACTIV-G 1.5]

id0110q3801500


Generator Drive Belt

Note
- The generator drive belt deflection/tension inspection is not necessary with the adoption of the drive belt auto tensioner.
- The generator drive belt does not have to be replaced because fraying of the generator drive belt does not affect the performance.

1. Visually inspect or feel that there is no wear, damage, or cracking on the inside and sides of the entire belt.

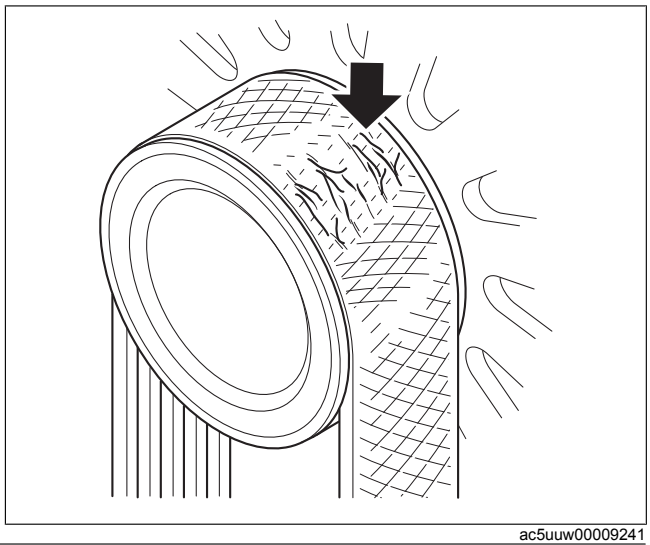


ac5uuw00009241

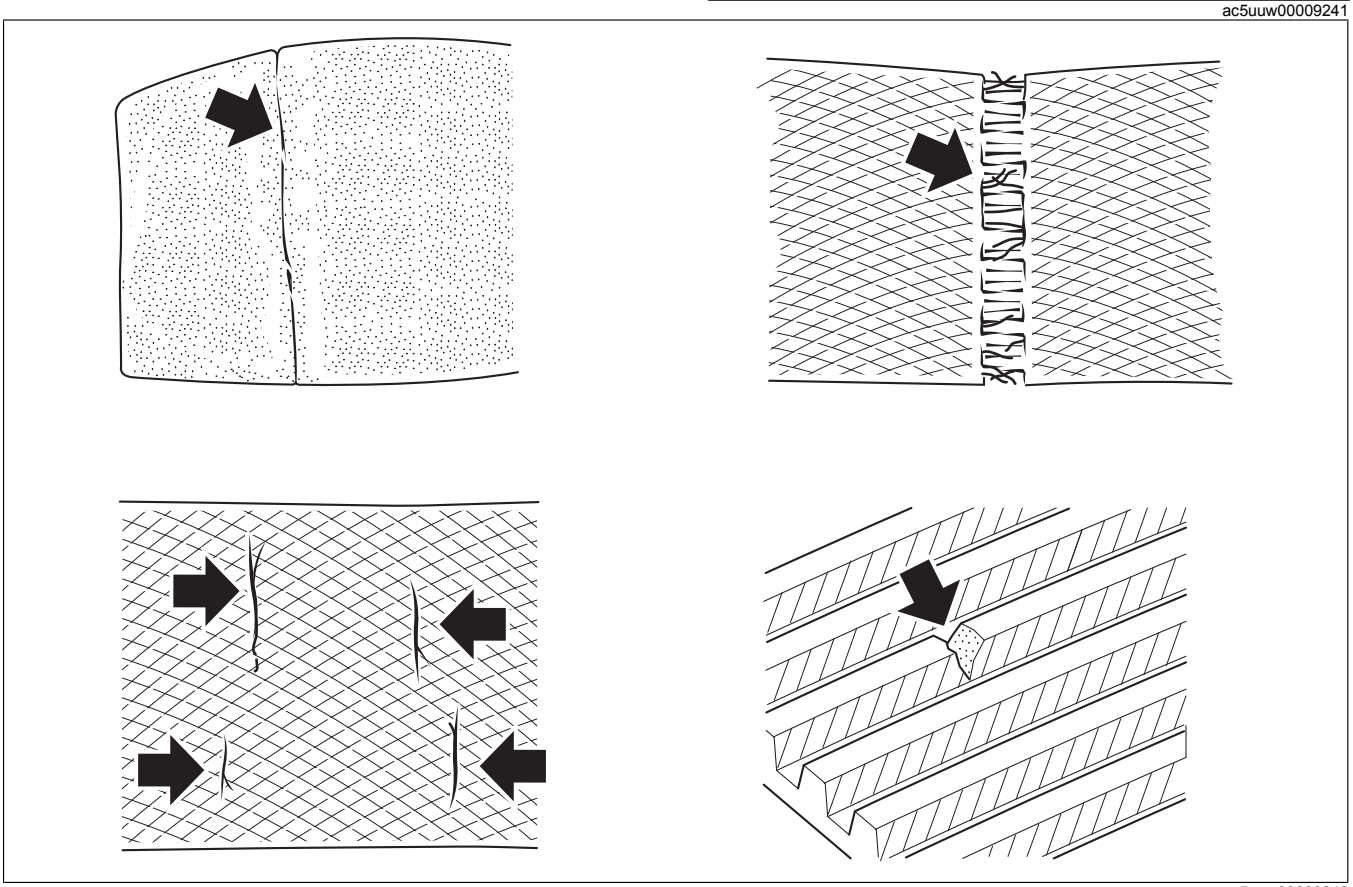

ac5uuw00009242

- Even if there is a little wear, damage, or cracking, replace the generator drive belt. (See DRIVE BELT REMOVAL/INSTALLATION [SKYACTIV-G 1.3, SKYACTIV-G 1.5].)

2. Verify that the indicator part of the cast hexagon on the drive belt auto tensioner is within the normal range.
   - If it exceeds the limit, replace the generator drive belt. (See DRIVE BELT REMOVAL/INSTALLATION [SKYACTIV-G 1.3, SKYACTIV-G 1.5].)

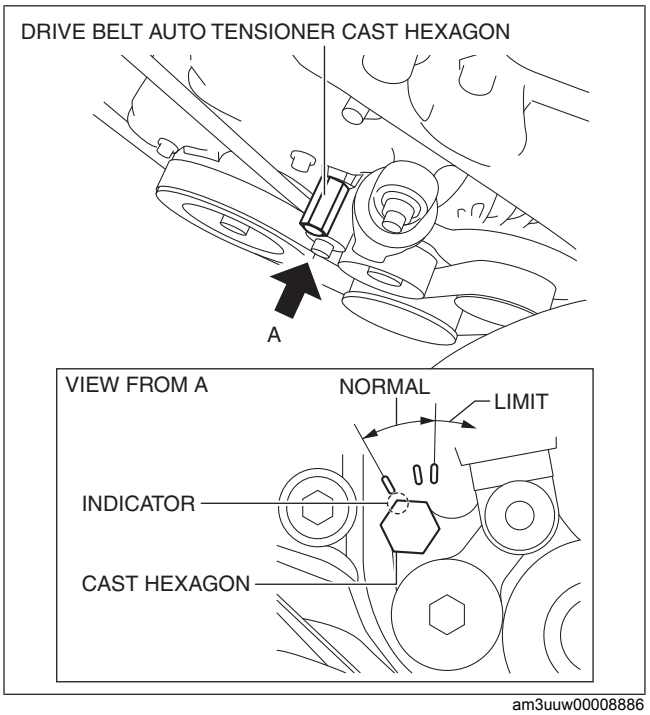

am3uuw00008886

Water Pump Drive Belt

Note
- The water pump drive belt deflection/tension inspection is not necessary with the adoption of the stretch-type water pump drive belt.

1. Visually inspect or feel that there is no wear, damage, or cracking on the inside and sides of the entire belt.
   - Even if there is a little wear, damage, or cracking, replace the water pump drive belt. (See DRIVE BELT REMOVAL/INSTALLATION [SKYACTIV-G 1.3, SKYACTIV-G 1.5].)
2. Start the engine to verify that abnormal noise does not occur.
   - If abnormal noise occurs, replace the water pump drive belt. (See DRIVE BELT REMOVAL/INSTALLATION [SKYACTIV-G 1.3, SKYACTIV-G 1.5].)