
IGNITION SYSTEM LOCATION INDEX [SKYACTIV-G 1.3, SKYACTIV-G 1.5]

id0118i4800100

Note

- The ignition coil for the SKYACTIV-G 1.3 and SKYACTIV-G 1.5 (with 4-1 exhaust system) engines does not have a built-in ion sensor.

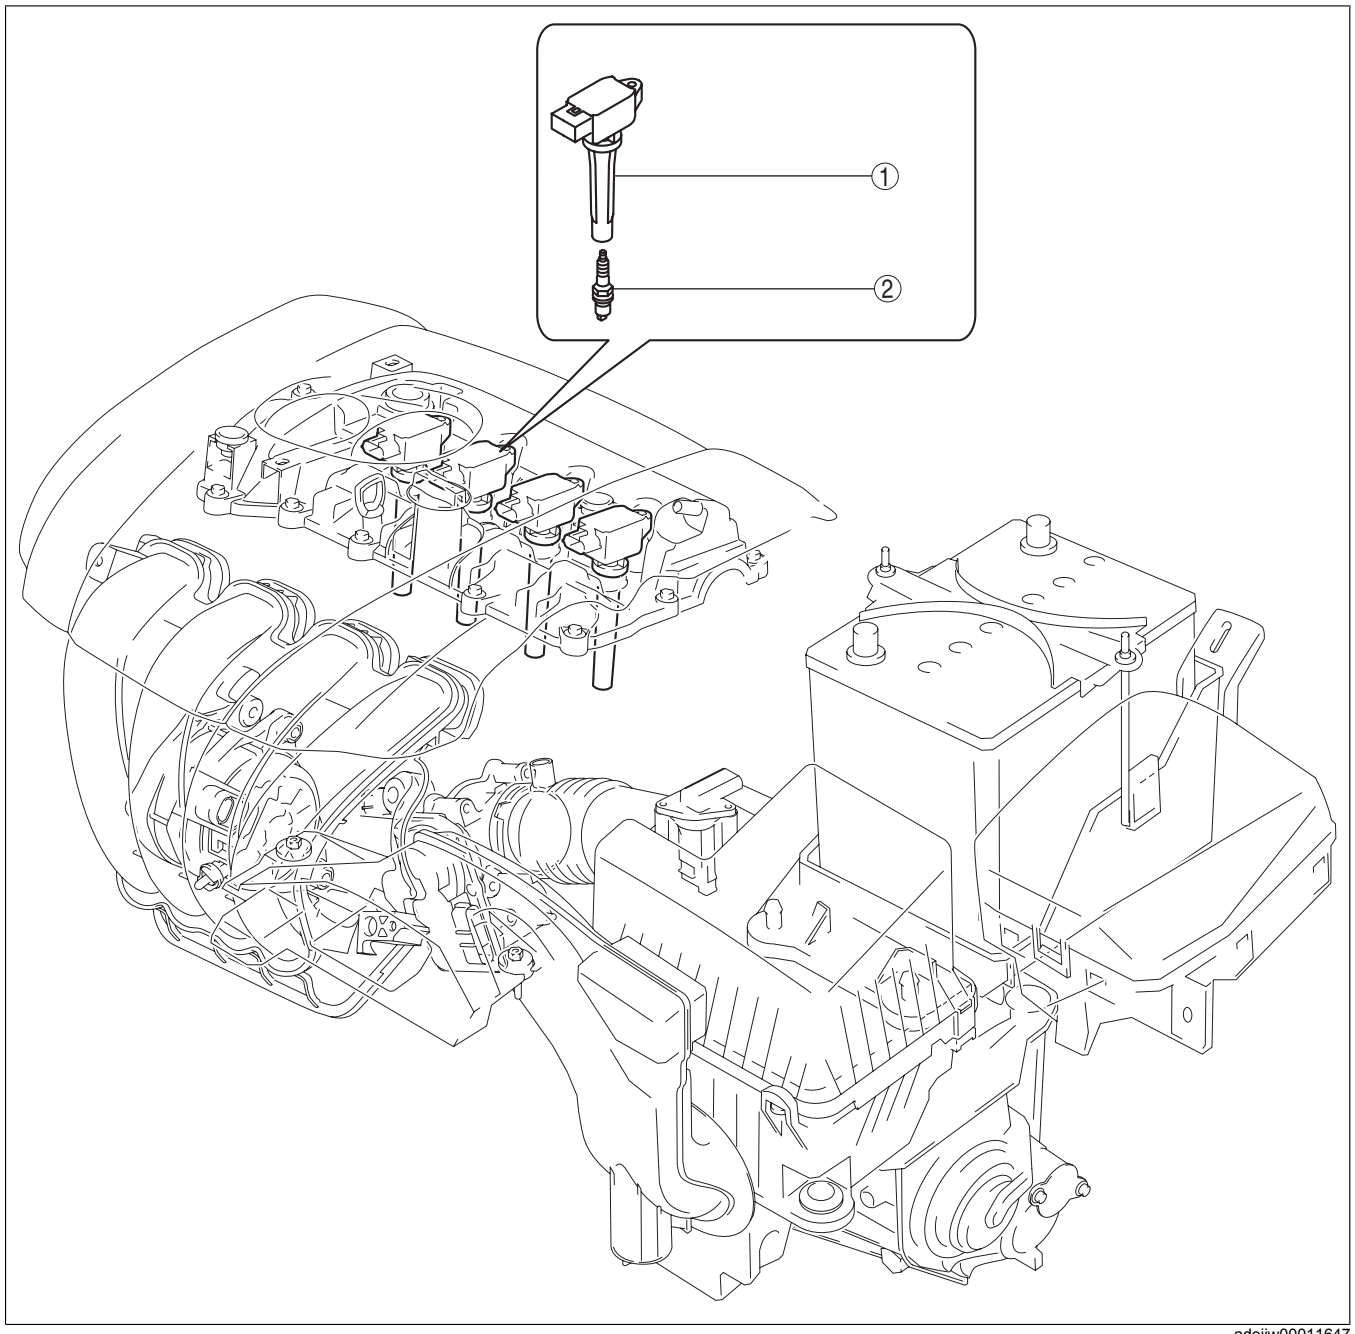

adejjw00011647

1	Ignition coil/ion sensor (See IGNITION COIL/ION SENSOR REMOVAL/INSTALLATION [SKYACTIV-G 1.3, SKYACTIV-G 1.5].) (See IGNITION COIL INSPECTION [SKYACTIV-G 1.3, SKYACTIV-G 1.5].)

2	Spark plug (See SPARK PLUG REMOVAL/INSTALLATION [SKYACTIV-G 1.3, SKYACTIV-G 1.5].) (See SPARK PLUG INSPECTION [SKYACTIV-G 1.3, SKYACTIV-G 1.5].)