
MANIFOLD ABSOLUTE PRESSURE (MAP) SENSOR INSPECTION [SKYACTIV-G 1.3, SKYACTIV-G 1.5]

id0140q1800900

Voltage Inspection

1. Connect the **M-MDS** to the DLC-2.
2. Switch the ignition ON (engine off).
3. Verify that the MAP sensor output voltage (PID: MAP) is within the specification. (See ON-BOARD DIAGNOSTIC TEST [SKYACTIV-G 1.3, SKYACTIV-G 1.5].) (See PCM INSPECTION [SKYACTIV-G 1.3, SKYACTIV-G 1.5].)
   - If not as specified, replace the MAP sensor/IAT sensor No.2. (See MANIFOLD ABSOLUTE PRESSURE (MAP) SENSOR/INTAKE AIR TEMPERATURE (IAT) SENSOR NO.2 REMOVAL/INSTALLATION [SKYACTIV-G 1.3, SKYACTIV-G 1.5].)

Specification (Reference)

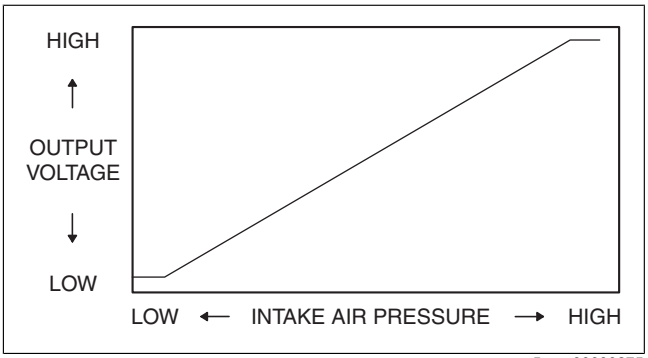

ac5wzw00000275