
POWER BRAKE UNIT VACUUM SENSOR INSPECTION [SKYACTIV-D 1.5]

id0140q2889400

PID/DATA Monitor Inspection

1. Connect the M-MDS to the DLC-2.
2. Switch the ignition ON (engine off).
3. Verify that the PID BBP value (power brake unit vacuum) is within the specification. (See ON-BOARD DIAGNOSTIC TEST [SKYACTIV-D 1.5].)
    - If not as specified, replace the power brake unit vacuum sensor. (See POWER BRAKE UNIT VACUUM SENSOR INSPECTION [SKYACTIV-D 1.5].)

Specification (Reference)

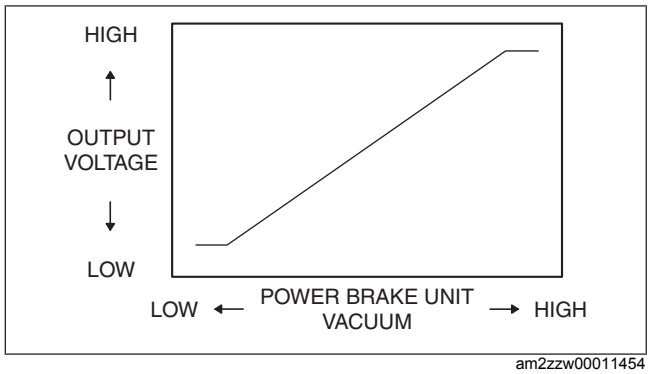

am2zzw00011454