ANTENNA FEEDER NO.3 INSPECTION

id092000813000


1. Disconnect the negative battery cable. (See NEGATIVE BATTERY CABLE DISCONNECTION/CONNECTION.)
2. Remove the following parts:
   (1) Front scuff plate (See FRONT SCUFF PLATE REMOVAL/INSTALLATION.)
   (2) Rear scuff plate (See REAR SCUFF PLATE REMOVAL/INSTALLATION.)
   (3) B-pillar lower trim (See B-PILLAR LOWER TRIM REMOVAL/INSTALLATION.)
   (4) Adjuster anchor cover (See FRONT SEAT BELT REMOVAL/INSTALLATION.)
   (5) Upper anchor installation bolt on the seat belt (See FRONT SEAT BELT REMOVAL/INSTALLATION.)
   (6) B-pillar upper trim (See B-PILLAR LOWER TRIM REMOVAL/INSTALLATION.)
   (7) Rear package tray (See REAR PACKAGE TRAY REMOVAL/INSTALLATION.)
   (8) Coat hook (See HEADLINER REMOVAL/INSTALLATION.)
   (9) Trunk covering (See TRUNK COVERING REMOVAL/INSTALLATION.)
   (10) Trunk board (See TRUNK BOARD REMOVAL/INSTALLATION.)
   (11) Trunk end trim (See TRUNK END TRIM REMOVAL/INSTALLATION.)
   (12) Liftgate upper trim (with with DAB antenna amplifier) (See LIFTGATE UPPER TRIM REMOVAL/INSTALLATION.)
3. Peel back the trunk side trim and remove the C-pillar trim. (See C-PILLAR TRIM REMOVAL/INSTALLATION.)

Note
- To facilitate the procedure, leave the C-pillar trim in the cabin without pulling the rear seat belt.

4. Remove the fasteners.
5. Peel back the seaming welt of the rear door and the liftgate.


Caution
- **If the headliner is peeled back excessively, the headliner could become creased. Be careful not to peel back the headliner excessively.**

6. Partially peel back the headliner.

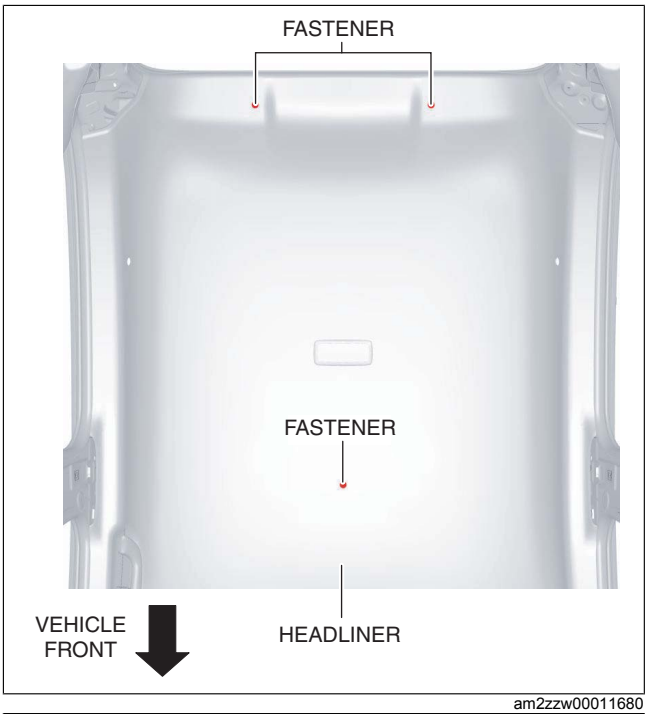


am2zzw00011680

7. Disconnect the antenna feeder No.2 connector.
8. Disconnect the center roof antenna connector.

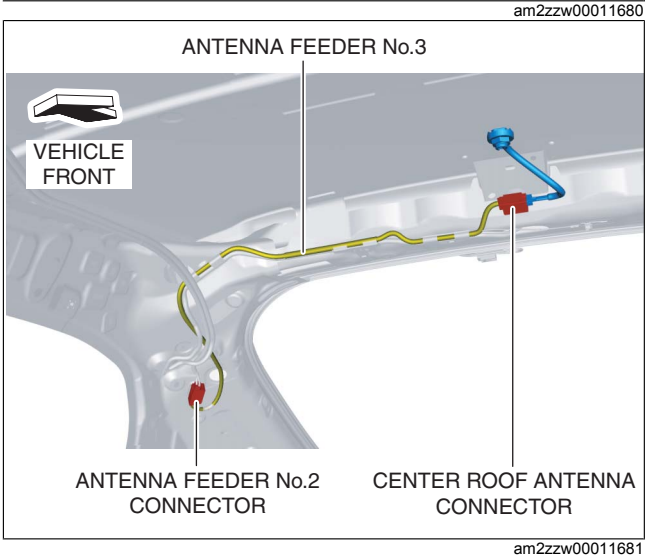

am2zzw00011681

9. Disconnect the DAB antenna amplifier connector. (with DAB antenna amplifier)

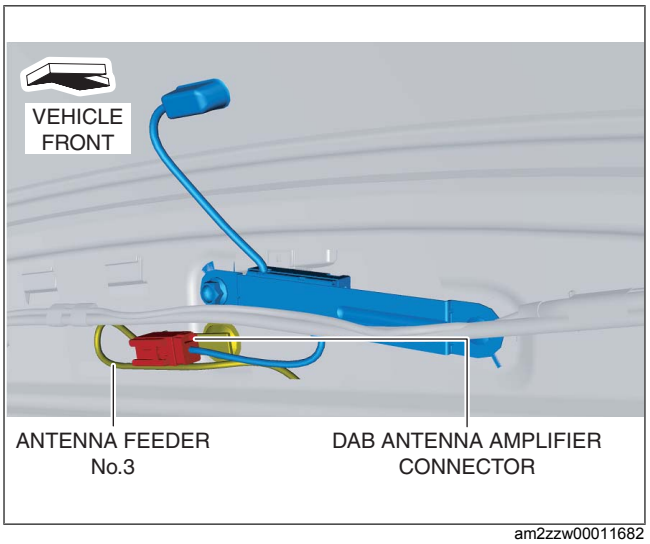

am2zzw00011682


10. Verify that the continuity between antenna feeder No.3 terminals is as indicated in the table.

: Continuity

Test condition	Terminal									
	ANTENNA FEEDER No.2 SIDE CONNECTOR					DAB ANTENNA AMPLIFIER SIDE CONNECTOR		CENTER ROOF ANTENNA SIDE CONNECTOR		
	A	A'	B	C	C'	A	A'	B	C	C'
Under any condition	○					○				
		○					○			
			○					○		
				○					○	
					○					○

: WITH DAB ANTENNA AMPLIFIER

am2zzw00011683

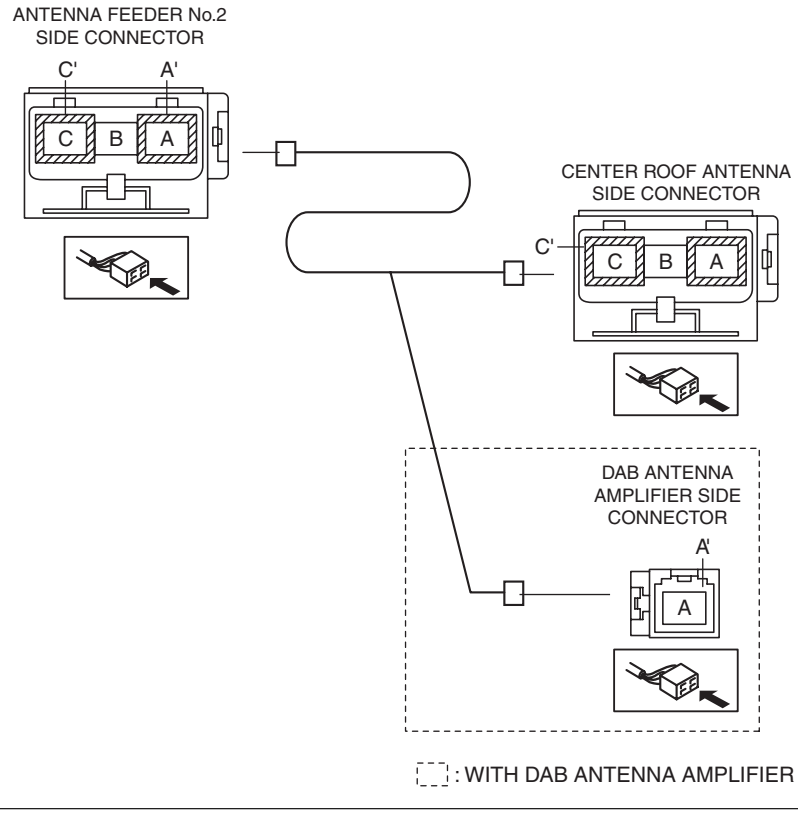

am2zzw00011684

- If not as indicated in the table, replace antenna feeder No.3. (See ANTENNA FEEDER NO.3 REMOVAL/INSTALLATION.)