CORNER JUNCTION REMOVAL [PANEL REPLACEMENT]

id098008611400


Symbol Marks

SYMBOL MARK	MEANING
●	SPOT WELDING
+	ARC WELDING (SPOT WELDING)

am2zzb00000540

Removal Procedure

1. Grind the 4 locations indicated by (A) shown in the figure.
2. Drill the 31 locations (LH), 32 locations (RH) indicated by (B) shown in the figure.

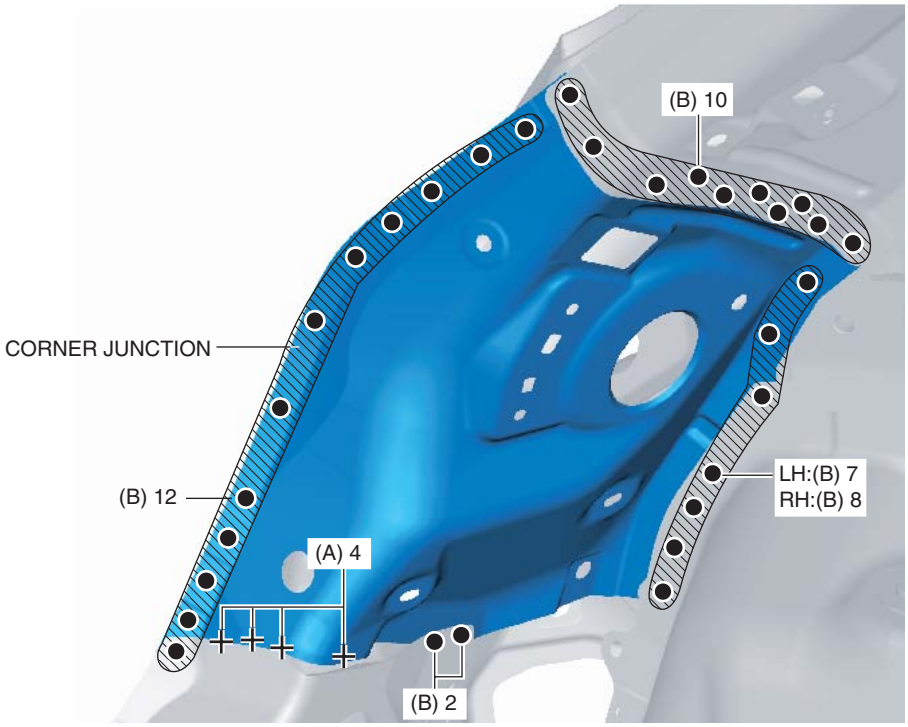

adejjb00000434

3. Remove the corner junction.