CORNER JUNCTION INSTALLATION [PANEL REPLACEMENT]

id098008611500


Symbol Marks

SYMBOL MARK	MEANING
●	SPOT WELDING
■	PLUG WELDING (ARC WELDING)
+	ARC WELDING (SPOT WELDING)

am2zzb00000543

Installation Procedure

1. When installing new parts, measure and adjust the body as necessary to conform with standard dimensions.
2. Drill holes for the plug welding before installing the new parts.
3. After temporarily installing new parts, make sure the related parts fit properly.
4. Plug weld the 19 locations (LH), 20 locations (RH) indicated by (A) shown in the figure.
5. Spot weld the 15 locations indicated by (B) shown in the figure.
6. Arc weld (spot welding) the 4 location indicated by (C) shown in the figure, then install the corner junction.

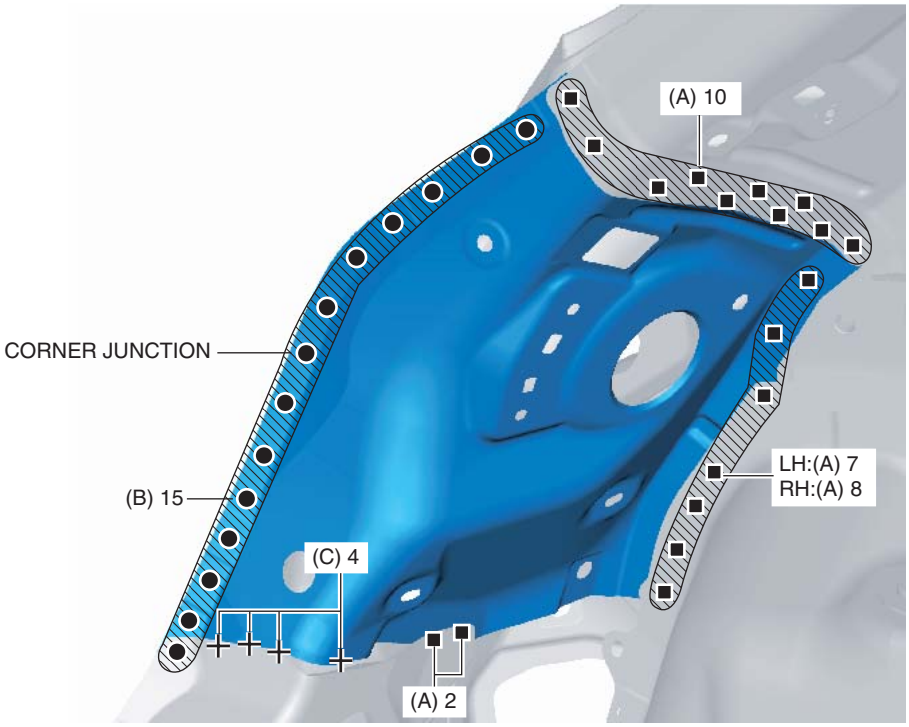

am2zzb00000544