


Plasma Machine

Computer connections



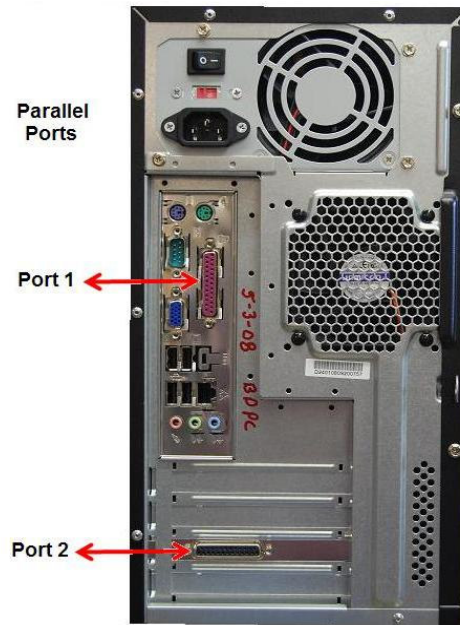

Step 1:

- Connect the 25 Pin cable to the control panel mounted on the machine. (control panel receptacle location may vary depending the type of system)

Step 2:

- Tighten the 25 Pin cable screws securely to the control panel.(do not over tighten or damage may occur)

Step 3:

- Connect the other end of the 25 Pin cable to the appropriate port on the PC.(refer to the image above for the correct port information)

Step 4:

- Tighten the 25 Pin cable screws securely to the PC.(do not over tighten or damage may occur)

Step 5:

- Connect the remainder of the PC (monitor, mouse, keyboard, etc...) as recommended by the PC manufacturer.

Step 6:

- Connect the 25 Pin cable to the Torch Height controller. (THC Control box)

Step 7:

- Tighten the 25 Pin cable screws securely to the controller.(do not over tighten or damage may occur)

Step 8:

- Connect the other end of the 25 Pin cable to port two on the PC.(refer to the image above for the correct port information)

Step 9:

- Tighten the 25 Pin cable screws securely to the PC.(do not over tighten or damage may occur)

Make sure power is off to all equipment before connecting or disconnecting any of the communication cables.