

LOW LEVEL PROTOCOLE Single DSPIC 33EP using RS232

To control the chassis you need to send via RS232 at 19200 bauds some special char that will be received by the DSPIC 33EP that controls the motors. To get the data from the chassis it is the same you need to receive from the DSPIC some char to read the IR sensors value, the battery level, the robot consumed current, the speed (in tics) and the accumulated Odometry (in tics).


Sending or receiving data is only a matter of sending and receiving chars on a RS232 serial port. This task is achieved on the embedded CPU running Linux or windows or any CPU that have one available com port. And you can use this protocol on any software that can open a serial port (ROS, Matlab, RTMAPS, C++, C#, java etc ...).

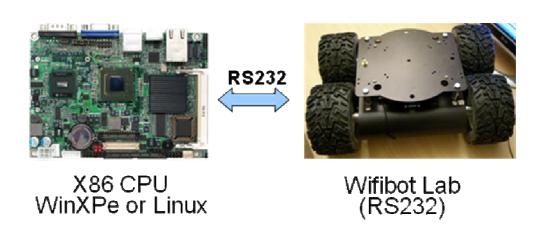

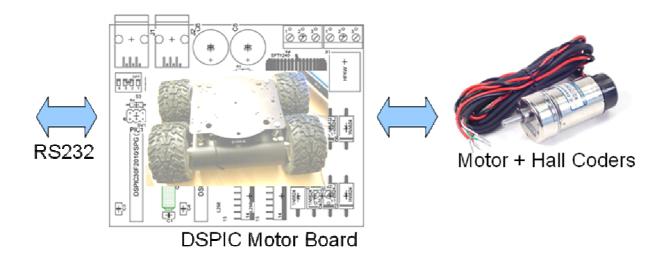

Controlling the motors:

DSPIC 33EP RS232

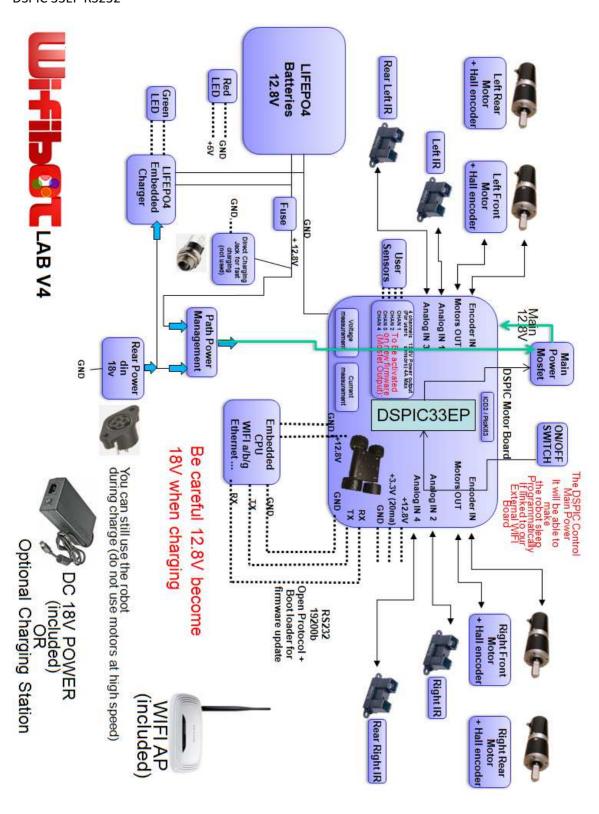

SET SPEED to move (Send periodically at max 250ms, else Timeout occurs and speed is set to 0):

You need to send 9 char at 19200 bauds.

sbuf[3] = (BYTE)(speed1 >> 8);


```
Char 1 is 255
Char2 is size (here is 0x07)
Char 3-4 is the left speed 0 -> 240 tics max
Char 5-6 is the right speed 0 -> 240 tics max
Char 7 is the Left / Right speed command flag: Forward / Backward and speed control left & right ON
Char 7 is decomposed as follow (1 byte char -> 8 bits):
(128) Bit 7 Left Side Closed Loop Speed control :: 1 -> ON / 0 -> OFF
(64) Bit 6 Left Side Forward / Backward speed flag :: 1 -> Forward / 0 -> Reverse
(32) Bit 5 Right Side Closed Loop Speed control :: 1 -> ON / 0 -> OFF
(16) Bit 4 Right Side Forward / Backward speed flag :: 1 -> Forward / 0 -> Reverse
(8) Bit 3 Relay 4 On/Off (DSUB15 POWER Pin 13 and 14)
(4) Bit 2 Relay 3 On/Off (DSUB15 POWER Pin 11 and 12)
(2) Bit 1 Relay 2 On/Off (DSUB15 POWER Pin 4 and 5)
(1) Bit 0 Relay 1 for Sensors. On/Off: 0 is OFF 1 is ON (DSUB15 POWER Pin 3)
Char 8-9 is the CRC 16 bits (char 7 low char 8 high, see end of document for details)
So to control for example the left side and the right side (Left & Right 2 motors, 2 encoders):
The speed is between 0-240
If we want the left side & right side to move at speed 120 forward without motor control we send:
Char 1 is 255
Char2 is 0x07
Char 3 is 120
Char 4 is 00
Char 5 is 120
Char 6 is 0
Char 7 is 80 (0 + 64 + 0 + 16)
Char 8 - \text{Char } 9 = \text{CRC16}(\text{data})
SetMotorRS23233f(hUSB, 120, 120, 80);
//hUSB is the serial port handle opened at 19200 baud
int SetMotorRS23233f(HANDLE hUSB, short speed1, short speed2, BYTE SpeedFlag)
       DWORD n;
       BYTE sbuf[10];
       sbuf[0] = 255;
       sbuf[1] = 0x07;
       sbuf[2] = (BYTE)speed1;
```

```
sbuf[4] = (BYTE)speed2;
sbuf[5] = (BYTE)(speed2 >> 8);
sbuf[6] = SpeedFlag+1;
short mycrcsend = Crcl6(sbuf+1,6);
sbuf[7] = (BYTE)mycrcsend;
sbuf[8] = (BYTE)(mycrcsend >> 8);

bool res = WriteFile(hUSB, &sbuf, 9,&n, NULL);
return res;
}
```

To use the old WIFIBOT protocol with only 2 char and less resolution (0 to 60):

(The wifibot socket protocol use this for the moment)

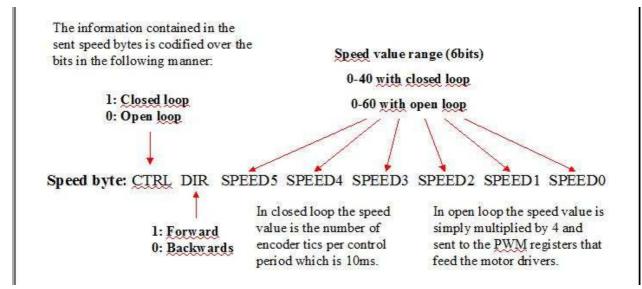

If we want the left side & right side to move at speed 20 forward without motor control we send:

```
128*0 + 64*1 + 20*1 = 84
SetMotorRS23233f_low_res(hUSB,84,84);
```

If we want the left side to move at speed 20 backward with motor control we send:

```
128*1 + 64*0 + 20*1 = 148

SetMotorRS23233f_low_res(hUSB, 148, 148);
int SetMotorRS23233f_low_res(HANDLE hUSB, BYTE speed1,BYTE speed2)
{
    DWORD n;
    BYTE sbuf[30];
    BYTE tt=0;
    sbuf[0] = 255;
    sbuf[1] = 0x07;

    int tmp1 = 8*(speed1&0x3F);
    int tmp2 = 8*(speed2&0x3F);
    if (speed2&0x80) tt=tt+32;
    if (speed2&0x40) tt=tt+16;
    sbuf[2] = (BYTE)tmp1;
    sbuf[3] = (BYTE)(tmp1 >> 8);
```

```
sbuf[4] = (BYTE)tmp2;
      sbuf[5] = (BYTE)(tmp2 >> 8);
      sbuf[6] = (speed1\&0x80) + (speed1\&0x40) + tt +1;//+1 Relay ON +8 10ms
      pid mode ;
      short mycrcsend = Crc16(sbuf+1,6);
      sbuf[7] = (BYTE)mycrcsend;
      sbuf[8] = (BYTE)(mycrcsend >> 8);
      bool res = WriteFile(hUSB, &sbuf, 9,&n, NULL);
      return res;
}
SET PID:
If we want to set a new PID on the left & right side at P=0.77 I=0.01
D=0.30
SetMotorPIDRS23233f(hUSB,0x00,0x00,77,1,30,360);
int SetMotorPIDRS23233f(HANDLE hUSB, BYTE speed1, BYTE speed2, BYTE pp, BYTE
ii,BYTE dd,short maxspeed)
      DWORD n;
      BYTE sbuf[30];
      sbuf[0] = 255;
      sbuf[1] = 0x09;
      sbuf[2] = speed1;//Always 0
      sbuf[3] = speed2; //Always 0
      sbuf[4] = pp;
      sbuf[5] = ii;
      sbuf[6] = dd;
```

Maxspeed is the max command possible – 20: set it to 360.

sbuf[10] = (BYTE)(mycrcsend >> 8);
WriteFile(hUSB, &sbuf, 11, &n, NULL);

sbuf[8] = (BYTE)(maxspeed >> 8);
short mycrcsend = Crc16(sbuf+1,8);

To GET DATA from the chassis:

return sbuf[0];

The DSPIC sends you 21 chars in continuous at 10ms:

sbuf[7] = (BYTE)maxspeed;

sbuf[9] = (BYTE)mycrcsend;

```
DSPIC send first a '255' char to help synchronise your software and after (the '255' is not sent in TCP or UDP):

//DSPIC C code to show you the sending part to the PC:
bufsend[0]=(-speedlab);
bufsend[1]=(-speedlab >> 8); //speed is a short and it is tics / 50 ms
bufsend[2]=(unsigned char)(tmpadc2 >> 2);//Bat Volt:10.1V 1.28V 404/4->101
bufsend[3]=(unsigned char)(tmpadc4 >> 2);//3.3v->255 2v-> 624/4 -> 156
bufsend[4]=(unsigned char)(tmpadc3 >> 2);//3.3v->255 2v-> 624/4 -> 156
bufsend[5]=bufposition[0];//Acumulated odometrie is a float
bufsend[6]=bufposition[1];//12ppr x 4 x 51 gear box = 2448 tics/wheel turn
bufsend[7]=bufposition[2];
bufsend[8]=bufposition[3];
bufsend[9]=(speedlab2);
```

```
bufsend[10]=(speedlab2 >> 8);
bufsend[11]=(unsigned char)(tmpadc0 >> 2);
bufsend[12]=(unsigned char)(tmpadc1 >> 2);
bufsend[13]=bufposition2[0];
bufsend[14]=bufposition2[1];
bufsend[15]=bufposition2[2];
bufsend[16]=bufposition2[3];
bufsend[17]=0;//robot current // *0.194-37.5 = I in Amp / *10 for the GUI
: 10 -> 1 A (ACS712 30Amp chip) // *0.129-25 =I (for ACS712 20A chip)
bufsend[18]=14; //firmware version
bufsend[19]=crc16 low;
bufsend[20]=crc16 high;
You receive by using:
int GetMotorRS23233f(HANDLE hUSB, SensorData *dataL, SensorData *dataR)
      DWORD n;
      BYTE sbuf[30];
      bool res=false;
      do {
            ReadFile(hUSB, &sbuf, 1, &n, NULL);
      }while(sbuf[0]!=255);
      res = ReadFile(hUSB, &sbuf, 21, &n, NULL);
      short mycrcrcv = (short)((sbuf[20] << 8) + sbuf[19]);</pre>
      short mycrcsend = Crc16(sbuf,19);
      if (mycrcrcv!=mycrcsend)
                  ReadFile(hUSB, &sbuf, 1, &n, NULL);
            }while(sbuf[0]!=255);
      }
      else {
            dataL->SpeedFront=(int)((sbuf[1] << 8) + sbuf[0]);</pre>
            if (dataL->SpeedFront > 32767) dataL->SpeedFront=dataL-
            >SpeedFront-65536;
            dataL->BatLevel=sbuf[2];
            dataL->IR=sbuf[3];
            dataL->IR2=sbuf[4];
            dataL->odometry=((((long)sbuf[8] << 24))+(((long)sbuf[7] <<
            16))+(((long)sbuf[6] << 8))+((long)sbuf[5]));
            dataR->SpeedFront=(int)(sbuf[10] << 8) + sbuf[9];</pre>
            if (dataR->SpeedFront > 32767) dataR->SpeedFront=dataR-
            >SpeedFront-65536;
            dataR->BatLevel=0;
            dataR->IR=sbuf[11];
            dataR->IR2=sbuf[12];
            dataR->odometry=((((long)sbuf[16] << 24))+(((long)sbuf[15] <<</pre>
            16))+(((long)sbuf[14] << 8))+((long)sbuf[13]));
            dataL->Current=sbuf[17];
            dataR->Current=sbuf[17];
            dataL->Version=sbuf[18];
            dataR->Version=sbuf[18];
      return res;
}
```

Serial Port Open (Windows):

```
HANDLE SetupRS232CommPort( LPCSTR comport)
      HANDLE hCom;
      DCB dcb;
      COMMTIMEOUTS ct;
      hCom = CreateFileA( comport, GENERIC READ | GENERIC WRITE, 0, 0,
      OPEN_EXISTING, 0, 0);
      GetCommState(hCom, &dcb);
      dcb.BaudRate = RS232_SPEED;//19200 bauds
      dcb.fParity = FALSE;
      dcb.fOutxCtsFlow = FALSE;
      dcb.fOutxDsrFlow = FALSE;
      dcb.fDtrControl = DTR_CONTROL_DISABLE;
      dcb.fDsrSensitivity = FALSE;
      dcb.fOutX = FALSE;
      dcb.fInX = FALSE;
      dcb.fRtsControl = RTS_CONTROL_DISABLE;
      dcb.fAbortOnError = FALSE;
      dcb.ByteSize = 8;
      dcb.Parity = NOPARITY;
      dcb.StopBits = 0;
      SetCommState(hCom, &dcb);
      GetCommTimeouts(hCom, &ct);
      ct.ReadIntervalTimeout = 500;
      ct.ReadTotalTimeoutMultiplier =500;
      ct.ReadTotalTimeoutConstant = 500;
      SetCommTimeouts(hCom, &ct);
      SetCommMask(hCom, EV_RXCHAR);
      return hCom;
```

CRC 16 bits (you should not use the starting bit "255"):

```
short Crc16(unsigned char *Adresse_tab , unsigned char Taille_max)
{
      unsigned int Crc = 0xFFFF;
      unsigned int Polynome = 0xA001;
      unsigned int CptOctet = 0;
      unsigned int CptBit = 0;
      unsigned int Parity= 0;
      Crc = 0xFFFF;
      Polynome = 0xA001;
      for ( CptOctet= 0 ; CptOctet < Taille_max ; CptOctet++)</pre>
      {
            Crc ^= *( Adresse_tab + CptOctet);
            for ( CptBit = 0; CptBit <= 7; CptBit++)</pre>
                  Parity= Crc;
                  Crc >>= 1;
                  if (Parity%2 == true) Crc ^= Polynome;
      }
      return(Crc);
}
```