



Republic of the Philippines

Department of Environment and Natural Resources

MINES AND GEOSCIENCES BUREAU

North Avenue, Diliman, Quezon City, Philippines

Tel. No. (+63 2) 8928-8642/ 8928-8937 Fax. No. (+63 2) 8920-1635 E-mail: central@mgb.gov.ph

FLOOD THREAT ADVISORY

To: **Brgy. Chairperson**
Brgy. San Roque
City of Marikina
Metropolitan Manila

Date: October 9, 2024

Dear Sir/Madam:

Please be advised that the Geohazards Mapping and Assessment Team (GMAT) of the Mines and Geosciences Bureau (MGB) has conducted **flood assessment** for the updating of 1:10,000 Scale Geohazard Map in your barangay. The following are the results and recommendations following the assessment:

Purok / Sitio / Area of Concern	GPS Coordinates (Luzon 1911)	Flood Susceptibility Rating	Geohazards Assessment
Mountainview	14° 37' 46.4" N, 121° 06' 11.3" E	Very High	The Balante Creek acts as the eastern boundary of the barangay, shared with Cainta, Rizal. The peripheral areas of <i>Mountainview</i> and <i>Midtown (Phase II) Subdivisions</i> are inundated by overtopping river water with heights ranging from 1.5 to greater than 2m during Ondoy. Another factor that exacerbates flooding is the clogging of the drainage canals and creeks, as noted by the barangay official. One resident also recalled an incident of riverbank erosion along the Cainta side of the riprap of Balante Creek.
Midtown Phase II	14° 37' 30.0" N, 121° 06' 11.2" E	Very High	
Purefoods	14° 37' 41.5" N, 121° 05' 40.3" E	Very High	Bounding the barangay to the west is Marikina River and the peripheral areas of <i>Purefoods</i> and <i>Shoe Museum (Isabelo Mendoza St.)</i> are inundated by floodwaters of greater than 2m, reaching the 2 nd floor of houses and establishments.
Isabelo Mendoza	14° 37' 50.2" N, 121° 05' 38.5" E	Very High	
Midtown Phase I	14° 37' 20.2" N, 121° 05' 54.3" E	Very High	The portion of the barangay in Midtown Phase I is near the boundary with Pasig City, which experienced flooding with heights ranging from ~1.4m to greater than 2m, depending on the severity of the weather event. During Ondoy, floodwaters almost reached the ceiling of the 1 st floor, while during Ulysses, ~1.4m.

Remarks / Recommendations:

- ✓ It is highly recommended to implement appropriate easements in construction of settlements or other infrastructure along rivers/creeks as specified in the Presidential Decree No. 1067 known as Water Code of the Philippines.
- ✓ Improvement and proper maintenance of existing drainage system in the barangay are recommended to prevent inundation of residential areas, critical facilities, and other assets. Avoid improper waste disposal, particularly along drainage canals as it may cause clogging and obstruction of water flow. Ensure regular clearing of natural and artificial drainage pathways, or prior to an impending tropical cyclone or other rain-bearing weather systems.

- ✓ Construction of appropriate and well-studied engineering measures (e.g., dike, flood wall, etc.) should be implemented to minimize the rate of erosion along rivers/creeks. Ensure that the structure follows engineering standards and has structural integrity. Also, damages in the structural mitigation measures should be reported to concerned agency/office responsible for the installation. The LGU is also encouraged to maintain such measures or reinforce identified damages, with the strong support of the barangay officials and active engagement of the communities and the private sector.
- ✓ Install a warning signage alerting motorists and residents of the danger of crossing bridges susceptible to flash flood during heavy rainfall events.
- ✓ The CDRRMO, together with the BDRRMO, should conduct Information, Education, and Communication (IEC) Campaign on flood hazards to flood-prone communities, particularly the households residing proximal to the river and irrigation canals.
- ✓ Strengthen and improve flood warning system with corresponding warning levels for pre-emptive evacuation purposes. The barangay should have constant communication with nearby and/or upland/upstream barangays during typhoon and monsoon season. This is to gather information from their counterparts in terms of the flood situation in their areas.
- ✓ Adhere to the warnings given by proper authorities prior to the landfall or passing of tropical cyclones and other prevailing weather disturbances. This may include City Disaster Risk Reduction Management Office (CDRRMO), Office of the Civil Defense (OCD) NCR, and other related agencies.

Prepared by:


JULIUS VINCENT UMALI
Senior Geologist

MA. LOURDES STEPHANIE V. LEIDO
Senior Geologist


JETHRO B. CAPINO
Geologist II

Received by:
Designation:
Office:


BARANGAY SAN ROQUE



The Balante Creek acts as the eastern boundary of the barangay, shared with Cainta, Rizal. The peripheral areas of *Mountainview* and *Midtown (Phase II) Subdivisions* are inundated by overtopping river water with heights ranging from 1.5 to greater than 2m during Ondoy. Another factor that exacerbates flooding is the clogging of the drainage canals and creeks, as noted by the barangay official. One resident also recalled an incident of riverbank erosion along the Cainta side of the riprap of Balante Creek (GPS Coordinates: 14° 37' 46.4 and 30.0" N, 121° 06' 11.3 and 11.2" E).



Bounding the barangay to the west is Marikina River and the peripheral areas of *Purefoods* and *Shoe Museum (Isabelo Mendoza St.)* are inundated by floodwaters of greater than 2m, reaching the 2nd floor of houses and establishments (GPS Coordinates: 14° 37' 41.5 and 50.2" N, 121° 05' 40.3 and 38.5" E).

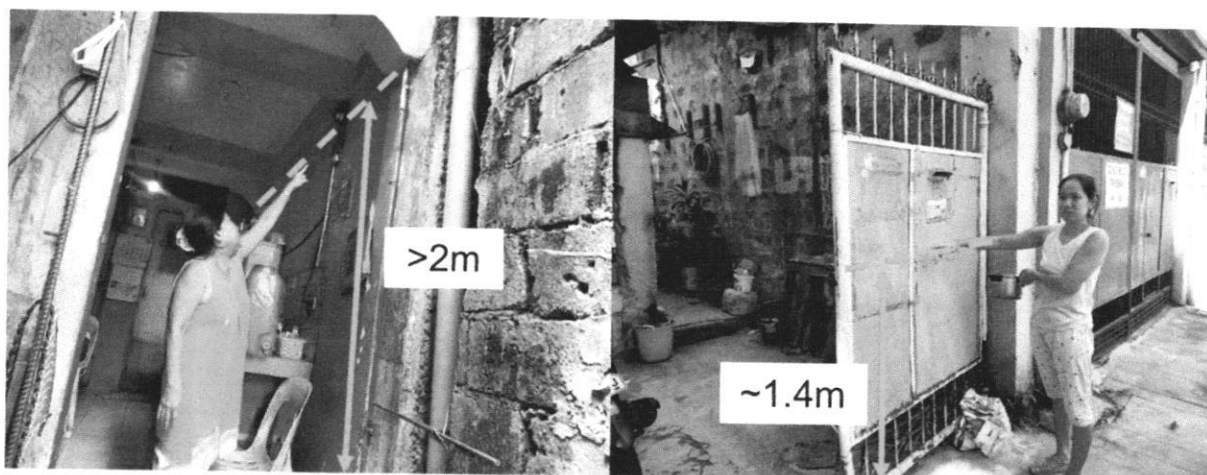

The portion of the barangay in Midtown Phase I is near the boundary with Pasig City, which experienced flooding with heights ranging from ~1.4m to greater than 2m, depending on the severity of the weather event. During Ondoy, floodwaters almost reached the ceiling of the 1st floor, while during Ulysses, ~1.4m (GPS Coordinates: 14° 37' 20.2" N, 121° 05' 54.3" E).

Recommendations:

- ✓ It is highly recommended to implement appropriate easements in construction of settlements or other infrastructure along rivers/creeks as specified in the Presidential Decree No. 1067 known as Water Code of the Philippines.
- ✓ Improvement and proper maintenance of existing drainage system in the barangay are recommended to prevent inundation of residential areas, critical facilities, and other assets. Avoid improper waste disposal, particularly along drainage canals as it may cause clogging and obstruction of water flow. Ensure regular clearing of natural and artificial drainage pathways, or prior to an impending tropical cyclone or other rain-bearing weather systems.
- ✓ Construction of appropriate and well-studied engineering measures (e.g., dike, flood wall, etc.) should be implemented to minimize the rate of erosion along rivers/creeks. Ensure that the structure follows engineering standards and has structural integrity. Also, damages in the structural mitigation measures should be reported to concerned agency/office responsible for the installation. The LGU is also encouraged to maintain such measures or reinforce identified damages, with the strong support of the barangay officials and active engagement of the communities and the private sector.
- ✓ Install a warning signage alerting motorists and residents of the danger of crossing bridges susceptible to flash flood during heavy rainfall events.
- ✓ The CDRMO, together with the BDRMO, should conduct Information, Education, and Communication (IEC) Campaign on flood hazards to flood-prone communities, particularly the households residing proximal to the river and irrigation canals.
- ✓ Strengthen and improve flood warning system with corresponding warning levels for pre-emptive evacuation purposes. The barangay should have constant communication with nearby and/or upland/upstream barangays during typhoon and monsoon season. This is to gather information from their counterparts in terms of the flood situation in their areas.
- ✓ Adhere to the warnings given by proper authorities prior to the landfall or passing of tropical cyclones and other prevailing weather disturbances. This may include City Disaster Risk Reduction Management Office (CDRRMO), Office of the Civil Defense (OCD) NCR, and other related agencies.