MILITARY SPECIFICATION

MOUNT, TELESCOPE: M134

This amendment forma apart of Military Specification MIL-M-46368B(MU), dated 11 September 1968, and is approved for use by all Departments and Agencies of the Department of Defense.

* Paragraph 2.1: Under drawings, delete IEL 8626072.

* paragraph 3.4.1(e): Change “pins” to “keys”.

Paragraph 3.4.2: Delete “445 Mils” and substitute “427 Mils”.

* Paragraph 4.3.2.1, first sentence: Delete “the List of Inspection Documents (IEL), when provided with”.

* paragraph 4.5.2.1: Delete “the List of Inspection Documents when provided with”.

* paragraph 4.6,2.2: Delete paragraph and substitute:

4.6.2.2 Orientation.- Secure the mount to the extended trunnion of a level and crosslevel type of fixture having the accuracies depicted on Drawing F6523553 by means of an adapter having accuracies shown as part 6 on Drawing F10555619. Secure an Inspection Aid Adapter having the accuracies depicted on Drawing F10553898 to the opposite extended trunnion of the level and crosslevel type fixture by the means provided. Mount adapter plate C11728666 to adapter (item 6) drawing F10555616 and secure by the means provided, Place Inspection Aid A8658940 over top surface of the adapter plate and level this surface. When the inspection aid indicates level set the elevation fixture to indicate zero elevation. Position the inspection aid against the plate and cross level fixture to indicate zero cant. Rotate the elevation mechanism to any elevation setting and recheck cant, if any. Repeat this check at 90° each side of this zero setting. Remove all angles of cant. Recheck level position of top surface of adapter plate to reassure position of keys. Remove adapter plate and position collimator F5549108 in the V slot of adapter item 6 dwg. F10555616. Erect a plumb line approximately. 40 feet from the collimator. Roll the collimator and position the vertical reticle line of the collimator parallel to the plumb line. Place target Figure II behind plumb line and coincide target lines A and B to collimator's horizontal and vertical reticle lines. Remove collimating telescope from test fixture and assemble the mount to test adapter. Secure by means of 4 bolts. Secure locator pin part 16

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T05:44Z
Check the source to verify that this is the current version before use.

shown on Drawing FI0555619 to fixture. Rotate crosslevel knob and pitch knob to level the pitch and crosslevel bubbles of the mount to within limit specified in 3.4.1(c). Place an inspection aid A8658940 on a parallel over each of the horizontal surfaces perpendicular to the mounting face, then over both surfaces parallel to the mounting surface and then over the quadrant gun pads. All readings must indicate level within the limit outlined in 3.4.1(d). Seat “V” block Part I shown on Drawing F105556I9, and collimator over locating keys of mount with base of “V" block resting on horizontal top seating surface. Sight through collimator and observe coincidence between the intersecting point of target lines C and D Figure II and the collimator’s optical line of sight. They must coincide within the limits specified in 3.4.1(e). By means of cross level knob, set crosslevel bubble of inspection aid adapter Drawing F10553898 to indicate level. Elevate fixture through full elevation and full depression travel. During this excursion, observe that level vial bubble of the inspection aid adapter remains in constant position. Any bubble movement indicates seating surface of adapter receiving the inspection aid is in a canted position. Set inspection aid to zero elevation. Return fixture to zero elevation. Reposition inspection aid on the inspection aid adapter seating pads. Rotate inspection aid 180° and observe level bubble setting. Both level vial bubble positions must indicate identical level settings. When all level reading and points of coincidence have been attained, the mount is orientated in accordance with 3.4.1.

* Paragraph 4.6.2.11.3, first sentence: Change “pins” to “keys”.

The outside margins have been marked to indicate where additions to the previous amendment have been made. This has been done as a convenience only and the Government assumes no liability whatsoever for any inaccuracies in this notation. Bidders and contractors are cautioned to evaluate the requirements of this document based on the entire content as written irrespective of the marginal notation and relationship to the last previous amendment.

Custodian:

Army-MU

Preparing activity:

Army-MU

Project No. 1240-A595

Source: https://assist.dla.mil -- Downloaded: 202610-22T05:44Z
Check the source to verify that this is the current version before use.

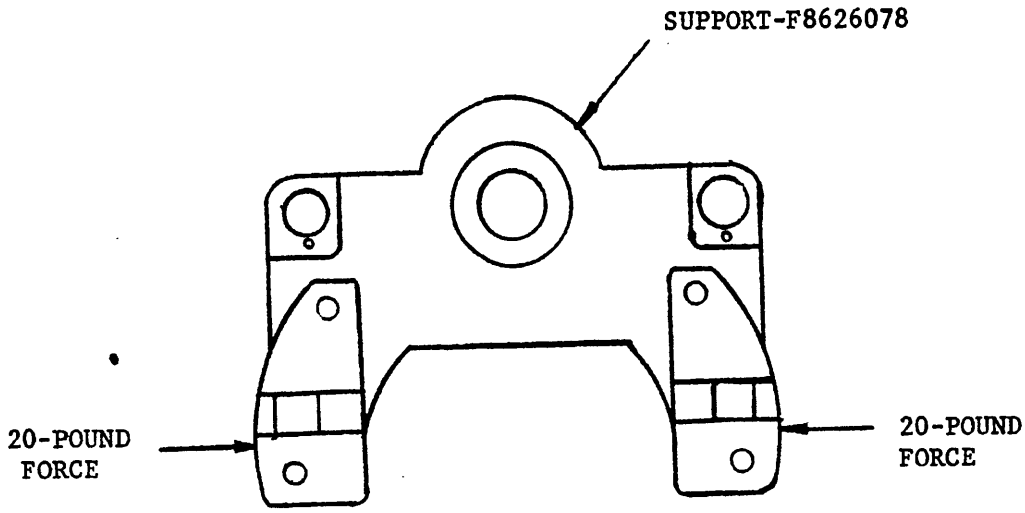

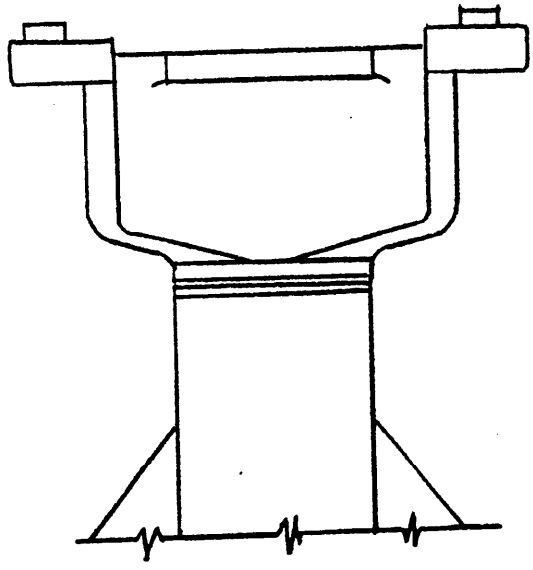

FIGURE 1

APPLICATION OF TANGENTIAL LOAD

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T05:44Z
Check the source to verify that this is the current version before use.