MIL-C-21084D(MC)
4 February 1980
SUPERSEDING
MIL-C-21084C(MC)
17 July 1974

MILITARY SPECIFICATION

COAT, WOMAN'S: WOOL, GABARDINE, BLUE

This specification is approved for use by U. S. Marine Corps, Department of the Navy, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification covers requirements for women's blue gabardine coats.

1.2 Classification. The coats shall be of one type in the following sizes as specified (see 6.2):

Schedule of Sizes

Short	Regular	Long
6	6	
8	8	8
10	10	10
12	12	12
14	14	14
16	16	16
18	18	18
20	20	20
	22	22

2. APPLICABLE DOCUMENTS.

2.1 Issues of documents. The following documents of the issue in effect on date of invitation for bids or request for proposal, form a part of the specification to the extent specified herein.

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to the Commandant of the Marine Corps (LMA-1), Headquarters, U. S. Marine Corps, Washington, D. C. 20380, by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

FSC 8410

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

SPECIFICATIONS

FEDERAL

V-T-276	- Thread, Cotton.
V-T-280	- Thread, Gimp, Cotton, Buttonhole
V-T-301	- Thread, Silk.
UU-P-268	- Paper, Kraft, Wrapping.
CCC-C-438	- Cloth, Buckram, Cotton.
DDD-L-20	- Label, For Clothing Equipage, and Tentage, (General Use).
DDD-T-86	- Tape, Textile, Cotton, General Purpose (Unbleached, Bleached or Dyed)

MILITARY

MIL-C-326	- Cloth, Silesia, Cotton
MIL-C-368	- Cloth, Satin, Rayon and Cloth, Twill Rayon
MIL-B-371	- Braid, Textile, Tubular
MIL-B-3461	- Buttons, Insignia, Metal, Uniform and Cap
MIL-C-10176	- Cloth, Gabardine, Wool, Polyester and Wool
MIL-C-15062	- Cloth, Flannel, Wool, Undercollar Cloth
MIL-P-15064	- Pad, Shoulder and Sleeve Head.
MIL-C-15065	- Coat Fronts
MIL-C-16375	- Cloth, Wigan, Cotton
MIL-B-17757	- Box, Shipping, Fiberboard (Modular Sizes)
MIL-C-43718	- Cloth, Twill, Polyester, Polyester and Cotton, Polyester and Rayon
MIL-C-82252	- Cloth, Broadcloth, Wool, and Wool Synthetic (Moth Proofed)

STANDARDS

FEDERAL

FED-STD-191	- Textile Test Methods
FED-STD-751	- Stitches, Seams and Stitchings

MILITARY

MIL-STD-129	- Marking for Shipment and Storage
MIL-STD-1608	- Provisions for Evaluating Quality of Coats, Women's Dress.

(Copies of specifications and standards required by contractors in connection with specific procurement functions should be obtained fror the procuring activity or as directed by the contracting officer.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

2.2 Other publications. The following documents form a part of this specification to the extent specified herein. Unless otherwise indicated, the issue in effect on date of invitation for bids or request for proposal shall apply.

LAWS AND REGULATIONS

U. S. Postal Service Manual

(Copies of the manual may be obtained from the Superintendent of Documents, U.S. Government Printing Office, Washington, D. C. 20402.)

UNIFORM CLASSIFICATION COMMITTEE, AGENT

Uniform Freight Classification Rules

(Application for copies should be addressed to the Uniform Classification Committee, Room 1106, 222 South Riverside Plaza, Chicago, Illinois 60606.)

NATIONAL MOTOR FREIGHT TRAFFIC ASSOCIATION, INC., AGENT

National Motor Freight Classification

(Application for copies should be addressed to the American Trucking Association, Inc., Tariff Order Section, 1616 P. Street, N.W., Washington, D. C. 20026.)

Department of Defense (DOD) Standard Color Card of
Official Standardized Shades for Sewing Threads 1968

(Copies may be obtained from the Color Association of the United States, Inc., 200 Madison Avenue, New York, New York 10016.)

3. REQUIREMENTS

3.1 Standard sample. Standard samples are furnished solely for guidance and information to the contractor (see 6.3). Variation from this specification may appear in the sample, in which case the specification shall govern.

3.2 First article. When specified (see 6.2), the contractor shall furnish sample unit(s) for first article inspection and approval (see 4.4 and 6.4).

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

3.3 Materials.

3.3.1 Basic material. The basic material shall be cloth, gabardine, wool, dark blue shade 2316 (see 6.3), 14.5 ounce, conforming to type I, class 5 of MIL-C-10176.

3.3.2 Lining. The material for lining the coat and vent shall be cloth, rayon, twill, black shade 2604 (see 6.3), 3.7 ounce, conforming to class 1 of MIL-C-368.

3.3.3 Silesia. The material for interlining the simulated breast pocket stays, armhole and shoulder seams of the coat shall be cloth, cotton, silesia, 4.5 ounce, black, conforming to type I of MIL-C-326 or cloth, polyester and cotton, twill, conforming to type I of MIL-C-43718, except the colorfastness requirements for crocking shall not apply.

3.3.4 Undercollar material. The undercollar material shall be cloth, wool, flannel, black (see 6.3), conforming to MIL-C-15062.

3.3.5 Collar interlining. The material for interlining the collar shall be cloth, cotton, buckram, natural color, conforming to type I, class 2 of CCC-C-438, except that the test for shrinkage shall be in accordance with method 5580 of FED-STD-191.

3.3.6 Piping. The material for the underply of shoulder straps and piping for the collar and ornamental sleeve pieces shall be cloth, broadcloth, wool, scarlet shade 2501 (see 6.3), conforming to type I, class 4 of MIL-C-82252.

3.3.7 Coat fronts. The coat fronts shall conform to type XIII of MIL-C-15065.

3.3.8 Shoulder pads. The shoulder pads shall conform to type III, class 2 of MIL-P-15064.

3.3.9 Sleeve head pads. The sleeve head pads shall conform to type IV of MIL-P-15064.

3.3.10 Tape, cotton. The cotton tape shall conform to type III, class 1 of DDD-T-86, 1/4 inch wide for reinforcing the folded edge of the simulated pocket welt and armholes and 3/8 inch wide for the front edge of the coat and the bridle tape.

3.3.11 Wigan. The material for reinforcing the bottom edge of the sleeves shall be cloth, cotton, wigan, 2.5 ounces, conforming to type I of MIL-C-16375.

3.3.12 Hanger braid. The braid for the coat hanger shall be cotton or rayon tubular flat braid 1/8 to 3/16 inch wide, minimum breaking strength 50 pounds, color black conforming to type IX, class 1 of MIL-B-371.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

3.3.13 Thread.

3.3.13.1 Silk. The silk thread for machine sewing shall conform to type I, size A, 3-ply of V-T-301 for all outside seaming and stitching, and size O, 3-ply of V-T-301 for machine felling. The thread for hand sewing shall conform to type III, class 3, size C of V-T-301.

3.3.13.2 Cotton. The cotton thread shall conform to V-T-276, type IC2, mercerized finish, ticket No. A, 3-ply for all inside seaming and stitching, V-T-276, type IB3, glazed finish, ticket No. 16, 4-ply for sewing on buttons and V-T-276, IA1 or IA2, ticket NO. 30, 3-cord for machine tacking armholes. The thread for basting shall be a good commercial grade.

3.3.13.3 Color and colorfastness. All thread shall be black AA, Cable No. 66043, (See DOD Standard Color Card of Official Standardized Shades for Sewing Threads 1968) except cotton thread for basting and for machine tacking armholes, which may be white. The colored threads, when tested as specified in the applicable thread specification, shall show good fastness to wet (dry) cleaning and, in addition, the silk thread shall show good fastness to light.

3.3.13.4 Gimp. The buttonhole gimp shall be cotton, No.8, soft or glazed finish, conforming to type I or type II of V-T-280. The color of the gimp shall be black AA, Cable No. 66043 showing good fastness to wet (dry) cleaning.

3.3.14 Insignia buttons and ring fasteners. The insignia buttons for coats shall be metal, gold plated, 27-line and 40 line, conforming to MIL-B-3461, type I, style 3, class A, subclass 1 for officers or subclass 2 for enlisted personnel as specified (see 6.2). Ring fasteners for attaching buttons to ornamental sleeve pieces shall conform to MIL-B-3461.

3.3.15 Labels. Each coat shall have an identification label and a size label as follows. The coats are intended to be dry cleaned and the labels shall show fastness to dry cleaning.

3.3.15.1 Identification label. The identification label shall conform to type I, class 1 of DDD-L-20. The content and format shall be as follows:

Dry clean only
Nomenclature (item description)
Contract number
Name of contractor
Wool Products Act Information

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

3.3.15.2 Size label. The size label shall conform to type I, class 2 of DDD-L-20. The label shall consist of the numerical size designation specified in 1.2 followed by the letters S, R or L for Short, Regular or Long and the stock number as shown by the following example:

$$\frac{14R}{\text{Stock Number}}$$

The stock number may be incorporated in the identification label instead of in the size label.

3.3.16 Bias binding. The binding for the underarm shields and raw edge of seam allowance shall be bias cut out of the lining material specified in 3.3.2. The binding shall be cut 3/4 inch wide and have sized edges.

3.4 Design. The coat shall be the U. S. Marine Corps design shown in Figures 1 and 2, a four-button, single-breasted, semiformfitting, half lined coat having a panel type front, a four-piece back with vent, an outside welt breast pocket, shoulder straps to button, ornamental sleeve piece at bottom of sleeve, a worked eyelet in each collar end, and a notched collar and lapels. The outer edges, the collar, shoulder straps and ornamental sleeve pieces shall be piped with scarlet wool broadcloth.

3.5 Patterns. Standard patterns will be furnished to the contractor by the Government. The standard patterns shall not be altered in any way and shall be used only as a guide for cutting the contractors working pattern. The standard patterns shall provide 3/16-inch allowance for seams at top (step) and front edges of lapels and front edges of coat; 1/8-inch allowance for shoulder straps and collar; 3/4-inch allowance for side seams, 5/8-inch allowance for center back seaming; and 3/8-inch allowance for all other seams. Standard patterns show size, seam allowances, warp directional lines for cutting, and are marked or notched for proper cutting, placement and assembly of the component parts.

3.5.1 List of pattern parts. Coats shall be cut from the materials specified herein in accordance with the pattern parts indicated below:

Item	Pattern Nomenclature	No. of cut parts
	Material: Cloth, Wool, Gabardine	
1.	Front	2
2.	Side front	2
3.	Side back	2
4.	Center back	2
5.	Front facing (right)	1
6.	Front facing (left)	1

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

Item	Pattern Nomenclature	No. of cut parts
	Material: Cloth, Wool, Gabardine	
7.	Top sleeve	2
8.	Under sleeve	2
9.	Top Collar	1
10.	Top Collarstand	1
11.	Ornamental sleeve pieces	2
12.	Pocket welt	1
13.	Shoulder strap (top ply)	2
14.	Underarm shield	2
	Material: Cloth, Rayon Lining	
15.	Front	2
16.	Back Yoke	1
17.	Top sleeve	2
18.	Under sleeve	2
19.	Right vent	1
	Material: Cloth, Wool flannel	
20.	Undercollar	1
	Material: Cloth, Buckram, Cotton	
21.	Undercollar interlining	1
	Material: Cloth, Cotton, Wigan	
22.	Sleeve bottom reinforcement	2
	Material: Cloth, Silesia or Polyester/Cotton	
23.	Welt, Pocket Stay	1
	Material: Cloth, Broadcloth, Wool Scarlet	
24.	Shoulder strap (under ply)	2
	Marker	
25.	Sleeve turnup and ornamental sleeve	
26.	Pocket welt	
27.	Collarstand	
28.	Top Collar marker	
	Shaper	
29.	Lapel shaper (working)	
30.	Undercollar (shaper)	
31.	Left vent (shaper)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

3.6 Construction.

3.6.1 Manufacturing requirements. The coats shall be manufactured in accordance with the operations and the stitch, seam and stitching types specified in Table I. The supplier is not required to follow the exact sequence of operations as listed in Table I, but all operations specified shall be used to manufacture the coats.

3.6.1.1 Stitches, seams, and stitchings. The stitch, seam and stitching types specified in Table I shall conform to FED-STD-751. The number of stitches per inch as specified in Table I indicates the minimum and maximum number permitted.

3.6.1.2 Thread breaks and ends of seams. Ends of seams and stitching produced with 301 stitch type, when not caught in other seams or stitching, shall be backtacked not less than 1/4 inch. Thread breaks (all stitch types) shall be secured by stitching back of break not less than 1/2 inch. Ends of a continuous line of stitching shall overlap not less than 1/2 inch except on the identification label.

3.6.2 Shade markings. The component parts of the coat, cut from one piece of basic material and lining material, including pairs of sleeve linings when cut from ends shall be shade marked to insure a uniform shade and size. Any method of shade marking may be used except:

(a) Corrosive metal fastening devices.
(b) Adhesive type tickets which show discoloration or the use of an adhesive mass which adheres to the material upon removal of the tickets.
(c) Sew-on shade tickets.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD	
					NDL	BOB/ LPR
1.	Cutting.					
	a. Cut coat in strict accordance with patterns furnished by the Government.					
	b. Cut material in the direction indicated by directional lines on pattern. The directional line shall be placed in the warp direction of the cloth unless otherwise indicated on the patterns.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD	
					NDL	BOB/ LPR
1.	Cutting. (cont'd) c. All wool parts of the coat shall be cut from one piece of basic material, except the underarm shields may be cut from ends. The stays for the insignia buttons attached to the ornamental sleeve piece shall be square patches, 3/4 by 3/4 inch, and may be cut from ends. When underarm shields are cut from ends, the shields shall match each other. d. The body lining of the coat shall be cut from one piece of rayon lining material. All other rayon parts may be cut from ends. When pairs of sleeve linings are cut from ends, the shade of the lining in each pair shall match. e. The silesia or polyester and cotton stay for the breast pocket shall be cut in accordance with the patterns furnished. Cut silesia or polyester and cotton stays for armhole and shoulder seam on the bias, 3/4 inch wide and 4 to 4-1/2 inches long. f. The wigan for the bottom edge of the sleeves shall be cut on the bias in accordance with the pattern furnished. g. The interlining for the collar shall be cut on the bias in accordance with the pattern furnished. h. The scarlet wool broadcloth for piping the edges of the collar, and ornamental sleeve pieces shall be cut in warp direction, 3/4 inch wide. The underply of the shoulder strap shall be cut in accordance with the pattern furnished.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
2.	Replacement of damaged parts.					
	a. Replace at time of cutting any part of the coat containing holes, seriously weakening defects such as smashes, multiple floats, loose or weakening slubs, etc, expected to develop into holes, shade bars and dye streaks or unsightly slubs, etc.					
	b. Replace any part damaged during manufacturing process by needle chews which may develop into holes, scissors or knife cuts, tears, holes, mends or burns in the material.					
3.	Shade marking.					
	a. Mark or ticket (see 3.6.2) all component parts cut from one piece of basic and lining materials or the lining material can be bundled.					
	b. The use of tickets with any metal fastening devices or sew-on shade tickets is prohibited on the rayon lining.					
4.	Make shoulder straps.					
	Finished appearance. The shoulder strap shall be uniformly stitched and shall finish smooth and flat, without twists, gathers or puckers. The buttonhole shall be clean cut, well made, properly positioned, well worked over gimp to fit a 27-line insignia button and the stitching shall be securely caught in the basic material. The gimp shall be pulled through to the underside of the buttonholes and the purling of the buttonholes shall be on the outside of the straps. On the finished coat, the straps, including the scarlet edging shall measure 2-3/8 ± 1/8 inches wide.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
4.	Make shoulder straps. (cont'd)					
	a. The shoulder straps shall be made of one ply of basic material and one ply of cloth, broadcloth, wool scarlet.					
	b. Position top ply and underply face to face with edges even and stitch together 3/16 inch from the edge at front, back and collar end, evenly trimming the edges of the strap for proper turning.	301	SSe-2 (a)	10-14	A	A
	c. Turn the strap, working out the seams and extending the edge of the underply 1/8 inch beyond the edge of the top ply. Top stitch the top ply to the underply uniformly 3/16 inch from the folded edge of the underply.	301	BSm-2 (b)	10-14	A (silk)	A
	d. Press the strap smooth and flat with a heated pressing iron or pressing machine.					
	e. Make a horizontal, eyelet end, square bar type, cut first buttonhole, 3/4 inch long, in each strap midway between the back and front edges with the inside edge of the eyelet placed so that in the finished coat, the edge of the shoulder strap button will be 1/4 to 1/2 inch from the edge of the collar. The purling shall finish on the outside of the strap.	But-ton-hole		38 per button hole (minimum) (not including bartack)	A	A
	f. The buttonhole shall be well worked over gimp and the ends of the gimp shall be pulled through to the underside.					
	g. Securely bartack the ends of the buttonholes and trim the ends of the thread and gimp.	Bar-tack		21 per bartack (minimum)	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
5.	Make undercollar.					
	Finished appearance. On the finished collar, the piping shall extend uniformly and evenly 1/8 inch beyond the side and top edges.					
	a. The undercollar assembly shall consist of one piece of undercollar cloth and a single piece of interlining material.					
	b. Mark the breakline on the undercollar with the collarstand marker. Position the undercollar on the interlining with lower edges even and join together at the breakline. The breakline stitching shall measure 1-1/4 ± 1/8 inches at the vertical center of the undercollar.	301	SSa-1	10-14	A	A
	c. Quilt the interlining to the undercollar with 6 or 7 rows of blindstitching.	103	SSm-6 to 7	4-6	A	A
	d. Mark and trim undercollar in accordance with the undercollar shaper.					
6.	Assemble top collar and undercollar.					
	Finished appearance. On the finished coat, the collar shall be 2-7/8 ± 1/8 inches wide, including the piping, at the center back.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
6.	Assemble top collar and undercollar. (cont'd)					
	a. Position collarstand on top collar, face to face, with notches matching. Stitch collarstand to topcollar with 1/4-inch seam.	301	SSz-3 (a)	10-14	A	A
	b. Spread open the seam and topstitch the collarstand and top collar, respectively 1/16 inch from seamline.	301	SSz-3 (b)	10-14	A	A
	c. Position the 3/4-inch-wide strip of scarlet piping on the outside of the top collar with one edge even with the upper and side edges of collar. Stitch the piping to collar 1/8 inch from upper and side edges of the collar.	301	SSa-1	10-14	A	A
	d. Turn the piping to the inside, working out the points, and top stitch uniformly 3/16 inch from the folded edge of piping, catching the turned under portion in the stitching. The piping shall finish 1/8 inch beyond the edges of the collar. Notch out the excess piping at each end to prevent bulkiness.	301	SSe-2 (b)	10-14	A (silk)	A
	e. In order to retain the proper shape in accordance with the pattern, press the top collar smooth and flat with a heated pressing iron or pressing machine.					
	f. Mark notches on the underside of top collar marker for proper position of undercollar.					
	g. Position the undercollar to the underside of the top collar with marks on the undercollar and top collar matching, and with the upper edge and each end of the undercollar in line with the stitching line of scarlet	101 or Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
6.	Assemble top collar and undercollar. (cont'd)					
	piping. Baste the undercollar to the top collar along the piped edges.					
	h. Fell raw edge of the undercollar to the scarlet piping on each end of the collar, and continue to fell along the upper edge of entire length of collar.	Hand		8-10	C (silk)	
	i. Press the collar smooth and flat with a heated pressing iron or pressing machine.					
	j. Trim the gorge and neck edge of top collar to provide for proper seaming to the coat, and cut a guide notch in the lower neck edge of top collarstand at center.					
	k. Make one eyelet at each end of the collar with center of eyelet 1 inch from the end and outer edge, respectively. The eyelet shall be well worked with the purling on either side of the collar, and shall finish with a 1/8-inch-diameter opening.	Eyelet		20 per eyelet (minimum)	A (silk) -or- 0 (silk)	A 0
7.	Make ornamental sleeve pieces.					
	Finished appearance. The piping shall be uniformly stitched to the ornamental sleeve pieces without twists, gathers, puckers, or pleats. The ornamental pieces shall finish smooth and flat and shall be uniform in appearance. The position of insignia buttons shall be in accordance with the marks on the pattern.					
	a. The ornamental sleeve pieces shall be made of one ply of basic material, piped with a 3/4-inch-wide strip (unhemmed) of scarlet wool broadcloth.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
7	Make ornamental sleeve pieces. (cont'd)					
	b. Seam a 3/4-inch-wide strip of scarlet piping to the ornamental sleeve pieces 1/8 inch from the top, the scalloped side and the bottom edges.	301	SSe-2 (a)	10-14	A or A (silk)	A or A (silk)
	c. Fold the scarlet piping, slightly offsetting the raw edge, and seam to edges as above.	301	SSav-2 (a)	10-14	A or A (silk)	A or A (silk)
	d. Turn back the sleeve pieces and the scarlet piping at the seamed edges, uniformally working the folded edge of the piping 1/8 inch beyond the edges of the sleeve pieces. Notch excess scarlet material at the top and lower points of ornamental pieces in order to reduce bulkiness. Topstitch the sleeve pieces uniformly 3/16 inch from the folded edge of the piping.	301	BSm-2	10-14	A (silk)	A (silk)
	e. Press ornamental sleeve pieces smooth and flat with a heated pressing iron or pressing machine. Sleeve pieces shall be uniform in shape and size.					
	f. Mark the edge of sleeve piece 1/4 inch from raw edge for seaming to sleeve. Mark location for insignia buttons as indicated by marks on the pattern. Assemble sleeve pieces in pairs.					
	g. Punch a hole through the sleeve piece at each mark for attaching 27-line insignia buttons.					
	h. Insert the shank of a 27-line insignia button through each hole and the stay piece and secure buttons to sleeve piece with ring toggle.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
8.	Seam sleeve at forearm.					
	Finished appearance. The forearm seam shall finish smooth and flat without twists, gathers, puckers, or pleats, and shall start and finish evenly at seam line.					
	a. Position the top and under sleeve, with notches matching, and join at the forearm with a 3/8-inch seam.	301 or 401	SSa-1	12-16	A	A
	b. Spread open the seam and press flat with a heated pressing iron.					
	c. With pattern marker, mark sleeve end for turnup and top sleeves for position of the ornamental sleeve piece.					
9.	Baste wigan reinforcement to sleeve.					
	a. Position the sleeve on the wigan reinforcement piece with the notches on the ends of the wigan in line with the turnup notches on the sleeve.					
	b. Tack the sleeve to the reinforcement piece along the forearm seam allowance, and along the backarm edges of the top and under sleeve.	101 or 301		8-12 8-12	A A	A A
	c. Baste sleeve and reinforcement piece together at the mark for the bottom turnup.	101 or 301				
	d. Trim ends of wigan even with backarm edges of the top and under sleeve.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
10.	Join ornamental sleeve piece to sleeve.					
	Finished appearance. The ornamental sleeve piece shall be uniformly stitched to the sleeve without twists, gathers, puckers, or pleats, and shall finish smooth, flat and without raw edges. The position of the ornamental sleeve piece shall be as shown on Figures 1 and 2.					
	a. Position the ornamental sleeve piece face to face on the top sleeve with marks on sleeve piece and sleeve matching, and the bottom edge of the sleeve piece aligned with the marked bottom turnup line. The bottom edge of the sleeve piece shall be even with the finished bottom edge of the sleeve.					
	b. Seam the ornamental sleeve piece to the sleeve on the mark, backtacking the sleeve piece no more than once for a distance of 3/8 to 1/2 inch at each end of stitching.	301	LSbj-1	10-14	A (silk)	A
	c. Turn the ornametal sleeve piece flat on the top sleeve and topstitch 3/16 inch from piped top, scalloped back and bottom edges.	301		10-14	A (silk)	A
11.	Seam sleeves at backarm.					
	Finished appearance. The backarm seam shall finish smooth and flat without twists, gathers, puckers, or pleats and shall start and finish evenly at seam line.					
	a. Join the top and under sleeve together at the backarm with a 3/8 inch seam, catching the ends of the wigan reinforcement piece in the stitching.	301 or 401	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
11.	Seam sleeves at backarm. (cont'd)					
	b. Spread open the seam and press smooth and flat with a heated pressing iron.					
	c. Turn up the bottom of the sleeve at the mark and tack the raw edge to the reinforcement piece with blind-stitching. The basic material shall not be caught in the stitching.	306 or 313 or 103	EFc-1 (b)	4-6	A A	A
12.	Seam sleeve linings.					
	Finished appearance. The sleeve lining shall be uniform in appearance, uniformly stitched, and shall finish smooth and flat without twists, gathers, puckers, or pleats. The seams shall start and finish evenly at seam line.					
	a. Position the top and under sleeve lining in accordance with notches on the pattern and join the forearm and backarm respectively with 3/8-inch seams.	301 or 401	SSbd-1 or SSa-1	10-14	A	A
13.	Assemble sleeve and sleeve lining.					
	Finished appearance. The sleeve linings shall be positioned, and seamed or tacked to sleeve without twists, gathers, puckers or pleats.					
	a. Position the sleeve lining on the sleeve with the upper edge of lining extending 3/4 to 1 inch beyond the armhole edge of sleeve.					
	b. Seam or tack the forearm and backarm seam allowances to the corresponding seam allowance of top sleeve with the seam lines aligned,	301 or Hand	SSa-1	6-8 1-2	A A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
13.	Assemble sleeve and sleeve lining. (cont'd)					
	commencing at the top edge of wigan reinforcement piece and extending to approximately midway to the armhole edge at the forearm and backarm. The fullness in the lining shall be evenly distributed.					
	c. Turn sleeve lining over the sleeve.					
14.	Fell turnup of sleeve lining; press sleeves.					
	Finished appearance. The sleeve linings shall not be short, tight or twisted.					
	a. Turn under the bottom edge of sleeve lining to finish 1 to 1-1/4 inches above the finished bottom edge of sleeve, and baste to turnup of sleeve.	101 or Hand				
	b. Fell the folded edge of sleeve lining to turnup of sleeve with blindstitching.	314 or Hand		6-8 8-10	0 (silk) C (silk)	0
	c. Turn sleeves right side out and assemble in pairs. Insert a sleeve pad in the sleeve to avoid creasing the front and back edges, and press smooth and flat with a heated pressing machine.					
15.	Make welt.					
	Finished appearance. The welt shall be uniformly stitched and shall finish smooth and flat without twists, gathers, puckers, pleats or raw edges.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBV LPR
15.	Make welt. (cont'd)					
	a. The welt for the simulated breast pocket shall be made of a single piece of basic material folded in accordance with notches and reinforced at the inside folded edge with 1/4-inch-wide cotton tape.					
	b. Position the tape on the underside of the welt piece with one edge even with the fold notches and seam 1/16 inch from the edge of the tape next to the fold line.	301	LSbj-1	10-14	A	A
	c. Fold the welt at the fold notches, with the tape on the outside, and close the ends with a 1/4-inch seam. Trim the corners of welt for proper turning.	301	SSa-1	10-14	A	A
	d. Turn the welt to the right side, working out the edges and corners completely. Edgestitch the welt uniformly 1/8 inch from seamed and folded edges.	301	SSe-2 (Seamed edges) OSf-1 (Folded edges)	10-14	A	A
	e. Press the welt smooth and flat with a heated pressing iron or pressing machine.					
16.	Make underarm shields.					
	Finished appearance. The underarm shields shall be made from one ply of basic material and shall finish smooth and flat without puckers, gathers, pleats or raw edges and shall be uniform in size and shape.					
	a. Bind the rounded edge of the underarm shield with bias binding, turning under the outside raw edge of the binding only and catching the turned under portion in the stitching 1/16 inch from folded edge.	301	BSb-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
17.	Fold and stitch darts in front lining.					
	Finished appearance. The dart shall be tapered to a point at upper and lower ends.					
	a. Fold front lining and stitch waist darts in accordance with marks indicated on the pattern, tapering the upper and lower ends to a flat point. Points shall be securely backtacked. Stitching shall be 3/8 inch from folded edge at the center.	301 or 401	OSf-1	10-14	A	A
18.	Seam wool facing to front lining; sew on label.					
	Finished appearance. The lining shall be carefully seamed to the facing so that in the finished coat, the lining shall be smooth and flat along the facing without creases, bulges, overlapping of excess material, or other defects or distortion.					
	a. Position the lining on the wool facing, with notches matching, and seam the front edge of the lining to the back edge of the facing 3/8 inch from the edge. The stitching shall extend from top (shoulder) edge of facing to approximately 1-1/4 inches from the bottom edge.	301 or 401	SSa-1	10-14	A	A
	b. Sew the identification label to the left front lining with a single row of stitching 1/16 inch from each edge of the label. The label shall be positioned horizontally with one end adjacent to the facing-lining joining seam and the lower edge of label approximately 3 inches above the bottom edge of the coat. The ends of the label stitching shall overlap not less than three stitches.	301	SSbj-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBV LPR
19.	Press lining seams and darts.					
	a. Press the facing lining joining seams and waist darts smooth and flat with a heated pressing iron or pressing machine.					
	b. The facing lining joining seam shall be pressed with the raw edge of the seam allowance toward the back. The waist darts shall be pressed with the folded edge towards the front.					
20.	Make yoke lining.					
	Finished appearance. The hem shall be uniformly stitched and shall finish smooth and flat without twists, gathers, puckers or pleats. The hem shall be 3/8 ± 1/8 inch wide.					
	a. Hem the bottom edge of the yoke lining with the raw edge turned under and caught in the stitching 1/16 inch from the folded upper edge of the hem.	301	EFb-1	10-14	A	A
21.	Make center pleat in yoke lining.					
	Finished appearance. The pleat shall finish smooth and flat without puckers or pleats. The folded edge of the pleat on the outside of the yoke shall be toward the left side.					
	a. Fold yoke lining in accordance with the notches on the pattern to form a 3/4-inch-wide pleat at the center back. Form the pleat by stitching across top of pleat at neckline.	301	SSa-1	10-14	A	A
	b. Press the pleat smooth and flat from the top to the bottom edges of the yoke lining with a heated pressing iron.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
22	Bind backs. Finished appearance. The binding shall be uniformly stitched. It shall not be tight or full causing puckers, gathers, or pleats. The basic material shall be securely caught in the stitching. a. The raw edges of the center and side backs shall be bound with the 3/4-inch-wide bias-cut binding with the outside raw edge only of the binding turned under and caught in the stitching 1/16 inch from the inner folded edge.					
	b. Bind the raw back edge of left and right center backs, respectively, from the top edge of backs to top end of vent. When binding the right center back, continue to bind the raw edge of right vent from top to bottom edge. The binding is not required along the top edge of the vent.	301	BSb-1	10-14	A	A
	c. Bind the raw side edge of left and right center backs, respectively, from top to bottom edge.	301	BSb-1	10-14	A	A
	d. Bind the raw side edges of left and right side backs from top to bottom edge.	301	BSB-1	10-14	A	A
23	Seam lining to left vent. Finished appearance. The vent lining shall be uniformly stitched and shall finish smooth and flat without twists, gathers, puckers or pleats.					
	a. Fold vent lining in half lengthwise face to face and stitch along the top, from the notches to the folded edge, with a 5/16-to 3/8-inch seam. Turn vent lining to the right side, forcing out corner and seam.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBV LPR
23.	Seam lining to left vent. (cont'd)					
	b. Position the raw edge of lining on the outside of left vent, with notches on the lining in line with the top end of vent; then seam together 3/8 inch from back edge. The lining shall extend from the notches to the bottom finished edge of coat.	301	SSe-2 (a)	10-14	A	A
	c. Turn the lining to the inside with the seam 1/16 to 1/8 inch back of folded edge. Stitch the entire length of vent 1/8 inch from the folded edge.	301	SSe-2 (b)	10-14	A	A
24.	Join backs.					
	Finished appearance. The side and center backs shall be joined without gathers, puckers or pleats. The folded edge of the right vent shall be in vertical line with the center back seam. In the finished coat, the right center back shall overlap the left center back not less than 3 inches when measured at bottom edge of coat and the right vent shall be 2 $\pm$ 1/8 inches wide measured at the bottom edge.					
	a. Stitch the 1/4-inch-wide stay tape to the inside of right center back along the vent, with the edge of the tape positioned approximately 1/8 inch in front of the fold notch of the vent.	301	SSaa-1	10-14	A	A
	b. Position the center backs with edges even and join with a 5/8-inch seam from the top edge of the backs to approximately 3/4 inch below top end of the vent, and from that point continue to stitch diagonally across the top end of the left and right vents to the bound edge of the backs.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
24.	Join backs. (cont'd)					
	c. Turn the right vent to the inside of the right center back in accordance with the notches and edge stitch uniformly 1/8 inch from the folded edge. The folded edge of vent shall be in line with the center back seam line.	301	OSf-1	10-14	A	A
	d. Join the left and right side backs to the respective center backs with a 3/8-inch seam.	301	SSa-1	10-14	A	A
25.	Press back seams and vent lining.					
	a. The side and center back seams and vent lining shall be pressed with a heated pressing iron or pressing machine.					
	b. Notch the top end of the left vent diagonally from the juncture point of the vent and the center seam allowance of the left center back to the lower end of the stitching for the center back seam.					
	c. Spread open the side and center back seams, respectively, and press flat.					
26.	Baste and stitch vent lining.					
	Finished appearance. The folded edge of the lining shall extend beyond the center seam allowance of the left backpart.					
	a. Baste vent lining to coat.	101 or Hand				
	b. Stitch the upper part of vent lining to the center back on each side of the seam allowance 1/8 inch from seamed edge of lining. Turn coat on outside.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBV LPR
26	Baste and stitch vent lining. (cont'd)					
	c. Stitch and backstitch across the top end of vent, through the vent lining, from the back center seam to the edge of the vent.	301	SSa-1	10-14	A	A (silk)
27	Seam reinforcement stay to armhole and shoulder.					
	Finished appearance. The silesia or polyester and cotton reinforcement stays shall be sewn to the armhole and shoulder edges of the fronts without gathers, puckers or pleats. The top end of the armhole stay and lower edge of the shoulder stay shall form a right angle at the armhole without the stays overlapping each other.					
	a. Seam the 3/4-inch-wide silesia or polyester and cotton stays to the underside of the fronts along the shoulder edge and upper front edge of the armhole, respectively, 1/8 inch from the outer edges.	301	SSaa-1	10-14	A	A
28	Join front and side front.					
	Finished appearance. Bust lines on both sides shall be alike. Fronts and side fronts shall be carefully joined without puckers or gathers. The seams shall start and finish evenly at the seam line. The contour of the waist and hip line shall be maintained in the seaming.					
	a. Fold side front with cut out edges even, and stitch waist dart in accordance with marks indicated on the pattern, tapering the upper and lower end to a flat point. Points shall be securely backtacked. Stitching shall be 3/8 inch from the cut out edge at the center.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
28.	Join front and side front. (cont'd)					
	b. Position fronts and side fronts with notches matching and join together with 3/8-inch seams.	301 or 401	SSa-1	10-14	A	A
	c. Spread open the front seam and waist darts and press flat with a heated pressing iron, maintaining contour.					
29.	Assemble simulated breast pocket on left front.					
	Finished appearance. The simulated breast pocket shall be smooth and flat with the ends of the welt uniformly stitched and with no puckering.					
	a. Mark the left front in accordance with breast pocket marker for position of breast pocket welt. Mark welt seam line on the underside 1 inch from folded edge for proper seaming to front.					
	b. Position the silesia or polyester and cotton stay piece for the pocket on the underside of the front. Position the welt on the outside of the left front, with marks on welt and front matching and with folded edge of welt towards the bottom edge of coat. Seam top ply of welt to the front at the mark through the stay piece.	301	LSbj-1	10-14	A	A
	c. Turn the pocket welt with the folded edge of welt towards top of front. Fold the body material over the raw edge of underply of welt. Fell the folded edge of the body material to the underply of welt with blindstitching. The felling shall not be visible on the outside of welt.	Hand		8-10	C (silk)	
	d. Tack the ends of welt to the front through the stay. The stitching shall be adjacent to the edge stitching for the welt.	Hand		8-10	C (silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
29	Assemble simulated breast pocket on left front. (cont'd) e. On the outside of the finished coat, the welt for the simulated pocket shall measure 1 ± 1/16 inch in height, and the width for each size coat, measured along top edge of welt, shall be as follows: Coat size — Width of Welt (inches) 6 through 12 — 3-1/2 14 through 22 — 4					
30	Seam reinforcement stay to armhole and shoulder. Finished appearance. The silesia or polyester and cotton stays shall be sewn to the front armhole and shoulder edges without gathers, puckers, or pleats. a. Seam the 3/4-inch-wide silesia or polyester and cotton stays to the underside of each front along the shoulder and upper front edges of armhole, respectively, 1/8 inch from the outer edge. The top end of the armhole stay and the lower edge of the shoulder stay shall form a right angle at the upper end of armhole without the stays overlapping each other.	301	SSaa-1	10-14	A	A
31	Interline fronts. a. Position the left and right fronts on the respective coat front interlining and baste along the front seams, properly distributing the fullness over the breast area. The basting shall extend from approximately 3 inches from the shoulder edge of fronts to approximately 1-1/2 inches from the bottom edge.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
31.	Interline fronts. (cont'd)					
	b. Baste the left front along the welt-joining seam line on the outside with the front and interlining lying smooth and flat.	101 Hopper				
	c. Tack the front and back ends of the simulated pocket stay to the coat front interlining. The tacking shall be as close as possible to the corners of the pocket.	101 Hopper or Hand				
	d. Baste horizontally along the shoulder, allowing room for setting shoulder pads and working the fullness on the front towards the armhole. Baste along the front of armhole approximately 1-1/2 inches from the edge and continue to baste down the back edge of interlining to approximately 1-1/2 inches from bottom edge of front.	101 Hopper				
	e. Baste along the breakline of lapel, starting at the gorge, and continue basting along the front edge below the breakline to approximately 1-1/2 inches from the bottom edge of front.	101 Hopper				
	f. Baste along the top and front edge of lapel down to the lower end of lapel.	101 Hopper				
32.	Baste bridle tape to lapel.					
	a. Position the 3/8-inch-wide bridle tape on the interlining side of the fronts along the breakline of lapel, with the front edge of the tape in line with notch in the gorge.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBV LPR
32.	Baste bridle tape to lapel. (cont'd)					
	b. Baste tape through the interlining and the front of coat along the breakline of lapel evenly and smoothly, holding the tape taut and properly distributing the fullness. The tape shall extend from the gorge notch to approximately 1-1/2 inches from the lower edge of lapel.	101 or Hand		6-8		
33.	Pad lapels.					
	a. Pad the lapels with seven to eight rows of blindstitching, from approximately 3/4 inch from front edge to the breakline, properly distributing the fullness of the interlining between the rows of stitching to roll the lapels.	103 or	SSm-7 or 8	4-8	A or 000	
		314	SSm-7 or 8	4-8	A or 000	A 000
	b. Blindstitch both edges of bridle tape to interlining.	103 or	SSm-2	4-8	A or 000	
		314	SSm-2	4-8	A or 000	A 000
34.	Press chest and lapels.					
	a. Roll press the lapels, shrinking to eliminate the fullness from the interlining, on a suitable type heated pressing machine.					
	b. Press the fronts individually on a suitable type heated pressing machine to conform to the shape of the body and eliminate excess fullness in the breast.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD	
					NDL	BOB/ LPR
35.	Join fronts and back.					
	Finished appearance. The fronts and side backs shall be joined together without puckers or pleats, The seams shall start and finish evenly at seam line. The contour of the waist and hip line shall be maintained in the seaming.					
	a. Position side fronts to the side backs at the sides with notches matching and join with a 3/4-inch seam.	301 or 401	SSa-1	10-14	A	A
36.	Press side and back seam.					
	a. Spread open the side and back seams and press flat with a heated pressing iron.					
37.	Tape armholes.					
	a. Sew the 1/4-inch-wide stay tape to the inside of basic material only at the lower edge of the armhole, starting from approximately 1/2 inch above the notch in the fronts and continuing along the back edge, to approximately 3/4 inch from the shoulder edge.	301 or 401	SSaa-1	10-14	A	A
	b. The tape shall be stitched with slight tension from front notch to side seam and shall be held taut along the back edge of armhole.					
	c. Press armhole tapes smooth and flat with a heated pressing iron.					
38.	Shape fronts.					
	a. Mark and shape the front edge of the coat. Mark and shape the lapels in accordance with the shaper furnished. The right front edge shall be dressed from the bottom notch to base of the lapel.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
38.	Shape fronts. (cont'd)					
	b. Mark the coat 1-1/4 inches from the bottom edge for the bottom turnup.					
	c. Trim the coat front interlining 1/4 to 3/8 inch back from the front edge of the fronts and top and front edge of the lapel. Trim bottom of interlining to approximately 1/4 to 3/8 inch above the mark for the bottom turnup.					
	d. On the finished coat, the top edge of the lapels shall be 1-1/4 ± 1/8 inches for sizes 6 through 12 and 1-1/2 ± 1/8 inches for sizes 14 through 22 when measured from tack at juncture point of collar and lapel to finished edge of lapel.					
39.	Bind bottom turnup.					
	a. Bind the raw edge of bottom turnup with bias binding, turning under the outside raw edge of binding only and catching the turned under portions in the stitching 1/16 inch from the inner folded edge. The binding shall extend from the vent at center back to approximately 2 inches beyond the side seam line.	301	BSg-2 (b)	10-14	A	A
40.	Baste facing-lining assemblies to fronts.					
	a. Position facing-lining assembly on outside of respective fronts and baste along the breakline, distributing the fullness in the breast area and continue to baste along the front and bottom edge. Baste front along top and front edges of lapel down to the lower end of lapel, working the fullness towards the center of lapel.	101 Hopper or Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
41.	Join facings and fronts with tape.					
	a. Join the facings and fronts together 3/16 inch from the top and front edges of lapel and front edges of coat, with the 3/8-inch-wide stay tape positioned on the interlining side of fronts, with the edge of the tape 1/8 inch from the front edges and caught in the stitching. Continue stitching along the lower edge of coat 3/16 inch above the front cutout with the tape properly positioned and caught in the stitching.	301	SSab-1	10-14	A	A
	b. The tape shall extend from the lapel notch to 1-1/2 to 2 inches from the side seams at the bottom of coat, except the tape is not required along the step of the left front. The tape shall be sewn with normal tension along the top and front edges of lapel and with slight tension along front and bottom edges of coat.					
42.	Fell tape to interlining.					
	a. Fell the back edge of the stay tape to the coat front interlining from the collar notch on top of lapel to the end of the tape at the bottom edge.	103	SSm-1	4-6	A	A
	b. Press the fronts and tape at the top and front edges of lapel, and front and bottom edges of coat, smooth and flat with a heated pressing iron or pressing machine.					
	c. Remove all basting stitches, trim lower front corner and corner of lapels. Notch lapel for proper turning.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
42.	Fell tape to interlining. (cont'd)					
	d. Spread open the front facing seam from label notch to the bottom edge of coat and press smooth and flat with a heated pressing iron.					
43.	Baste fronts and bottom edge of coat.					
	a. Turn the facing-lining assemblies to the inside of the fronts, working the corners of lapels out completely. Turn up the bottom of coat, lapping the back edge of facing on the ends of the bottom turnup and working the front corners out completely.					
	b. Baste along the top and front edges of the lapel, including the step of the left front and finished bottom edges of the coat, working the seams to the edges of the coat.	101 or Hand		4-6		
44.	Baste facing (second time).					
	a. Baste facing to front approximately 1-1/4 inches from the top and front edges of lapel and front and bottom edges of the coat, holding the lower corners of the coat in such a manner as to cause the lower front edge of front to roll inward.	101 or Hand				
	b. Baste along the breakline of the lapel, properly placing the fullness to allow the lapel to roll.	101 or Hand				
	c. Baste the lapel diagonally from the corners to the breakline, properly placing the fullness to allow the lapel to roll.	101 or Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
44.	Baste facing (second time). (cont'd)					
	d. Baste the facings to the front as close to the facing-lining seam as possible, placing the proper fullness over the breast area. The basting shall extend approximately 1-1/2 inches from the bottom edge of the coat to approximately 3 inches from the shoulder edges of facings.	101 or Hand				
45.	Tack facings at back edge to interlining.					
	a. Raise the lining and tack the seam allowance at back edge of the facings to the coat front interlining with blindstitching, starting approximately 2 inches from the bottom edge of coat and tacking to approximately 2-1/2 inches from the shoulder edge of interlining. Tacking shall be through seam allowance of facing and lining.	103 or 314 or Hand	SSa-1 SSm-1	4-6 4-6 4-6	A A C (silk)	A
46.	Fell bottom turnup.					
	a. Fell the bound and raw edge of the bottom turnup to the fronts and backs with blindstitching.	103 or 306 or Hand	EFm-1	4-6 4-6 4-6	0 (silk) 0 (silk) C (silk)	0
47.	Baste yoke lining to back.					
	a. Position and baste the one-piece rayon yoke lining to the inside of the back along the center pleat and armholes, shoulder (allowing room for shoulder pads) and bottom edge of the yoke.	101 or Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBV LPR
48.	Baste and fell front lining.					
	a. Fold the front lining at the shoulder in accordance with notches, forming a chest pleat, and baste the entire length of the pleat. Continue to baste from the lower edge of armhole along the side seam and across the bottom edge of lining. The folded edge of the chest pleat on the outside of the lining shall be toward the armhole.	101 or Hand				
	b. Turn under the back and bottom edge of lining and baste to coat, lapping the folded edge over the bottom and side seam and yoke lining and basting to allow room for felling.	101 or Hand				
	c. Fell the turned under portion of the front lining to the bottom turnup and side seam allowance of fronts and to the yoke lining with blindstitching 1/4 to 3/8 inch from the folded edge.	301 or Hand	EFc-1 (b)	6-8 8-10	0 C (silk)	0
49.	Trim front lining and interlining.					
	a. Trim the excess coat front interlining and front lining at the armhole.					
	b. Trim the yoke lining even with the back at the neck.					
50.	Baste shoulder pads.					
	a. Insert shoulder pad between interlining and chest padding of coat front interlining, in line with the armhole edge and securely tack the pad to the interlining and chest padding only.	101 or Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
51.	Seam shoulders.					
	Finished appearance. The shoulders shall be evenly joined with the front and back seam lines matching, working in the proper fullness on the backs in order that the shoulders may be properly shaped.					
	a. Join fronts and backs together at the shoulder with a 3/8-inch seam.	301 or 401	SSa-1	10-14	A	A
	b. Spread open the shoulder seam and press flat with a heated pressing iron or pressing machine over a suitable block, holding the shoulder short. Care shall be exercised in pressing the shoulder seam in order that the shoulders shall not have a distorted appearance in the finished coat.					
52.	Baste lining at shoulders and neckline.					
	a. Position shoulder interlining and lining at neck. Baste upper part of each shoulder on the outside and turn the coat on the inside. Turn under and lap the shoulder edge of the yoke lining on the front lining. Baste lining to coat along the folded edge with top end of chest pleat caught in the basting at the shoulders. Baste the lining to the back at the neck, from shoulder seam to shoulder seam.	Hand or 101 Hopper				
53.	Stitch hanger and label to coat.					
	a. Stitch the ends of the hanger and upper edge of the size label to the neck of coat at the inside center back.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBN/ LPR
53.	Stitch hanger and label to coat. (cont'd)					
	b. The hanger opening, in the finished coat, shall be 1-1/2 ± 1/8 inches long when measured along the neck edge of the collar.					
54.	Set collar.					
	Finished appearance. The seam joining top collar to facing at the gorge shall be of uniform gage and shall finish smooth and flat without twists, puckers, pleats, or other distortions.					
	a. Mark the coat on the outside around the neck from shoulder seam to shoulder seam, 5/8 inch from the top edge, and continue to mark along the gorge with the line of marking tapering to 3/8 inch at the lapel notch.					
	b. Join the top collar to the facing at the gorge, from the collar notch to a point not less than 1 inch in back of the lapel breakline.	301	SSa-1	12-16	A	A
	c. Clip the facing at the back end of joining seam.					
55.	Tack top collar to fronts at gorge.					
	a. Spread open the seam joining top collar to facing and tack the seam allowance of the top collar to the front at the gorge, from the collar notch to the back end of the seam, catching the top end of bridle tape in the tacking.	Hand or 301		2-4 12-16	C (silk) A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
56.	Baste undercollar to coat.					
	Finished appearance. Fullness in the collar along the neck edge shall be properly placed over the shoulders so that the collar will not be tight along the outer edge over the shoulders.					
	a. Turn the collar to the outside with the lower edge of the undercollar lapped on the outside of the coat at the mark.					
	b. Securely tack the corners of the undercollar across the juncture point of the collar and the lapel.	Hand		8-10	C (silk)	
	c. Baste the undercollar to the fronts and backs, placing proper fullness over shoulder.	Hand				
	d. In the finished coat, the ends of the collar shall be 1-1/4 ± 1/8 inches for sizes 6 through 12 and 1-5/8 ± 1/8 inches for sizes 14 through 22 when measured from the juncture of the collar and lapel to the finished edge.					
57.	Tack coat to collar interlining.					
	a. Raise the lower (neck) edge of the top collar and tack the neck edge of coat to the undercollar interlining with overcast stitches, or blind-stitching by machine, catching the back lining in the tacking from shoulder seam to shoulder seam.	Hand or 103	SSm-1	2-3 3-4	C (silk) A	
58.	Baste top collar to coat.					
	a. Turn under the lower edge of the top collar and collarstand and baste from gorge seam to gorge seam.	Hand or 101		4-6		
	-or-					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
58.	Baste top collar to coat. (cont'd)					
	b. In lieu of operations 57 a, 58 a, and 59 b, join lower edge of top collar and collarstand from gorge seam to gorge seam.	301	SSa-1	12-16	A	A
59.	Fell collar to coat.					
	a. Fell the neck edge of the undercollar to the fronts and backs from collar notch to collar notch.	Hand or		8-12	C (silk)	
		Machine (hand type felling) or	LSa-1	8-12	C (silk)	
		306	LSa-1	8-12	0 (silk)	0
	b. Fell the folded edge of the top collar to the coat from gorge seam to gorge seam, catching the top edge of the size label and the ends of the coat hanger in the stitching.	Hand		8-10	C (silk)	
60.	Edgestitch coat.					
	a. Stitch the top and front edge of lapel, front edge of coat (including the step of the left front) and continue the stitching along the bottom edge of coat the width of the facing.	301	SSe-2	10-14	A (silk)	A
61.	Set shoulder straps.					
	Finished appearance. The shoulder straps shall be uniform in length and setting. In the finished coat, the straps shall be 2-1/4 $\pm$ 1/8 inches wide at the armhole seam and shall taper to 1-5/8 $\pm$ 1/8 inches at the buttonhole eyelet end.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
61.	Set shoulder straps. (cont'd)					
	a. Position the shoulder straps with the rounded end of the strap even with the edge of the neck and with the notch at the back raw edge of shoulder strap aligned with the shoulder seam line at the armhole.					
	b. Stitch the shoulder straps to the coat 3/16 to 1/4 inch from the armhole edge. Trim the shoulder straps even with the armhole where necessary.	301 or 401	SSa-1	10-14	A	A
62.	Set sleeves.					
	Finished appearance. The sleeves shall be properly and carefully set and shall be uniformly stitched without twists, gathers, pleats, puckers or raw edges.					
	a. Position the outside of the sleeves on the outside of the coat with notches matching and with the sleeve lining turned back from the armhole edge.					
	b. Join the sleeves to the coat with a 3/8-inch seam, evenly distributing the fullness between notches and catching the end of the shoulder strap in the stitching.	301 or 401	SSa-1	10-14	A	A
	c. Press the armhole smooth and flat with a heated pressing iron to remove the fullness. Care shall be exercised in pressing the armhole seam in order not to stretch the armhole.					
63.	Baste armhole.					
	a. Baste around inside armhole, positioning yoke lining, shoulder pad, and front lining in place and distributing fullness evenly. Turn the coat on the outside.	101 or Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
63.	Baste armhole. (cont'd)					
	b. Baste around outside armhole adjacent to the armhole seam, forcing out the armhole in the basting. The basting shall extend the entire circumference of the armhole.	101 or Hand				
64.	Baste underarm shield to coat.					
	a. Position the underarm shield on the lining side of the coat at the base of armhole, and baste the shield to the coat along the armhole and outer (convex) edges.	101 or Hand				
65.	Tack armhole and stitch sleeve head pads.					
	a. Position the sleeve head pad on the sleeve, with the folded edge of the pad approximately 1/8 inch back from the raw edge of the armhole seam and with the front end of the pad matching the notch in the fronts.					
	b. Stitch the sleeve head pad from end to end to the sleeve through the armhole sleeve seam allowance, 1/8 inch from the folded edge of the pad, catching the front and back linings, shields at the base of armhole and shoulder pad in the stitching. Continue stitching the lining around the remainder of the armhole. Trim away the excess material.	301	SSa-1	4-6	30/3	30/3
66.	Tack underarm shields to lining.					
	a. Tack bottom edge of underarm shields on the underside to lining.	Hand		4 per tack (minimum)	C (silk)	
	b. In the finished coat, the shields shall measure not less than 2 inches in length from the folded edge of sleeve lining.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
67.	Fell back lining and facing-lining assembly at shoulders.					
	a. Fell the back lining and facing-lining assembly together at the shoulders, securing the top end of the shoulder pleat in the felling. The felling shall be placed over the folded edge of the back lining.	Hand		8-10	C (silk)	
68.	Fell sleeve lining at armhole.					
	a. Position the sleeve lining at the armhole, with the back and forearm seam of the sleeve and sleeve lining matching.					
	b. Turn under the top raw edge of the sleeve lining and lap 1/4 to 3/8 inch onto the armhole seam allowance over the front and back lining and underarm shield. Fell the sleeve lining to the coat around the entire armhole, placing the stitching over the folded edge of sleeve lining and distributing the fullness in accordance with good commercial practice. Backstitch 1/8 inch from the felled edge of sleeve lining along the lower armhole from approximately 1-1/2 inches above the forearm seam line in sleeve lining to the side seam line in the body lining.	Hand		8-10	C (silk)	
	or					
	c. Machine stitch lower edge of sleeve lining, at the armhole, on the inside from forearm seam to backarm seam and hand fell the remaining portion as specified in operation 68 b above.	301	SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
68.	Fell sleeve lining at armhole. (cont'd)					
	d. Machine stitch lower edge of sleeve lining, at the armhole, on the inside from forearm seam to backarm seam and stitch remaining portion of the sleeve lining at the armhole with machine simulated hand felling.	Machine simulated		8-10	C (silk)	
	NOTE: It is required that the simulated hand felling produced by machine shall be equal to or better than hand felling.					
69.	Make buttonholes.					
	Finished appearance. The buttonholes shall be cut-first type, clean cut, well made and well worked over gimp to fit a 40-line insignia button. The stitching of the buttonholes shall be securely caught in the basic material. The gimp shall be pulled through to the underside of the front. The purling of the buttonholes shall be on the outside.					
	a. Mark the right front in accordance with the marks on the pattern for the locations of four buttonholes. The buttonholes shall be evenly spaced.					
	b. Make one horizontal eyelet-end, square-bar type buttonhole, 1-1/8 inches long at each of the marks. The inside edge of the eyelet end of the buttonhole shall be 5/8 inch from the front edge of the coat.	Buttonhole		50 per button (minimum) not including bartack	B (silk)	F
	c. Securely bartack the ends of each buttonhole, catching the ends of the gimp in the bartack. Trim the ends of the gimp.	Bartack		21 per bartack	A (silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
70.	Clean coat. a. Pull and remove all basting thread. Trim all ends of stitching and remove all loose ends of thread from the coat. Remove all spots, stains and shade tickets and markings without injury to the material.					
71.	Press coat. a. The coat shall be well pressed throughout with a heated iron or pressing machine of a type suitable to obtain the desired shape and appearance in accordance with good manufacturing practices. b. Block the shoulders to remove the fullness and press shoulders smooth on a shoulder shaping machine with shoulder straps properly positioned over shoulder seam and pressed flat. c. Press the armholes solid from the inside, creasing the sleeve lining at the edge of the armhole seam allowance in the front, back and armpit of the lower armhole. The armpit and the back of the armhole shall be held short while pressing. d. Block the armholes on a pressing buck, shrinking in top sleeves. Sleeves shall not be creased. e. Press the entire collar smooth and flat, stretching where necessary to obtain the proper shape and staightening the edges, working any fullness towards the center of the collar and removing the fullness by shrinking.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
71.	Press coat. (cont'd) f. Press the lapels smooth and flat from the breakline to the front edge, straightening the edges and working the fullness towards the center of the lapel and removing the fullness by shrinking. Lapels shall not be creased. g. Press the fronts and welt for the simulated pocket smooth and flat on a body machine, straightening the front edges of the coat, working the fullness towards the bust, and shrinking and properly shaping the chest. Care shall be exercised in pressing the fronts so that the bottom edges are even. h. Press the collar by creasing on the breakline for a distance of 4 to 5 inches centered across the center back. i. Press bottom edge of coat smooth and flat, exercising care that the lining is not exposed below the bottom edge. j. Press the sides, working the fullness towards the back. k. Press the back smooth and flat, removing all fullness. l. Insert a sleeve pad in the sleeves in order to prevent creasing, and press sleeves smooth and flat. m. Remove all wrinkles and impressions from under the lapels, collar and shoulder straps.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
71.	Press coat. (cont'd)					
	n. Press pleats in upper front lining and center back lining smooth and flat.					
	o. Press lining throughout with a heated pressing iron, removing all wrinkles and creases.					
72.	Mark for buttons.					
	a. Mark the location for sewing four 40-line insignia buttons to the left front of the coat, 1 inch back from the finished edge, to properly engage buttonholes in the right front.					
	b. Mark the location for sewing one 27-line insignia button to each shoulder to properly engage with the neck end of the buttonhole in the shoulder straps, in order that on the finished coat, the straps shall lie smooth and flat without twisting or bulging.					
73.	Sew on buttons.					
	a. The buttons shall be securely sewn to the coat with the ends of the stitching securely tacked.					
	b. Sew one 27-line insignia button at the mark on each shoulder. The buttons shall not be sewn through the lining.	Hand or 301 or 101		4-6 per button (double thread) 14-16		16/4
	c. Sew one 40-line insignia button at each of the marks on the left front through all plies.	Hand or 301 or 101		4-6 per button (double thread) 14-16		16/4

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
73.	Sew on buttons. (cont'd) d. The insignia buttons on the front shall be sewn with the eagle upright. The shoulder buttons shall be sewn with the head of the eagle towards the edge of the collar.					

3.7 Finished measurements. The finished coat shall conform to the measurements shown in Table II.

Table II. Finished measurement 1/

Size	1/2 Bust 2/ (Short, Regular, Long)	Back length 3/ Short	Back length 3/ Regular	Back length 3/ Long	Sleeve length 4/ Short	Sleeve length 4/ Regular	Sleeve length 4/ Long
	inches	inches	inches	inches	inches	inches	inches
6	17-1/4	25	26		16-1/4	17-1/4	18-1/4
8	17-3/4	25-1/4	26-1/4	27-1/2	16-1/4	17-1/4	18-1/4
10	18-1/4	25-1/2	26-1/2	27-3/4	16-1/4	17-1/4	18-1/4
12	19	25-3/4	26-3/4	28	16-1/4	17-1/4	18-1/4
14	19-3/4	26	27	28-1/4	16-1/4	17-1/4	18-1/4
16	20-1/2	26-1/4	27-1/4	28-1/2	16-1/4	17-1/4	18-1/4
18	21-1/2	26-1/2	27-1/2	28-3/4	16-1/4	17-1/4	18-1/4
20	22-1/2	26-3/4	27-3/4	29	16-1/4	17-1/4	18-1/4
22	23-1/2	27	28	29-1/4	16-1/4	17-1/4	18-1/4

1/ Tolerance on all measurements: ± 3/8 inch. Tolerance is on 1/2 bust measurement.

2/ Bust measurement taken with coat buttoned from folded edge to folded edge in line with pit of armhole.

3/ Back length measurement taken along center back seam from lower edge of the undercollar to bottom edge of coat.

4/ Sleeve length measurement taken along forearm seam from the armhole seam line to bottom edge of sleeve.

3.8 Workmanship. The finished coats shall conform to the quality and grade of product established by this specification. The occurrence of defects shall not exceed the applicable point value or defect limit.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

4.2 Classification of inspection. The inspection requirements specified herein are classified as follows:

1. First article inspection (see 4.4).
2. Quality conformance inspection (see 4.5)

4.3 Inspection conditions. Unless otherwise specified, all inspections shall be in accordance with the test conditions specified in MIL-STD-1608.

4.4 First article inspection. When first article is required, inspection shall be made of a completely fabricated coat for all provisions of this specification.

4.5 Quality conformance inspection.

4.5.1 Testing of components. Testing of components shall be in accordance with the applicable subsidiary specifications and standards to the extent applicable, except that this specification shall govern in the event of conflict. The method of testing shall be as specified in FED-STD-191, wherever applicable.

4.5.2 In-process inspection. Inspection shall be performed during the manufacturing of the end item to ascertain that the operations are performed as specified herein. The Government reserves the right to determine the acceptability of construction methods not performed in accordance with specified requirements for operations or subassemblies.

4.5.3 Examination of the end item. Prior to the formation of a lot and as a final step in the contractors production control plan, each coat shall be buttoned on a model form and examined for those defects identified by an asterisk (*) and listed as selected defects in MIL-STD-1608. Any coat containing a selected defect shall not be included in the end item lot.

4.5.3.1 Finished measurement examination. The provisions for the finished measurement examination of the finished coat shall be as specified in MIL-STD-1608 and as outlined in 3.7.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

4.5.4 Examination of packaging. Shipping containers that are fully prepared for delivery except for closure shall be subjected to the examination of preparation for delivery described in MIL-STD-1608. The occurrence of defects during this examination shall not exceed the applicable point value or defect limit specified in MIL-STD-1608.

5. PACKAGING

5.1 Preservation and packaging. Preservation and packaging shall be level A or commercial as specified (see 6.2).

5.1.1 Level A. Each coat shall be folded in half lengthwise inside out with the front edges and lapels aligned, the collar turned up, one armhole inserted in the other and sleeves lying full length between the fold. The coats shall be folded in half again in the length and then folded in half in the width.

5.1.2 Commercial. Commercial packaging shall afford adequate protection against deterioration and physical damage during shipment from the supply source to the first receiving activity. The contractor may use his standard practice provided it meets the requirements specified for commercial packing.

5.2 Packing. Packing shall be level A, B or commercial as specified (see 6.2).

5.2.1 Level A.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

5.2.1.1 Method 1. Ten coats of one size only, folded as specified in 5.1.1 shall be packed in a fiberboard shipping container conforming to class weather resistant, size 2A of MIL-B-17757. Four coats shall be placed in the bottom of the container with collars at one end and the armholes of the coats placed alternately at opposite sides. Four coats shall be similarly placed with collars at the other end of the containers. The two remaining coats shall be placed on top with the collars and armholes of each placed at opposite sides and ends, respectively, of the container. Each container shall have the contents completely covered on top and bottom with a sheet of 60-pound minimum basis weight kraft paper conforming to grade B of UU-P-268. Each shipping container shall be assembled, closed and reinforced as specified in the appendix to the box specification. Towards the end of the contract, or when there is less than the required amount per container of the same size, mixed sizes may be packed within the same shipping container.

5.2.1.2 Method 2. When specified (see 6.2), six level B shipping containers (60 coats of one size only) shall be overpacked in a fiberboard shipping container conforming to class weather resistant, size 4, of MIL-B-17757 reinforced as specified in appendix to the box specification. Towards the end of the contract or when there is less than the required amount per container of the same size, mixed sizes may be packed within the same shipping container.

5.2.2 Level B. Ten coats of one size only, folded as specified in 5.1.1, shall be packed in a fiberboard shipping container conforming to class domestic, size 2A of MIL-B-17757. The fiberboard used for fabricating the container and the liner shall be grade 275. Four coats shall be placed in the bottom of the container with collars at one end and the armholes of the coat placed alternately at opposite sides. Four coats shall be similarly placed with collars at the other end of the container. The two remaining coats shall be placed on top with the collar and armholes of each placed at opposite sides and end, respectively, of the container. Each container shall have the contents completely covered on top and bottom with a sheet of 60-pound minimum basis weight kraft paper conforming to grade B of UU-P-268. Each shipping container shall be assembled, closed, and reinforced as specified in the appendix to the box specification. Towards the end of the contract, or when there is less than the required amount per container of the same size, mixed sizes may be packed within the same shipping container.

5.2.3 Commercial. Coats shall be packed in a manner to insure carrier acceptance and safe delivery at destination. Containers shall be in accordance with Uniform Freight Classification Rules, National Motor Freight Classification Rule and U. S. Postal Service Manual or regulations of other carriers applicable to the mode of transportation.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

5.3 Marking. In addition to any special marking required by the contract shipping containers shall be marked in accordance with MIL-STD-129.

5.3.1 Mixed sizes. Each shipping container that is packed with mixed sizes (see 5.2.1 and 5.2.2) shall have, securely attached to the end and side, directly under the printing or stenciling, a white paper label 5 inches by 4 inches. The words "MIXED SIZES" shall be plainly stamped or printed on the label. The quantity and sizes of the coats contained in the shipping container shall be legibly stamped or printed under the words "MIXED SIZES" on the label.

6. NOTES

6.1 Intended use. The coats described herein are intended for wear by women personnel of the U. S. Marine Corps.

6.2 Ordering data. Purchasers should exercise any desired options offered herein, and procurement documents should specify the following:

6.2.1 Procurement requirements.

(a) Title number and date of this specification.
(b) Size required (see 1.2)
(c) Whether first article is required (see 3.2).
(d) Type insignia buttons required (see 3.3.1
(e) Levels of packaging and packing required (see 5.1 and 5.2).
(f) When level A, method 2, packing is required (see 5.2.1.2).

6.2.2 Contract data requirements. Data conforming to Data Item Descriptions DI-R-4803, DI-R-4805, DI-T-4901, DI-T-4902, DI-T-4903 and DI-T-4904 will usually be required for delivery in connection with this specification. When so required, such data will be specified for delivery on a DD Form 1423 included in the contract.

6.3 Samples and shade samples. For information regarding the availability of sample of the coat and of standard shades specified, address inquiry to the procuring activity issuing the Invitation for Bids.


6.4 First article. First article examination, test and approval shall be as specified by the contracting officer (see 3.2).

6.5 Figures. Figures 1 and 2 show general design of the coat and are furnished for information only. In the event of conflict between these figures and the text of this specification, the text of this specification shall govern.

6.6 Marginal notations. Asterisks are not used in this revision to identify changes with respect to the previous issue, due to the extensiveness of the changes.

Preparing activity
Navy - MC
Project No. 8410-N471

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

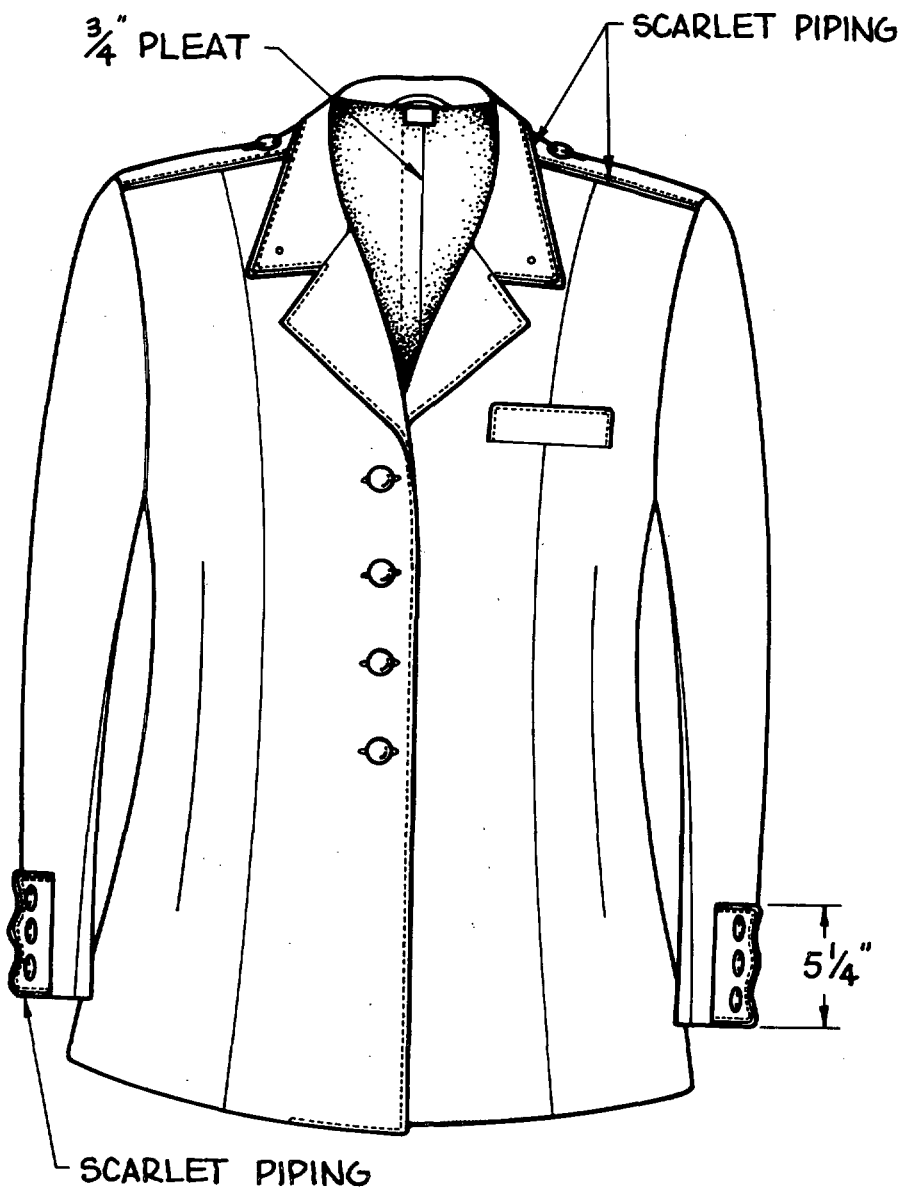

FRONT VIEW

FIG. 1 COAT,WOMAN'S:WOOL,GABARDINE,BLUE

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

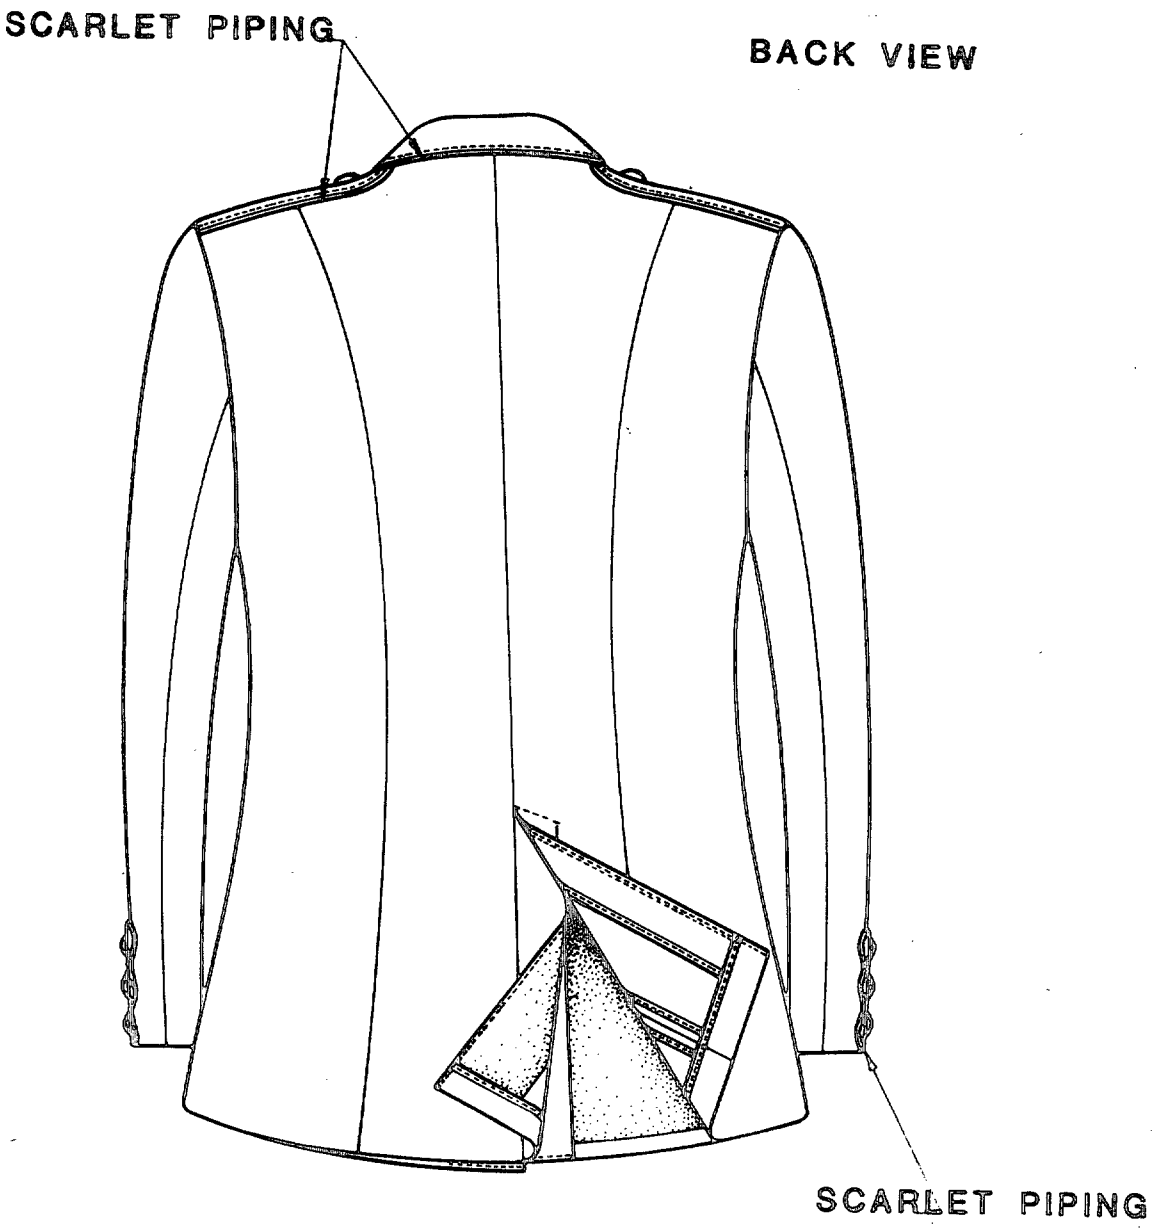


FIG. 2 COAT,WOMAN'S,WOOL,GABARDINE,BLUE

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

OMB Approval
No. 22-R255

INSTRUCTIONS: The purpose of this form is to solicit beneficial comments which will help achieve procurement of suitable products at reasonable cost and minimum delay, or will otherwise enhance use of the document. DoD contractors, government activities, or manufacturers/vendors who are prospective suppliers of the product are invited to submit comments to the government. Fold on lines on reverse side, staple in corner, and send to preparing activity. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements. Attach any pertinent data which may be of use in improving this document. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity.

DOCUMENT IDENTIFIER AND TITLE

MIL-C-21084D(MC) COAT, WOMAN'S: WOOL, GABARDINE, BLUE

NAME OF ORGANIZATION AND ADDRESS

CONTRACT NUMBER

MATERIAL PROCURED UNDER A

☐ DIRECT GOVERNMENT CONTRACT ☐ SUBCONTRACT

1. HAS ANY PART OF THE DOCUMENT CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE?

A. GIVE PARAGRAPH NUMBER AND WORDING.

B. RECOMMENDATIONS FOR CORRECTING THE DEFICIENCIES

2. COMMENTS ON ANY DOCUMENT REQUIREMENT CONSIDERED TOO RIGID

3. IS THE DOCUMENT RESTRICTIVE?

☐ YES ☐ NO *(If "Yes", in what way?)*

4. REMARKS

SUBMITTED BY *(Printed or typed name and address - Optional)*

TELEPHONE NO.

DATE

DD FORM 1 JAN 72 1426 REPLACES EDITION OF 1 JAN 66 WHICH MAY BE USED

S/N 0102-LF-014-1802

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.

FOLD

DEPARTMENT OF THE NAVY
Headquarters, U. S. Marine Corps
Washington, D. C. 20380

OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

POSTAGE AND FEES PAID
DEPARTMENT OF THE NAVY
DOD-317



Commandant of the Marine Corps
Headquarters, U. S. Marine Corps
(Code LMA-1)
Washington, D. C. 20380

FOLD

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T08:43Z
Check the source to verify that this is the current version before use.