MIL-E-45782B
28 December 1967
Superseding
MIL-E-45782A(MI)
16 January 1964

MILITARY SPECIFICATION

ELECTRICAL WIRING, PROCEDURES FOR

This specification is mandatory for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification covers the fabrication and termination of shielded electrical harness and cable assemblies and the wiring of electrical and electronic circuits of subassemblies used in missile systems.

1.2 Classification. Shield termination and securing of harnesses, cables, and wire bundles shall be of the following types, classes, and methods, as specified (see 6.2). In the event that a class or method is not applicable to a particular assembly, that portion of the classification shall be omitted from the ordering data (see 6.2(b)).

Example:	III	2	D	a
	Type (See 1.2.1)	Class (See 1.2.2)	Method, Terminating (See 1.2.3)	Method, Securing (See 1.2.4)

1.2.1 Type. Shield terminations shall be of the following types:

Type I - Without ferrules
Type II - With one-piece ferrules. (Not for use in new design, see 6.7)
Type III - With two-piece ferrules.

FSC 1430

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

1.2.2 Class. Shield terminations shall be of the following classes:

Class 1 - Ungrounded.
Class 2 - Grounded.

1.2.3 Terminating method. Shields terminated with ferrules shall be in accordance with one of the following methods (see 3.3.3.3).

Method A - One-piece ferrule. (See 6.7)
Method B - Two-piece ferrule - braided shield.
Method C - Two-piece ferrule - combed shield.
Method D - Two-piece ferrule - folded, combed shield.
Method E - Two-piece ferrule - insulated, folded, combed shield.
Method F - Two-piece ferrule, multiple - shielded conductors, double-folded shield.
Method G - Two-piece ferrule, multiple-shielded conductors, single-folded shield.

1.2.4 Securing method. When cables, harnesses, or wire bundles are to be secured, they shall be secured in accordance with one of the following methods (see 3.3.8):

Method a - Double-lock stitch.
Method b - Single-lock stitch.
Method c - Lacing ties.
Method d - Harness straps.

2. APPLICABLE DOCUMENTS

* 2.1 The following document of the issue in effect on date of invitation for bids or request for proposal, form a part of this specification to the extent specified herein.

SPECIFICATIONS

FEDERAL

* O-F-506 - Flux, Soldering, Paste and Liquid.
P-D-680 - Dry-Cleaning Solvent.
QQ-B-575 - Braid, Wire (Copper, Tin-Coated Tubular).
* QQ-S-571 - Solder, Tin Alloy, Lead-Tin Alloy, and Lead Alloy.

MILITARY

MIL-C-17 - Cables, Radio Frequency; Coaxial, Dual Coaxial, Twin Conductor, and Twin Lead.
* MIL-I-631 - Insulation, Electrical, Synthetic-Resin Composition, Nonrigid.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

* MIL-T-713 - Twine, Impregnated, Lacing and Tying (for use in Electrical and Electronic Equipment)

MIL-Y-1140 - Yarn, Cord, Sleeving, Cloth and Tape, Glass

MIL-I-3190 - Insulation Sleeving, Electrical, Flexible, Treated

MIL-C-5015 - Connectors, Electric, AN Type

MIL-W-5086 - Wire, Electrical, 600-volt, Copper, Aircraft

* MIL-C-7078 - Cable, Electric, Aerospace Vehicle, General Specification for

MIL-W-7139 - Wire, Electrical, Polytetrafluoroethylene-Insulated, Copper, 600-volt

MIL-I-7444 - Insulation Sleeving, Electrical, Flexible

MIL-T-7928 - Terminals, Lug and Splice, Crimp Style, Copper

MIL-W-8160 - Wiring, Guided Missile, Installation of, General Specification for

MIL-C-8603 - Clamps, Tube Support, Loop Type

* MIL-F-14256 - Flux, Soldering, Liquid (Rosin Base)

MIL-W-16878 - Wire, Electrical, Insulated, High Temperature

MIL-I-18057 - Insulation Sleeving, Electrical, Flexible, Glass Fiber, Silicone Rubber Treated

* MIL-F-21608 - Ferrule, Shield Terminating, Crimp Style, Brass

MIL-I-22076 - Insulation Tubing, Electrical, Nonrigid, Vinyl Very Low Temperature Grade

MIL-I-22129 - Insulation Tubing, Electrical, Polytetrafluoroethylene Resin, Nonrigid

* MIL-W-22759 - Wire, Electrical, Fluoro-Carbon-Insulated, Copper and Copper Alloy

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

* MIL-T-22910 - Tool, Crimping, Hand, for Crimp Style Electric Terminal and Shield Ferrule

* MIL-I-23053 - Insulation, Tubing, Electrical, Heat-Shrinkable

* MIL-S-23190 - Strap, Cable, Adjustable, Plastic

MIL-C-26482 - Connectors, Electric, Circular, Miniature, Quick Disconnect

* MIL-C-26500 - Connectors, General Purpose, Electrical, Miniature, Circular, Environment Resisting, 200 Deg. C Ambient Temperature

* MIL-C-27500 - Cable, Electrical, Shielded and Unshielded, Aircraft and Missile

* MIL-C-38300 - Connectors, Electrical, Circular, Multicontact, High Environment, Quantitative Reliability, General Requirements for

MIL-C-45224 - Cable and Harness Assemblies, Electrical, Missile System: General Specification for

* MIL-S-45743 - Soldering, Manual Type, High Reliability, Electrical Connections; for Missile Systems, Procedures for

* MIL-W-81044 - Wire, Electric, Cross Linked Polyalkene Insulated, Copper

STANDARDS

MILITARY

MIL-STD-130 - Identification Marking of U. S. Military Property

MIL-STD-202 - Test Methods for Electronic and Electrical Component Parts

MIL-STD-454 - Standard General Requirement for Electronic Equipment

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

* MIL-STD-826 - Electromagnetic Interference Test Requirements and Test Methods

* MS-3057 - Clamp, Cable, Electrical Connector

* MS-17823 - Tool, Hand, for Adjustable Plastic Cable Straps

* MS-17824 - Tool, Hand, for Adjustable Plastic Cable Straps

* MS-18034 - Strap, Cable, Adjustable, Plastic, Type I

* MS-20031 - Connectors, Receptacle, Electric, Solder Type, Jam Nut Mounting, Hermetic Seal

* MS-20032 - Connectors, Receptacle, Electric, Solder Mounting, Hermetic Seal

* MS-20659 - Terminal, Lug, Crimp Style, Copper, Uninsulated, Class I

MS-25036 - Terminal Lug, Crimp Style, Copper, Insulated, Class I

MS-25037 - Crimping Tool, Hand, for Copper, Insulated Terminals

MS-25181 - Splice, Electric, Permanent, Crimp Style, Copper, Insulated, Class I

*

MS-63042 - Crimping Tool, Terminal, Hand

AIR FORCE-NAVY AERONAUTICAL

AN-3427 - Crimping Tool, Electric Cable Terminal, Hand

* MS-17776 - Crimping Tool, Electric Wire Terminal, Hand, 22-10 Capacity

(Copies of specifications, standards, drawings, and publications required by suppliers in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

2.2 Other publications. The following documents form a part of this specification to the extent specified herein. Unless otherwise indicated, the issue in effect on date of invitation for bids or request for proposal shall apply.

Aeronautical Materials Specification
AMS-3815 - Braid, Flat, Nylon

(Application for copies of AMS specifications, should be addressed to the Society of Automotive Engineers, Inc., 485 Lexington Avenue, New York 17, N. Y.)

National Aerospace Standards Committee
NAS 702 - Wire, Electrical, Insulated, Copper Hook-up and General Purpose (For 105° C. Service)

* NAS 1599 - Connectors, General Purpose, Electrical, Miniature Circular, Environmental Resisting, 200° C. Maximum Temperature

(Application for copies should be addressed to the National Standards Association, Inc., 1315 Fourteenth Street, N. W., Washington 5, D. C.)

3. REQUIREMENTS

3.1 Specification application. In the event of any conflict between requirements of this specification and applicable drawings, the latter shall govern. This specification shall be used to establish requirements not otherwise specified.

* 3.1.1 Preproduction approval. Preproduction approval for a new procedure or for use of a nonstandard part, material, or tool (see 6.3.10), if required (see 6.2), shall be obtained prior to production. (see 6.3.11).

* 3.2 Materials and parts. Materials and parts shall conform to the applicable drawings and specifications referenced thereon, or shall be as specified herein or by the procuring activity. Unless otherwise specified, standard MS and AN parts shall be used in accordance with MIL-W-8160.

* 3.2.1 Solder. Soldering shall be in accordance with MIL-S-45743, unless otherwise specified on engineering drawings or by the procuring activity. Solder shall be in accordance with QQ-S-571 (SN-50 or SN-60), either plain or fluxcore. The flux shall be rosin or alcohol rosin conforming to MIL-F-14256 or O-F-506.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

3.2.2 Shielding. Shielding shall be in accordance with MIL-C-7078, MIL-W-16878, MIL-C-27500, QQ-B-575, or NAS 702.

3.2.3 Clamps. Loop-type support clamps shall be in accordance with MIL-C-8603.

* 3.2.4 Lacing twine, cord, or braid. Lacing twine, cord, or braid shall be in accordance with MIL-T-713, MIL-Y-1140, AMS-3815, or shall be manufactured from other non-fungus nutrient synthetic fibers and suitably treated to prevent fraying and slippage, and prior to use, shall be specifically approved by the procuring activity.

* 3.2.5 Insulated conductors. Insulated conductors shall be in accordance with MIL-W-5086, MIL-W-16878, MIL-W-7139, MIL-W-22759, MIL-W-81044 or NAS 702.

* 3.2.6 Connectors. Connectors shall be in accordance with MIL-C-5015 Series R, MIL-C-26482, MIL-C-26500, MIL-C-38300, MS-20031, MS-20032 or NAS 1599.

3.2.6.1 Connector clamps. Connector clamps shall be in accordance with Standard MS-3057.

3.2.7 Potting material. Potting material shall provide protection from destruction or deterioration due to moisture, vibration, shock, temperature, salt air, fungus, or any other environmental factor.

3.2.8 Solvents. Solvents used for cleaning or removal of grease and oil shall consist of a suitable noncorrosive material, such as trichloroethane, tricholorethylene, alcohol, or solvent in accordance with P-D-680.

* 3.2.9 Sleeving. Insulation sleeving shall be in accordance with MIL-I-631, MIL-I-3190, MIL-I-7444, MIL-I-18057, MIL-I-22076, MIL-I-22129, or MIL-I-23053.

3.2.10 Cable, coaxial. Coaxial cable shall be in accordance with MIL-C-17.

3.2.11 Terminal lugs. The fabrication materials for terminal lugs shall be in accordance with MIL-T-7928 and as specified herein. Types and classes of terminal lugs shall be determined by the specific application.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

3.2.12 Splice connectors. The fabrication materials for splice connectors shall be in accordance with MIL-T-7928 and as specified herein. Splice connectors shall be used only in applications specifically approved by the procuring activity. Types of classes of splice connectors shall be determined by the specific application.

3.2.13 Ferrules.

* 3.2.13.1 One-piece. The fabrication materials for one-piece ferrules shall be in accordance with MIL-F-21608 and applicable drawings, or left to the discretion of the manufacturer, subject to approval of the procuring activity and acceptable performance in accordance with the requirements specified herein. The types and classes on one-piece ferrules shall be determined by the specific application.

* 3.2.13.2 Two-piece. The materials and design of the outer and inner ferrule shall be in accordance with MIL-F-21608 and associated standards or left to the discretion of the manufacturer, subject to approval of the procuring activity and acceptable performance in accordance with the requirement specified herein.

* 3.2.14 Straps. Cable straps shall be in accordance with MIL-S-23190, MS18034 or as specified on applicable drawings.

3.3 Procedures. Procedures (see 6.3.11) for terminating and splicing cable and harness assemblies and securing wire bundles shall be as specified herein.

3.3.1 Soldering. Soldering shall be in accordance with MIL-S-45743.

3.3.2 Potting. If required by the procuring activity, connectors shall be potted as specified on the applicable assembly drawing.

* 3.3.3 Shield termination. When ferrule shielding terminations are being made, extreme care shall be exercised in selecting the proper size ferrule rings and crimping tools to assure a reliable joint. Because of the danger of damaging the conductor insulation, solder shall not be used in making shielding terminations with ferrules. All shields terminating with ferrules shall have the ferrule assembly covered with a snug, flexible insulating sleeve except where preinsulated ferrules are used. The sleeve shall fit snug over the ferrule assembly so that it does not slip during handling. The sleeve shall extend approximately $\frac{1}{4}$ inch beyond each ferrule end. A spot tie may be used between each ferrule end and the end of the insulating sleeve. Lacing cord, when required, shall be used for the spot tie. Clear heat-shrinkable sleeving may be used in lieu of the above, upon approval of procuring activity. When a cable or harness assembly contains individually shielded conductors, the shields may be terminated with the use of ferrules. If the assembly

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

contains less than five individually shielded conductors, each shield may be terminated with either a one- or two-piece ferrule assembly. The ferrule assemblies shall be staggered in the cable or harness as shown in figure 1 except where radio frequency interference attenuation requirements demand that all grounding leads to be the shortest possible length. If the harness, cable, or wire bundles contains five or more individually shielded conductors, each conductor shall be prepared as described in 3.3.3.3, method F or G.

3.3.3.1 Jumpers. Jumpers and ground wires shall be fabricated from insulated, flexible, stranded wire (insulation of type used in the assembly), or as specified on the detail drawing. In general, jumpers shall not cause strain on the termination points.

3.3.3.2 Ungrounded with ferrules. The procedure for terminating ungrounded shields with ferrules shall be the same as that for grounded shields with ferrules shall be the same as that for grounded shields with ferrules, except that the grounding lead shall be omitted.

3.3.3.3 Grounded with ferrules. Grounding of shielding with ferrules shall be accomplished by one of the following methods.

3.3.3.3.1 Method A - one-piece ferrules. The installation of standard one-piece ferrules (see 6.3.9 and 6.7) to terminate or ground a braided shield shall be as follows:

a. Strip the insulation jacket, the braided shield, and the conductor insulation to the approximate length as shown in figure 2.

* b. Flare the braid slightly by rotating the insulated conductor as shown in figure 3.

* c. Select the proper ferrule by measuring the diameter of the conductor insulation and selecting the ferrule in accordance with respective dimensions shown on applicable drawings.

* d. Select the crimping dies recommended for the application in accordance with applicable drawings. Determine that the crimping tool has been checked for proper adjustment. Gages conforming to drawing requirements shall be used.

e. Place ferrule in position, ferrule inner ring (supporting) under the cable shielding and the outer ring (ferrule skirt, fig. 3) over the cable shielding as shown in figure 4.

f. Place the ground wire between the braid and outer ring of the ferrule as shown in figure 5.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

g. Insert preassembled ferrule flush against the stop plate of the crimping tool (inspection holes of ferrule in visible and vertical position) as shown in figure 6 and close the crimping tool until dies are completely closed (dies closed to minimum opening or the crimping tool ratchet releases).

h. Remove the crimped ferrule from the crimping tool and examine for proper crimp.

i. When required by the procuring activity (see 6.2), prepare destruction test samples under production conditions in accordance with the sampling procedure specified in 4.4.2.2.2.1.

* 3.3.3.3.1.1 Nonstandard ferrule (see 6.3.10 and 6.7). Installation procedures of procuring activity approved, preinsulated, one-piece ferrules shall be as specified herein. Crimp tools used shall be as recommended by the ferrule manufacturer and approved by the procuring activity (see 4.6.4).

* 3.3.3.3.1.1.1 Application of nonstandard ferrules. In ferrule application, for preclusion of excessive cable build-up on shielded multiconductor cables, a maximum of 15 shields and a ground wire shall be group terminated into a one-piece ferrule (see 3.3.3.3.1.1).

* 3.3.3.3.1.1.2 Installation of nonstandard ferrules. Nonstandard, preinsulated, one-piece ferrules shall be installed as follows:

a. Strip the cable insulation and each shielded conductor as required to maintain the insulation, shield, and conductor integrity.

b. Grouping of ferrules may be staggered to preclude buildup and installation interference.

c. The type and size of ferrule for shield termination shall be in accordance with the drawing.

d. Destructive test samples, if required, shall be prepared in accordance with the tests specified herein (see 4.4.2.2). Crimped ferrules shall be examined visually and when deemed necessary shall withstand a 20 pound pull test (see 4.3).

e. Unless otherwise specified, ground wire shall be unshielded AWG No. 20 stranded insulated conductors of the same type used in the cable or harness assembly.

f. For external ground support equipment assembly applications, the ferrule terminations shall be embedded in the potting compound

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

that is used in the cable or harness assembly. For internal assembly applications, the shielded termination shall be insulated and securely tied with the same materials used in the cable or harness assembly.

* 3.3.3.3.1.2 Multiconductor terminations. In applications where all conductors are not shielded or where a specific application does not permit practical use of two-piece ferrule terminations for commoning the ground of multiconductor cables, one-piece ferrules similar to one of the examples shown in figure 1 may be used with procuring activity approval. If one-piece ferrules are used, the installation shall be as follows:

a. Strip the multiconductor cable covering as necessary to interconnect the individual shields.

b. Strip the individual conductors in accordance with the procedure specified for one-piece ferrules (fig. 2).

c. Install ferrules as specified in 3.3.3.3.1 and as shown in figure 1 as necessary for the specific application.

* 3.3.3.3.1.3 Shield termination ferrule installation procedures. Installation of standard one-piece shielding ferrules to terminate on ground braided shields shall be as follows:

a. The shield of a wire shall be separated from the insulated wire as shown in figure 7. The strands of the shielded wire shall be separated with a pointed tool to make a hole large enough to pull the insulated wire through. A maximum of 10 percent shield strand damage shall be permitted only on high temperature or hard coated wire. Shield strands on the other type wire shall not be damaged.

* b. Braids shall be prepared as shown in figure 8. The loose braid shield shall be pulled taut and twisted approximately 180 degrees so as to make a snug fit around the insulation. The length of the braid strap shall be at least 1.5 inches long or if not practicable, the length shall be dictated by the application considering radio frequency interference.

* c. An example of shields and jumper leads inserted in ferrules is shown in figure 9. Ferrule sizes shall be as specified on the detail drawings. When the specified ferrule size does not provide a secure hold on shield terminations, shields shall be folded in order to fill the ferrule. Reference design requirements for ferrule size selection shall be as specified in table VI.

d. If more than one braid group is used, the braid terminations

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

may be staggered, keeping a 1/8 inch distance between ferrules as shown in figure 10 or as specified in the detail drawing.

e. When staggering is not required, braids shall be stripped uniformly as shown in figure 11.

f. Ferrule terminations shall be embedded into the potting compound in external cable applications requiring potting boots whether staggered or uniformly stripped. When a protective sleeve is used, covering the main cable, the sleeve end shall cover the ferrules and be tied securely prior to potting. When a right angle potting boot is used, an additional boot, as required to fit shield terminations, shall be used to the rear of the right angle potting boot. Internal cable applications, when potted, shall ordinarily require short potting boots.

3.3.3.3.2 Method B - Two-piece ferrule - braided shield. Installation of two-piece uninsulated ferrules (outer and inner) as dead end or floating termination of the shield on a cable or to install a common ground connection shall be as follows:

a. Strip conductor shield to expose the conductor insulation as shown in figure 12.

b. Measure conductor insulation diameter, select inner ferrule having inside diameter a minimum of 0.005-inch greater than the diameter of the conductor insulation. Select outer ferrule by adding 0.025-inch for braid thickness (single braid) and 0.040-inch for ground wire to the outside diameter of the inner ferrule.

c. Place the outer ferrule over the conductor braid and jacket (fig. 12).

* d. Rotate the insulated conductor slightly to fan out the braid and slide the inner ferrule under the braid. See figures 3 and 13.

* e. Inner ferrule shall extend a minimum of 1/16 inch and a maximum of 1/8 inch beyond the end of the conductor shield (fig. 14).

* f. Insert the 3/10 inch stripped end of ground lead under the outer ferrule (between the inside surface of the ferrule and the shield) and position the outer ferrule over the inner ferrule. No frayed strands of the braid shall be visible beyond the connector end of the inner ferrule (fig 15).

* g. Select the crimping die recommended for the application. Determine that the crimping tool has been certified for proper adjustment in accordance with 4.6.4.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

NOTE: If outer ferrule used has different diameters, crimp shall be made on the small diameter only (ferrule end adjacent to the stripped end of the conductor).

h. Position tool in place over the outer ferrule and close until dies are completely bottomed (dies closed to minimum opening or the crimping tool ratchet releases).

i. Remove crimped conductor from crimping tool and examine crimp and ground wire for proper assembly (fig. 16).

j. When required by the procuring activity (see 6.2), prepare destructive test samples under production conditions in accordance with the sampling procedures specified in 4.4.2.2.2.2.

3.3.3.3.3 Method C - two-piece ferrule - combed shield.

a. Repeat steps a. through c. of Method B.

b. Unbraid the shield strands that will contact the ferrule sleeves, and comb out the strands.

c. Repeat d. through j. of Method B.

3.3.3.3.4 Method D - two-piece ferrule - folded, combed shield.

a. If an outer insulation is used over the shielding braid, strip the insulation back to allow installation of the ferrule on the shield.

b. Trim the shield braid so that a length of braid twice the length of the ferrule is left for installation under the ferrule.

c. Slip the inner ferrule sleeve over the shielding braid and into assembly position.

d. Separate and comb out the braided shield strands that extend beyond the inner ferrule sleeve. Fold the combed strands back over the inner ferrule sleeve.

e. Repeat f. through j. of Method B.

3.3.3.3.5 Method E - two-piece ferrule - insulated, folded, combed shield. (Method E applies only to single or multiconductor shielded wires with an insulating cover over the shield braid).

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

a. Strip the outer insulating cover to a point where the ferrule assembly will be located. The inner ferrule must be over the insulating cover with the ferrule edge even with the edge of the wire covered.

b. Trim the braided shield so that the bare portion is the same length as the ferrule. Place the inner ferrule sleeve over the outer insulating cover.

c. Unbraid and comb the bare shield strands extending beyond the shield cover. Fold the strands back over the inner ferrule sleeve.

d. Repeat f. through j. of Method B.

* 3.3.3.3.6 Method F. two-piece ferrule, multiple - shielded conductors, double-folded shield. Ferrules may be used to terminate shields of five or more individually shielded conductors. This method employs only one inner ferrule sleeve to cover the entire group of conductors including unshielded conductors, placing the previously separated braided shield of the individual conductors on the outside of the inner ferrule sleeve and assembling an outer ferrule sleeve over the inner ferrule sleeve and shield braid as follows:

a. Prepare each individually shielded wire by separating the shield strands with a pointed tool to make a hole large enough to pull the insulated conductor through, as shown in figure 17. The hole in the shield shall be made so that when the inner ferrule sleeve is properly positioned, the sleeve edge will be at the approximate location of the hole in the braid. When this method is used on a harness or cable, the ferrule assembly shall be as close to the connector as possible.

b. Fold the loose ends of the shields back against the harness. These loose ends should be uniformly distributed around the diameter of the harness.

c. Measure the harness diameter and select inner ferrule having an inside diameter a minimum of 0.010 inch greater than the diameter of the harness.

d. Slip the inner ferrule sleeve over all the insulated conductors and shields and position the sleeve as shown in figure 18.

e. Fold the loose ends of the shield braid (evenly distributed around periphery of inner ferrule) over the inner ferrule sleeve and trim the ends of the shield even with the edge of the ferrule sleeve.

f. Select an outer ferrule having an inside diameter a minimum of

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

0.120 inch and a maximum of 0.275 inch greater than the outside diameter of the inner ferrule, depending on the number of shielded conductors.

g. Position the outer ferrule over the inner ferrule leaving approximately 1/16 inch of the connector-end of the inner ferrule extending beyond the outer ferrule. Exercise care to prevent frayed ends of shielding from extending beyond the edge of the outer ferrule (fig 19A).

h. When the shields are to be connected to a solder pot in a connector, fold the free end of the ground wire under the inner ferrule and pull the lead through the inner ferrule into position for connection to the solder pot of the connector.

i. When crimp connections are to be used, repeat g. through j. of Method B.

3.3.3.3.7 Method G. two-piece ferrule, multiple - shielded conductors, single-folded shield. This method is similar to method F in that the inner and outer ferrule sleeves are used over the entire group of shielded conductors but the method of folding the loose shield ends over the inner ferrule is different. Either method is approved.

a. Repeat step a. of method F.

b. Measure the harness diameter and select inner ferrule having an inside diameter a minimum of 0.005 inch greater than the diameter of the harness.

c. Slip the inner ferrule sleeve over all the conductors and loose shield ends and position as shown in figure 19B.

d. Fold the loose shield ends back over the inner ferrule sleeve with the shields evenly distributed around the sleeve circumference. The shields should be trimmed even with the edge of the ferrule sleeve.

e. Repeat f. through j. of Method B.

* 3.3.3.3.8 Ferrule termination of outer shield. When the harness, cable, or wire bundle contains an outer shield over all the conductors, the shield may be terminated by using a two-piece ferrule with an inner and an outer sleeve. The steps to be performed are the same as those of 3.3.3.3, method F or G, using the inner and outer sleeves, except the shield will consist of one piece instead of individual shields.

3.3.3.4 Ungrounded without ferrules. With the shield prepared as described in 3.3.3.3.6a, the loose end of the shielding shall be cut off so

Source: https://assist.dla.mil -- Downloaded: 2026-10-15T03:51Z
Check the source to verify that this is the current version before use.

that approximately 1/2 inch remains. The loose ends of the shield shall be folded back over the lacing, and either a second wrapping of lacing or length of insulation sleeving applied over the folded portion as shown in figure 20. If sleeving is used, the sleeving shall cover the entire folded portion of the shield and shall be of the proper size so that it will not move. When the individual shielded conductors in an assembly are terminated asdescribed, lacing cord shall be wrapped around the entire assembly at the location of the shield termination. The wrapping shall consist of a spot tie of at least four turns. If a multiconductor assembly contains an outer shield over all the conductors, the shield breakout shall be performed as described for the individually shielded conductors as shown in figures 21 and 22.

3.3.3.4.1 Heat-shrinkable sleeving application. As an alternate method to that specified in 3.3.3.4, heat-shrinkable sleeving may be used to insulate the cut-off shielding ends. Unbraid the shield and cut off the strands 1/4 inch from the end of the outer insulation. Lay the strands back on the outer insulation and slide a 5/8 inch length of snug fitting heat-shrinkable sleeving over the strands. Center the sleeving over the cut-off strands. Direct the hot air from a heater gun to all areas of the heat-shrinkable sleeving to assure proper shrinkage. The heat shrunk sleeving shall be snug fitting around the joint and provide a nonslip permanently fixed assembly.

3.3.3.5 Grounded without ferrules. When the cable, harness, or wire bundle contains individually shielded conductors and the shields are to be terminated and grounded to a connector shell without the use of ferrules, the individual shields will be terminated as described in 3.3.3.3.6a. The hole in the shield shall be properly located so that enough loose shield will be available for making the connection to the connector clamp, as shown in figure 23. The loose shield on each conductor shall be pulled taut, to smooth out any wrinkles, and twisted to make a snug fit around the conductor. The individual loose shield ends shall be twisted or platted together. A terminal lug shall be soldered or crimped to the ends of the shields, and shall be mounted to the cable clamp screw. The complete assembly shall be as shown in figure 23.

3.3.4 Shield termination at terminal boards. When ferrules are used to terminate shields at terminal boards and the shield is to be grounded, the following procedure shall be used:

a. Strip back the shielding, and outer insulation cover if used, a maximum of 2 1/2 inches from the end of the shielded wire.

b. Assemble the ferrule and jumper as specified in 3.3.3.3, method A, B, C, D, or E.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

c. Install sleeving.

d. If the shielding is to be connected to terminal, strip the insulation from the loose end of the jumper wire, tin the wire, and solder it to the terminal, using the procedures specified in MIL-S-45743.

e. If the shield is to be grounded to a chassis, or component by attaching it to a fastening screw, strip the insulation from the loose end of the jumper and attach a ground lug. The ground lug shall be assemblied to the screw as specified in 3.3.5.

3.3.5 Terminal lug connector grounding. When terminal grounding lugs are used and assembled to the screw of the connector clamps or other approved grounding screws, the lug shall be assembled with a split washer and flat washer (flat washer next to terminal lug) between the screw head and the terminal lug. The terminal lug shall make direct contact with the grounding surface. The complete grounding connection shall be over-sprayed with an acrylic spray or varnish.

3.3.5.1 Grounding surface. The terminal lug grounding surface shall be free of dirt, grease, or any other foreign matter that would create a high-resistance contact. The contacting surface shall be a metallic, low-resistance surface. There shall be no paint or insulating finish that would create a high-resistance surface. The resistance from the terminal lug to the grounding medium shall meet the requirements of 3.4.5.

3.3.5.2 Terminal lug assembly. Terminal lugs may be an open tab solder cup, solderless crimp-type, or other approved types for attaching shields or conductors to component screw terminals, connector cable clamp screws, and chassis or bus bar ground screws. The open tab type is generally used for grounding the braided shield of a shielded conductor, cable, or harness where applicable.

3.3.5.3 Terminal lugs used to secure conductor, cable, or harness shields. When a terminal lug is used to secure the shield of a conductor, cable, or harness to a screw fastening, and when the shield termination is prepared without ferrules, the following procedures shall be used:

a. The end of the shield where the lug will be fastened may be twisted, braided, or combed, but shall be neat and free of loose strands.

b. The shield end shall be placed in contact with the terminal lug fastening area, taking maximum advantage of the area. If the terminal lug contains crimping tabs, the shield must extend fully under all tabs. The terminal lug will be crimped or the tabs bent over the shield with the specified tool The assembly shall be capable of withstanding a 15-pound tensile test between the terminal lug and the shield without movement of the shield in the terminal lug.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

3.3.6 Terminal lugs used to secure insulated, stranded conductors. When a terminal lug is used to secure an insulated, stranded conductor to a screw, one of the following procedures shall be used. Broken strands of the conductor shall not exceed the limits specified in MIL-STD-454, Requirement 5.

3.3.6.1 Standard crimp terminal lugs. Installation procedures for crimping standard insulated or uninsulated terminal lugs to AN-22 through AN-4/0 copper conductors shall be as follows:

a. Remove the insulation from the conductor to a distance within the limits specified in figure 24.

b. Measure the diameter of the bare conductor (fig. 25) and select proper terminal lug by the conductor diameter and circular mil area in accordance with table I.

* c. Select applicable crimping tool conforming to AN-3427, MS17776, MS25037, or MS63042.

* d. Determine that crimping die opening has been certified for proper adjustment (see 4.6.4).

e. Insert terminal lug, tongue first, into selected crimping tool. Position the leading edge of terminal lug against the locator stop (fig. 26).

f. Squeeze grips of crimping tool slowly until jaws hold terminal firmly in place without denting the barrel of the terminal lug.

g. Insert stripped wire into barrel of terminal lug until the conductor butts firmly against the forward stop of the terminal lug barrel (fig 27) with the strands of the conductor clearly visible through the inspection opening of the terminal lug.

h. Squeeze tool handles until ratchet releases. For approved crimping tools not equipped with a ratchet release, squeeze the tool handles until the dies are completely bottomed (dies closed to minimum opening).

i. Remove crimped terminal lug from the crimping tool and examine for proper crimp.

j. When required by the procuring activity (see 6.2), prepare destructive test samples under production conditions in accordance with the sampling procedures specified in 4.4.2.2.1.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

3.3.6.2 Nonstandard crimp terminal lugs. Installation of nonstandard insulated or uninsulated terminal lugs to copper conductors shall be in accordance with the procedures specified for standard terminal lugs, except the crimping tool shall be as recommended by the terminal lug manufacturer and approved by the procuring activity.

TABLE I. Conductor diameter and circular mil area

Terminal or connector size	Range of circular mil area		Maximum outside diameter of conductor (inches)
	Minimum	Maximum	
22-18	511	2050	0.052
16-14	2050	5180	0.077
12-10	5180	13090	0.122
8	13090	20820	0.172
6	20820	33090	0.219
4	33090	52620	0.277
2	52620	74000	0.352
1	74000	94000	0.387
0	94000	119000	0.437
00	119000	155000	0.497
000	155000	190000	0.552
0000	190000	230000	0.619

3.3.6.3 Solder terminal lugs. When a solder termination is specified the installation shall be as follows:

a. The insulation of the wire shall be stripped back sufficiently to allow the conductor strands to penetrate the full depth of the solder cup and allow approximately 1/8 inch between the end od the lug solder cup and the conductor insulation.

b. The conductor end shall be tinned as specified in MIL-S-45743.

c. The solder cup and conductor shall be soldered as specified in MIL-S-45734.

3.3.7 Splice connectors. Splice connectors are not acceptable for use with coaxial cabling.

3.3.7.1 Pre-insulated connectors. Crimping procedures for preinsulated splice connectors for use with copper conductors, wire sizes AN-22 through AN-10 shall be as follows:

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

a. Remove insulation from the conductor in accordance with lengths specified in table II and figure 28. The remaining insulation shall not be damaged. Broken strands of the conductor shall not exceed the limits specified in 3.3.6.

b. Measure the diameter of stripped conductor (fig. 25) and select the proper splice connector by the conductor diameter and circular mil area in accordance with table I.

* c. Select applicable crimping tool confirming to AN-3427, MS17776, or MS25037.

d. Determine that crimping tool has been checked for proper adjustment (see 4.6.4).

e. Insert one end of splice connector into properly selected crimping tool. If the connector stop plates have been removed from crimping tool, center splice barrel over tool indentor. When crimping tool stop plates are in position, insert splice connector barrel into crimping position as shown in step 1 of figure 29.

f. Squeeze crimping tool handles slowly until the crimping jaws hold the connector body firmly in place without denting the crimping barrel of the connector.

g. Insert stripped conductor into the crimping barrel of the connector, insulation shall butt firmly against crimping barrel of the splice connectors.

h. Check position of conductor to determine that the conductor is fully bottomed (ends of conductor wire clearly visible through the splice connector inspection hole).

i. Close crimping tool handles until ratchet releases. For approved crimping tools not equipped with ratchet release, squeeze tool handles until the dies are completely bottomed (dies closed to minimum opening) (step 2, fig. 29).

j. Remove crimped connector from the crimping tool and examine for proper crimp.

k. Rotate crimping tool 180 degrees and repeat steps (a) through (j) for the second conductor (step 3, fig. 29).

3.3.7.2 Uninsulated splice connectors, large conductors. Crimping procedure for large copper conductors of wire sizes AN-8 through AN-4/0 shall be as follows:

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

a. Strip the conductors to be connected to the lengths specified in table II. When insulation of the splice connection is required, insert the wire through the insulation sleeve before crimping. The wire insulation remaining on the conductor shall not be damaged. Broken strands of the conductor shall not exceed the limits specified in 3.3.6.

* b. Examine the crimping tool to determine that it has been properly certified for proper adjustment (see 4.6.4).

c. Place one end of splice connector into crimping position in the crimping tool and squeeze the tool to firmly hold connector without denting the barrel of the connector.

d. Insert stripped conductor into the end of the splice connector gripped in the crimping tool. Observe connector inspection opening to determine that the conductor is fully bottomed (conductor firm against conductor stop) in the connector.

e. Close the crimping tool handles until the ratchet releases. For tools not equipped with ratchet release, squeeze tool handles until the dies are completely bottomed (dies closed to minimum opening).

f. Release splice connector and crimp the other end of the connector by repeating (c), (d), and (e).

g. Examine crimp to determine proper connection.

h. When insulation of connection is required after crimping, cover splice connector with approved insulation tubing (preferably transparent plastic, length in accordance with table III) and secure each end with fungus resistant cord or approved substitute. When approved shrinkable tubing is used as insulating material, fungus resistant cord is not required.

3.3.7.3 Nonstandard splice connectors. Installation of nonstandard insulated or uninsulated splice connectors for use with copper conductors shall be in accordance with the procedure specified for standard splice connectors, except the crimping tool shall be as recommended by the splice connector manufacturer and approved by the procuring activity.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

TABLE II. Wire stripping lengths for copper conductor splices

AN wire sizes	Strip length (inches)
22	3/16
20-18	1/4
16-14	1/4
12-10	5/16
8	7/16
6	1/2
4	1/2
2	5/8
1	5/8
1/0	11/16
2/0	13/16
3/0	13/16
4/0	7/8

TABLE III. Length of insulation sleeve (large conductors)

AN wire size	Insulation sleeve length (inches)
8	1 5/16
6	2 1/8
4	2 1/8
2	2 13/32
1	2 13/32
1/0	2 17/32
2/0	2 25/32
3/0	2 13/16
4/0	2 15/16

* 3.3.8 Securing wire bundles. All wire bundles and harnesses which are not inclosed in conduit or other protective covering shall be continuously laced when the length is sufficient to accommodate two or more complete stitches. As an alternate method, cable or harness straps may be used, if approved, in lieu of lacing. Spot ties may be substituted for a continuous lace within subassemblies when the lacing length is less than four complete stitches. All lacing or spot ties shall be performed with materials specified herein and shall be snug.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

All knots of all lacing shall be coated with an acrylic spray or other suitable lacquer. The starting and terminating sections and the stitching shall be as specified in the following procedures; however, when specified on the applicable drawings or by the procuring activity, other approved methods of lacing may be used. The following procedures contain acceptable methods of lacing. Assemblies being laced in accordance with these methods shall be long enough to accommodate the termination of lacing, distances between component and termination of the lacing, and distance required for two complete stitches. At sharp bends in the harness or wire bundle, the spacing between stitches shall be shortened to provide a better lacing dress. When coaxial cables are routed with other cable groups, they shall be routed on the inside of the wire bundle providing the cables are sufficiently buried in the bundle to prevent damage from cable clamps and string ties. Cables routed with small harness bundles which do not contain sufficient number of wires to completely surround the cables, shall be routed so that the cables lie on the outside of the wire bundle and shall be secured in place with electrical insulation tape. During lacing operations, care should be taken to keep the lacing cord tension to a minimum consistent with the intended usage. This is especially important when polyvinylchloride insulated wire is used.

3.3.8.1 Method a-double - lock stitch. This method consists of starting and terminating sections of wound lacing cord locked in place and double-lock stitch plus running-hitch stitching.

a. To prevent undue stress between the laced harness or wire bundle and the attached components (connector, relay pins), and to prevent the individual conductors from flaring out, the distance between the component and the termination section (fig. 30, ref. A) shall not exceed one stitching interval as specified in table IV.

b. Cut a piece of lacing approximately eight inches long, fold in half, and lay on assembly parallel to conductors with the loop end toward the end of the assembly (the end to which component will be attached), as shown in figure 31A.

c. Divide the conductors into two equal groups, unwind estimated length of lacing cord necessary to wrap the assembly as specified herein, and feed between conductor groups at location of cord (fig. 31A).

d. Wind a minimum of six turns clockwise, looking from the short end of the assembly (fig. 31B). The turns shall be wound away from the short end of the assembly, starting at a position to meet the requirements of table IV and (a).

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

e. Repeat a second layer of winds clockwise, returning over the first layer. The last turn shall cover the first turn, as shown in figure 31C.

f. Feed the loose end of the lacing cord through the middle of the assembly, between two even groups of conductors, and through the loop of the cord, as shown in figure 31C.

g. Pull the loose end of the lacing cord tight, closing the loop and locking the lacing in place. Trim all the loose ends. The finished section should be as shown in figure 31D.

h. Stitch the entire assembly with the double-lock stitch plus running hitch shown in figure 32, with the stitching intervals meeting the requirements of table IV.

i. The terminating section at the opposite end of the assembly will be performed as specified in (a) through (g).

TABLE IV. Assembly diameter and stitching interval

Assembly diameter (inch)	Interval (maximum)
1/4	3/4 inch
1/2	1 1/2
1	2 inches
Over 1	3

NOTE: When the cable diameter is between the listed sizes, revert to the smaller diameter for applicable stitching interval. (Example: Harness size 3/8 inch, use 3/4 inch stitching interval).

3.3.8.2 Method b - single-lock stitch. This method consists of starting and terminating sections of wound lacing cord (fig. 31D) and single-lock stitching.

a. Perform a starting section according to (a) through (g) of 3.3.8.1.

b. Stitch the complete assembly using the single-lock stitch shown in figure 33.

c. The lacing shall be terminated at the opposite end of the assembly as specified in (a) through (g) of 3.3.8.1.

3.3.8.3 Spot ties.

3.3.8.3.1 Method c - lacing tie. When lacing ties are used, they

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

shall consist of at least two complete turns of lacing cord around all the conductors being tied. The lacing cord shall be secured with a suitable non-slip knot to prevent movement of the tie during handling of the assembly. The tie shall be performed as follows:

a. Holding a short length of lacing cord parallel with the conductors (fig. 34), wrap two turns of lacing cord loosely around the complete assembly. The first turn should lap over the parallel section, and the second turn should run under the parallel section, as shown in figure 34, reference A.

b. Pull the ends of the lacing cord, as shown in figure 34, refernece A, so that the turns are snug.

c. Tie a terminating knot with loose ends of the lacing cord, as shown in figure 34, reference B.

d. Trim the loose ends of the lacing cord so they are approximately 1/4 inch in length (fig. 34, ref. C).

* 3.3.8.3.2 Method d - harness straps. Plastic or nylon harness straps of an approved source may be used on harness or wire bundles. The straps shall be mounted snugly on the assembly conductors and be capable of being locked to prevent loosening or opening. These straps shall be positioned to correspond with the stitching interval specified in table IV. Straps may be used to secure the wire bundle or harness that mounts directly to the electrical assembly chassis. Procedures for installation of harness or cable straps shall be in accordance with instructions of the strap manufacturer subject to approval of the procuring activity.

3.3.8.4 Lacing branches and breakouts. When a harness assembly or wire bundle contains branches or conductor breakouts, the following procedures shall apply:

a. Where practicable, the main trunk of the wire bundle or harness shall be continuously laced between connectors or components. The main trunk is the portion containing the largest number of wires (fig. 35, ref. A).

b. A terminating section as described in 3.3.8.1 shall be performed on the main trunk of the harness or wire bundle at the beginning of a wye branch, as shown in figure 35, reference B.

c. The branch shall be continuously laced, beginning at the junction (fig 35, ref. C).

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

d. Terminating sections shall be placed on both sides of a tee junction (fig 35, ref. D).

e. If the branch or breakout consists of three or fewer conductors, spot ties may be used in place of the terminating sections described in (b) and (d).

* 3.3.9 Grommet holes. If the connector is equipped to contain more wires than those specified on the detail drawing, unused insulating grommet holes shall be filled with vinyl or nylon rod.

3.3.10 Insulation sleeving. Unless protected by an insulation grommet, sleeving shall be used at the soldered terminations of relay pins, connector plugs, and receptacle solder pots. The sleeve shall be slipped over the conductor and soldered terminal after the solder joint has cooled. Connections to be potted shall not be sleeved.

3.3.11 MS-R connector torque. When the backshells, adapters, and connector cable clamps are assembled to the connector, and when plugs are mated with receptacles or MS-R connectors, all threaded joints shall be torqued to assure that sealing is obtained. The following minimum torque values shall be used:

Connector Size	Torque ft-lbs
14	4
20	7
24	9
28	11
32	13
40	17

3.4 Performance.

3.4.1 General.

3.4.1.1 Terminal lugs and splice connectors. Terminal lugs and splice connectors shall conform to the performance requirements of MIL-T-7928, except for the tensile strength and dielectric strength requirements which shall be as specified herein.

3.4.1.2 One-piece ferrules. One-piece ferrules shall conform to the performance requirements of MIL-F-21608, except for the tensile strength, dielectric strength and grounding resistance requirements which shall be as specified herein.

3.4.1.3 Two-piece ferrules. Two-piece ferrules attached to the shielding over one or more cables shall conform to the voltage drop, temperature cycling, vibrations, and corrosion resistance requirements specified for one-piece ferrules (see 3.4.1.2).

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

* 3.4.1.4 Straps. Cable straps shall conform to the performance requirements of MIL-S-23190 and applicable drawings.

3.4.2 Tensile strength.

3.4.2.1 Terminal lugs and splice connectors. The crimped connection between the terminal lug or splice connector shall not break or become distorted to the extent that it is unfit for the purpose intended under the tensile load specified in table V.

3.4.2.2 One-piece ferrule. The mechanical connection between the ferrule and the ground wire of the crimped ferrule shall not break or become distorted to the extent it is unfit for the purpose intended under the tensile load specified in table V.

3.4.2.3 Two-piece ferrule. The crimped connection shall be capable of withstanding a tensile pull in accordance with table V.

* 3.4.2.4 Straps. Cable straps shall conform to the tensile strength requirements of MIL-S-23190.

TABLE V. Tensile strength requirements

Wire size (AWG)	Tensile strength (Pounds)	
	Terminal Lugs, Splices & One-piece ferrules	Two-piece ferrules
26	7	
24	10	
22	15	18
20	19	20
18	38	40
16	50	
14	70	
12	110	
10	180	
8	225	

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

TABLE V. Tensile strength requirements (cont'd)

Wire size (AWG)	Tensile strength (Pounds)	
	Terminals Lusg, Splices, & One-piece ferrules	Two-piece ferrules
6	300	
4	400	
2	550	
1	650	
0	700	
00	750	
000	825	
0000	875	

3.4.3 Dielectric strength.

3.4.3.1 Terminal lugs and splice connectors. The insulation over the barrel of insulated terminal lugs or splice connectors shall have a minimum dielectric strength sufficient to withstand 1,500 volts root mean square (rms) at commercial frequencies for a minimum of one minute.

* 3.4.3.2 Ferrule. The insulation over the surface of the outer shell shall have a minimum dielectric strength sufficient to withstand 1,500 volts rms at commercial frequencies for a minimum of one minute.

3.4.4 Continuity. All electrical circuitry and grounds involving no electrical components shall be continuous according to the individual wiring diagrams or running lists.

* 3.4.5 Grounding resistance. The resistance to ground of grounded

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

shields shall not exceed 0.1 ohm or as specified on applicable drawings.

3.4.6 Insulation resistance.

3.4.6.1 Cable and harness assemblies. The insulation resistance of cable and harness assemblies shall be in accordance with MIL-C-45224.

3.4.6.2 Electrical subassemblies. The insulation resistance shall be a minimum of 100 megohms at a specified voltage (see 4.6.3.3.2).

3.4.7 Radio interference. The mechanical connection of a crimped terminal, splice connector, or ferrule shall meet the radio frequency interference requirement specified in MIL- STD-826.

3.5 Dimensions.

3.5.1 Terminal lugs. Dimensions for standard terminal lugs shall conform to MS-20659 or MS-25036 as applicable. Dimensions of non-standard terminal lugs shall be furnished to the procuring activity by the manufacturer. Dimensions furnished shall be those indicated in figure 36. Maximum dimension shall be shown for the A dimension; minimum dimensions shall be shown for B, C, J and X dimensions; maximum and minimum dimensions shall be shown for D, E, F, G and W dimensions.

3.5.2 Splice connectors. Dimensions for standard splice connectors shall conform to MS-25181 and this specification. The contour in areas other than critical dimensions areas may vary from that shown in figure 37. Dimensions of nonstandard splice connectors shall be furnished to the procuring activity by the manufacturer. Dimensions furnished shall be those delineated in figure 37.

* 3.5.3 One-piece ferrules. Dimensions for one-piece ferrules shall conform to applicable drawings and shall be furnished the procuring activity by the manufacturer. Dimensions furnished shall be those dimensions shown in figure 38. Only dimensions A, B, C, G, and K shall apply to uninsulated ferrules. Dimension tolerances for one-piece ferrules shall be approved by the procuring activity.

* 3.5.3.1 Shield termination ferrule. Dimensions for shielding ferrules shall be furnished the procuring activity by the manufacturer. Dimensions furnished shall be in accordance with figure 39. Dimension tolerances shall be approved by the procuring activity.

3.5.4 Two-piece ferrules. The dimensions shown in figure 40 for inner and outer ferrules shall be furnished the procuring activity by the ferrule manufacturer. Unless otherwise specified by the procuring activity, the dimensions of inner and outer ferrules used to terminate

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

or ground shields for single or multiple conductors terminating into electrical connectors shall be as specified herein.

3.5.5 Wire, cable, harness, and wire bundles. Wire, cable, harness lengths, or wire bundles shall be as specified on the applicable detail drawing; otherwise, lengths shall be as short as possible in order to perform the necessary function with no undue stress on the wire, cable, harness, or termination. Acceptable wiring lengths and routing are shown in figure 41.

* 3.5.6 Straps. Cable strap dimensions shall conform to MIL-S-23190 and associated military standards.

3.6 Product marking. Unless otherwise specified herein or on detail drawings, marking for identification shall be in accordance with MIL-STD-130.

3.6.1 Cable and harness assemblies. Marking methods as specified on the detail drawing or as specified in MIL-C-45224 shall be applied to the cable or harness. In case of conflicting marking requirements between this specification and the applicable drawing, the latter shall govern.

3.6.2 Subassembly connectors, jacks, and terminals. Designations for connectors, jacks and terminals that are permanently installed in a subassembly may be made on a surface close to the device with a permanent ink or etching.

3.7 Crimping tools. Crimping tools not conforming to the following standards shall be submitted to the procuring activity for approval prior to production use. The assembly manufacturer shall obtain crimping die dimensions (indentor and nest) and "close position" die clearance (opening between crimping dies) for nonstandard tools. The assembly manufacturer shall be responsible for the development of suitable gages or test methods, approved by the procuring activity, to ensure proper tool adjustments.

3.7.1 Terminal lugs and splice connectors. Standard crimping tools for crimping terminal lugs or splice connectors shall conform to AN-3427 (conductors sizes AN-10 through AN-4/0), or MS17776 or MS25037 (conductor sizes AN22 through AN-10) and this specification.

* 3.7.2 One-piece ferrules. Standard crimping tools for crimping one-piece ferrules shall conform to MIL-T-22910, applicable drawings, and this specification.

3.7.3 Two-piece ferrules. Crimping tools for crimping two-piece ferrules shall be tools recommended by the ferrule manufacturer and approved by the procuring activity.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

* 3.7.4 Straps. Tools to install cable straps shall be in accordance with MIL-S-23190, MS17823, MS17824 or shall be in accordance with the strap manufacturer's specifications subject to approval by the procuring activity.

3.8 Workmanship. The electrical subassemblies, cables, and harnesses shall contain no protrusions, sharp edges, dents, cracks, bends, breaks, chips, loose solder, loose solder connections, broken wire strands (other than specified herein), discontinuity of shielding or jacket, chipped paint, or any other defect that would indicate poor quality of workmanship or render the assembly unsuitable for the purpose intended. Crimped insulated terminations shall not exhibit splits, chips, or punctured insulation. Workmanship during initial crimping operations shall be of the highest quality, crimped connections shall be adequate, over and under crimping shall be avoided.

4. QUALITY ASSURANCE PROVISIONS

* 4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the supplier is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract or order, the supplier may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

* 4.2 Visual examination. A visual examination of materials, workmanship, construction, crimping, marking and dimensions shall be made to determine conformance to this specification and applicable standards and drawings.

4.3 Materials and components examination.

* 4.3.1 Materials and procedures. The inspector shall ascertain that all terminal lugs, splice connectors or ferrules used in fabrication of terminations and the crimping tools used in crimping and all straps and strap tools have been inspected and accepted prior to assembly in accordance with their respective specifications, standards or drawings. The inspector shall ascertain that the procedures used are in accordance with this specification or as approved by the procuring activity.

* 4.3.2 Ferrules. Installation of nonstandard ferrules (see 6.3.10) shall be examined to determine compliance with 3.3.3.3.1.1.2. It shall be ascertained that the installation of nonstandard ferrules are in accordance with this specification and are capable of meeting 20-pound pull test requirements.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

4.4 Sampling.

* 4.4.1 Preproduction approval. The sample for preproduction approval, if required (see 6.2), shall consist of the number of samples specified in the contract or order (see 6.2). The preproduction sample shall be subjected to the examinations and tests specified herein (see 4.6.1).

* 4.4.2 Acceptance test samples.

* 4.4.2.1 Nondestructive inspections. The sample for nondestructive inspections shall consist of all crimped termination submitted for acceptance at any one time. (See 4.6.3)

* 4.4.2.2 Destructive tests. The sample for destructive test (see 4.6.2) shall consist of the samples by type, crimp and wire size as specified herein. Upon satisfactory exhibition of acceptable performance, a reduced sampling plan may be offered for Government approval.

4.4.2.2.1 Terminal lug or splice connector. The sample for destructive tests shall consist of prepared samples equal to a minimum of four percent of production but not less than two samples from each lot or order of twenty or less. The samples shall be prepared during regular production crimping utilizing completed item from normal production.

4.4.2.2.2 Ferrules.

* 4.4.2.2.2.1 One-piece. The sample for destructive tests shall consist of prepared samples equal to a minimum of four percent of production but not less than two samples from each lot or order of twenty or less. The samples shall be prepared during regular production utilizing completed item for normal production.

* 4.4.2.2.2.2 Two-piece. The sample for destructive tests for two-piece ferrule crimps shall consist of prepared samples equal to a minimum of four percent of production but not less than two samples from each lot or order of twenty or less for single conductor crimps. Samples shall consist of prepared samples equal to a minimum of two percent but not less than one sample from each lot or order of fifty or less for multiconductor crimps. The samples shall be prepared under production conditions utilizing completed items from normal production.

* 4.4.2.2.3 Straps. The sample for destructive tests for cable straps shall consist of four percent of production, but not less than two samples from each lot or order of twenty or less. The samples shall be prepared under production conditions utilizing completed items from normal production.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

4.5 Lot size. An inspection lot shall consist of materials and parts fabricated to a particular type of conductor or multiconductor, as applicable, under essentially the same conditions and presented for acceptance at any one time.

4.6 Test procedures.

4.6.1 Preproduction approval.

4.6.1.1 Terminal lug and splice connector. The terminal lug or splice connector preproduction sample of 4.4.1, prepared from identical materials (terminal lugs or splice connector and conductor) utilizing approved crimping tools and crimping procedures to be used in regular production, shall be subjected to the examinations of 4.2, 4.3, the acceptance test specified herein, and the following test.

* 4.6.1.1.1 Radio frequency interference. The crimped terminal lug or splice connector preproduction sample shall be subjected to the radio frequency interference tests as specified in MIL-STD-826 to determine conformance of the terminal lug or splice connector, as applicable, to the requirement of 3.4.7.

4.6.1.2 Ferrules.

4.6.1.2.1 One-piece. The one-piece ferrule preproduction approval sample of 4.4.1, prepared from identical materials (ferrules and conductors) utilizing approved crimping tools and crimping procedures to be used in regular production, shall be subjected to the examinations of 4.2, 4.3, the acceptance tests specified herein, and the following test.

* 4.6.1.2.1.1 Radio frequency interference. The crimped one-piece ferrule preproduction sample shall be subjected to the radio frequency interference tests as specified in MIL-STD-826 to determine conformance of the one-piece ferrule to the requirement of 3.4.7.

4.6.1.2.2 Two-piece. Two-piece ferrules preproduction approval samples of 4.4.1, prepared from identical materials (outer and inner ferrules and single or multiconductor cables) utilizing approved crimping tools and crimping procedures to be used in regular production, shall be subjected to the examinations of 4.2 and 4.3, the acceptance tests specified herein, and the following tests.

4.6.1.2.2.1 Voltage drop. Millivolt drop across the crimped ferrule shall be measured from the intersection of the tongue and barrel of the grounding wire terminal lug to a point on each shielded wire as shown in figure 42. Measurements shall be made after the temperature of the cable assembly has stabilized. These voltage drops shall be caused by a test current of one ampere (maximum) (see 3.4.1.3).

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

4.6.1.2.2.2 Temperature cycling. A minimum of one sample crimped to a ground conductor in accordance with the procedure of 3.3.3.3.2 or 3.3.3.3.6, as applicable, shall be subjected to a temperature cycling test by alternately placing the test termination in hot and cold temperature chambers for 30 minute periods. The temperature of the hot chamber shall be plus 257 degrees Fahrenheit (F) (minimum) and the temperature of the cold chamber shall be minus 85 degrees F (minimum). During temperature cycling, the test sample shall be placed in room ambient temperature of 70 (plus or minus 5) degrees F for a minimum of 15 minutes between each hot and cold phase of the test. After five cycles from hot to cold temperature the voltage drop across the connection shall be measured to determine that the crimped termination meets the temperature cycling requirements of 3.4.1.3.

4.6.1.2.2.3 Vibration. A minimum of one sample, crimped to a ground conductor (AN-22 or AN-20) in accordance with the procedure of 3.3.3.3.2 or 3.3.3.3.6, as applicable, shall be subjected to voltage drop test (see 4.6.1.2.2.1) prior to vibration. The sample shall be mounted on a vibration table with the cable secured to the table within two inches from the crimped ferrule. The free end of the ground wire shall be attached to a stable support with slack allowed in the ground wire (fig. 43). The sample shall be vibrated for 6 hours in each of the three major axes in accordance with method 201 of MIL-STD-202. Electrical continuity through the sample shall be monitored throughout the test, there shall be no interruption of continuity in excess of 10 microseconds. After the vibration test, the sample shall be subjected to the voltage drop tests to determine conformance to the vibration requirement of 3.4.1.3.

4.6.1.2.2.4 Corrosion resistance. A minimum of one crimped termination shall be tested for voltage drop prior to subjection to corrosion tests. The test sample shall be subjected to a 5 percent salt-solution concentration fog in accordance with method 101, condition A, of MIL-STD-202. The test specimen shall be placed in a position within the test chamber which will permit the most uniform coverage of the test specimen by the fog. Following the salt-spray (fog) test, the samples shall be washed throughly with distilled water and air dried for a minimum of one hour. The test specimen shall be subject to the voltage drop test and the results compared to the original voltage drop tests to determine damage caused from salt-spray exposure. Voltage drop after the corrosion test shall not be greater than 150% of the initial value.

* 4.6.1.2.2.5 Radio frequency interference. The crimped preproduction sample shall be subjected to the radio frequency interference tests as specified in MIL-STD-826 to determine conformance of the two-piece termination to 3.4.7.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

* 4.6.1.3 Straps. The cable strap preproduction approval sample of 4.4.1, prepared from identical materials, shall meet the applicable tests of MIL-S-23190 and tests specified on applicable drawings.

4.6.2 Acceptance tests.

4.6.2.1 Terminal lug and splice connectors. The destructive test samples of 4.4.2.2.1 shall be subjected to the acceptance tests as specified herein. Insulated samples shall be divided into two equal groups, one group shall be subjected to the dielectric strength test and one group shall be subjected to the tensile strength test. Applicable tests shall be conducted in the order listed.

4.6.2.1.1 Dielectric of insulation. Insulated terminal lug or splice connector dielectric strength shall be measured by dipping the terminal lug tongue or approximately one half of the splice connector in hot beeswax having a temperature not greater than 310 degrees F. The component shall be dipped to a depth sufficient to close the open end of the terminal lug or splice connector without covering the edge of the depression resulting from the crimping operation. When the beeswax has hardened, the barrel of the terminal lug or splice connector shall be immersed in a 5 percent salt water solution to a depth sufficient to cover the crimped areas of the barrel and the insulation support. A voltage of 1,500 rms at commercial frequencies shall be applied between the wire, assembled (crimped) to the terminal lug or splice connector, and the salt water solution for 1 minute (minimum) to determine conformance to 3.4.3.1.

4.6.2.1.2 Tensile strength. The terminal lug or splice connector test sample shall be placed in a standard tensile testing machine and sufficient force applied to pull the conductor out of the terminal lug or splice, or break the wire, terminal lug or splice connector. The speed of the holding head shall be not greater than 1-inch-per-minute. Determine conformance to 3.4.2.1.

4.6.2.2 Ferrules.

4.6.2.2.1 One-piece. The destructive test samples of 4.4.2.2.2.1 shall be subjected to the acceptance tests as specified herein. Insulated ferrules shall be divided into two groups, one group shall be subjected to the dielectric strength test and one group shall be subjected to the tensile strength test.

4.6.2.2.1.1 Dielectric of insulation. Insulated ferrule dielectric strength shall be determined by removing the inner wire (conductor and conductor insulation) from the metal shield and crimped ground wire. The ferrule shall be dipped in hot beeswax (temperature not greater than 310 degrees F.) to a depth sufficient to seal the end of the ferrule having the two "peep holes" (fig. 44) but not covering the crimped area of the ferrule. When the beeswax has hardened, the sample shall be immersed in a 5 percent salt water solution to a depth sufficient tocover the crimped areas of the insulation sleeve. A voltage of 1,500 rms at commercial frequencies shall be applied between the metal shield braid and the salt water solution for a minimum of one minute to determine conformance to 3.4.3.2.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

4.6.2.2.1.2 Tensile strength. The sample shall be placed in a standard tensile-testing machine and sufficient force applied to the ground wire to pull the crimped wire from the crimped ferrule or to break the wire. The test shall be made with a maximum head speed travel of 1-inch-per-minute. Determine conformance to 3.4.2.2.

4.6.2.2.2 Two-piece tensile strength. Tensile strength tests of two-piece ferrule terminations shall be conducted by placing the test sample in a tensile testing machine (fig. 45) and applying pull force, in the direction of the arrow (fig. 45), to the crimped ground wire. The speed of the crimping jaw shall be not greater than 1-inch-per-minute. Determine conformance to 3.4.2.3.

* 4.6.2.3 Straps. The destructive test samples of 4.4.2.2.3 shall be subjected to the tensile strength and melting point tests of MIL-S-23190.

4.6.3 Final assembly tests. The following tests shall be made on each cable, harness, wire bundle, and electrical assembly fabricated in accordance with this specification.

4.6.3.1 Continuity. Each cable, harness, or electrical assembly shall be tested for electrical continuity according to the applicable wiring diagram or running list. The test shall be in accordance with MIL-C-45224. Other methods of performing this test require the approval of the procuring activity (see 3.4.4).

4.6.3.2 Grounding resistance. The resistance to ground of grounded shields shall be measured with a low resistance measuring instrument having a suitable resistance scale to determine compliance with 3.4.5.

4.6.3.3 Insulation resistance. After installation of the assembly, with connectors, splices, or terminals attached, and prior to connecting functional electrical components, the insulation resistance shall be measured between all isolated conductors and between all isolated conductors and ground. Exceptions shall be as specified on the detail drawings. The measurements shall be performed with an insulation-resistance instrument and shall meet the requirements of 3.4.6. The potential shall be applied for not more than one minute.

4.6.3.3.1 Cable and harness assemblies. The insulation resistance test shall be in accordance with MIL-C-45224.

4.6.3.3.2 Electrical assemblies. The insulation resistance shall be measured with an instrument that has a test potential of 100 volts direct current. The instrument shall have a full-scale reading of 2,000 megohms or greater, with a minimum accuracy of five percent at 100 megohms.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

4.6.4 Crimping tool inspection. The crimping tool die clearance "G" dimensions (fig. 46) with the tool in the fully closed position, shall be gaged with "GO" and "NO GO" gages prior to initial production and after each 40 hours of use, or other inspection schedule (approved by the procuring activity) which will assure performance of the termination as specified herein. Gages, for acceptable tools not conforming to military standards, shall be checked with gages recommended by the tool manufacturer and approved by the procuring activity. (See 3.8)

5. PREPARATION FOR DELIVERY

This section is not applicable to this specification.

6. NOTES

6.1 Intended use. The materials, parts, tools, methods, and procedures covered by this specification are intended for use in the fabrication and testing of crimp-type (solderless) and solder-type terminations on electrical cables, harnesses, wire bundles, single or multiconductor electrical circuits, and the wiring of electronic and electrical subassemblies used in missile systems.

6.2 Ordering data. Procurement documents should specify the following:

a. Title, number, and date of this specification and the applicable drawing.

b. The desired procedures as applicable, by type, class, and methods (see 1.2).

* c. Materials and parts required, where options are permitted (see 3.2).

d. Whether preproduction approval is required (see 3.1.1).

e. Number of units required for the preproduction sample (see 4.4.1).

f. Where the preproduction approval tests are to be conducted.

6.3 Definitions.

6.3.1 Ferrule. For the purpose of this specification the term ferrule, either one-piece or two-piece, insulated or uninsulated, is defined as a ring(s) used to strengthen an electrical conductor at termination point, either to ground, or at termination of shielded or coaxial cable. The ferrule is so constructed to permit the crimping of ground wire (as applicable) and cable shields(s) between

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

the inner and outer ferrules (for twopiece ferrules) or between the inner surface of the outer shell (ferrule skirt) and the barrel (shield receiving surface) of the ferrule (for one-piece ferrules).

6.3.2 Crimp connections. For the purpose of this specification, crimp connections are defined as those connections, insulated or uninsulated, made by crimping terminal lugs, splice connectors, or ferrules to copper conductors.

* 6.3.3 Cable assembly. A cable assembly consists of two or more insulated conductors with a concentric lay or unilay design, assembled with connectors or terminals, and having protective outside cover or jacket as an integral part of the cable construction or other component.

6.3.4 Harness assembly. A harness assembly consists of two or more conductors, laced or jacketed together with or without breakouts, and assembled with connectors or terminals at one or both ends.

6.3.5 Lacing. Lacing refers to the complete, continuous method of securing wires together in a harness, wire bundle, or cable assembly with specified lacing cord, from the initial turn of the starting section to the last turn of the terminating section. Lacing includes the starting and terminating sections plus the running stitches. Spot ties are considered as an alternate type of lacing.

6.3.6 Stitching. Stitching is a portion of the completed lacing between the starting and terminating sections.

6.3.7 Wire bundles. A wire bundle is a group of two or more conductors connecting relays, terminal boards, or other electrical components within an electrical assembly that may be laced, spot tied, or supported by cable clamps to form a neat compact trunk.

6.3.8 Crimp tool. For the purpose of this specification, crimp tools are defined as tools utilized to form solderless terminations or connections in electrical circuits utilizing copper conductors.

6.3.8.1 Indentor. The indentor of a crimp tool is the die making the indentation or crimp forming the connection of conductor to the terminal lug, splice connector, or ferrule.

6.3.8.2 Nest. The nest of the crimp tool is the die that holds or anchors the terminal lug, connector or ferrule during crimping operations.

* 6.3.9 Standard terminations and tools. For the purpose of this specification, standard terminal lugs, splice connectors, one-piece ferrules, two-piece ferrules, and crimp tools are defined as those

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

terminations or crimp tools meeting the requirements of the respective specifications, standards, or drawings specified herein.

6.3.10 Nonstandard terminations and tools. For the purpose of this specification, nonstandard terminal lugs, splice connectors, one-piece ferrule, two-piece ferrules and crimp tools are those terminations or crimp tools that do not meet all the requirements of the respective specifications, standards, or drawings specified herein or any standard, specification, or drawing in existence and require procuring activity approval prior to production use.

6.3.11 Installation procedures. Installation procedures specified herein are not to be considered restrictive. Procedures other than those specified herein require procuring activity approval.

6.4 Cross reference chart of classification.

	*ABMA-PD-E-53	MIL-E-45782
Type	A	I
	B	II
	C	III
Class	I	1
	II	2
Method: Terminating	1	A
	2	B
	3	C
	4	D
	5	E
	6	F
	7	G
Method: Securing	a	a
	b	b
	c	c
	d	d

*NOTE: Superseded Army Missile Command purchase description.

* 6.5 Supersession data. This specification also includes the requirements of MPD 10400B, dated 1 October 1965. To specify the procedure of that superseded document, specify type III, class 2, method B.

* 6.6 Design criteria for ferrule and tool selection (see 3.3.3.3.1.3) The selection of proper ferrule size, as determined by the braid mass factor, shall be in accordance with table VI. The braid mass factor shall be determined as specified in table VII.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

TABLE VI - FERRULE SELECTION

Braid Mass Factor	"A" Dimension of 3.5.3.1
500-646	.156
646-791	.180
791-917	.187
940-1026	.207
1126-1296	.235
1296-1688	.261

TABLE VII - MASS FACTOR DETERMINATION

Number of conductors in a common shield	Wire Gauge	Weight of 30-inch length of shield in grams	Braid Mass Factor
1	24	4.50	72
2	24	9.50	152
3	24	10.50	168
1	22	6.25	100
2	22	7.80	125
3	22	10.10	161
4	22	11.60	186
1	20	6.40	103
2	20	6.50	136
3	20	10.85	173
1	18	8.40	134
3	18	13.20	210
3	16	13.40	214
1	16	7.60	123
2	22*	15.20	240
4	22*	21.00	336
4	10*	21.00	336

*High temperature wire

NOTE: Braid mass factor includes the use of a 20-gauge jumper or ground wire.

* 6.7 Type II With one-piece ferrules. Type II shield termination shall not be used for new design unless specifically required by the procuring activity. In all cases where type II terminations are not considered mandatory by the procuring activity, type III -(two-piece ferrules) shall be used with the applicable terminating method (see 1.2.3).

6.8 Specification changes. The margins of this specification are

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

marked with an asterisk to indicate where changes (additions, modifications, corrections, deletions) from the previous issue were made. This was done as a convenience only and the Government assumes no liability whatsoever for any inaccuracies in these notations. Bidders and contractors are cautioned to evaluate the requirements of this document based on the entire content irrespective of the marginal notations and relationship to the last previous issue.

Custodians:
Army - MI
Navy - AS
Air Force - 70

Review Activities:
Army - EL
Navy - AS, SH
Air Force - 19, 70, 80


User Activities:
Army - MU
Navy - CG, OS, MC
Air Force - NONE

Preparing Activity:
Army - MI

Project No. 1430-0016

Code "C"

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

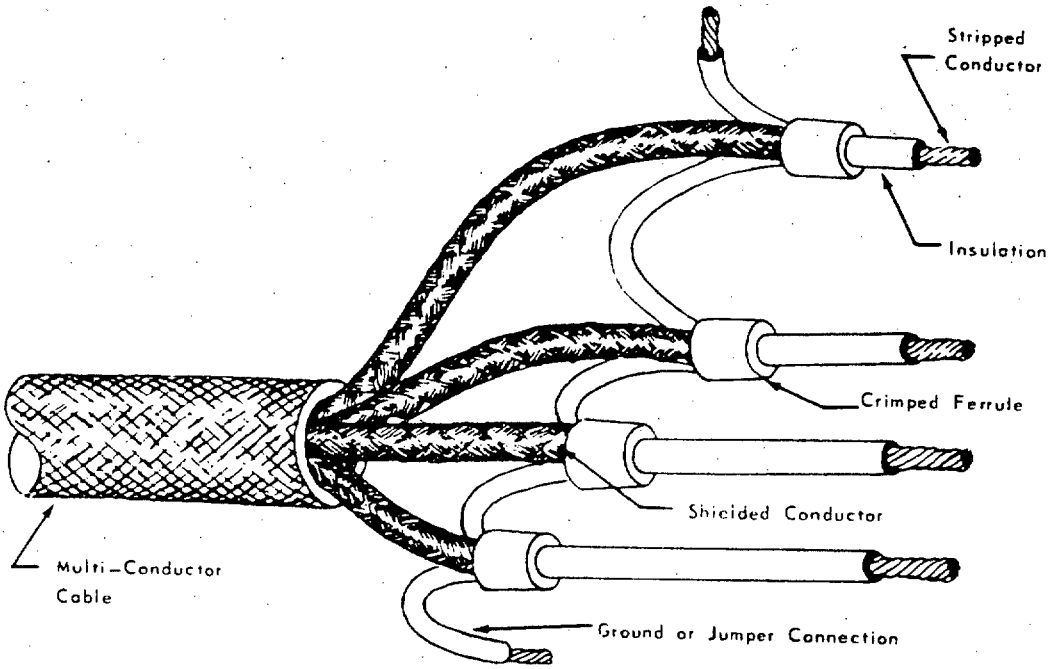

NOTE: Stagger Ferrule Connections To Prevent Build-up of Ferrules.


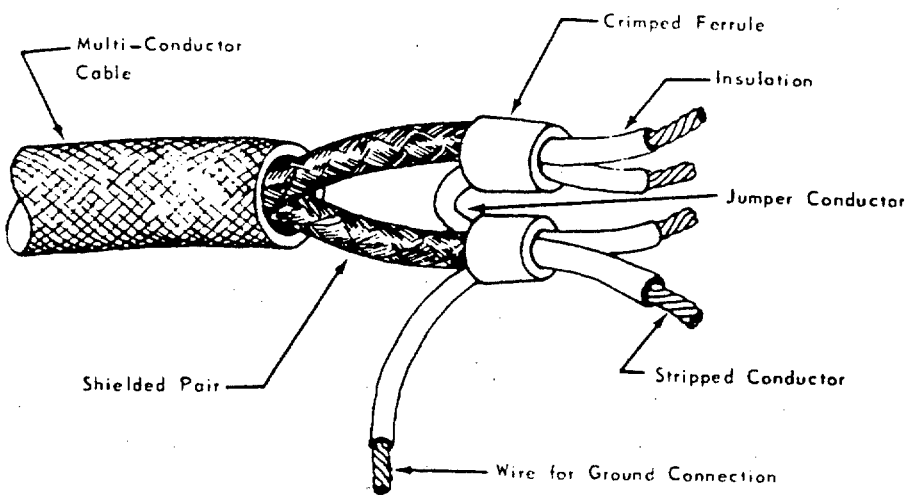


FIGURE 1. ONE-PIECE FERRULE MULTI-CONDUCTOR CONNECTIONS

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

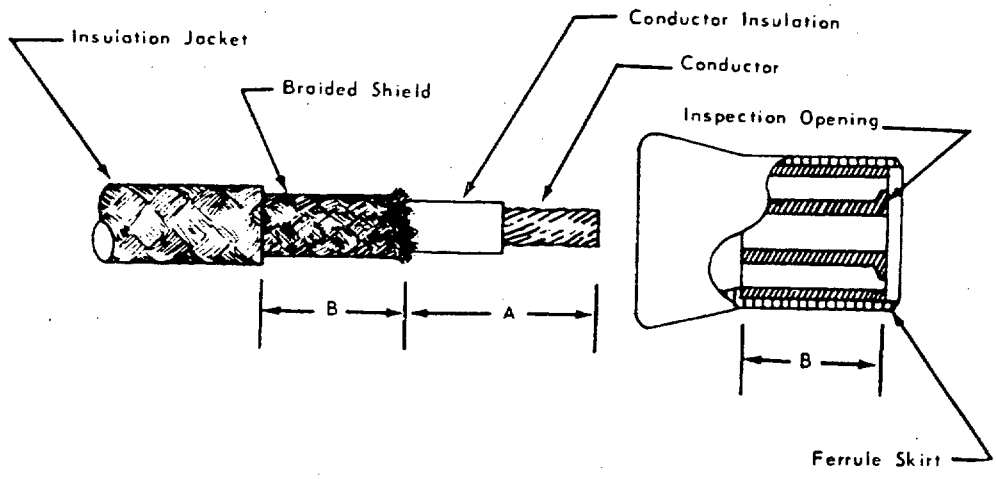

A – Desired Length

B – Length of Conductor Receiving Barrel of Ferrule

FIGURE 2. CABLE STRIPPING FOR ONE-PIECE FERRULE INSTALLATION

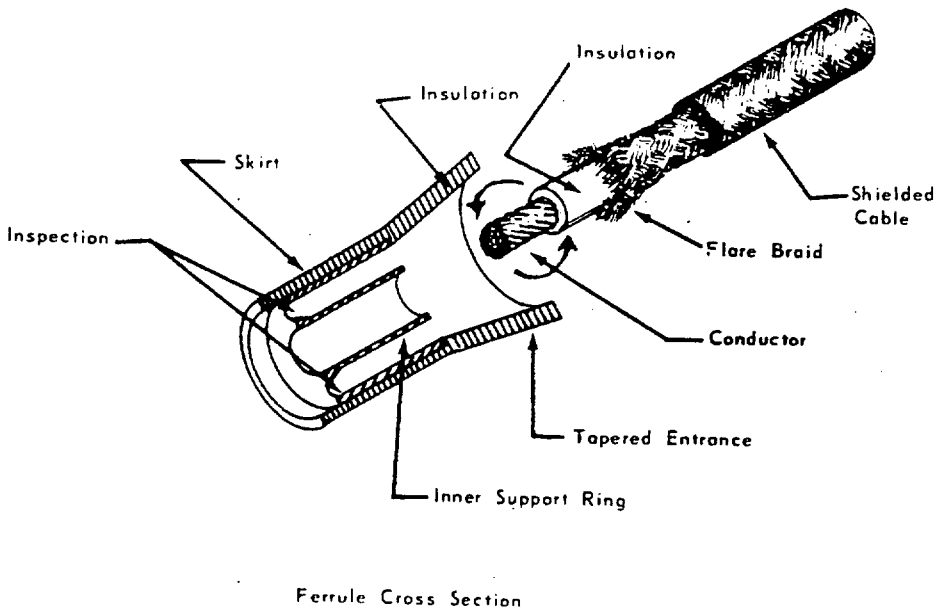


FIGURE 3. FLARE CONDUCTOR BRAID

Source: https://assist.dla.mil -- Downloaded: 2026-10-22 03:51Z
Check the source to verify that this is the current version before use.

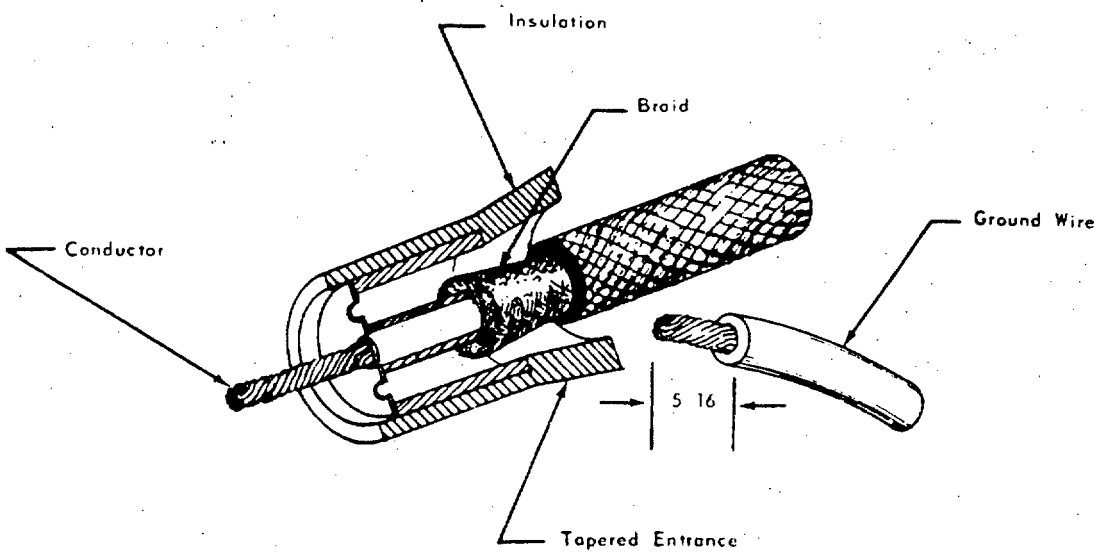


FIGURE 4. PREPARATION OF ONE-PIECE FERRULE TERMINATION

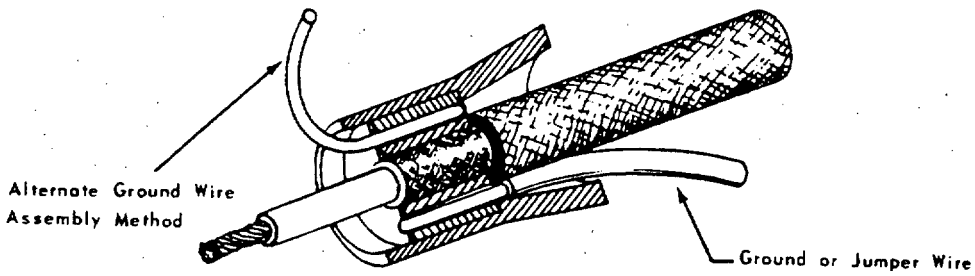


FIGURE 5. PREASSEMBLED ONE-PIECE FERRULE TERMINATION

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

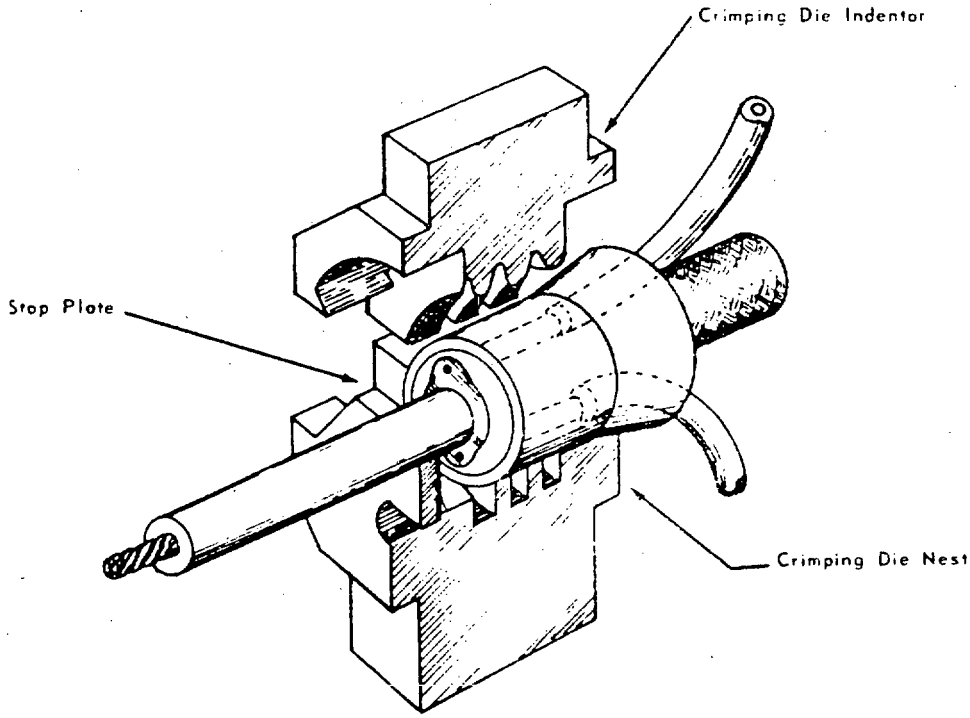


FIGURE 6. CROSS SECTION OF CRIMPING DIE WITH PREASSEMBLED FERRULE IN CRIMPING POSITION

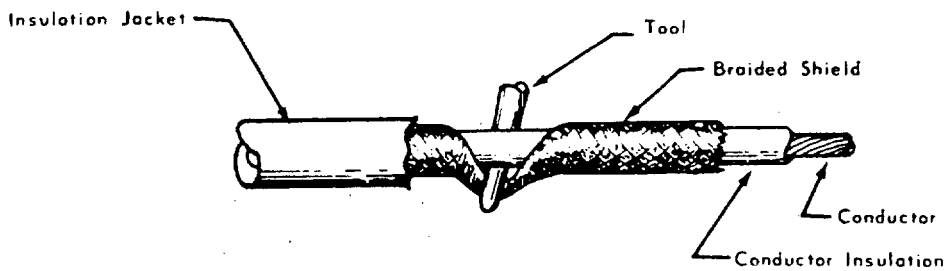


FIGURE 7. SHIELD SEPARATION

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

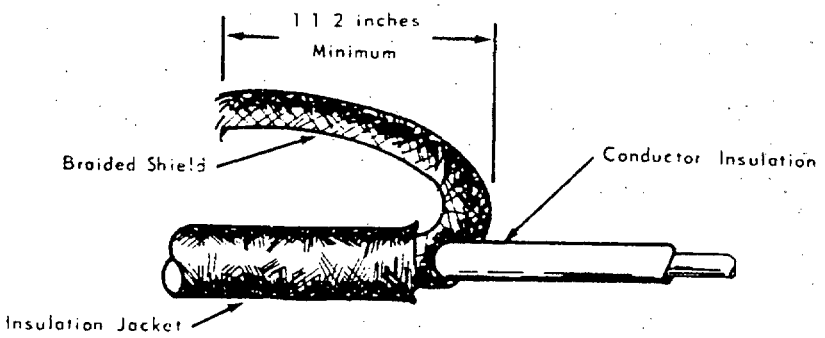


FIGURE 8. BRAID PREPARATION

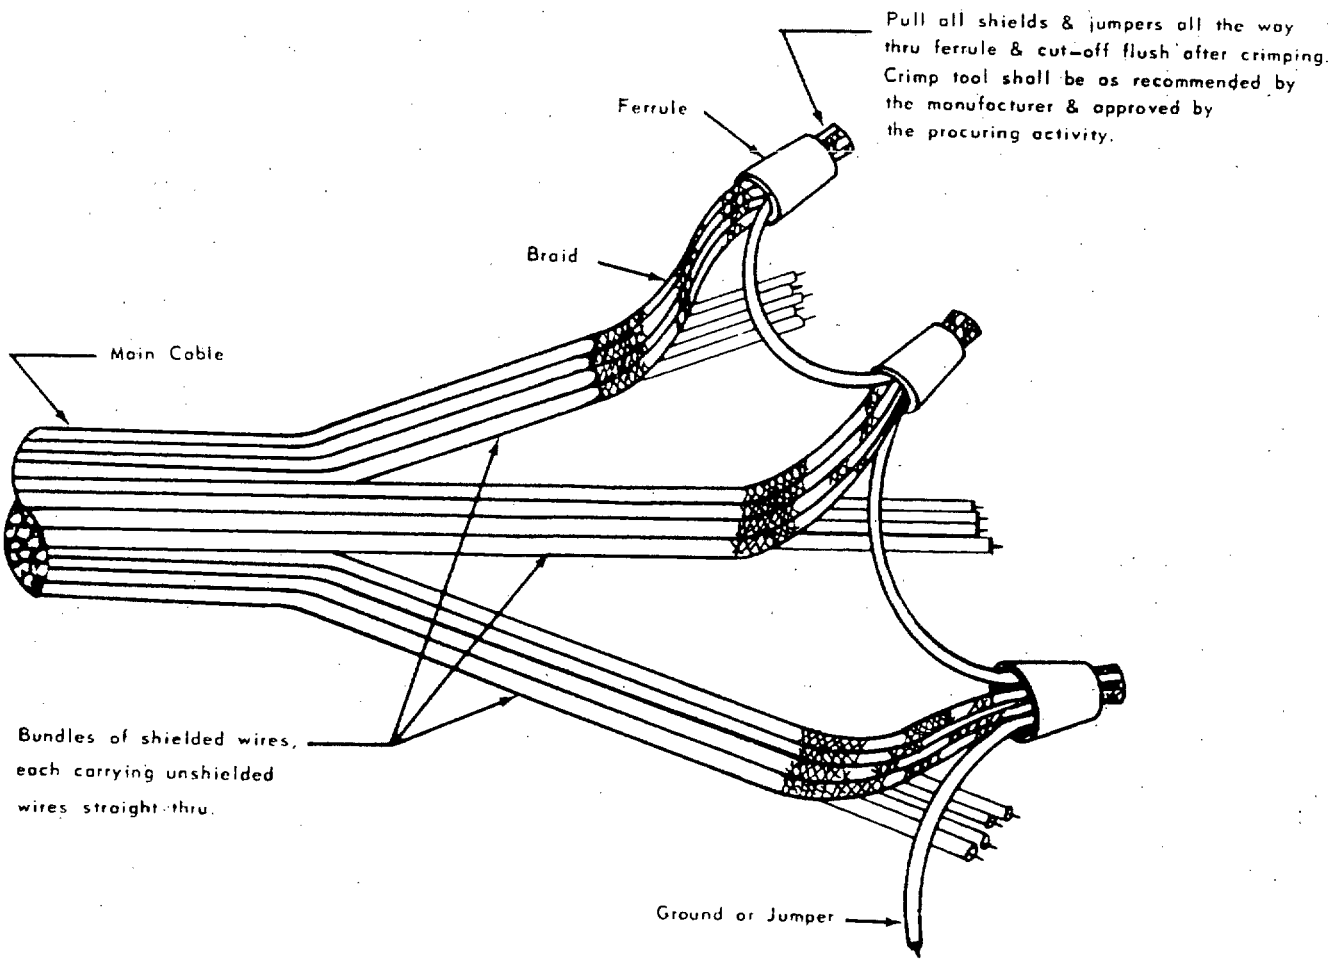


FIGURE 9. APPLICATION OF FERRULES

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.


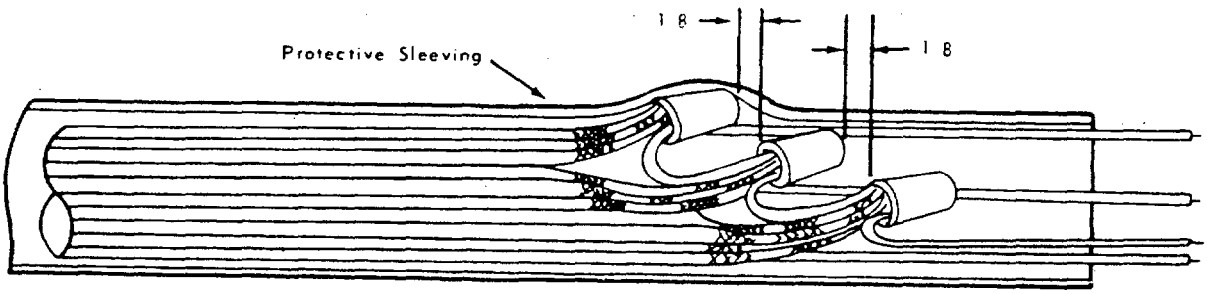


FIGURE 10. MULTIPLE FERRULE APPLICATION

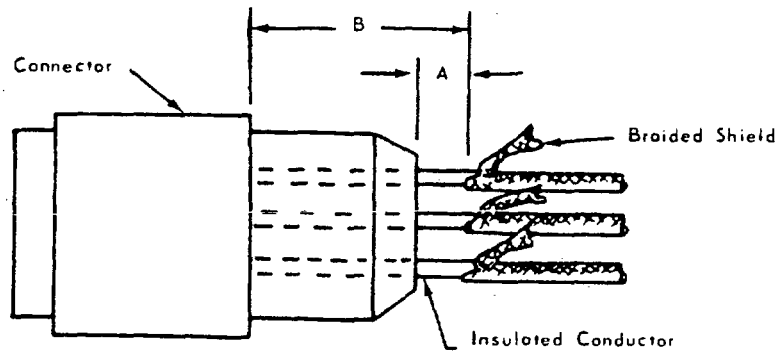

A - POTTED CONNECTORS - 1 4 plus or minus 1 8 inch.
B - UNPOTTED CONNECTORS - 7 8 to 1 1 2 inches normal.

The B dimension of "E" type environment resisting military standard connectors to shell size 24 shall be 2 inches and shell size 24 to 36 inclusively shall be 3 1/2 inches.

FIGURE 11. POTTED AND UNPOTTED APPLICATIONS

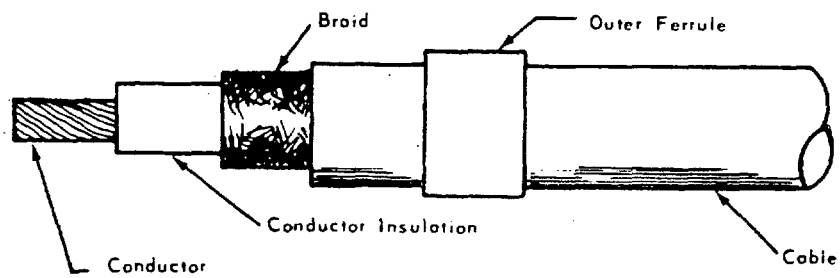


FIGURE 12. CONDUCTOR PREPARATION

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

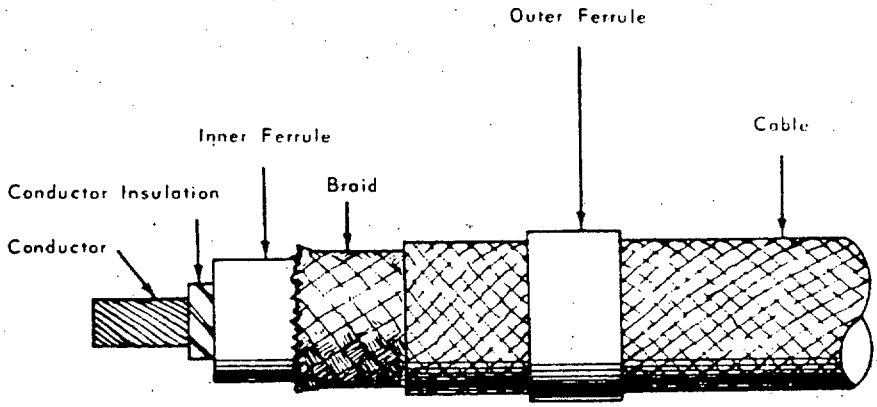


FIGURE 13. CABLE PREPARATION FOR INNER FERRULE

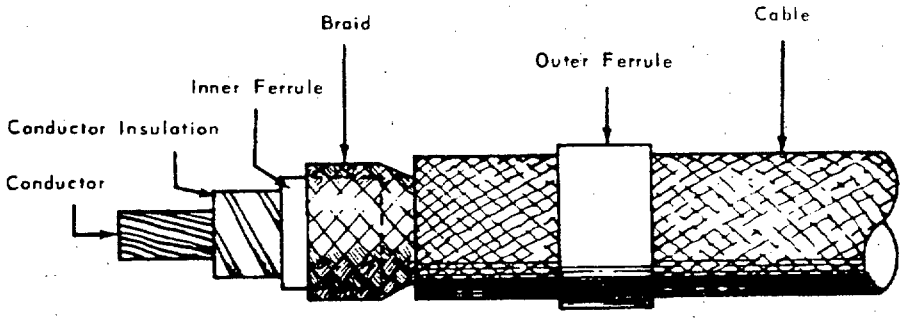


FIGURE 14. POSITION OF INNER FERRULE

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

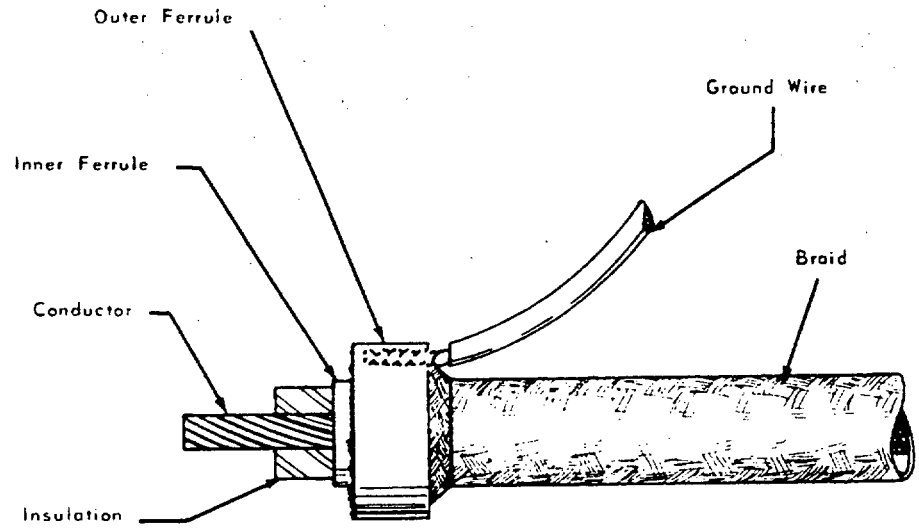


FIGURE 15. GROUND WIRE ASSEMBLY

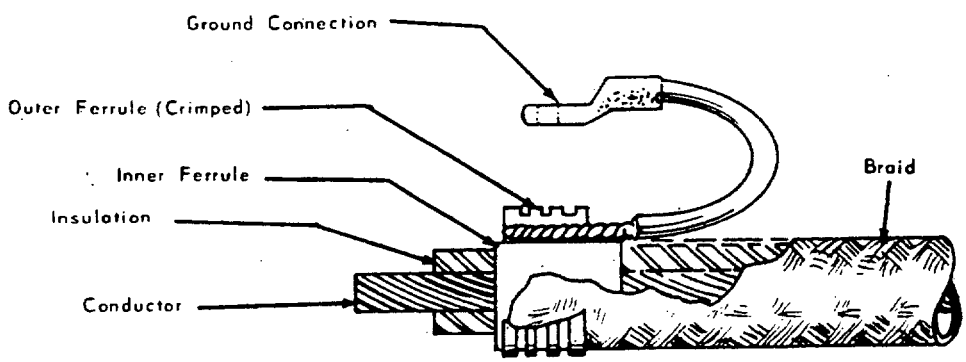


FIGURE 16. CRIMPED TWO-PIECE FERRULE, SINGLE CONDUCTOR

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

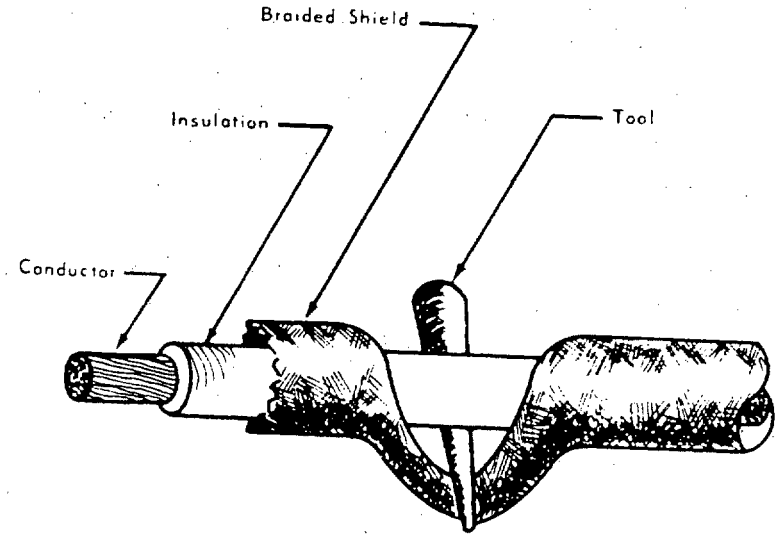


FIGURE 17. PREPARATION OF INDIVIDUALLY SHIELDED WIRE

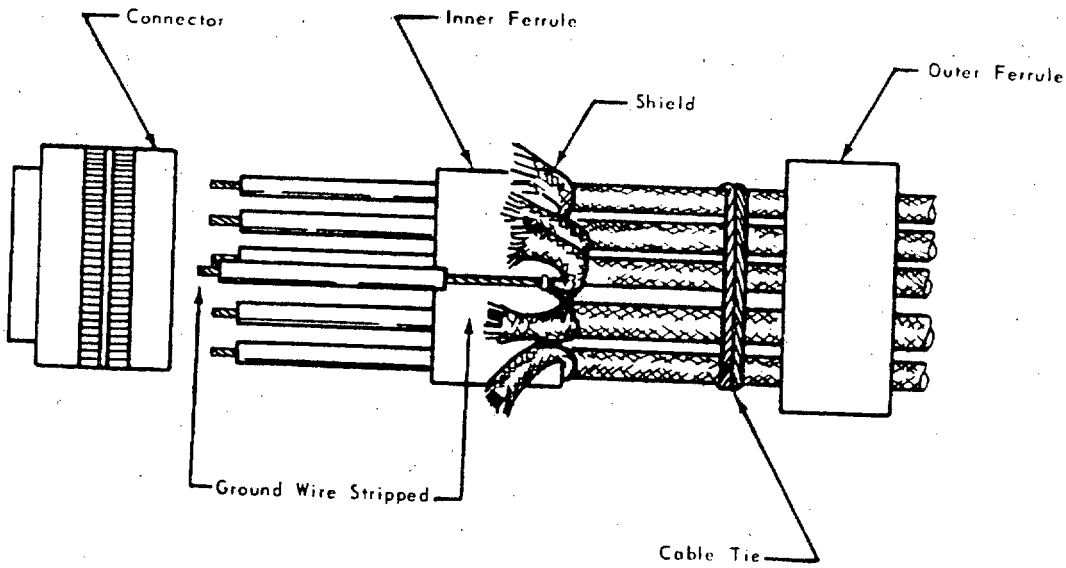


FIGURE 18. POSITIONING OF INNER FERRULE SLEEVE

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

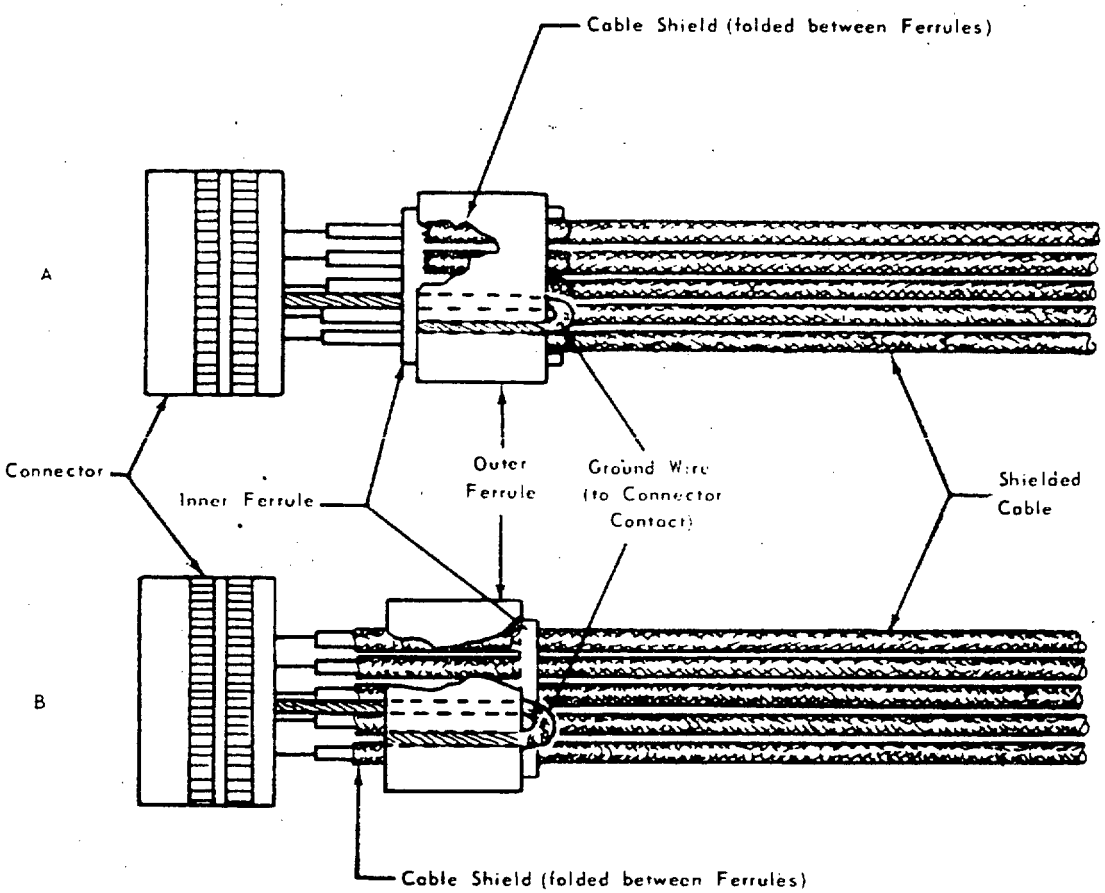


FIGURE 19. POSITIONING OF INNER AND OUTER FERRULE SLEEVES

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

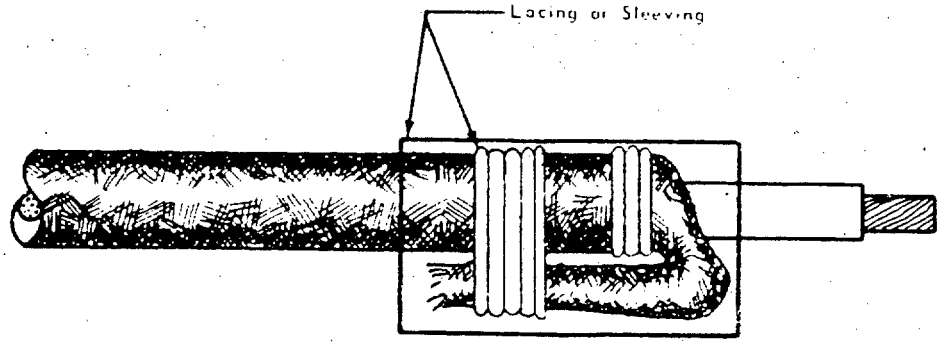


FIGURE 20. POSITION OF INSULATION SLEEVING

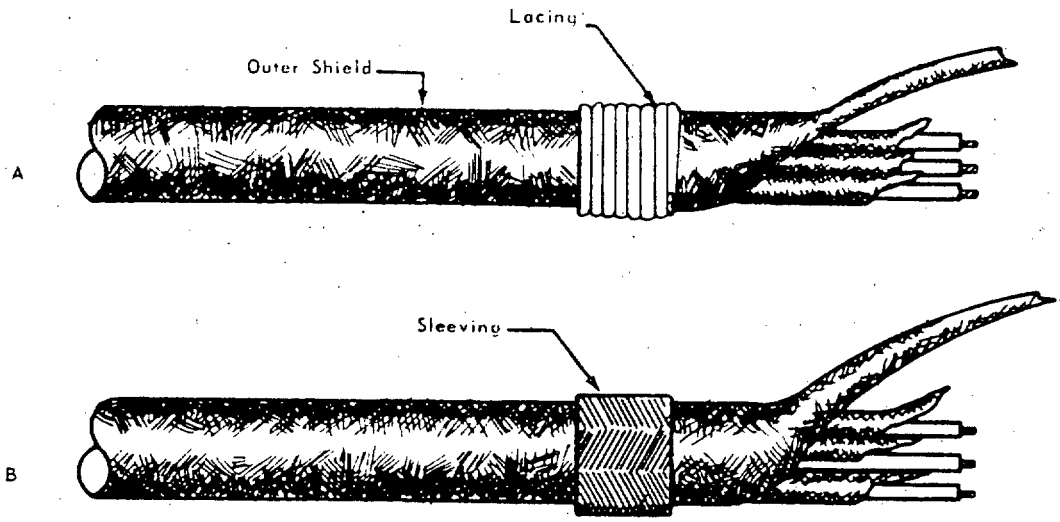


FIGURE 21. PREPARATION OF SHIELDED CONDUCTORS CONTAINING AN OUTER SHIELD

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

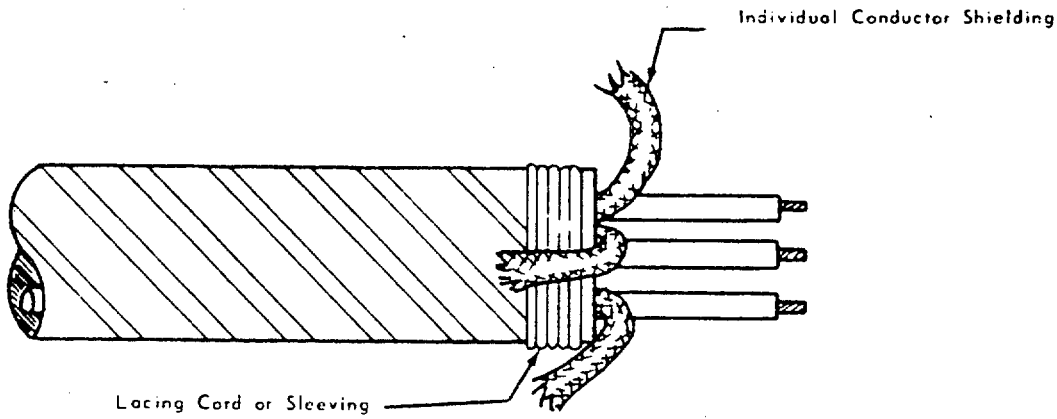


FIGURE 22. BREAKOUT OF SHIELDS OF INDIVIDUAL CONDUCTORS


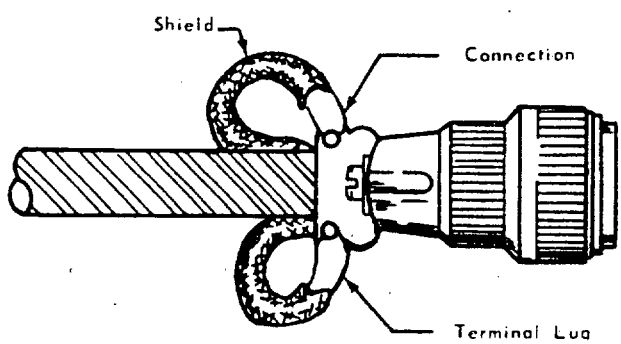


FIGURE 23. SHIELD CONNECTION TO CABLE CLAMP


Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

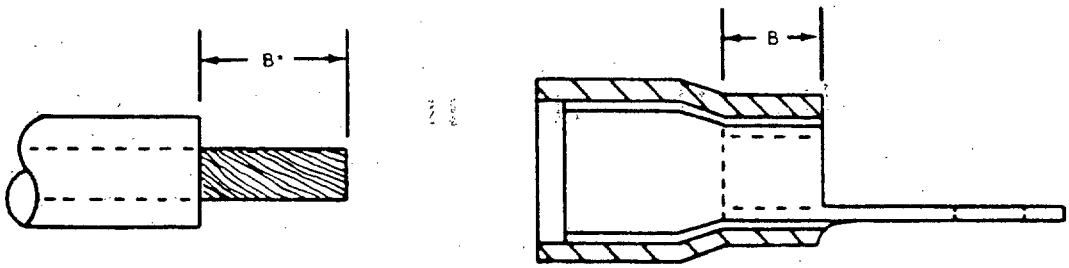

B – Length of terminal lug crimping barrel (inches)

B* – Strip length – plus 1 32 minimum, plus 3 64 maximum


FIGURE 24. INSULATION STRIP LENGTH

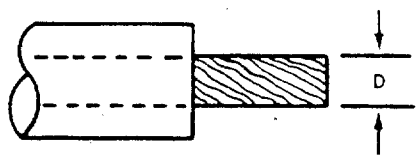

D – Diameter of conductor

FIGURE 25. CONDUCTOR DIAMETER

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

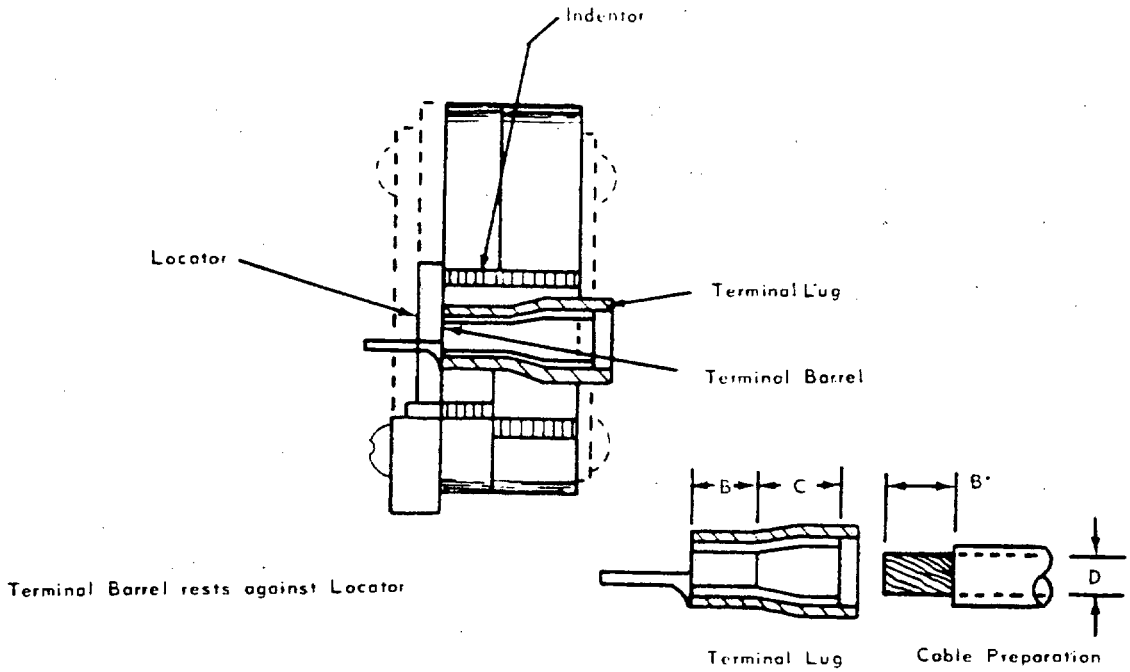

B – Barrel Length

C – Insulation Grip

D – Diameter of Conductor (Bare)

B* – Strip Length – plus 1 32 minimum, plus 3 64 maximum

FIGURE 26. PREPARATION OF TERMINAL LUG TERMINATION, TYPICAL


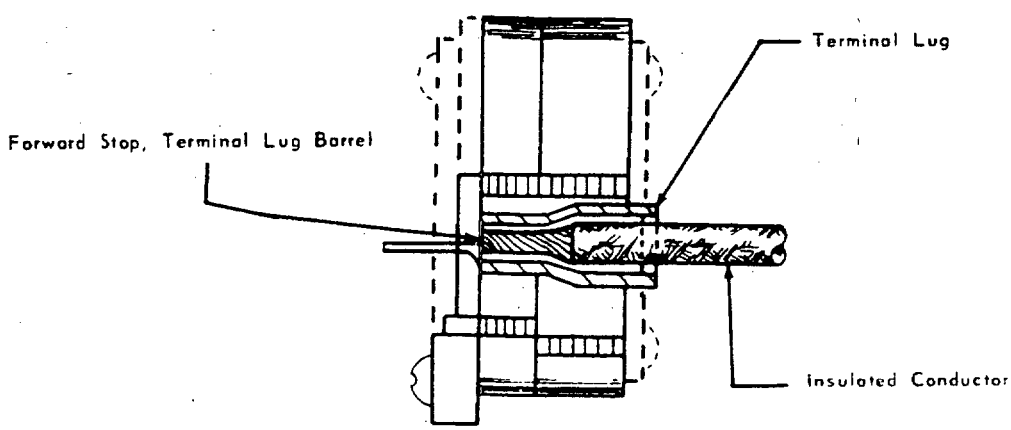


FIGURE 27. CONDUCTOR POSITION PRIOR TO CRIMPING


Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

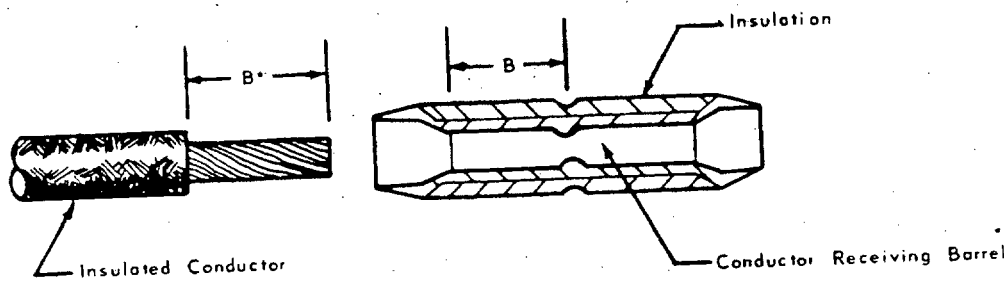

B – Length of conductor receiving barrel.

B* – Insulation strip length, plus 1/32 minimum, plus 3/64 maximum.

FIGURE 28. CONDUCTOR STRIP LENGTH

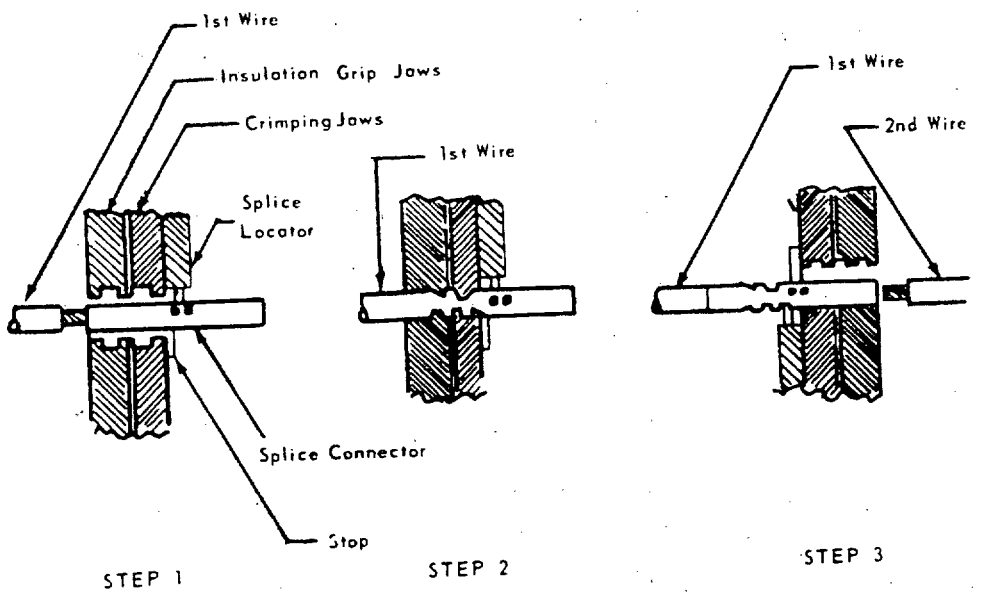

STEP 1 — CRIMPING JAWS OPEN

STEP 2 — CRIMPING JAWS CLOSED CRIMP 1ST WIRE

STEP 3 — CRIMPING JAWS OPEN FOR CRIMPING 2ND WIRE

FIGURE 29. TYPICAL SPLICE CONNECTOR CRIMPING PROCEDURE

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

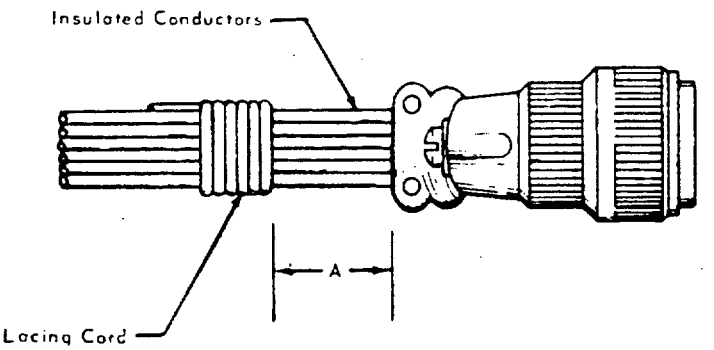


FIGURE 30. DISTANCE BETWEEN COMPONENT AND TERMINATING SECTION

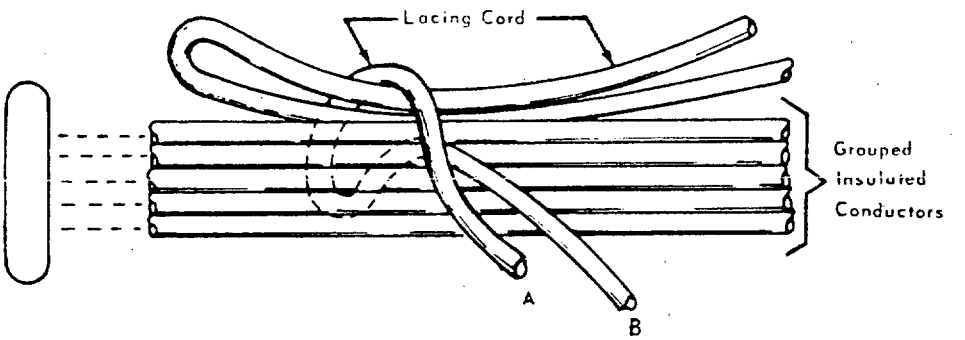


FIGURE 31A. METHOD OF BEGINNING STARTING SECTION

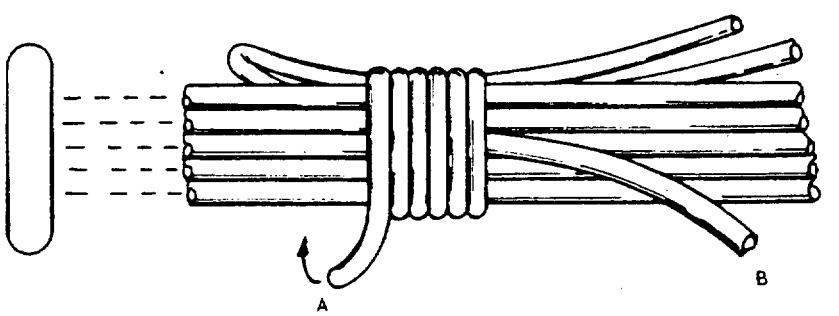


FIGURE 31B. WRAPPING STARTING SECTION

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

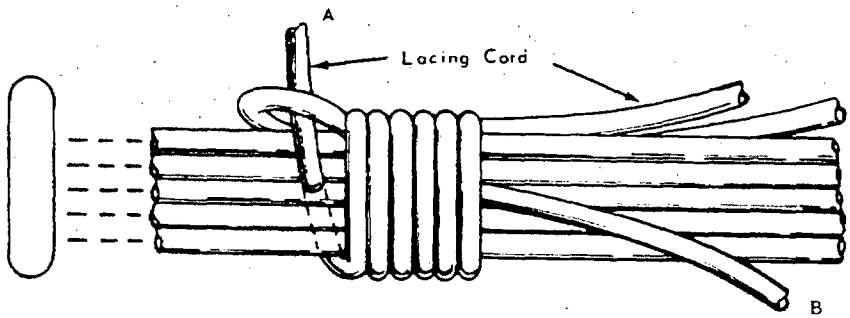


FIGURE 31C. TYING STARTING SECTION

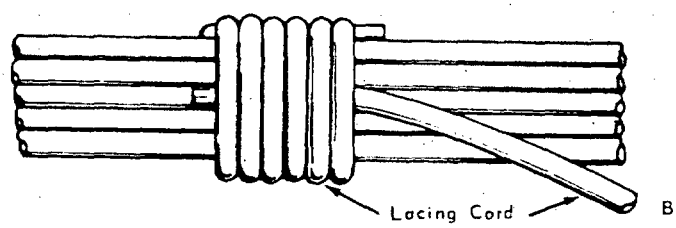


FIGURE 31D. FINISHED STARTING SECTION

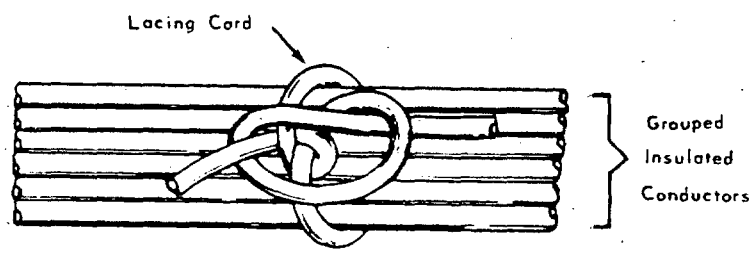


FIGURE 32. DOUBLE-LOCK STITCH PLUS RUNNING STITCH

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

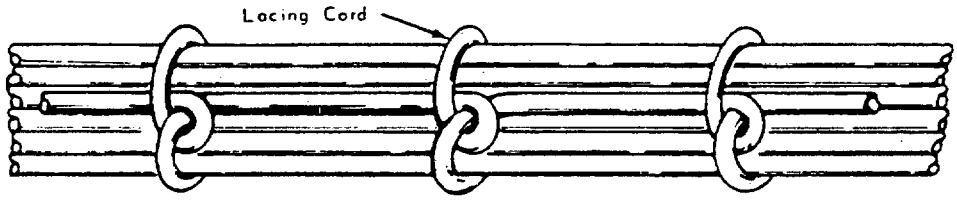


FIGURE 33. SINGLE-LOCK STITCH

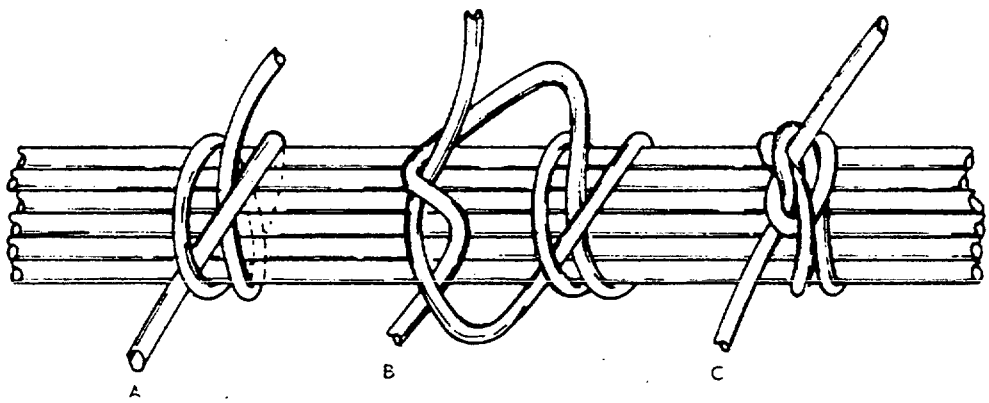


FIGURE 34. LACING TIES


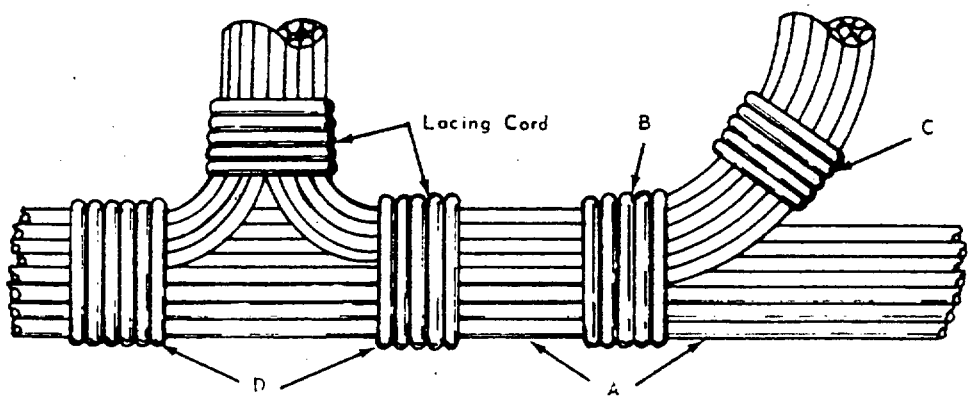


FIGURE 35. LACING BRANCHES OR BREAKOUTS

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

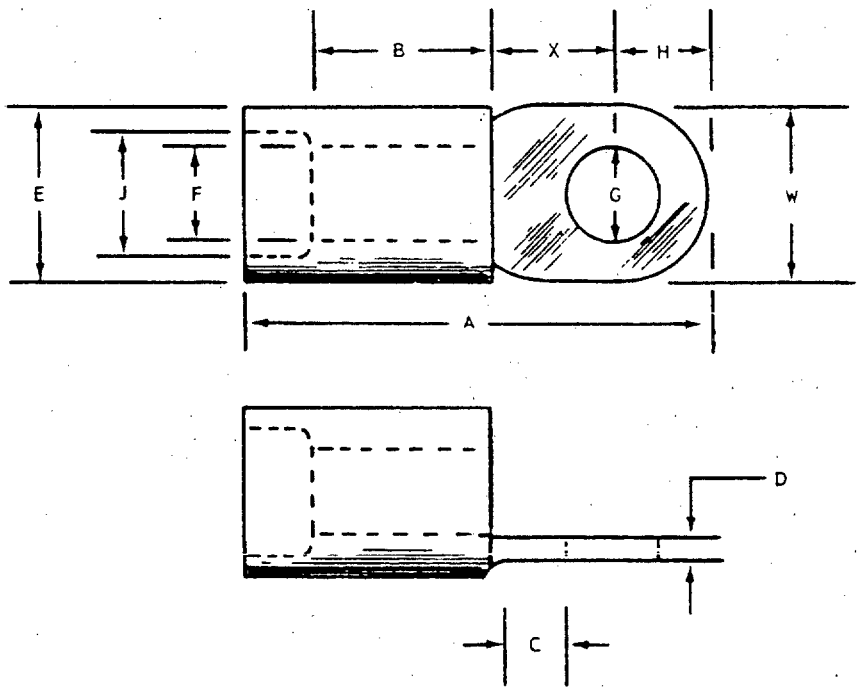

A – Overall Length

B – Length of Barrel (Crimping)

C – Radius Tongue Flat Surface

D – Thickness of Tongue

E – Outside Diameter of Insulation

F – Inside Diameter of Barrel

G – Diameter of Stud Hole

H – Radius of Terminal Lug Flat


J – Inside Diameter of Insulation Grip

W – Width of Tongue

X – Center of Stud Hole to Insulation on Barrel of Terminal Lug

FIGURE 36. TERMINAL LUG DIMENSIONS

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

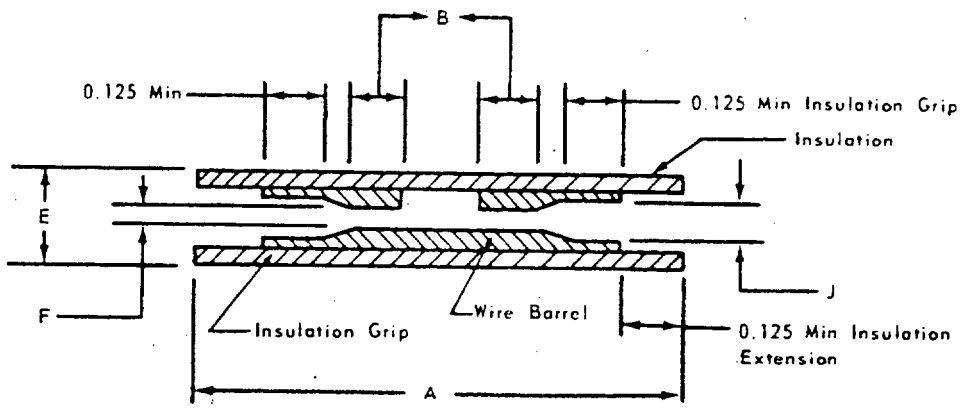

A – Overall Length of Splice Connector

B – Length of Wire Barrel

E – Outside Diameter of Splice Connector (may be exceeded by .060 ± .005 to provide Locator)

F – Diameter of Wire Barrel (determined as average of two Diameters measured at right angles)


J – Diameter of Insulation Barrel

Dimensions in inches

NOTE: This splice is not acceptable for coaxial Cabling.

FIGURE 37. DIMENSIONS OF SPLICE CONNECTOR

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

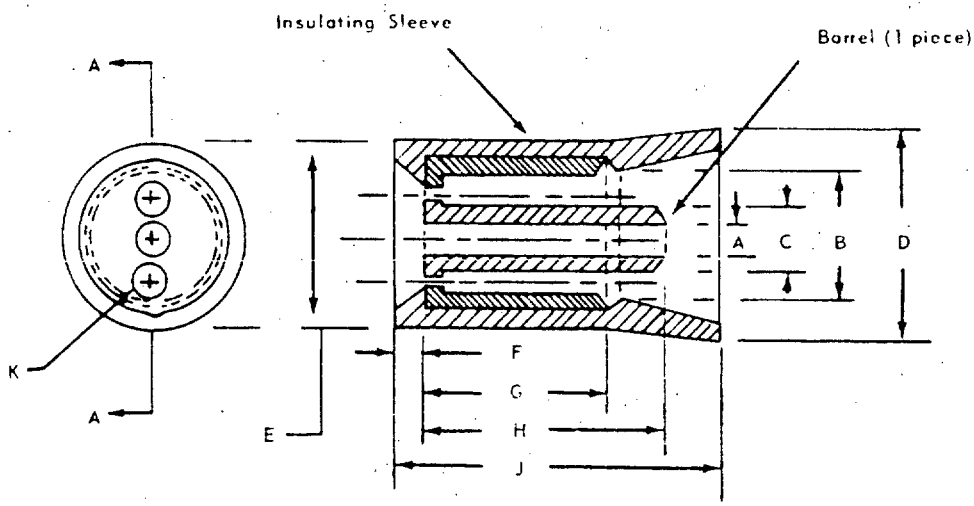

SECTION AA

A – Inside Diameter Barrel (Conductor Receiver)

B – Inside Diameter Meter Crimping Surface

C – Outside Diameter Conductor Receiving Barrel

D – Outside Diameter Insulating Sleeve (Flared End)

E – Outside Diameter Insulating Sleeve (Unflared End)

F – Length of Insulation Overhang (Unflared End)

G – Length Metal Crimping Surface (Barrel)


H – Length of Conductor Receiving Barrel

J – Overall Length of One-Piece Ferrule

K – Diameter of Inspection Hole

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

FIGURE 38. ONE-PIECE FERRULE DIMENSIONS

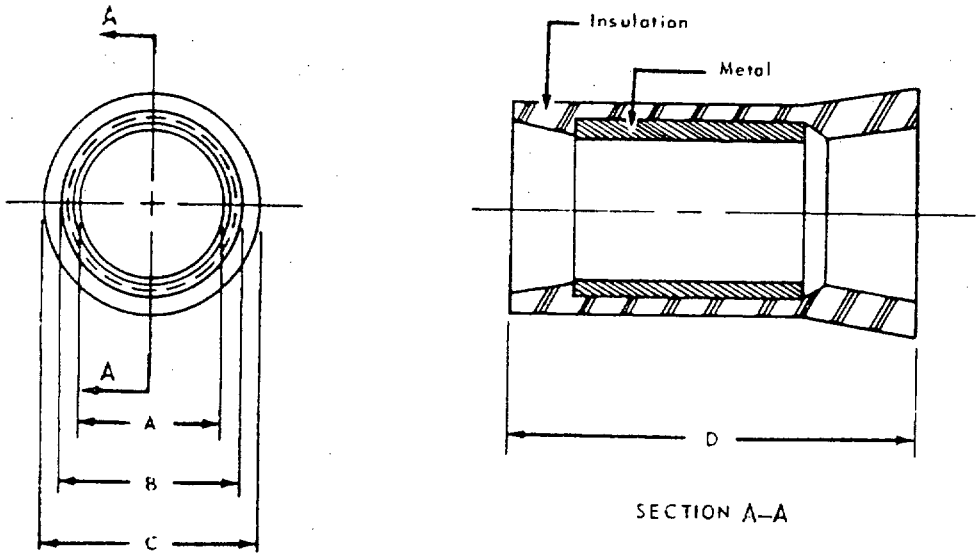


A – Inside Diameter Barrel (Shielding Receiver)

B – Inside Diameter Insulating Sleeve

C – Outside Diameter Insulating Sleeve

D – Overall Length

FIGURE 39. SHIELDING FERRULE DIMENSIONS

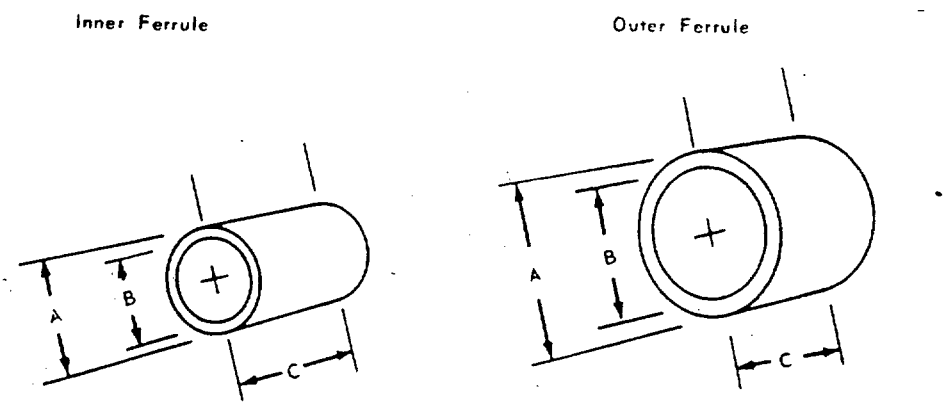

A – Outside Diameter

B – Inside Diameter

C – Overall Length

FIGURE 40. TWO-PIECE FERRULE DIMENSIONS

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.


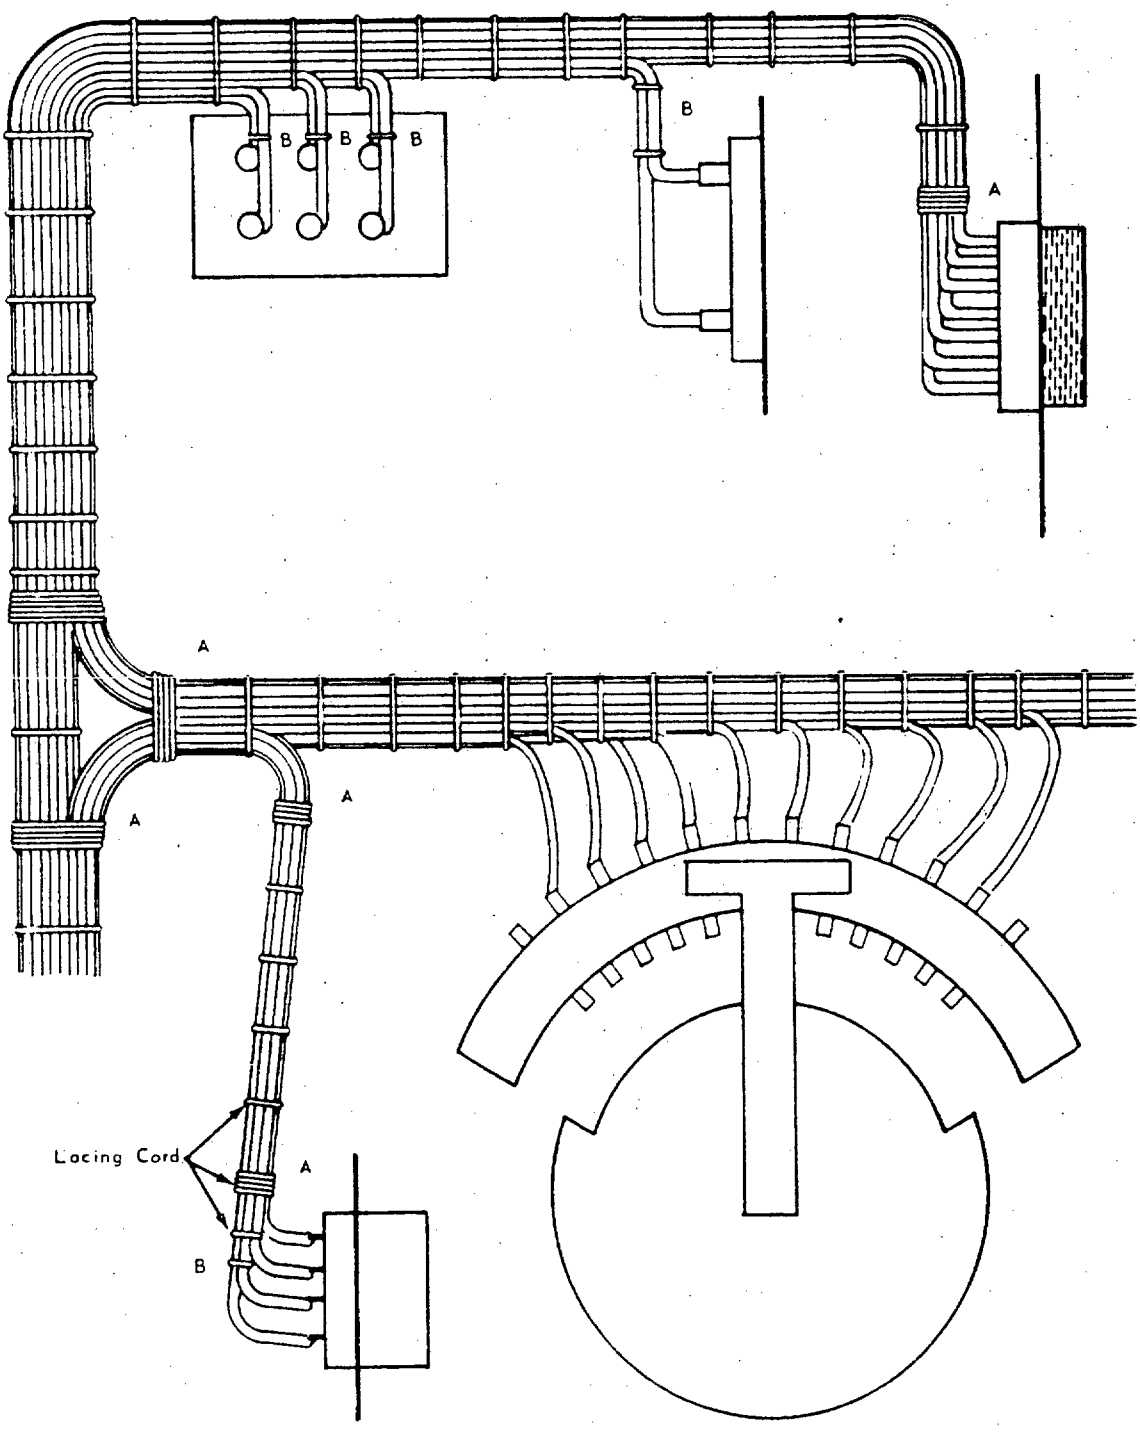


FIGURE 41. ACCEPTABLE WIRING AND ROUTING.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

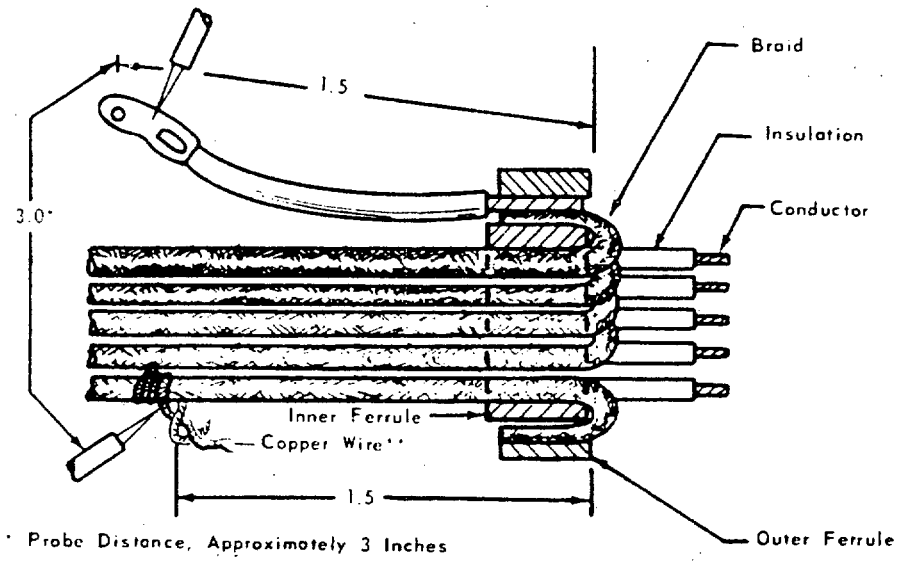

* Probe Distance, Approximately 3 Inches

** AN-30 to AN-26 Copper Wire Tightly Wound Around Each Conductor Braid As Shown

FIGURE 42. VOLTAGE DROP TEST SETUP

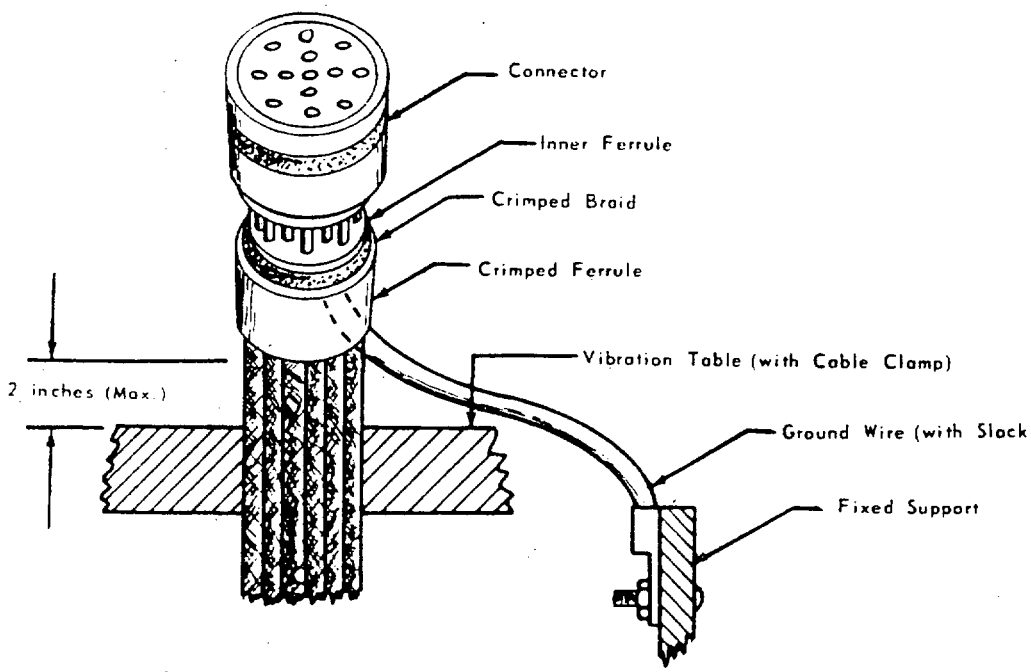


FIGURE 43. VIBRATION TEST SETUP

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

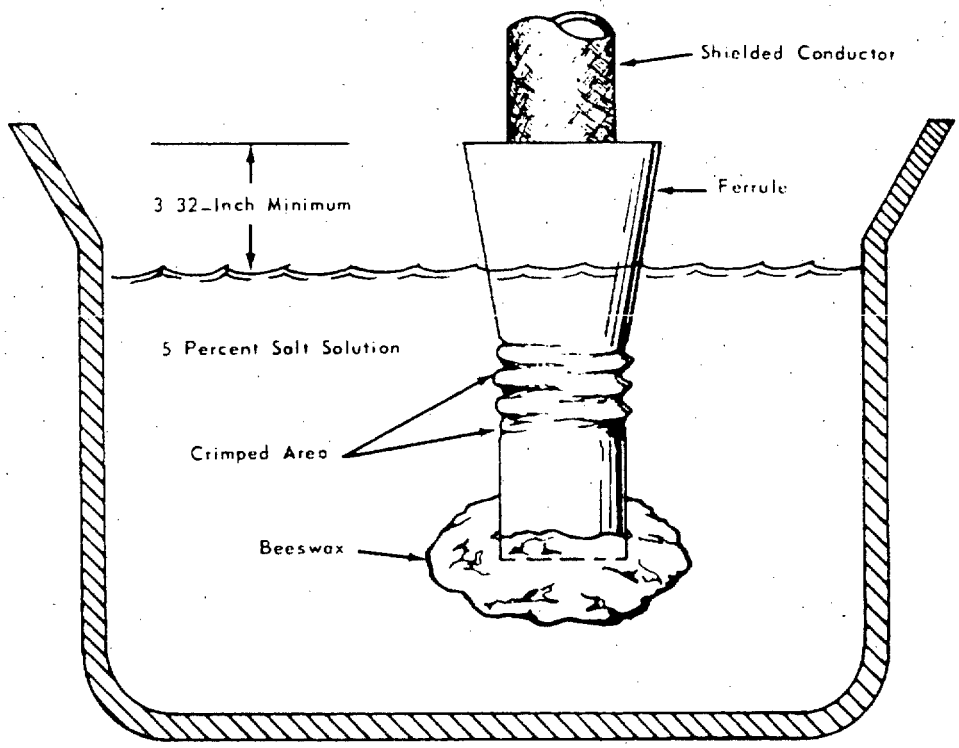


FIGURE 44. FERRULE DIELECTRIC TEST SETUP

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

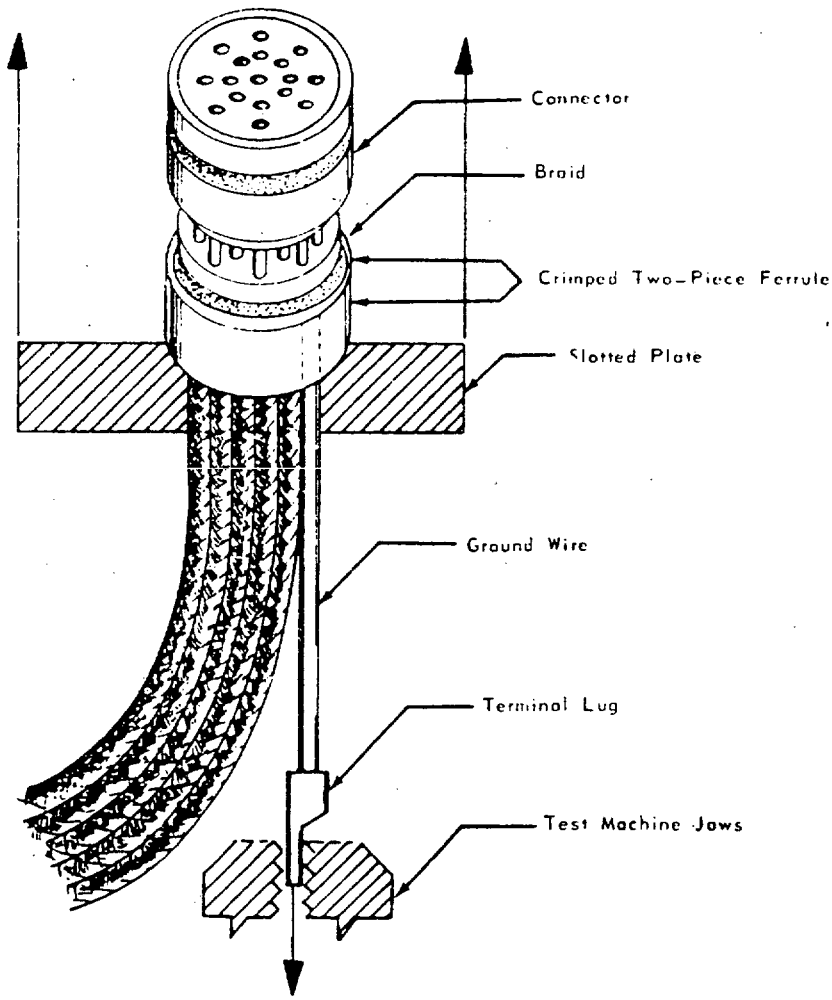


FIGURE 45. TENSILE STRENGTH TEST SETUP TWO-PIECE FERRULE

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

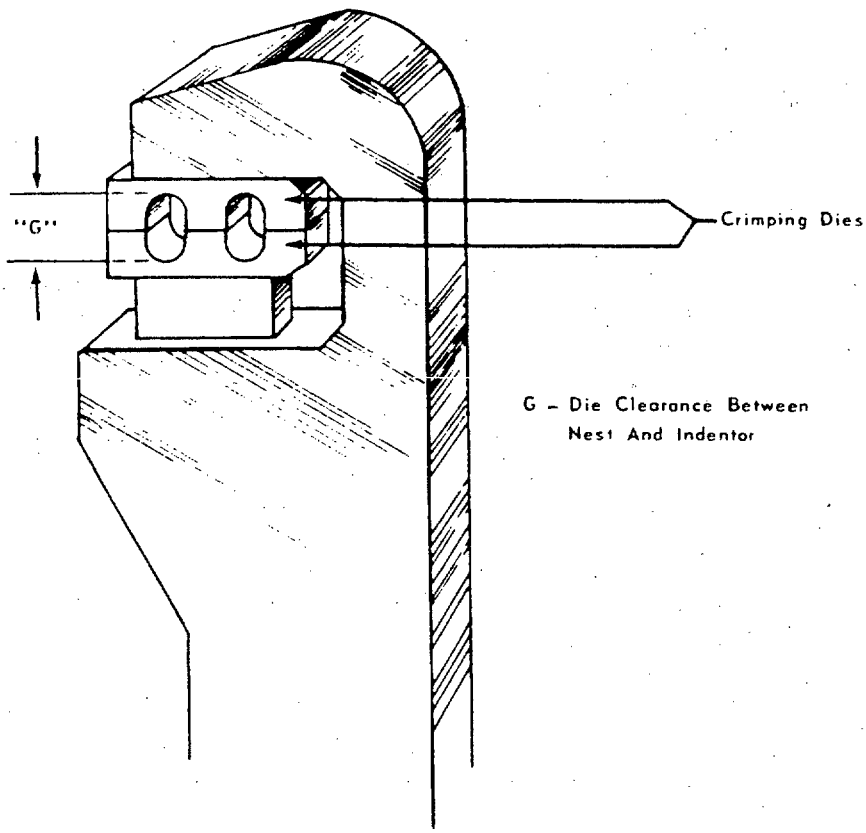


FIGURE 46. GAGE DIMENSIONS HAND TOOLS

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

FOLD

DEPARTMENT OF THE ARMY

POSTAGE AND FEES PAID
DEPARTMENT OF THE ARMY

OFFICIAL BUSINESS

Commanding General
U. S. Army Missile Command
ATTN: AMSMI-IES
Redstone Arsenal, Alabama

FOLD

GPO 303-223/Z 739

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.

SPECIFICATION ANALYSIS SHEET

Form Approved Budget Bureau No. 119-R004

INSTRUCTIONS

This sheet is to be filled out by personnel either Government or contractor, involved in the use of the specification in procurement of products for ultimate use by the Department of Defense. This sheet is provided for obtaining information on the use of this specification which will insure that suitable products can be procured with a minimum amount of delay and at the least cost. Comments and the return of this form will be appreciated. Fold on lines on reverse side, staple in corner, and send to preparing activity.

SPECIFICATION

ORGANIZATION	CITY AND STATE

CONTRACT NO.	QUANTITY OF ITEMS PROCURED	DOLLAR AMOUNT
		$

MATERIAL PROCURED UNDER A

☐ DIRECT GOVERNMENT CONTRACT ☐ SUBCONTRACT

1. HAS ANY PART OF THE SPECIFICATION CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE?

A. GIVE PARAGRAPH NUMBER AND WORDING

B. RECOMMENDATIONS FOR CORRECTING THE DEFICIENCIES

2. COMMENTS ON ANY SPECIFICATION REQUIREMENT CONSIDERED TOO RIGID

3. IS THE SPECIFICATION RESTRICTIVE?

☐ YES ☐ NO IF "YES", IN WHAT WAY?

4. REMARKS *(Attach any pertinent data which may be of use in improving this specification. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity)*

SUBMITTED BY *(Printed or typed name and activity)*	DATE

DD FORM 1 APR 63 1426 REPLACES NAVSHIPS FORM 4863, WHICH IS OBSOLETE.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T03:51Z
Check the source to verify that this is the current version before use.