[INCH-POUND]
FED-STD-809C
January 17, 2017
SUPERSEDING
FED-STD-809B
January 15, 2010

FEDERAL STANDARD

# NEUTRALIZATION AND REPAIR OF GSA APPROVED CONTAINERS AND VAULT DOORS

Beneficial comments, recommendations, additions, deletions, clarifications, etc., and any other data which may improve this document should be sent to: General Services Administration, Federal Supply Service, Plan, Policy, and Program Integration (P3I) Division, Engineering Division (QSD), Washington, DC 20406.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:02Z
Check the source to verify that this is the current version before use.

# FOREWORD

This standard establishes requirements for the neutralization and repair of GSA approved containers and vault doors. It provides the US Government with an economic alternative to replacing containers or vault doors that have been damaged from opening techniques used as a result of combination lock and bolt linkage failures. The opening and repair methods described in this standard have been designed specifically to balance the cost-effectiveness of repair versus replacement while maintaining the security integrity of the container or vault door. To meet the goal of this standard, only properly trained and equipped personnel should attempt to perform the opening and repair methods described in this standard.

The General Services Administration (GSA) authorizes commercial training facilities specifically approved by GSA to provide hands-on training in these opening and repair methods. Upon successful completion of this course, the GSA Certified Technician shall be capable of opening the locked-out container or vault door using one of the approved methods contained herein without creating any additional vulnerabilities. Due to the procurement limitations (Limited Use clause) of GSA Approved security products, the GSA Approved training for these products is also limited to US Persons (per 22 CFR 120.15) and organizations that are approved to procure the products.

The security integrity is only restored if a GSA Certified Technician strictly adheres to the methods contained within this Standard. Any deviation to the opening and repair methods outlined in this Standard will require GSA approval before a recertification can be authorized.

The opening and repair methods described in this federal standard can be hazardous to the technician and the office environment, requiring full knowledge of safety equipment and procedures. In some cases it may be necessary to move the security container to a safe and secure area before attempting the opening and repair methods described in this standard.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:02Z
Check the source to verify that this is the current version before use.

# PREAMBLE

The General Services Administration has authorized the use of this federal standard by all federal agencies.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:02Z
Check the source to verify that this is the current version before use.

CONTENTS

Page

1. SCOPE ..... 1

2. REFERENCED DOCUMENTS ..... 1
2.1 Government Documents ..... 1

3. DEFINITIONS ..... 2

4. GENERAL REQUIREMENTS ..... 2
4.1 Basic Information ..... 2
4.2 Opening Techniques ..... 2
4.2.1 Method 1: Drilling Inside Dial Ring ..... 2
4.2.2 Method 2: Hole saw ..... 2
4.2.3 Method 3: Cut-off saw ..... 2
4.2.4 Method 4: Drilling Outside Dial Ring ..... 2
4.3 Container Service Record ..... 3
4.4 Repairs ..... 3
4.4.1 Repairs, Unauthorized ..... 3
4.4.2 Repairs, Authorized ..... 3
4.4.2.1 Method 1A ..... 3
4.4.2.2 Method 1B ..... 3
4.4.2.3 Method 2 ..... 3
4.4.2.4 Method 3 ..... 3
4.4.2.5 Other Methods ..... 4
4.4.3 Container Integrity ..... 4
Table 1 ..... 5

5. DETAILED REQUIREMENTS ..... 5
5.1 Method 1: Drilling Inside Dial Ring -- Neutralizing Black Label or Red Label Containers ..... 5
5.1.1 Containers ..... 5
5.1.2 Tools and Equipment ..... 6
5.1.3 Layout and Marking Procedures ..... 6
5.1.4 Drilling Procedure ..... 6
5.1.5 Repair Procedure ..... 6
5.1.6 Safety Precautions ..... 7
5.1.7 Security Precautions ..... 7
5.2 Method 2: Hole Saw--Neutralizing Red Label Class 6 and Hamilton Green Label Class 7 Containers ..... 7
5.2.1 Containers ..... 7
5.2.2 Tools and Equipment ..... 8
5.2.3 Layout and Marking Procedures ..... 8



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:02Z
Check the source to verify that this is the current version before use.

CONTENTS

5.2.4 Cutting Procedure ..... 8
5.2.5 Repair Procedure ..... 9
5.2.6 Safety Precautions ..... 9
5.2.7 Security Precautions ..... 9
5.3 Method 3: Cut-off Saw--Neutralizing Red Label Class 5 and 6 and Hamilton Green Label Class 7 Security Containers ..... 9
5.3.1 Containers ..... 10
5.3.2 Tools and Equipment ..... 10
5.3.3 Layout and Marking Procedures ..... 11
5.3.4 Cutting Procedure ..... 11
5.3.5 Repair Procedure ..... 12
5.3.6 Safety Precautions ..... 12
5.3.7 Security Precautions ..... 12

5.4 Method 4: Drilling Outside Dial Ring--Neutralizing Black Label or Red Label Doors ..... 13
5.4.1 Containers/Doors ..... 13
5.4.2 Tools and Equipment ..... 13
5.4.3 Layout and Marking ..... 13
5.4.4 Drilling Procedure ..... 13
5.4.5 Repair Procedure ..... 13
5.4.6 Safety Precautions ..... 14
5.4.7 Security Precautions ..... 14

6. NOTES ..... 15
6.1 Background Information ..... 15
6.1.1 GSA Containers ..... 15
6.1.2 GSA Label ..... 15
6.1.3 GSA Upgraded Container Requirements ..... 15
6.1.4 New Container Neutralization Techniques ..... 15
6.1.5 Storage of FF-L-2740 Combination locks ..... 16
6.1.6 Shipping of FF-L-2740 Combination Locks ..... 16
6.1.7 Movement of Security Containers ..... 16
6.2 Additional Information and Points of Contact ..... 17
6.2.1 Drawer Heads ..... 17
6.2.2 GSA Training Organizations ..... 17

FIGURES
1. Security container and label ..... 18
2. Container measurements ..... 19
3. Builders circular saw ..... 20
4. Classes and sizes of security containers, showing cutting locations ..... 21



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:02Z
Check the source to verify that this is the current version before use.

## 1. SCOPE

This standard establishes procedures for the neutralization and repair of GSA approved containers and vault doors.

## 2. REFERENCED DOCUMENTS

2.1 Government Documents. The issues of the following documents in effect on the date of invitation for bids or request for proposal form a part of this standard to the extent specified herein.

Federal Specifications:

| | |
|---|---|
| AA-F-358 | Filing Cabinet, Legal and Letter Size, Uninsulated, Security |
| AA-F-363 | Filing Cabinet, Security, Maps and Plans, General Filing, and Storage |
| AA-D-600 | Door, Vault, Security |
| FF-L-2740 | Locks, Combination |
| AA-C-2786 | Cabinet, Security, Information Processing System Storage, Class 5 |
| AA-C-2859 | Cabinet, Security, Weapons Storage |
| FF-L-2937 | Combination Lock, Mechanical |

(Copies of these federal specifications are available on the Department of Defense Lock Program website, (https://portal.navfac.navy.mil/go/locks/ .)

General Services Administration:

Optional Form 89 - Security Container Records Form

(Copies of this form are available on the Department of Defense Lock Program website, see para 6.2.)

Air Force:

AFTO Form 36 - Maintenance Record for Security Type Equipment

(Copies of this form are available on the Air Force website, http://www.e-publishing.af.mil/formfiles/to/afto36/afto36.xfd.)



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:02Z
Check the source to verify that this is the current version before use.

## 3. DEFINITIONS

The terms used in this standard are commonly understood by the technical community to which they apply and are not used here in such a way to introduce new or limited meanings.

## 4. GENERAL REQUIREMENTS

4.1 Basic Information. Before attempting neutralization procedures on containers or vault doors, determine if the products are under warranty. Only products with red or blue labels may be under warranty (red or blue label products more than a year old are not under warranty). Contact the manufacturer concerning warranty provisions (provide the serial number and description of container). GSA contracts require manufacturers to provide warranties. During the period of the warranty (generally one year from the date of manufacture) if a lockout occurs due to failure of the locking system, the Government has the right to require the container manufacturer to provide access to the container contents within 24 hours. This provision applies in CONUS only. Contact GSA for further information regarding warranty provisions (page 16).

Neutralization of lockouts or repairs of any damage that affects the integrity of a security container approved for storage of classified material shall be done only by authorized (appropriately cleared) or continuously escorted US persons (per 22 CFR 120.15) specifically trained in the approved methods.

4.2 Opening Techniques. In order to maintain the GSA label on a container or vault door, one of the following procedures must be used for opening and repair. Table 1 identifies appropriate methods for use on various GSA approved security equipment.

4.2.1 Method 1: Drilling inside dial ring. This procedure involves drilling into the combination lock to manipulate lock components to allow retraction of the lock bolt.

4.2.2 Method 2: Hole Saw. This procedure involves using a drill and hole saw to cut the drawer face and drawer bolts.

4.2.3 Method 3: Cut-off Saw. This procedure involves using a circular saw and abrasive metal cut-off blades to cut the drawer face and drawer bolts.

4.2.4 Method 4: Drilling outside dial ring. This procedure involves drilling into the door of an IPS container, map and plan container, weapons container, or vault door to gain access to disconnected linkages to allow retraction of the boltwork.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:02Z
Check the source to verify that this is the current version before use.

4.3 Container Service Record. Whenever a security container is serviced or repaired, the work must be documented using either Optional Form 89, Security Container Records Form, or (Air Force) AFTO Form 36, Maintenance Record for Security Type Equipment.

4.4 Repairs.

4.4.1 Repairs, Unauthorized. GSA approved containers and vault doors that have been opened , repaired, or modified in a manner other than as described herein are not considered to have been restored to their original state of security integrity. The "Test Certification" label on the inside of the locking drawer or door, and the "General Services Administration Approved Container/Vault Door" label on the outside of the container/door shall be removed.

**NOTE**

*Contact the Technical Support Hotline (See 6.2 for contact information) before attempting any unauthorized opening or repair procedures.*

4.4.2 Repairs, Authorized. GSA approved containers that have been opened as described herein may be repaired by the following methods, as appropriate. See Table 1 for repair methods appropriate for the opening method used. See 5.1.5, 5.2.5, 5.3.5 and 5.4.5 for a detailed description of these repair methods.

4.4.2.1 Method 1A: Drive a tapered, hardened, tool-steel pin, steel dowel, drill bit or bearing, or a carbide-center mild steel pin into the hole. Weld the repair both on the inside and outside surfaces.

4.4.2.2 Method 1B: Drive a carbide-center mild steel pin into the hole. Weld the repair both on the inside and outside surfaces.

4.4.2.3 Method 2: Replace the control drawer head.

4.4.2.4 Method 3: Repair of a bolt linkage lockout opening procedure.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:02Z
Check the source to verify that this is the current version before use.

.

4.4.2.5 Other Methods. If any other neutralization/repair method is used, a detailed description of the procedure (photographs included) must be supplied in addition to an explanation and/or justification for the unusual opening and/or repair. GSA will review the description of the opening and repair procedures and notify the sender if the repair method maintains the equipment's GSA approval. All requests for approval of other methods will be adjudicated by the GSA IACSE/SEALS Subcommittee.

4.4.3 Product Integrity. With the exception of frames bent through application of extraordinary stress, a GSA approved security container or vault door is considered to have been restored to its original state of security integrity if it meets any of the following conditions:

(a) All damaged or altered parts (e.g., locking drawer, drawer head, etc.) are replaced with new or cannibalized parts;

(b) It has been drilled through the area covered by the dial ring (hole no larger than 3/8" diameter) using opening Method 1; the drilled hole is repaired with either repair Method 1A or repair Method 1B; and a replacement lock meeting FF-L-2740 is used (weapons containers, field safes, and armory vault doors shall use a lock meeting FF-L-2937);

(c) It has had the bolts cut using a hole saw (opening Method 2) or cut-off saw (opening Method 3). The lock is replaced with one meeting FF-L-2740 (field safes shall use a lock meeting FF-L-2937), and the drawer head is replaced (repair Method 2).

(d) It has been opened in accordance with Method 4 and repaired in accordance with Method 3. The lock is replaced with one meeting FF-L-2740 (weapons containers and armory vault doors shall use a lock meeting FF-L-2937).



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:02Z
Check the source to verify that this is the current version before use.

Table 1. Opening and Repair Procedures

| GSA Class | Label Color | Door/Container Type | Opening Method | Repair Method |
|---|---|---|---|---|
| ALL | Black | ALL | 1 | 1A |
| 5 | Red | Filing Cabinet | 1, 3 | 1B, 2 |
| 6 | Red | Filing Cabinet | 1, 2, 3 | 1B, 2 |
| 7 | Green | Filing Cabinet – Hamilton Products Group | 1, 2, 3 | 1B, 2 |
| 7 | Green | Filing Cabinet – Mosler | 1 | 1B |
| 5 & 6 | Red | Map & Plan / General Purpose Container | 1,4 | 1B, 3 |
| 5 | Red | Weapons Container | 1,4 | 1B, 3 |
| 5 | Blue | Information Processing System Container | 1,4 | 1B, 3 |
| 5 | Red | Vault Door | 1,4 * | 1B, 3 |
| 5 & 6 | Black/Red/Blue | Vault & Container Doors | 4* | 3 |

* NOTICE – Before attempting to neutralize the vault door, consider gaining entrance by penetrating the wall of the vault. It is often faster and less expensive to repair.

**Table 1 Note**

For repair Methods 1A, 1B, and 3, the outside of the container or vault door must be puttied, sanded and repainted in such a way that no evidence of the hole or its repair remains on the outer surface. When containers or doors are repainted, they shall be painted one of the original approved colors (grey, black, or parchment); weapons containers and vault doors are only approved in gray. The paint and processes used to repaint the containers or doors shall result in a textured finish. The exterior of the container or vault door shall be one uniform color. The interior of a container may be a different color.

## 5. DETAILED REQUIREMENTS

5.1 Method 1: Drilling--Neutralizing Black Label or Red Label Containers. This method is approved for neutralization of lockouts on GSA door-type containers and GSA vault doors and allows for an authorized repair of the drilled door. It may also be used on drawer-type containers, especially those for which replacement parts are not available. For warranty coverage information, see paragraph 4.1.

5.1.1 Containers. This procedure is recommended for opening black label containers and vault doors, and those red label products for which opening Methods 2 and 3 are not appropriate. Some black label containers and all red, green, and blue label containers have hardplates which are difficult to drill.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:02Z
Check the source to verify that this is the current version before use.

5.1.2 Tools and Equipment. Tools and equipment recommended to perform this procedure include:

1. Tape measure
2. Hammer
3. Assorted punches
4. Heavy-duty drill motor
5. Assorted drill bits, no larger than 3/8" diameter
6. Lever-type or fixed drill rig (fixed drill rig required if using diamond-tipped core drills)
7. Borescope; must fit within the hole drilled and must be appropriate for the approach to opening the lock
8. Ice pick or similar sharp probe
9. Safety equipment

5.1.3 Layout and Marking Procedures. The hole must be within the area covered by the dial ring. Removal of the dial and dial ring facilitates accurate measurement and marking of the drill point, and drilling of the hole. The precise location of the drill point will depend on the container, the lock being neutralized and the approach used (drilling off the fence, scoping the wheels, etc.). For information on where to drill, or any other specifics of this method, call the Technical Support Hotline (see 6.3 ).

5.1.4 Drilling Procedure. Attach the drill rig to the container according to the drill rig manufacturer's instructions. Drill through the outer skin of the drawer or door with a high-speed steel or cobalt drill bit. Use a pressure rig, either fixed or lever-type, with a carbide-tipped drill bit to penetrate the hardplate. If carbide-tipped drill bits cannot penetrate the hardplate, use a diamond-tipped core drill with a fixed drill rig.

After drilling through the hardplate, use a high-speed steel or cobalt drill bit to complete the drilling into the lock case. Manipulate internal components of the lock to retract its bolt, then use the container's handle to retract the boltwork.

5.1.5 Repair Procedure. Repair the drilled hole with either: repair Method 1A for all black label containers/doors; or repair Method 1B for all red, blue, or green label containers/doors.

a) Method 1A: A tapered, hardened, tool-steel pin, steel dowel, drill bit or bearing, or a carbide-center mild steel pin, shall be driven into the hole. There shall remain at each end of the pin a shallow recess not less than 1/8" nor more than 3/16" deep to permit the acceptance of substantial welds (recommend MIG or TIG). The repair shall be welded both on the inside and outside surfaces. The outside of the drawer head or door must then be puttied, sanded, and repainted in such a way that no visible evidence of the hole or its repair remains on the outer surface.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:02Z
Check the source to verify that this is the current version before use.

b) Method 1B: A carbide-center mild steel pin with a diameter slightly larger than the hole, shall be driven into the hole. There shall remain at each end of the pin a shallow recess not less than 1/8" nor more than 3/16" deep to permit the acceptance of substantial welds (recommend MIG or TIG). The pin is welded both on the inside and outside surfaces. The outside of the drawer head or door must then be puttied, sanded, and repainted in such a way that no visible evidence of the hole or its repair remains on the outer surface.

5.1.6 Safety Precautions. All safety precautions should be taken to prevent injury during this procedure. Possible hazards include, but are not limited to:

1. Hot or sharp surfaces or edges.
2. Hot drill bits and metal chips.
3. Drill bit binding in hole.
4. Pressure rig becoming detached from container.

5.1.7 Security Precautions. The classified material custodian (or alternate) for the container being neutralized should be present during this procedure.

5.2 Method 2: Hole saw--Neutralizing Red Label Class 6 and Hamilton Green Label Class 7 Containers. This procedure attacks the drawer head boltwork. It may be used in conjunction with repair Method 2 to restore the security integrity of the container.

5.2.1 Containers. GSA approved Class 6 security filing containers manufactured after October 1, 1990 meet the requirements of Fed spec AA-F-358G (or later version). GSA approved Class 7 security filing containers meet the requirements of Fed spec AA-F-2815. Due to the increased covert entry resistance of these containers, traditional lockout neutralization techniques may not be cost-effective. Containers manufactured under AA-F-358G (or later version) are differentiated from earlier models by inspecting the GSA label attached to the face of the container. GSA approval labels on containers manufactured before October 1, 1990 are silver with BLACK lettering (or BLACK with silver lettering). GSA approval labels on containers manufactured after that date are silver with RED lettering. Containers manufactured under AA-F-2815 (Class 7 containers) are differentiated from all other containers by having GSA labels that are silver with GREEN lettering (see Figure 1). The procedures to neutralize lockouts on Class 6 GSA security containers manufactured under AA-F-358G (or later version), and Hamilton Class 7 GSA security containers, are presented here. This procedure is presented as an alternative to opening Method 3. Opening Method 3 creates dust and debris and may not be appropriate for some situations.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:02Z
Check the source to verify that this is the current version before use.

5.2.2 Tools and Equipment. Tools and equipment recommended to perform this procedure include:

1. Hammer
2. Assorted punches
3. Heavy duty drill motor
4. 1-1/4" or 1-1/2" carbide tipped hole saws (may not be readily available)
5. Safety equipment

5.2.3 Layout and Marking Procedures.

1. Identify the container as a Class 6 red label or Hamilton Class 7 green label GSA approved security filing container (see Figure 1). The face of a Class 6 or Class 7 container will be approximately 1/8" thick or less, and will overlap the front of the container.
2. Determine, from the external label, whether it was made by Alpha, Mosler, Diebold Mosler, Millennium Metals, or Hamilton Products Group. Refer to Figure 1.
3. Figures 2 and 3 are not actual size. They provide measurements for each make of Class 6 or Class 7 container, to locate the holes to be drilled. Using the measurements from the appropriate drawing, locate and center punch for the hole saw's pilot drill. Contact the Technical Support Hotline for questions or problems (see 6.2).
4. Spread a drop cloth in front of the safe to catch chips from cutting hole in drawer face (if necessary).

5.2.4 Cutting Procedure. The technician will cut through the face of the drawer head and continue through the locking bolts. Each hole saw cut will remove a section of a locking bolt. This will allow the drawer handle to be rotated to retract the bolt ends. This also allows the locking drawer to be opened without damaging the lock or the rest of the container.

1. At one of the center punched locations, use the hole saw with a pilot drill and cut through the face of the drawer head.
2. Inspect the hole to verify that it is aligned with the locking bolt to be cut.
3. Using the hole in the drawer face for support, cut through the locking bolt. Do not engage the trigger lock on the drill motor. Move the drill slightly horizontally and vertically to create a slightly larger hole. This reduces the chance that the hole saw will bind.
4. Repeat these steps on the other side to cut the other bolt. Turn the handle to retract the boltwork.

Note: If the bolt linkage is severed during the cutting procedure, retract the bolts with a screwdriver or similar tool.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:02Z
Check the source to verify that this is the current version before use.

5.2.5 Repair Procedure. Replace the drawer head. Replacement drawer heads may be cannibalized or are available from the container manufacturers (see phone numbers in 6.2.1). To replace the drawer head:

1. Remove the control drawer from the container.
2. Remove the damaged drawer head from the drawer assembly.
3. Install a new or cannibalized drawer head on drawer assembly.
4. Install a GSA approved combination lock on the new drawer-head (use original lock if appropriate).
5. Reinstall control drawer in container.

5.2.6 Safety Precautions. All safety precautions should be taken to prevent injury during this procedure.

Possible hazards include, but are not limited to:

1. Hot or sharp surfaces or edges.
2. Hot drill bits and hole saws.
3. Hot metal chips.
4. Hole saw binding in hole.

Recommended that the following safety and protective gear be used:

1. Eye protection, such as safety goggles
2. Leather gloves
3. Drop cloth

5.2.7 Security Precautions. The classified material custodian (or alternate) for the container being neutralized should be present during this procedure.

5.3 Method 3: Cut-off saw--Neutralizing Red Label Class 5 and 6 and Hamilton Green Label Class 7 Security Containers. All containers discussed here have one or more drawers with a mounted combination lock. The drawer with the combination lock is referred to as the control drawer. Control drawers are locked in place by hardened steel bolts that extend from each side of the drawer to engage the body of the container. The drawer head of the control drawer is removable from the drawer itself. This procedure attacks the drawer head boltwork. It may be used in conjunction with repair Method 2 to restore the security integrity of the container.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:02Z
Check the source to verify that this is the current version before use.

5.3.1 Containers. GSA approved Class 5 and Class 6 security file containers manufactured after October 1, 1990 meet the requirements of Fed spec AA-F-358G (or later version). GSA approved Class 7 security filing containers meet the requirements of Fed spec AA-F-2815. Due to the increased covert entry resistance of these containers, traditional lockout neutralization techniques may not be cost-effective. Containers manufactured under AA-F-358G (or later version) are differentiated from earlier models by inspecting the GSA approval label attached to the face of the container. GSA approval labels on containers purchased before October 1, 1990 are silver with BLACK lettering (or BLACK with silver lettering). GSA approval labels on containers manufactured after that date are silver with RED lettering (see Figure 1). Procedures to neutralize lockouts on Class 5 and 6 GSA security containers manufactured under AA-F-358G (or later version) and Hamilton Class 7 containers are presented here.

This method, opening Method 3, creates dust and debris and may not be appropriate for some situations. Opening Method 2 may also be used on Class 6 red label and Hamilton Class 7 green label containers.

5.3.2 Tools and Equipment. Tools and equipment recommended to perform this procedure include:

Safety equipment

Alpha, Hamilton, Mosler & Diebold Mosler, and Millennium Metals Class 6 Containers, Letter and Legal Size, and Hamilton Class 7 Containers:

1. Heavy duty 7-1/4" builders circular saw.
2. 7" x 1/8" abrasive metal cutoff blades.

Hamilton Class 5 Container, Legal Size*:

1. Heavy duty 7-1/4" builders circular saw
2. 7" x 1/8" abrasive metal cutoff blades.

Mosler and Diebold Mosler Class 5 Containers, Legal Size:

1. Heavy-duty 10-1/4" builders circular saw (requires minor modification, as shown in Figure 4).
2. 10" abrasive metal cutoff blades.

* Hamilton Products Group Class 5 drawer heads require only one cut per bolt.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:02Z
Check the source to verify that this is the current version before use.

Number of blades listed for the various containers is approximate and will vary with specific tools used and operator experience.

5.3.3 Layout and Marking Procedures.

1. Using the appropriate dimensions in Figure 5, measure up from the bottom of the drawer head and mark. Make at least three equally spaced marks across the drawer.
2. Using a straight edge, draw a horizontal line using the marks made in Step 1 as a guide. This is the centerline of the locking bolt.
3. Using the appropriate dimensions in Figure 5, measure from the right side of the drawer and mark. Repeat this same measurement on the left side of the drawer.
4. Using a builder's square or a straight edge, draw the vertical lines at the marks on both the right and left sides of the drawer face. These are the saw cut locations.

5.3.4 Cutting Procedure. The technician will make four* vertical cuts through the face of the drawer-head. Each pair of cuts will remove a section of a locking bolt. This will allow the drawer handle to be rotated to retract the bolt ends. This allows the locking drawer to be opened without damaging the lock or the rest of the container.

1. Determine the type, class and manufacturer of the file container. Contact the Technical Support Hotline if identification assistance is needed.
2. Remove the label holder from the face of the container before beginning layout.
3. Lay out and mark cutting locations on the face of the control drawer (see Figure 5)
4. Set the cutting depth of the circular saw to maximum.
5. Using the circular saw, cut through the drawer face and through the locking bolt at each marked location.
6. When the cutting is complete, rotate the handle and open the drawer.

* Hamilton Products Group Class 5 drawer heads require only one cut per bolt.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:02Z
Check the source to verify that this is the current version before use.

Notes:
a. Make the inboard cuts first to prevent the locking bolt from rolling during cutting.
b. Depth setting may need to be reset during cutting procedure.
c. Maintain the cut centered at the horizontal line.
d. Cutting too high will damage the container frame.
e. Cutting too low will sever the bolt carrier rods on a Hamilton container.
f. Always maintain a firm grip on the saw.

If the bolt linkage is severed during the cutting procedure, enlarge the outer cut on each side of the drawer (if necessary) and retract the bolts with a screwdriver or similar tool.

5.3.5 Repair Procedure. Replace the drawer head. Replacement drawer heads may be cannibalized or are available from the container manufacturers (see phone numbers in 6.2.1). To replace the drawer head:

1. Remove the control drawer from the container.
2. Remove the damaged drawer head from the drawer assembly.
3. Install a new or cannibalized drawer head on drawer assembly.
4. Install a GSA approved combination lock on the new drawer-head (use original lock if appropriate).
5. Reinstall control drawer in container.

5.3.6 Safety Precautions. All safety precautions should be taken to prevent injury during this procedure. Use extreme caution when using the modified 10-1/4-inch circular saw. Possible hazards include, but are not limited to:

1. Hot or sharp surfaces and edges
2. Hot saw blades
3. Hot flying sparks

Use the safety and protective gear recommended:
1. Eye protection, such as a full face shield
2. Hearing protection
3. Leather gloves
4. Fire extinguisher

It is also recommended that a second person be present, to see that sparks do not cause a fire.

5.3.7 Security Precautions. The classified material custodian (or alternate) for the container being neutralized should be present during this procedure.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:02Z
Check the source to verify that this is the current version before use.

5.4 Method 4: Drilling outside of the dial ring--Neutralizing Black Label or Red Label Containers. This method is approved for neutralization of lockouts on GSA door-type containers and GSA vault doors and allows for an authorized repair of the drilled door. For warranty coverage information, see paragraph 4.1.

5.4.1 Containers/Doors. This procedure is recommended for opening IPS containers, map and plan containers, weapons containers, or vault doors to gain access to disconnected linkages and allow retraction of the lock bolt(s).

5.4.2 Tools and Equipment. Tools and equipment recommended to perform this procedure include:

1. Tape measure
2. Hammer
3. Assorted punches
4. Heavy-duty drill motor
5. Assorted drill bits, no larger than 1/2" diameter
6. Lever-type or fixed drill rig (fixed drill rig required if using diamond-tipped core drills)
7. Borescope; must fit within the hole drilled and must be appropriate for the approach to opening the lock
8. Ice pick or similar sharp probe
9. Safety equipment

5.4.3 Layout and Marking Procedures. The hole must be ½" diameter or less. No more than 2 holes per door are allowed. The precise location of the drill point will depend on the container, and the approach used. For information on where to drill, or any other specifics of this method, call the Technical Support Hotline (see 6.2).

5.4.4 Drilling Procedure. Attach the drill rig to the container according to the drill rig manufacturer's instructions. Drill through the outer skin of the door with a high-speed steel or cobalt drill bit. Manipulate internal components to retract the boltwork.

5.4.5 Repair Procedure. Continuously weld a 2"x 2" x 3/8" steel plate to the inside of the vault door, or door of an IPS container or map & plan container. (If a vault door was drilled to reach the escape mechanism, repair the hole using repair Method 1B.) The outside of the door must then be puttied, sanded, and repainted in such a way that no visible evidence of the hole or its repair remains on the outer surface. No more than 2 holes per container are authorized and the holes must be no larger than ½" in diameter.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:02Z
Check the source to verify that this is the current version before use.

5.4.6 Safety Precautions. All safety precautions should be taken to prevent injury during this procedure. Possible hazards include, but are not limited to:

1. Hot or sharp surfaces or edges.
2. Hot drill bits and metal chips.
3. Drill bit binding in hole.
4. Pressure rig becoming detached from container.

5.4.7 Security Precautions. The classified material custodian (or alternate) for the container being neutralized should be present during this procedure.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:02Z
Check the source to verify that this is the current version before use.

## 6. NOTES

6.1 Background Information. This document details unclassified procedures to neutralize and repair lockouts on GSA-approved security containers and vault doors in a manner that will allow retention of the GSA approval.

6.1.1 GSA Containers. GSA tests containers, combination locks, and vault doors to ensure that they provide the levels of performance required in Federal specifications. Products that meet the specification requirements are approved for listing on Qualified Products Lists and are authorized to bear a GSA approval label. Current Federal specifications for security products include AA-F-358 for security filing cabinets, AA-F-363 for map and plan and general purpose cabinets, AA-C-2859 for weapons containers, AA-C-2786 for information processing system storage containers, and AA-D-600 for vault doors. The Federal specification for combination locks that secure classified material is FF-L-2740. The Federal specification for combination locks that secure classified material in field safes, and arms, ammunition, and explosives in weapons containers and behind armory vault doors, is FF-L-2937. Federal specifications which have been canceled, but which were used for other products, include AA-F-357 for insulated security filing cabinets, AA-F-2815 for Class 7 security filing cabinets, AA-S-1518 for tool-resistant security containers, and AA-D-2757 for Class 8 security vault doors.

*6.1.2.* GSA Label. When locked-out containers or doors are opened in a manner that causes damage to the product or reduces the security of the product, the GSA approval label must be removed. *Proper opening and repair of containers and vault doors allow the GSA label to be retained and will not require recertification of the container or vault door.*

6.1.3. GSA Upgraded Container Requirements. In 1990, GSA revised the container and door specifications to increase the level of protection they provide. The label color was changed to differentiate new equipment from earlier models. On products manufactured prior to October 1, 1990, the GSA label is black and silver. Beginning October 1, 1990, labels are red and silver, although some specialized containers have labels with other colors. In 1992, changes were made in the requirements for the combination locks installed on containers at the time of manufacture.

6.1.4. New Container Neutralization Techniques. The changes in container and door construction provide covert entry resistance. New neutralization techniques have been developed to provide cost-effective means of entry and to prevent damage to the combination locks. Traditional techniques are not appropriate, considering the difficulty of drilling the hardplate, the increased cost of combination locks, and the removable drawer heads.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:02Z
Check the source to verify that this is the current version before use.

6.1.5 Storage of FF-L-2740B Combination locks. All GSA “limited use” electronic security equipment (FF-L-2740B combination Locks) must be protected against tampering while being warehoused or shipped to the end user. All manufacturing, distribution, storage and Locksmith facilities shall store FF-L-2740B locks in facilities that have security-in-depth (as defined in 32 CFR 2001.92 (a)) or in a padlocked 16 gauge steel cabinet. The GSA must be contacted immediately if a burglary or intrusion into the facility has been discovered or any other incident resulting in the loss of control over the security equipment. All GSA limited use security equipment in stock at the time must be considered compromised and returned to GSA.

6.1.6 Shipping of FF-L-2740B Combination locks. Any shipping companies used to transport the GSA limited use security equipment must have a tracking capability (for example: Fed Ex, UPS & USPS) and require a signature upon receipt. The serial numbers from each of the GSA limited use security equipment must be sent under separate cover for verification upon receipt by the end user.

6.1.7 Movement of GSA Security Containers. The movement of GSA security containers should be accomplished by professionals trained and equipped for the movement of heavy equipment. Special "safe" moving equipment designed to move heavy GSA Approved security containers safely without damaging the container are readily available and should be used. The GSA Approved security container should be attached to the moving equipment with straps from the sides or the rear. At no time should the front of the security container come in contact with the moving equipment. The combination lock dial, dial ring and security container handles should never be used in any way to aid in the movement of the security container.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:02Z
Check the source to verify that this is the current version before use.

6.2 Additional Information and Points of Contact.
Department of Defense Lock Program:
Technical Support Hotline
Phone: (805) 982-1212, toll-free (800) 290-7607, or DSN 551-1212
Website: https://portal.navfac.navy.mil/go/locks/

Quality Assurance Information:
General Services Administration
National Furniture Center
Phone: (703) 605-9256

6.2.1. Drawer Heads. For information on drawer head replacement or warranty provisions, contact:

Hamilton Products Group Inc. Government Sales
Phone: (800) 876-6066

Diebold Mosler Government Sales
Phone: (800) 568-7233

Alpha Safe and Vault
Phone: (703) 281-7233

Millennium Metals
Phone: (877) 510-3799

6.2.2. GSA Training Organizations:

MBA USA
Phone: (888) 622-5495

LSI
Phone: (866) 574-8724

MILITARY INTERESTS:

Preparing Activity:
GSA-FAS

Military Coordinating Activity:
Navy-YD

Custodians:
DLA-IS
AF-99
Army-AR



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:02Z
Check the source to verify that this is the current version before use.

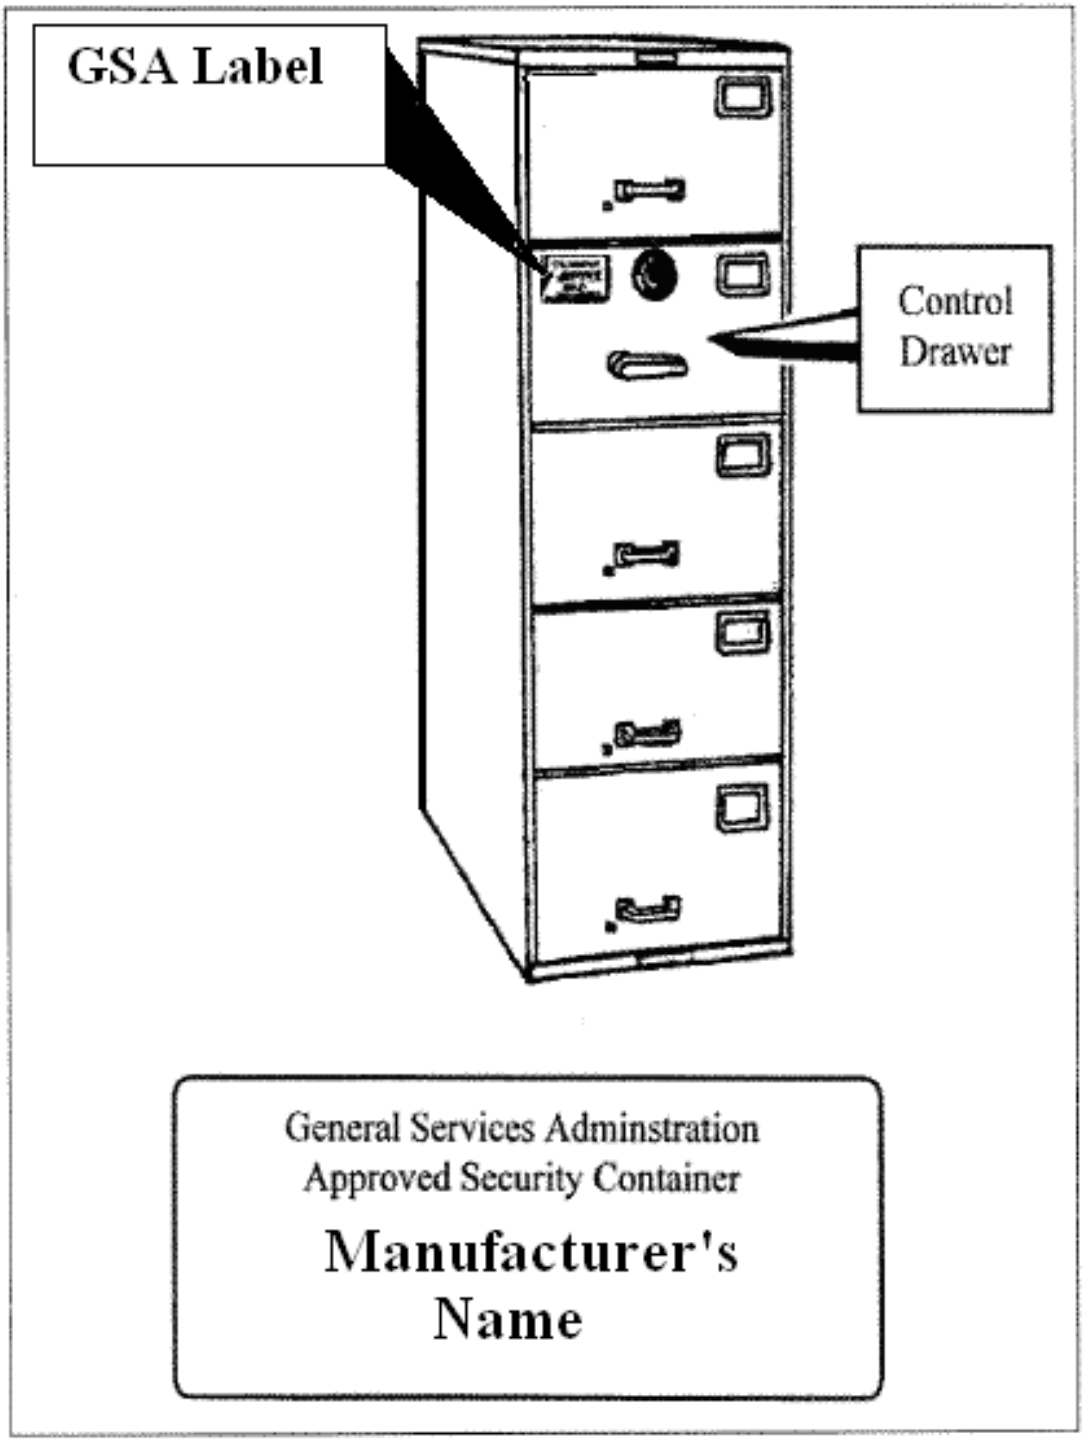



Figure 1. Security container and label



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:02Z
Check the source to verify that this is the current version before use.

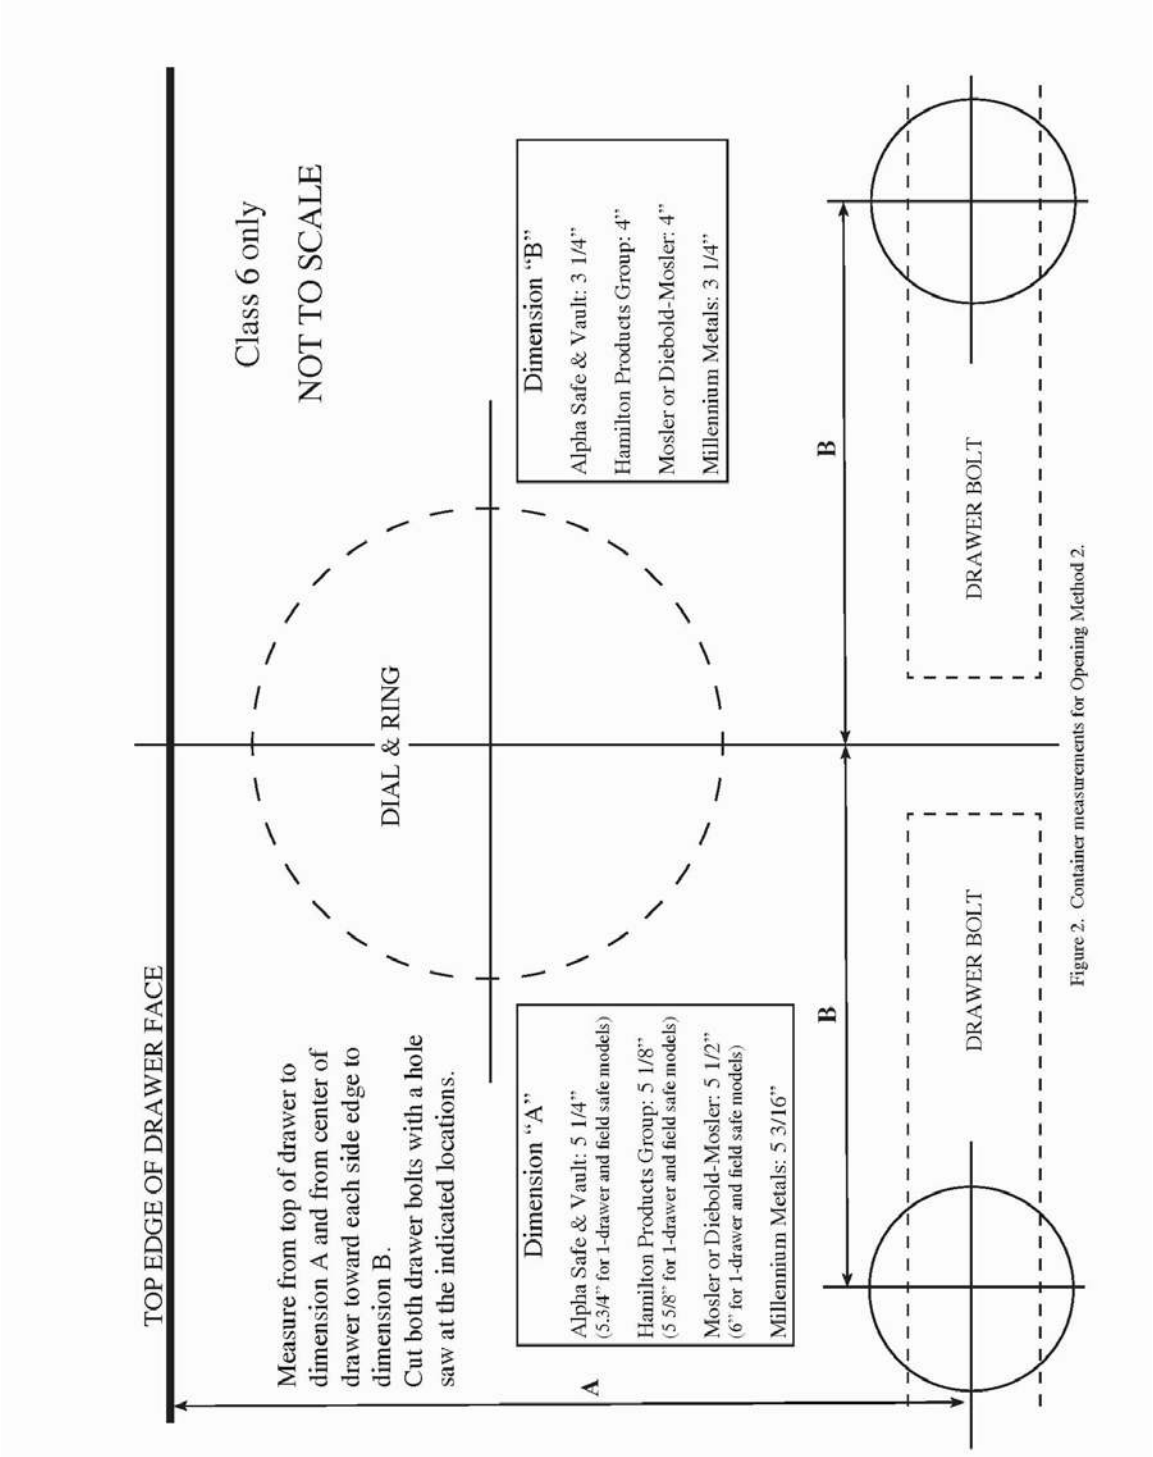



Figure 2. Container measurements for Opening Method 2.

Figure 2. Container opening method 2 measurements.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:02Z
Check the source to verify that this is the current version before use.

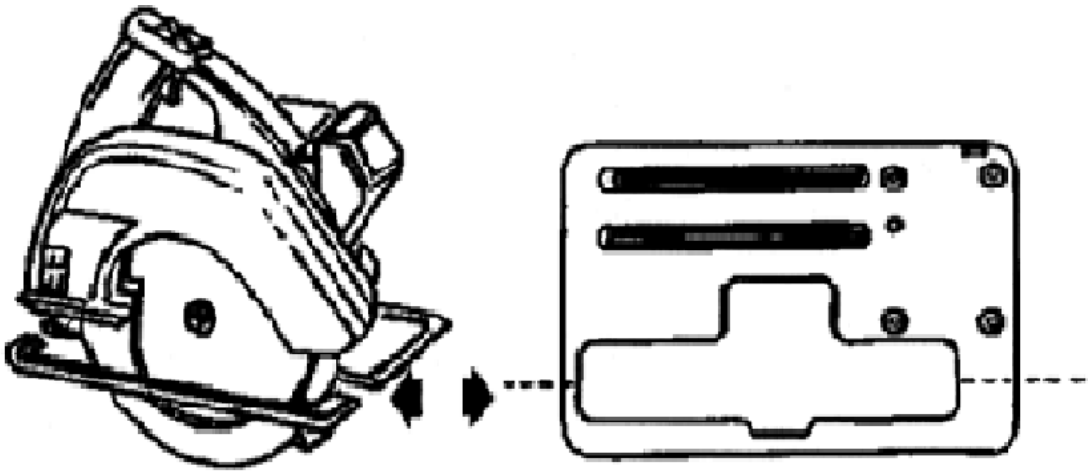


Figure 3. Builder's circular saw. Cut the foot assembly of the 10 ¼" circular saw as shown. File or grind the cut edges of the foot assembly to remove sharp edges. This size saw is necessary on Mosler or Diebold-Mosler Class 5 security files. A 7 ¼" builders circular saw is adequate for other files and does not require the modification shown above.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:02Z
Check the source to verify that this is the current version before use.

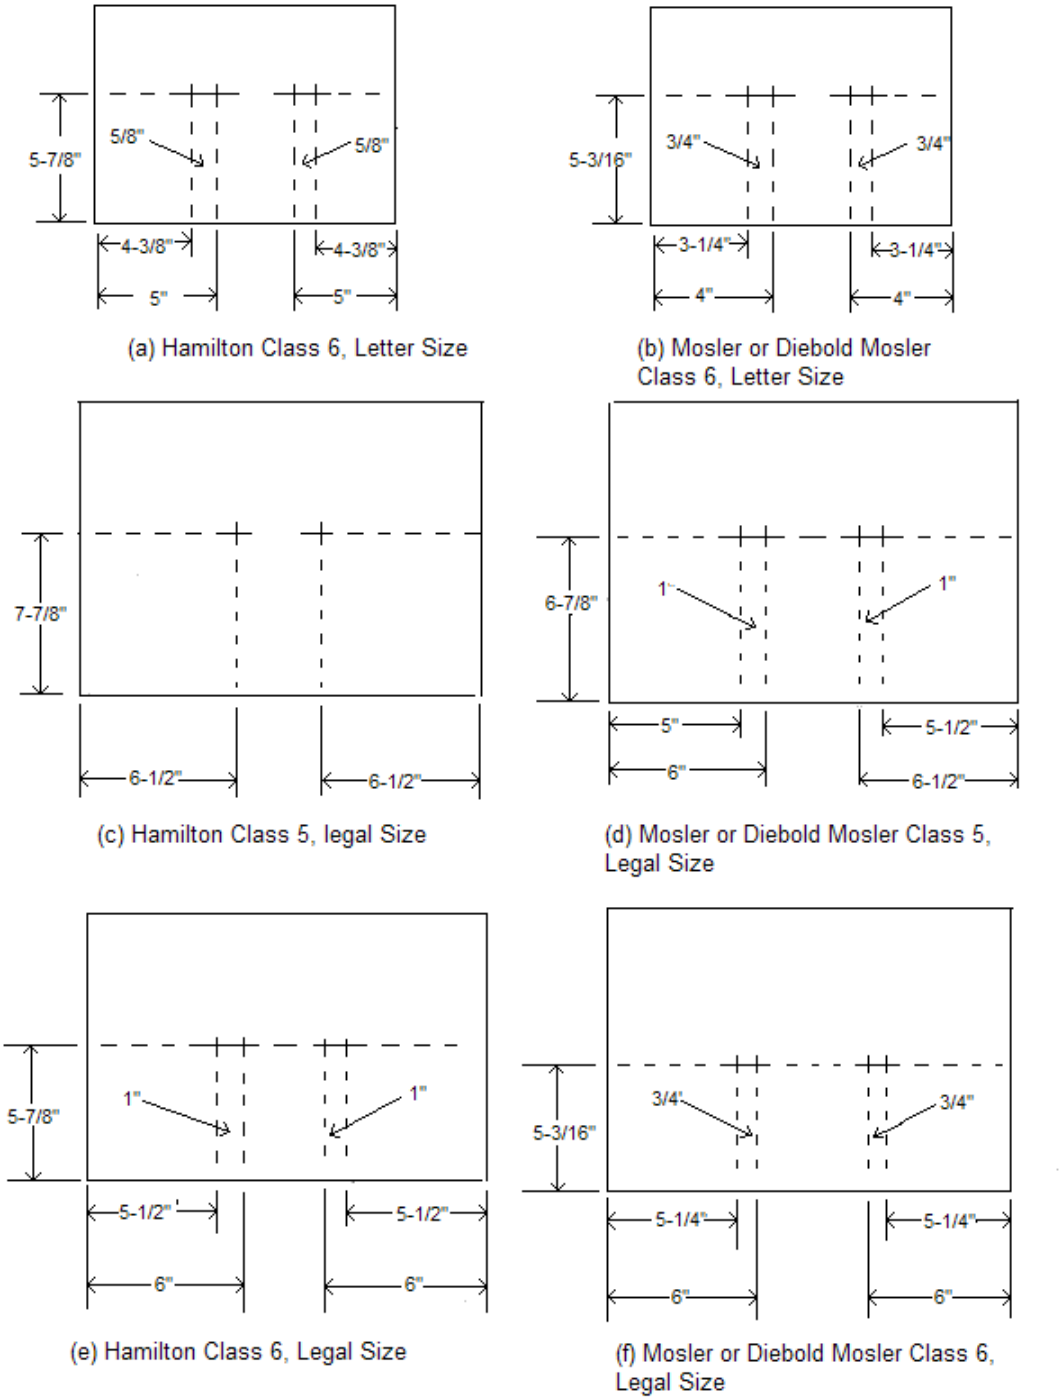



Figure 4. Classes and sizes of security containers, showing cut marks locations.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:02Z
Check the source to verify that this is the current version before use.