MIL-E-63124A(AR)
AMENDMENT 3
10 May 1983
SUPERSEDING
AMENDMENT 2
7 September 1982

MILITARY SPECIFICATION

ELECTRONICS MODULE ASSEMBLY

This amendment forms a part of Military Specification MIL-D-63124A(AR), dated 17 December, 1979 and is approved for use by the US Army Armament Research and Development Command and is available for use by all Departments and Agencies of the Department of Defense.

PAGE 2

2.1: Delete MIL-STD-454 and MIL-STD-1460 in its entirety and substitute the following:

MIL-S-45743 - Soldering Manual Type, High Reliability, Electrical and Electronic Equipment

MIL-S-46844 - Solder Bath Soldering of Printed Wiring Assemblies.

PAGE 3

3.3.3, Change to read:

"The electronics module shall provide two outputs of 20.0 to 30.0 volts direct current (DC), a chaff dispense signal and a flare dispense signal, with characteristics conforming to Figure 1. These outputs shall be initiated by the respective input signals".

Add "Figure 1" as shown:

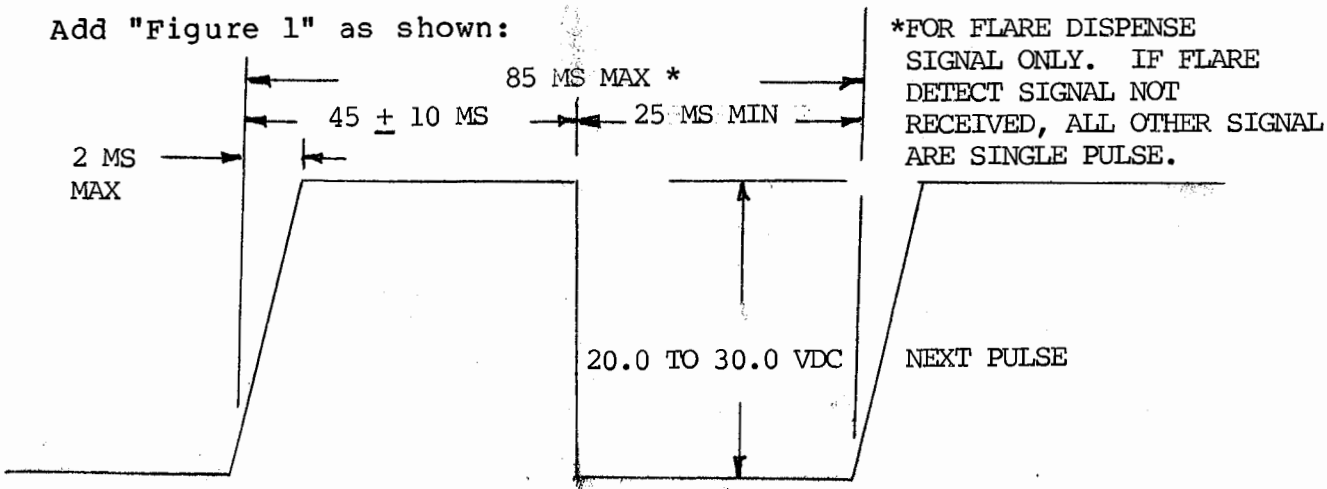

FIGURE 1 Dispense signal

FSC 1095

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

3.3.4, Change to read:

"If the electronics module does not receive a flare detection signal from the dispenser assembly, it shall provide another flare dispense signal within 85 ms. The electronics module shall be limited to three flare dispense actions only for each flare dispense input signal. If the electronics module does receive a flare detection signal, it shall not generate additional dispense signals".

3.3.5, Change to read:

"A chaff count signal or a flare count signal shall be generated each time a chaff or flare is dispensed. Both count signals shall conform to Figure 1".

PAGE 5

Change "Figure 1" to "Figure 2".

PAGE 6

* 3.4.4: Add "Procedure I" after "Test Method 501.1".

3.5, Delete "MIL-STD-1460" and add "MIL-S-45743 and MIL-S-46844 as applicable".

PAGE 8

* TABLE I, First article inspection: Delete sequence of testing as follows:

From	To
Examination of Defects	Examination of Defects
Burn in	Burn in
Functioning	Functioning
Transportation vibration	Transportation vibration
Aircraft vibration	Aircraft vibration
Humidity	Humidity
High temperature	Low temperature
Low temperature	High temperature
Examination of Defects	Examination of Defects

PAGE 15

Para. 4.4.2.6: Under Major add, "Grommet missing or improperly assembled, 0.40% 3.2 Visual".

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.

* 4.5.7, Line six (6): Delete "be determined by thermal survey in accordance with MIL-STD-781" and substitute "for sixteen (16) hours".

The margins of this amendment are marked with an asterisk or vertical lines to indicate where changes (additions, modifications, corrections, deletions) from the previous amendment were made. This was done as a convenience only and the Government assumes no liability whatsoever for any inaccuracies in these notations. Bidders and contractors are cautioned to evaluate the requirements of this document based on the entire content irrespective of the marginal notations and relationship to the last previous amendment.

Custodian:
Army-AR

Preparing activity:
Army-AR

(Project 1095-A137)

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:16Z
Check the source to verify that this is the current version before use.