MILITARY SPECIFICATION

WARHEAD SECTION ASSEMBLY
NIKE HERCULES TRAINER
M-74

1. SCOPE

1.1 This specification covers requirements, quality assurance provisions, and the preparation for delivery criteria for one type of section assembly entitled as Warhead Section Assembly Nike Hercules Trainer M-74, which is used for training on the Nike Hercules warhead section.

2. APPLICABLE DOCUMENTS

2.1 The following documents, of the issue in effect on date of invitation for bids or request for proposals, form a part of this specification to the extent specified herein:

STANDARDS

MILITARY

MIL-STD-105	- Sampling Procedures and Tables for Inspection by Attributes.
MIL-STD-1168	- Lot Numbering of Ammunition.

DRAWINGS

ORDNANCE CORPS

8846001	- Warhead Section Assembly.
8846373	- Warhead Section Assembly - Packaging Drawing.
EL-8855807	- Equipment List.

(Copies of specifications, standards, drawings, and publications required by suppliers in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer.)

3. REQUIREMENTS

3.1 Materials. The contractor shall furnish objective evidence (see 6.2) that the material complies with the specifications listed on the applicable drawing.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:41Z
Check the source to verify that this is the current version before use.

3.2 Assembly. The warhead assembly shall comply with all requirements specified on the drawing (dwg) 8846001, with all requirements specified herein, and with the requirements of all applicable specifications to the extent specified on the drawing and herein.

3.3 First article testing. Requirements for the submission of first article samples by the contractor shall be as specified in the contract (see 4.2).

3.4 Serialization. A six letter serial code shall be assigned to the item. Serial codes required on these items shall be obtained by means of a letter addressed to: Commander, Officer, Picatinny Arsenal, Dover, New Jersey 07801, ATTENTION: SARPA-QA-T-M. The letter of request shall include:

a. Exact nomenclature of the item as specified on the applicable drawing.
b. Name of the contractor.
c. Contract number or procurement request order number.
d. Number of serial codes required (unused code numbers shall be returned).

3.5 Continuity. The warhead assembly shall exhibit point to point continuity and malfunction when tested as specified in 4.4.1.

3.6 Pneumatic. The warhead assembly shall respond to the pneumatic functions when tested as specified in 4.4.2.

3.7 Weight. The total weight of this assembly shall be 1100 lbs. within a tolerance of plus or minus 15 lbs. when tested as specified in 4.4.3.

3.8 Center of gravity. The center of gravity of the assembly shall be at Station 124 within a tolerance of plus or minus 1/2 inch when tested as specified in 4.4.4.

3.9 Workmanship.

3.9.1 Plastic and metal characteristics. All components shall be free from cracks, splits, cold flow, shrinkage, cold shuts, inclusions, porosity, or any similar characteristic.

3.9.2 Threads. Threads shall be full and undamaged for the entire minimum length or depth as required on the applicable drawing.

3.9.3 Burrs. Parts shall be free from burrs.

3.9.4 Foreign matter. Parts shall be free from chips, dirt, grease, rust, corrosion, or any embedded foreign material.

3.9.5 Cleaning. The cleaning method shall not be injurious to any of the parts, nor shall the parts be contaminated by the cleaning agent.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:41Z
Check the source to verify that this is the current version before use.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the supplier is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract or order, the supplier may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

4.2 First article inspection.

4.2.1 Quantity to be submitted. When the contract requires first article inspection, the contractor shall submit 3 complete assemblies (see dwg 8846001) for first article testing to the testing facility designated in the invitation for bids or request for proposal.

4.2.2 Inspection and testing to be performed. The first article inspection sample shall be subjected to the inspections and tests specified in Table I. Tests shall be conducted in order specified in Table I.

Table I

First article inspection and tests

Inspection or Test	Dest	Non-Dest
1. Classification of Characteristics (see 4.3.2.1)		X
2. Electrical (see 3.5)		X
3. Pneumatic (see 3.6)		X
4. Weight (see 3.7)		X
5. Center of gravity (see 3.8)		X

4.2.3 Inspection equipment. The inspection and testing specified in 4.2.2 shall be accomplished by using the gages and test equipment specified in 4.3.4.1.

4.2.4 Rejection. If any item fails to comply with any of the applicable requirements, the first article sample shall be rejected.

4.3 Quality conformance inspection.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:41Z
Check the source to verify that this is the current version before use.

4.3.1 Lot formation.

4.3.1.1 Production lot. A lot shall consist of parts and assemblies produced by one manufacturer in one unchanged process, in accordance with the same drawing, same drawing revision, same specification and same specification revision. Drawing, specification and process changes not affecting safety, performance, storage, or interchangeability, as determined by the Government, shall not necessitate changing the lot interfix number. The criteria and procedures for the assignment of lot numbers shall be in accordance with MIL-STD-1168.

4.3.1.2 Inspection lot. A lot or batch and its formation, size, and presentation is described in MIL-STD-105, Section 5. Accordingly, a lot shall mean an inspection lot and a batch shall mean an inspection batch for the purpose of this specification. The manner in which each inspection lot or batch is to be presented and identified by the contractor, shall be designated or approved by the Government representative.

4.3.2 Product inspection examination. A sample shall be selected at random from each inspection lot in accordance with the applicable major or minor characteristic table (see Table II and Table III), and inspected for all characteristics in the applicable classification. Any characteristics in the sample found to be defective shall reject the inspection lot. Sequence for the inspection of characteristics in each classification need not be followed as long as all characteristic inspections are performed.

Table II
Major Characteristics

Lot Size	Sample Size	Lot Size	Sample Size	Lot Size	Sample Size	Lot Size	Sample Size
1-16	all	28-29	23	52-56	31	132-156	39
17	16	30-31	24	57-62	32	157-191	40
18	17	32-34	25	63-69	33	192-244	41
19-20	18	35-36	26	70-76	34	245-334	42
21	19	37-40	27	77-86	35	335-519	43
22-23	20	41-43	28	87-97	36	520-1120	44
24-25	21	44-47	29	98-112	37	over 1120	45
26-27	22	48-51	30	113-131	38		

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:41Z
Check the source to verify that this is the current version before use.

Table III
Minor Characteristics

Lot Size	Sample Size	Lot Size	Sample Size	Lot Size	Sample Size	Lot Size	Sample Size
1-9	all	14-16	12	28-33	16	77-121	20
10	9	17-18	13	34-41	17	122-273	21
11	10	19-22	14	42-54	18	over 273	22
12-13	11	23-27	15	55-76	19		

4.3.2.1 Classification of characteristics (see 3.2). Critical, major and minor characteristics are defined in MIL-STD-105. Inspection shall be conducted as follows:

4.3.2.1.1 Warhead section assembly (dwg 8846001).

Categories	Characteristics	Method of Inspection
Critical:	None defined.	
Major:		
101.	Scratches on visible surfaces exposing primer coat or bare metal	Visual
102.	Inert prima cords not strapped to cartridge support flange	Visual
103.	Inert prima cords not screwed into the inert arm safe base	Visual
104.	W5F and W6F cables not connected to J1 and J8 connector or cartridge	Visual
105.	Weight incorrect	Scale
106.	Center of gravity incorrect	Measure
107.	Decal and identification plate missing	Visual
108.	Instructor's access door missing	Visual
109.	Guides for rear body section fins missing	Visual
110.	Wire and tubing on instructor's panel improperly or poorly installed	Visual
111.	Instructor's panel improperly fastened or installed	Visual
112.	All removable components not marked "Training Use Only"	Visual
113.	Wire insulation damaged exposing bare wire	Visual
114.	Warhead section dented to extent it affects inner component	Visual

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:41Z
Check the source to verify that this is the current version before use.

Major:

115. W5F and W6F cables cut or broken exposing bare wire.....Visual
116. Straps securing cable missing or broken.....Visual
117. Dust caps missing on cartridge assembly or deformed to extent it prevents assembly.....Visual
118. Cap chains broken.....Visual
119. Markings missing, misleading or unidentifiable.....Visual
120. Mounting holes at station 87.5 improperly tapped.....Gage
121. Mounting holes at station 87.5 improperly located.....Gage
122. Mounting holes at station 150 improperly drilled.....Gage
123. Mounting holes at station 150 improperly located.....Gage
124. Evidence of poor workmanship (see 3.9).....Visual
125. Objective evidence relating to material missing or improper (see 3.1).....Visual

Minor: None defined.

4.3.2.1.2 Container M409 prior to closing (see dwg 8846373).

Categories	Characteristics	Method of Inspection

Critical: None defined.

Major:

101. Warhead section missing.....Visual
102. Desiccant bags missing, torn or insufficient.....Visual
103. Foreign matter in container.....Visual
104. Weld cracked.....Visual
105. Container dented or damaged to extent it will not close or protect contents.....Visual
106. Bolts between warhead at station .150 and the thrust mount bracket missing.....Visual
107. Bolts between thrust mount and movable track missing.....Visual

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:41Z
Check the source to verify that this is the current version before use.

Major:

108.	Hoisting beam left in place	Visual
109.	Moveable track clamp at station 87.5 missing	Visual
110.	Plastic plugs in lifting eye socket missing	Visual
111.	Evidence of poor workmanship (see 3.9)	Visual

Minor: None defined.

4.3.2.1.3 Container M409 sealed (see dwg 8846373).

Categories	Characteristics	Method of Inspection

Critical: None defined.

Major:

101.	Markings missing, misleading or unidentifiable	Visual
102.	Painting defective to the extent it shows the primer coat or bare metal	Visual
103.	Closure lifting handles missing or damaged	Visual
104.	Latching handles missing or unoperative	Visual
105.	Latching handles wrench missing	Visual
106.	Humidity indicator card missing	Visual
107.	Humidity indicator shows pink at "30"	Visual
108.	Glass over humidity card broken or missing	Visual
109.	Cover over humidity indicator missing	Visual
110.	Shipping papers missing if shipped as spare	Visual
111.	Evidence of poor workmanship (see 3.9)	Visual

Minor: None defined.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:41Z
Check the source to verify that this is the current version before use.

4.3.3 Testing. All tests shall be performed. Tests shall be performed in the order specified below:

	Test	Test classification
a.	Continuity	Minor
b.	Pneumatic	Minor
c.	Weight	Minor
d.	Center of gravity	Minor

None of these tests are considered destructive and samples so tested may be returned to the lot.

4.3.3.1 Continuity (see 3.5), pneumatic (see 3.6), weight (see 3.7), and center of gravity (see 3.8). Each warhead assembly in the lot shall be tested in accordance with 4.4.1, 4.4.2, 4.4.3 and 4.4.4. If any item fails to comply with 3.5, 3.6, 3.7 and 3.8, the item shall be rejected and removed from the lot.

4.3.4 Acceptance inspection equipment.

4.3.4.1 Major characteristics and tests. Inspection and testing shall be performed with the acceptance inspection equipment, operating instructions, and calibration instructions specified on the Equipment Lists (EL) (see EL-8855807). When either of the conditions listed below exist, the contractor shall design required equipment or specify suitable commercial equipment and obtain approval prior to use on the contract.

a. Any deviation from equipment or procedures specified on the EL is desired (see 6.3).
b. The code "CD" is listed in the "Part or Identifying Number" column on the EL (see 6.1.2).

4.3.4.1.1 Required equipment. The following equipment will be required:

(a) A power supply capable of supplying a current of 2 amps at 28 vdc shall be used for three tests.
(b) A (T-229) T-4014 Tester shall be used for these tests.
(c) A test adapter cable in accordance with Figure 2-1 shall be used.
(d) A regulated pressure nitrogen supply (350 psi).

4.3.4.2 Minor characteristics and tests. Acceptance inspection equipment for minor characteristics is not specified on ELs. The acceptance inspection equipment, operating instructions and calibration instructions used by the contractor for minor classification inspection shall be approved by the Government representative authorized by the procuring agency.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:41Z
Check the source to verify that this is the current version before use.

4.4 Test methods. The tolerances specified herein are absolute with no allowance for test equipment inaccuracy. The tolerances used by the manufacturer shall be equal to the absolute tolerances less the accuracy tolerances of the test equipment used.

4.4.1 Electrical test.

4.4.1.1 T-4014 test. Complete test with malfunction.

4.4.1.1.1 Preparation for test.

NOTE: This test shall not be performed until 28 volts direct current (vdc) power has been connected to P3 of the W5F cable as follows: Plus connector to pins A, B, C, D, E, F, G, M. Minus connector to pins X, Y, Z, a, b, c, d, e.

4.4.1.1.1.1 Check receptacle J3 on cartridge to be certain that SAFE plus is properly inserted.

4.4.1.1.1.2 At this time, Mission Plug shall not be connected to receptacle J2 of the cartridge.

4.4.1.1.1.3 T-4014 AC PWR, Baro Set power S1, S4, S5, and S6 shall be in the OFF position.

4.4.1.1.1.4 Connect from T-4014 GND to earth ground with the W13-C ground with the W13-C ground strap.

4.4.1.1.1.5 T-4014 shall be connected to a 115 ± 10 volts, 60 spc, ac power source by means of the W3-H power cable, from receptacle J1 on the T-4014 to the power source.

4.4.1.1.1.6 Upon operation of ac power switch to the ON position, check that the ac power and defective lamps light and the test set motor starts.

4.4.1.1.1.7 When hinged access doors on the T-4014 have been opened, check that the #3 lamp is lighted. Press SURFACE TO AIR, XL, XS, READY DEFECTIVE, 1, 2, 3 and 4 press to test lamps. The aforementioned lamps will light when pressed.

4.4.1.1.1.8 Operate AC PWR switch to OFF position. Observe the following: AC PWR #3 and DEFECTIVE lamps go out ant test motor stops.

4.4.1.1.1.9 Connect W6H Test Cable from T-4014 (T-229) to the cartridge in the following manner.

Connect P1 to J3 on the T-4014.
Connect P2 to J2 on the T-4014.
Connect P3 to J6 on the cartridge.
Connect P4 to J7 on the cartridge.

4.4.1.2 Baroswitch setting procedures and limit test. Remote setting of Simulated Baroswitches is done using the T-4014 Test Set. The operation is performed using the same ground power and test connections as were used previously on the electrical test. (Paragraph 4.4.1.1.1).

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:41Z
Check the source to verify that this is the current version before use.

4.4.1.2.1 Upon operation of AC power switch to the ON position, check that the AC power and defective lamps light and the test set motor starts.

CAUTION: Do not operate Baro Set PWR Switch to the ON position unless switch S1 is in the OFF position.

4.4.1.2.1.1 Operate Baro Set PWR Switch to the ON position (S2 is normally in Fuse Baro position.)

NOTE: If M-1 Baro Indicator operates, allow it to come to rest before proceeding.

4.4.1.2.1.2 Operate switch, S-3 to the increase position until the indicator reads 25,000 ± 10 feet.

4.4.1.2.1.3 Operate switch S-3 to the decrease position until the indicator reads 10,000 ± 10 feet.

4.4.1.2.1.4 Operate switch, S-3 to the decrease position until the indicator reads minus 3000 ± 10 feet.

4.4.1.2.1.5 Operate switch, S-2 to the A.B. position and hold.

NOTE: If M-1 Baro Indicator operates, allow it to come to rest before proceeding.

4.4.1.2.1.6 Operate switch, S-3 to the decrease position until the indicator reads minus 3000 ± 10 feet.

4.4.1.2.1.7 Operate switch, S-3 to the increase position until the indicator reads 10,000 ± 10 feet.

4.4.1.2.1.8 Operate switch, S-3 to the increase position until the indicator reads 25,000 ± 10 feet.

4.4.1.2.1.9 Release all switches.

NOTE: If M-1 Baro Indicator operates, allow it to come to rest before proceeding.

4.4.1.2.2 Operate baro set power switch to the OFF position.

4.4.1.3 Continuity test.

NOTE 1: All installations for the above (paragraph 4.4.1.2) tests are required for this procedure.

NOTE 2: All switches on the Instructor's Panel to be in the "normal" position.

4.4.1.3.1 Warhead type.

4.4.1.3.1.1 Operate XS-XL switch on the Instructor's Panel to the XS position. The XS indicator on the T-4014 shall light.

4.4.1.3.1.2 Operate XS-XL switch on the Instructor's Panel to the XL position. The XL indicator on the T-4014 shall light.

4.4.1.3.2 Circuitry tests (T4014).

4.4.1.3.2.1 Operate switches and observe that lights indicate as specified in Table IV.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:41Z
Check the source to verify that this is the current version before use.

Table IV

J2 Insert	J3 Insert	PANEL SW-UP	S1 Position	READY LAMP	DEFECTIVE LAMP	PROCESSED LAMPS #1	#2	#3	#4	S.A. LAMP	S.S. LAMP
-	Safe	-	Off	Off	On	Off	Off	On	Off	Off	Off
-	Safe	-	1	On	Off	On	On	On	On	Off	Off
-	Safe	1-4	1	Off	On	On	On	On	Off	Off	Off
-	Safe	-	2	On	Off	On	On	On	On	Off	Off
-	Safe	2-1	2	Off	On	Off	On	On	On	Off	Off
-	Safe	2-2	2	Off	On	On	Off	On	On	Off	Off
-	Safe	2-3	2	Off	On	On	On	Off	On	Off	Off
-	Safe	2-4	2	Off	On	On	On	On	Off	Off	Off
-	Safe	-	3	On	Off	On	On	On	On	Off	Off
-	Safe	3-1	3	Off	On	Off	On	On	On	Off	Off
-	Safe	3-2	3	Off	On	On	Off	On	On	Off	Off
-	Safe	3-3	3	Off	On	On	On	Off	On	Off	Off
-	Safe	3-4	3	Off	On	On	On	On	Off	Off	Off
-	Safe	-	4	On	Off	On	On	On	On	Off	Off
-	Safe	4-1	4	Off	On	Off	On	On	On	Off	Off
-	Safe	4-2	4	Off	On	On	Off	On	On	Off	Off
-	Safe	4-3	4	Off	On	On	On	Off	On	Off	Off
-	Safe	-	5	On	Off	On	On	On	On	Off	Off
-	Safe	5-1	5	Off	On	Off	On	On	On	Off	Off
-	Safe	5-2	5	Off	On	On	Off	On	On	Off	Off
-	Safe	5-3	5	Off	On	On	On	Off	On	Off	Off
-	Safe	5-4	5	Off	On	On	On	On	Off	Off	Off
-	Safe	-	6	On	Off	On	On	On	On	Off	Off
-	Safe	6-1	6	Off	On	Off	On	On	On	Off	Off
-	Safe	6-2	6	Off	On	On	Off	On	On	Off	Off
-	Safe	6-4	6	Off	On	On	On	On	Off	Off	Off
-	Safe	-	7	On	Off	On	On	On	On	Off	Off
-	Safe	7-4	7	Off	On	On	On	On	Off	Off	Off
-	Arm	-	8	On	Off	On	On	On	On	Off	Off
-	Arm	8-1	8	Off	On	Off	On	On	On	Off	Off
-	Arm	8-2	8	Off	On	On	Off	On	On	Off	Off
-	Arm	8-3	8	Off	On	On	On	Off	On	Off	Off
S.A.	Safe	-	Off	Off	Off	Off	Off	Off	Off	On	Off
S.S.	Safe	0	Off	Off	Off	Off	Off	Off	Off	Off	On

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:41Z
Check the source to verify that this is the current version before use.

4.4.1.3.2.2 Operate the T-4014 AC PWR switch to OFF.

4.4.1.3.2.3 Connect regulated nitrogen supply to the cartridge support fitting adjacent to J5 of the cartridge.

4.4.1.3.2.4 Pressurize fitting to 10 psi max. and turn off tank valve.

4.4.1.3.2.5 Operate Instructor's Panel Static Probe system switch to the leak position. The pressure shall immediately fall off.

4.4.1.3.2.6 Insert Arm plug in J3 and S.S. plug in J2 of cartridge support respectively. The voltage meter shall show a maximum drop of 5 volts.

4.4.1.3.2.7 Insert Arm plug in J3 and S.A. plug in J2 of cartridge support respectively. The voltage meter shall show a maximum drop of 5 volts.

4.4.1.4 Circuitry tests (Launcher Operating Unit).

4.4.1.4.1 Continuity test.

4.4.1.4.1.1 Preparation for test.

4.4.1.4.1.2 Remove power from P1 of the W5-F Cable. Remove P3 and P4 of the T-4014 Cable from J6 and J7 on the Cartridge.

4.4.1.4.1.3 The continuity shall be as specified in Table V.

Table V
L. O. R. CIRCUITS

WH Switch Position	Panel Malfunction	J-2 Insert	J-3 Insert	W5-F - P3	Continuity W6-F - P2	Gnd
XS	-	-	-	-	C	Yes
XL	-	-	-	-	h	Yes
Either	-	S.S.	-	T	-	Yes
Either	-	S.A.	-	S	-	Yes
Either	-	-	-	-	B	Yes
Either	Ready	-	-	-	B	No
Either	-	-	Arm	R	-	Yes
Either	-	-	-	R	-	No
Either	-	-	-	-	D	Yes
Either	Safe	-	-	-	D	No
Either	-	-	-	-	E	No
Either	-	-	-	-	J	Yes
Either	-	-	-	-	e	No
Either	-	-	-	-	d	No
Either	-	-	-	-	K	No

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:41Z
Check the source to verify that this is the current version before use.

Table V (Con't)
L. O. R. Circuits

WH Switch Position	Panel Malfunction	J-2 Insert	J-3 Insert	W5-F - P3	Continuity W6-F - P2	Gnd
Either	-	-	Safe	A	-	Yes
Either	-	-	Safe	B	-	Yes
Either	-	-	Safe	C	-	Yes
Either	-	-	Safe	D	-	Yes
Either	-	-	Safe	E	-	Yes
Either	-	-	Safe	F	-	Yes
Either	-	-	Safe	G	-	Yes
Either	-	-	Safe	M	-	Yes
Either	-	-	Safe	X	l	
Either	-	-	Safe	Y	l	
Either	-	-	Safe	Z	l	
Either	-	-	Safe	a	l	
Either	-	-	Safe	b	m	
Either	-	-	Safe	c	m	
Either	-	-	Safe	d	m	
Either	-	-	Safe	e	m	

4.4.1.5 Fuse Baro Set.

4.4.1.5.1 Preparation for test.

4.4.1.5.1.1 Connect test adaptor cable as follows:
P1 to P2 of the W6F Cable.
P2 to P3 of the T-4014 Cable W6H.
P3 to P4 of the T-4014 Cable W6H.

4.4.1.5.2 Operate T-4014 power switch to the ON position.

4.4.1.5.3 Operate Baro Set power switch to the ON position.

NOTE: If M-1 Baro Indicator operates, allow it to come to rest before proceeding.

4.4.1.5.3.1 Operate switch, S-3 to the increase position until the indicator reads 1,000 ± 10 feet.

4.4.1.5.3.2 Operate switch, S-3 to the decrease position until the indicator reads minus 3,000 ± 10 feet.

4.4.1.5.3.3 Operate Baro set power switch to the OFF position.

4.4.1.5.3.4 Operate the T-4014 AC power switch to the OFF position.

4.4.1.5.4 Disconnect test adaptor cable from W6H and W6F Cables and store cable ends inside trainer.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:41Z
Check the source to verify that this is the current version before use.

4.4.2 Pneumatic Tests.

NOTES: 1) These procedures may be accomplished prior to installing instructor's panel in the Warhead section. 2) Slight leakage of pop-off valves after closing shall not be cause for rejection. 3) Reduce tank pressure to 120 pounds per square inch (psi) before accomplishing leakage test.

4.4.2.1 Operate System Control Valve and Bleed Valve on Instructor's Panel to OFF position.

4.4.2.2 Using regulated pressure nitrogen supply, charge panel fill until 300 psi gage reads 250-275 psi. Pop-off valve shall open.

4.4.2.3 Remove nitrogen supply from Panel fitting. Pop-off valve shall close at 200 psi minimum.

NOTE: Warhead pressure shall always be regulated before cartridge is pressurized.

4.4.2.4 Set system control valve to "Warhead" position.

4.4.2.4.1 Turn warhead regulator slowly in a clockwise direction, until 30 psi gage reads 25-30 psi. Pop-off valve shall open.

4.4.2.4.2 Turn warhead regulator in a counterclockwise direction until 30 psi gage reads 15 psi. Warhead pressure shall be 15 $\pm$ 2 psi.

4.4.2.4.3 Pop-off valve shall close at 18 psi min.

4.4.2.5 Set system control valve to cartridge position.

4.4.2.5.1 Turn warhead regulator and cartridge regulator in counterclockwise direction until they turn freely.

4.4.2.5.2 Set bleed valve to "Warhead" position; pressure shall drop to zero with control valve in warhead position.

4.4.2.5.3 Set control valve to "Cartridge" position; pressure shall drop to zero with bleed valve in cartridge position.

4.4.2.5.4 Record tank pressure.

4.4.2.6 After minimum of sixteen hour period, again check and record tank pressure.

4.4.2.6.1 Pressure loss shall not exceed 1 psi.

4.4.2.6.2 Set control valve and bleed valve to OFF position.

4.4.3 Weight. The total weight of the assembly shall be tested utilizing a scale.

4.4.4 Center of gravity. The center of gravity of the assembly shall be tested utilizing a level at the flange at Station 150.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:41Z
Check the source to verify that this is the current version before use.

5. PREPARATION FOR DELIVERY

5.1 Preservation and packaging. The warhead section shall be preserved and packaged in accordance with dwg 8846373.

5.2 Packing. If the warhead section is shipped as part of the Warhead Section of the Nike Hercules Guided Missile Trainer it shall be shipped in accordance with dwg 8846373. If the warhead section is shipped separately as a spare it shall be shipped in accordance with dwg 8846373 except that the carton containing the accessories and the Instructor's guide book shall not in included.

5.3 Marking. The M-409 container shall be marked in accordance with dwg 8846373.

6. NOTES

6.1 Ordering data. Procurement documents should specify the following:

6.1.1 Procurement requirements.

a. Title, number, and date of this specification.

6.1.2 Contract data requirements (see 4.3.4.1). Data specified in 4.3.4.1 will be delivered as identified on a numbered DD Form 1664 when required on a DD Form 1423 incorporated in the contract.

6.2 Objective evidence. Records of contractor quality control and inspections which can be verified.

6.3 Acceptance inspection equipment (see 4.3.4.1). The contractor shall obtain approval from the Commander, Picatinny Arsenal, Dover, New Jersey 07801, ATTN: SARPA-QA-N-I.


6.4 Supersession data. This specification supersedes the requirements of Purchase Description X-PA-PD-2126 dated 7 March 1962.

Custodian:
Army - PA

Preparing activity:
Army - PA

Project No.1115-A060

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:41Z
Check the source to verify that this is the current version before use.

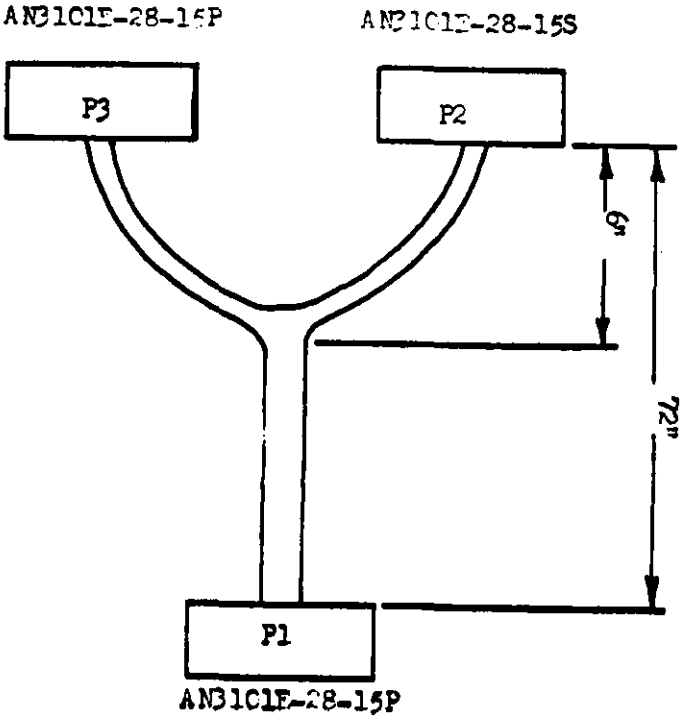

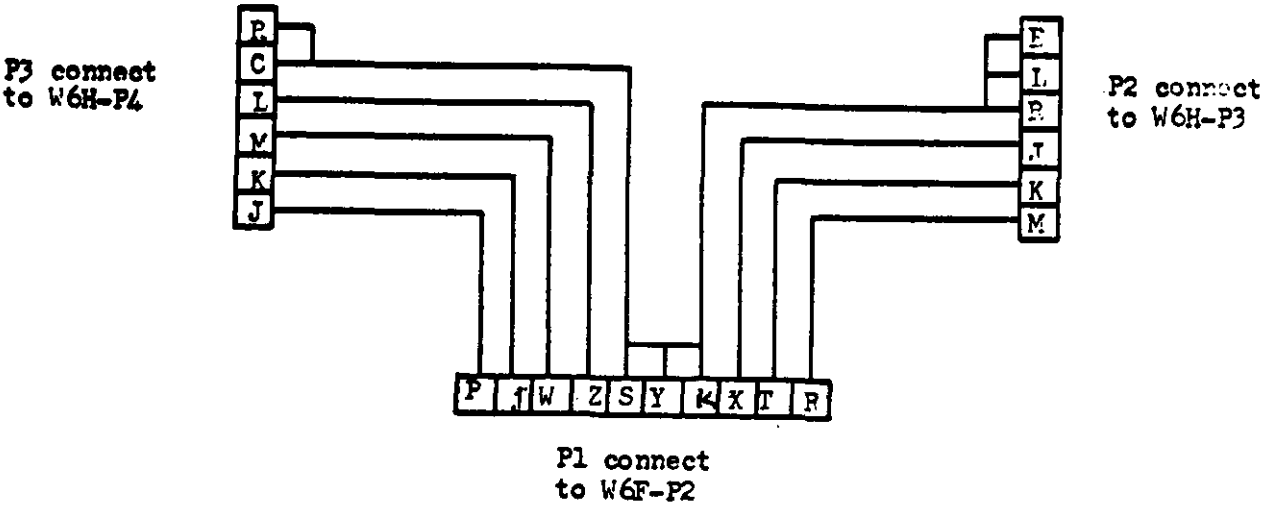


Figure 1

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:41Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

OMB Approval
No. 22-R255

INSTRUCTIONS: The purpose of this form is to solicit beneficial comments which will help achieve procurement of suitable products at reasonable cost and minimum delay, or will otherwise enhance use of the document. DoD contractors, government activities, or manufacturers/vendors who are prospective suppliers of the product are invited to submit comments to the government. Fold on lines on reverse side, staple in corner, and send to preparing activity. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements. Attach any pertinent data which may be of use in improving this document. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity.

DOCUMENT IDENTIFIER AND TITLE

NAME OF ORGANIZATION AND ADDRESS

CONTRACT NUMBER

MATERIAL PROCURED UNDER A

☐ DIRECT GOVERNMENT CONTRACT ☐ SUBCONTRACT

1. HAS ANY PART OF THE DOCUMENT CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE?

A. GIVE PARAGRAPH NUMBER AND WORDING.

B. RECOMMENDATIONS FOR CORRECTING THE DEFICIENCIES

2. COMMENTS ON ANY DOCUMENT REQUIREMENT CONSIDERED TOO RIGID

3. IS THE DOCUMENT RESTRICTIVE?

☐ YES ☐ NO *(If "Yes", in what way?)*

4. REMARKS

SUBMITTED BY *(Printed or typed name and address - Optional)*

TELEPHONE NO.

DATE

DD FORM 1 JAN 72 1426 REPLACES EDITION OF 1 JAN 66 WHICH MAY BE USED

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T19:41Z
Check the source to verify that this is the current version before use.