NOTE: The document identifier and heading have been changed on this page to reflect that this is a performance specification. There are no other changes to this document. The document identifier on subsequent pages has not been changed, but will be changed the next time this document is revised.

INCH-POUND

MIL-PRF-83536/22
AMENDMENT 5
10 July 1999
SUPERSEDING
AMENDMENT 4
15 June 1999

PERFORMANCE SPECIFICATION SHEET

RELAYS, ELECTROMAGNETIC, ESTABLISHED RELIABILITY, 3PDT, LOW LEVEL TO 10 AMPERES, PERMANENT MAGNET DRIVE, HERMETICALLY SEALED, ALL WELDED, TRANSIENT SUPPRESSED DC COIL


This amendment forms a part of MIL-PRF-83536/22, dated 27 March 1992, and is approved for use by all Departments and Agencies of the Department of Defense.

PAGE 1

FIGURE 1, side view: Delete "SERIAL NUMBER SHALL BE MARKED ON TOP OF RELAYS" and "MARKING (EITHER SIDE)".

PAGE 2

FIGURE 1, delete and substitute:"

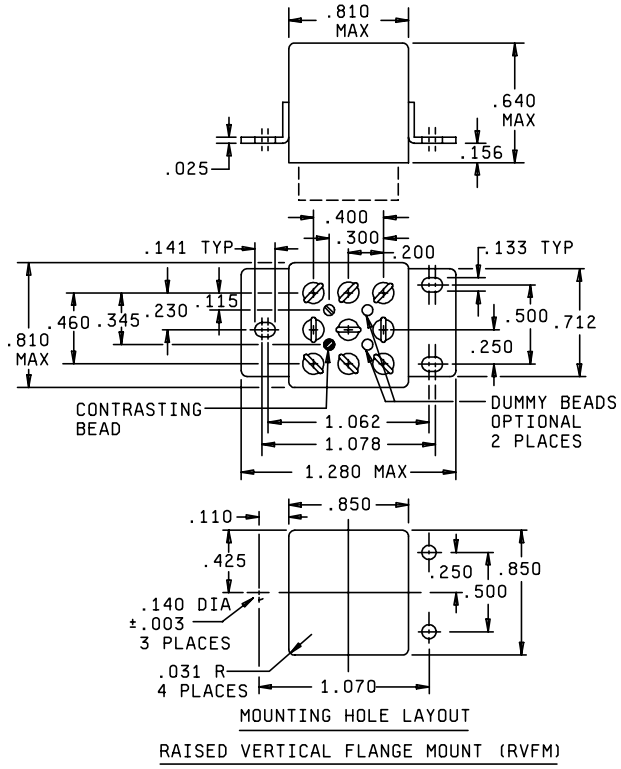

"

PAGE 3

FIGURE 1, side view: Delete "SERIAL NUMBER SHALL BE MARKED ON TOP OF RELAYS".

FIGURE 1, side view: Delete "MARKING (EITHER SIDE)" and substitute "MARKING (SEE NOTES 8 AND 9)".


DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T08:53Z
Check the source to verify that this is the current version before use.

PAGE 4

* FIGURE 1, delete and substitute:

"

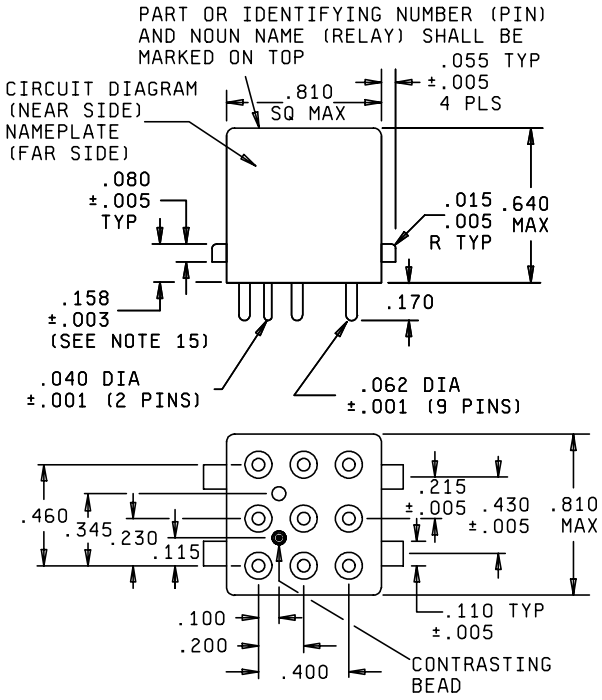

TRACK MOUNT


"

PAGE 5

FIGURE 1, above figure title: Add "CIRCUIT DIAGRAM".

FIGURE 1, add the following circuit diagram:

"

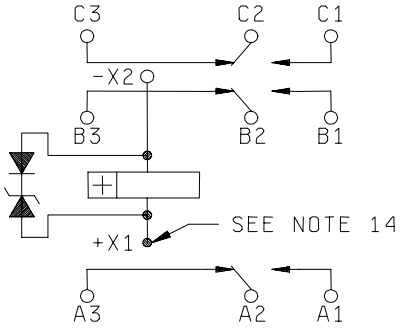

CIRCUIT DIAGRAM
(ALTERNATE INTERNAL DIODE CONFIGURATION)

"

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T08:53Z
Check the source to verify that this is the current version before use.

PAGE 6

* NOTE 10, delete and substitute “10. Socket pin terminals shall provide the operational, environmental, and interface characteristics to provide a reliable interconnect to gold-plated contacts. Terminals shall be gold plated. One system for gold plating that may be used is ASTM B488, type 3, class 1.25 with a nickel underplate of 50 to 150 microinches thick. The gold plating system shall enable the product to meet the performance requirements of this specification and shall be approved by the qualifying activity.”

* NOTE 11, delete and substitute “11. Gasket shall provide a reliable seal between the relay and mating socket that will meet the environmental, operational, and interface requirements of the relay with the mating socket. The gasket shall have shore hardness 15 to 35, thickness .050 ±.005. Gasket material according to AMS 3332 has been considered acceptable. Gaskets are not supplied with track mount relays."

PAGE 7

Delete "Contact voltage drop or resistance:" and substitute "Contact voltage drop and resistance:".

PAGE 8

Coil transient suppression: Add "(42 V dc maximum)".

PAGE 11

Vibration (random), both paragraphs, lines 2 and 3: Delete "15 minutes each plane".

Weight: Delete "(28.15 g's)" and substitute "(28.15 grams)".

PAGE 13

TABLE V, delete and substitute:

" TABLE V. Supersession data.

Superseded PIN M6106/	Replacement PIN M83536/22-
24-003	025
29-003	017
29-004	017
29-007	018
29-008	018
29-011	019
29-012	019
29-015	020
29-016	020
29-019	021
29-020	021
29-023	022
29-024	022
29-027	023
29-028	023
29-031	024
29-032	024

"

The margins of this amendment are marked with an asterisk to indicate where changes (additions, modifications, corrections, deletions) from the previous amendment were made. This was done as a convenience only and the Government assumes no liability whatsoever for any inaccuracies in these notations. Bidders and contractors are cautioned to evaluate the requirements of this document based on the entire content irrespective of the marginal notations and relationship to the last previous amendment.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T08:53Z
Check the source to verify that this is the current version before use.

Custodians:
Army - CR
Navy - EC
Air Force - 11
DLA - CC

Preparing activity:
DLA - CC

(Project 5945 - 1059-18)

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T08:53Z
Check the source to verify that this is the current version before use.