INCH-POUND

MIL-P-70505 (AR)
AMENDMENT 4
26 December 1992
SUPERSEDING
AMENDMENT 3
3 April 1989

MILITARY SPECIFICATION

PROJECTILE, 155MM: XM864
PROPELLANT GRAIN

This Amendment forms a part of Military Specification MIL-P-70505 (AR), dated 28 December 1984, and is approved for use by the US Army Armament, Munitions and Chemical Command and is available for use by all Departments and Agencies of the Department of Defense.

PAGE 1

Add the designation "(M864)" in the title and change XM864 to "M864" wherever it appears in the specification.

* 2.1.1 Add the following military specifications:

"MIL-P-46994 - Pellets, Granules Boron/Potassium Nitrate
MIL-A-70625 - Automated Acceptance Inspection Equipment for Non-Electronic Components, Design, Testing and Approval of"

PAGE 2

2.1.1 Add the following Military Standard:

"MIL-STD-453 - Inspection, Radiographic"

2.1.2 Add the following drawings:

INSPECTION EQUIPMENT DRAWINGS

9880422 - Envelope Drawing Radiographic Equipment 155MM M864 Propellant Grain".

AMSC N/A FSC 1320

DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil - Downloaded: 2022-08-29 08:08:37
Check the source to verify that this is the current version before use.

2.2 Add the following new paragraphs:

"2.2 Non-Government publications. The following document(s) forms a part of this document to the extent specified herein. Unless otherwise specified, the issues of the documents which are DoD adopted are those listed in the issue of the DODISS cited in the solicitation. Unless otherwise specified, the issues of documents not listed in the DODISS are the issues of the documents cited in the solicitation (see 6.2).

ANSI Z1.1	- Guide for Quality Control Charts
ANSI Z1.2	- Control Chart Method of Analyzing Data
ANSI Z1.3	- Control Chart Method to Controlling Quality During Production

(Applications for copies should be addressed to American National Standards Institute, 1430 Broadway, N.Y., N.Y. 10018.)"

PAGE 3

3.3 Heat of reaction. Delete "930 ± 35 cal/g" and substitute "950 ± 50 cal/g".

* 3.4 Delete in its entirety and substitute the following:

"3.4 Strand burning rate. Strand burning rate tests shall be performed under the test conditions of 70°F ± 5°F and 14.7 psia ± 10%. The acceptance value for the burn rate shall be 1.00 ± .10mm/sec."

3.6.2.1 Add the following new paragraph:

"3.6.2.1 Inhibitor flash. There shall be no evidence of inhibitor flash as indicated on the applicable drawing."

* 3.6.3 Delete in its entirety and substitute the following:

"3.6.3 Internal defects. Each grain segment (individual split) shall contain no cracks, voids or fissures measuring more than .20 inch in any direction and no foreign material measuring more than 0.20 inch in any direction. The total combined length of all cracks, voids, fissures and posority in any segment shall not exceed .30 inch and the combined length of all foreign material (maximum dimension each particle) shall not exceed 0.20 inch."

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

3.7 Mechanical properties. Delete paragraphs a and b and substitute the following:

"a. Modulus of elasticity of 700 psi minimum per sample average.

b. Ultimate stress of 170 psi minimum per sample average."

PAGE 5

* 4.3.1 Submission. Add the following first article sample item to the inspection list:

Description	Quantity Required
"Pre-cast inhibitor, prior to assembly to grain (if applicable)	12"

PAGE 6

4.3.1 Table I First article inspection

a. Change "Table I" to 'Table II"

b. Under "Propellant after mixing and curing, change strand burning samples from "12" to "18". Add the following in the paragraph reference section of the strand burning test. "14.7 psia only, 6 at each temperature"

* c. Delete "Grain split after curing, before assembly "and substitute: "Precast inhibitor, prior to assembly to grain (if applicable)."

PAGE 7

* 4.4.1.1 Delete in its entirety and substitute the following:

"4.4.1.1 Propellant or inhibitor batch. A batch of material, either inhibitor or propellant, is defined as a homogeneous quantity of raw materials that are blended and processed in at one time. As a maximum, a batch shall consist of materials blended at one time in one mixing or blending bowl. A batch shall contain individual ingredients from not more than one lot from one manufacturer for each ingredient. After a batch has been accepted following physical and mechanical properties testing, it may be combined with other accepted batches provided that the batches are homogeneous."

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

device is required to be in the safe condition (at rest with the solenoid voltage

4.4.2. Examination. Add the following subparagraph (c):

"c. Statistical process control (SPC). For those dimensions identified in the Classification of Defects Tables by the reference, "(see Appendix A)", the contractor must utilize the principals of SPC as defined herein, ANSI Z1.1, ANSI Z1.2, ANSI Z1.3, and in Appendix A. When the contractor satisfies the control conditions identified in Appendix A acceptance will then be by SPC. The SPC sample size and frequency of selection shall be determined by the contractor. If the SPC sample is to be less than 4 items per hour, then the approval of the procuring agency must be sought prior to the elimination of sampling inspection for acceptance. The contractor may request to implement SPC acceptance for any other feature that is not annotated in the classification for defects by requesting approval of the procurement agency and by meeting all the conditions specified in this specification When not accepting product by SPC, acceptance of product for those features identified with references to Appendix A, will only be in accordance with MIL-STD-414 or MIL-STD-1235 plan CSP-1, -2, -T using variable measurement capable gages."

PAGE 8

4.4.2.1 Spacer, Grain. In Examination or Test section, add "(see Appendix A)" after major defects 101 and 102.

PAGE 10

4.4.2.3 Grain split after curing, before assy.

a. Change title to "Precast inhibitor, prior to assembly to grain"

b. Delete special defect A and substitute the following:
"A. Inhibitor prior to bonding to propellant (applies to precast inhibitor only) 100% 3.6.2 Visual"

PAGE 11

4.4.2.4 Grain after assembly.

a. Add the following special defect:
"c. Inhibitor flash present 100% 3.6.2.1 Visual"

b. Major defect 104. Change "four" to "two"

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

c. Major defect 106 Change "4" to "2"

d. Major defect 107 Change "8" to "4"

e. Minor defect 201. Change "Location of spacers" to "True position of spacers"

PAGE 12

4.4.2.5 Packaging, Grain. Change Minor 202 from "100%" to ".65%".

PAGE 13

* 4.5.1 Strand burning characteristics of propellant Delete in its entirety and substitute:

"4.5.1 Strand burning characteristics of propellant. Along with propellant grains cast from each batch of mix of chemicals, three (3) test strands shall be taken from the same propellant batch and cured in the same curing chamber under the same conditions for the same length of time. The strands shall be tested in accordance with 4.5.11. If the average burn rate of three test strands fails to meet the requirements of 3.4, the batch shall be rejected."

PAGE 14

* 4.5.3 Heat of reaction. Delete in its entirety and substitute the following:

"4.5.3 Heat of reaction. One representative propellant specimen obtained from the same physical property sample prepared for the mechanical property tests shall be used to perform this test. The test shall be conducted in accordance with 4.5.12."

PAGE 15

4.5.5 Physical defects.

a. Delete "3.6.2" in the last sentence and substitute "3.6".

b. Add the following sentence at the end of the paragraph:

"Equipment and procedures used for radiographic inspection shall be in accordance with MIL-STD-453. Grain segments may be radiographed prior to assembly of spacers."

Source: https://assist.dla.mil -- Downloaded: 20260-26T04:29Z
Check the source to verify that this is the current version before use.

* 4.5.5.1 Add the following new paragraph:

"4.5.5.1 Automated grain inspection. As an optional form of radiographic inspection to hard x-ray film, every propellant grain shall be inspected for defects by using a Government approved automated inspection system manufactured in accordance with drawing 9880422, and MIL-A-70625. All rejected grain segments shall be carefully removed from the accepted grain segments immediately after inspection and reject marking by the automated inspection system. If the automated inspection system is chosen by the contractor to be the primary method of radiographic inspection, it is required that the contractor also maintain an approved manual hard x-ray inspection system as a secondary method, in the event that the automated inspection system fails to work properly."

4.5.5.2 Add the following new paragraph:

"4.5.5.2 Calibration of radiograph equipment. The automated grain inspection system shall be calibrated by using the standard described in drawing 9880422 at the start and finish of each production shift, or change in operator, as well as at one (1) hour intervals during production. If the inspection process is determined to be inadequate, the condition shall then be corrected and all items inspected since the last acceptable calibration check shall be reinspected."

PAGE 16

4.5.10.3 Change paragraph number to "4.5.6.3".

4.5.10.4 Change paragraph number to "4.5.6.4".

* Add the following new paragraphs:

"4.5.11 Strand burn rate test.

4.5.11.1 Required materials:

QTY	Description
1	Plastic tube, PVC (1.1 O.D. X .960 I.D. X 12" Long nominal)
6	Mylar disc (1-1/8" Diameter nominal)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

dents, or other marks which may indicate damage which could inter-

3	2L $BKNO_3$ pellets
6 grams	IP-10 $BKNO_3$ powder. Use the finest granulation size $BKNO_3$ powder available.
1	Tube of Duco cement or equivalent

4.5.11.2 Preparation of test specimens.

a. Sandblast the I.D. of the plastic PVC tube.

b. Wash/scrub the I.D. of the plastic PVC tube with clean tap water and a bottle brush. Final rinse in clean isopropyl alcohol, then allow plastic PVC tube to dry.

c. Place a rubber stopper securely into one (1) end of the plastic PVC tube.

d. Mix together 50% inhibitor composition and 50% methylene chloride. Fill the plastic PVC tube with the mixture to coat the sides of the tube, then pour the mixture out of the tube. Continue to reuse the mixture as required for additional plastic PVC tubes.

e. Remove the rubber stopper from the tube and hang the tube on a cure rack for approximately 12 hours minimum at ambient temperature.

f. Hang the inhibitor tubes in an oven. Cure the inhibitor for 12 hours minimum at +160° F ± 10 °F.

g. Cast and cure the propellant into the plastic PVC tubes.

h. X-ray the cured propellant stick per MIL-STD-453. The assembly shall be x-rayed at 0° to the radiation source. The radiographic requirements of 3.6.3 apply. Identify areas that fail these parameters.

i. Chuck the propellant sticks lightly in a lathe. Machine three (3) each propellant sticks from x-ray accepted areas of the propellant sticks in accordance with Figure 1.

j. Place a mylar seal onto the end opposite of the bored propellant stick in accordance with Figure 2.

k. Adhere a 2L pellet of $BKNO_3$ to the bored flat face of the propellant with Duco cement or equivalent, and allow to dry.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

l. Place a two (2) gram quantity of IP-10-$BKNO_3$ powder around the adhered 2L pellet and seal the propellant stick with a mylar seal in accordance with Figure 3.

m. Place a mylar seal over the IP-10-$BKNO_3$ powder, $BKNO_3$ 2L pellets, and seal the end of the grain shut in accordance with Figure 2.

4.5.11.3 Test procedure. The three specimens tested shall be placed into heat sink blocks, prior to conditioning. The test specimens will then be conditioned at 70 degrees F for a minimum of two hours. After conditioning, each specimen will be removed from the chamber and placed on the test stand. The mylar seal at the ignition end will be slit with a razor blade and two (2) M-100 electric matches will be installed. Firing will be initiated by application of a 5 ampere/50 ms electrical pulse to the match leads. Conduct the test and record the data in accordance with Figure 4. If the match fails to light after 3 attempts, replace the match. These tests are to be performed to evaluate the burn rate of the propellant and not the ignitability of the unit. Therefore, any burn rate test sample failing to ignite may be replaced.

Time is recorded by a photo cell monitoring the flame intensity. Firing shall be accomplished within five minutes of chamber removal.

4.5.11.4 Test equipment.
The following equipment, or equivalent, shall be utilized:

Equipment	Manufacturer	Model	Range
Conditioning Chamber	-	-	+200 to -100°F
Oven	Despatch	RS-2	Amb to +350°F
Temperature Recorder	Doric	205	-325 to +755°F
Test Stand	-	-	-
Photo Cell	-	-	-
Amplifier	Vishay	2310	±0 - 10 VDC

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

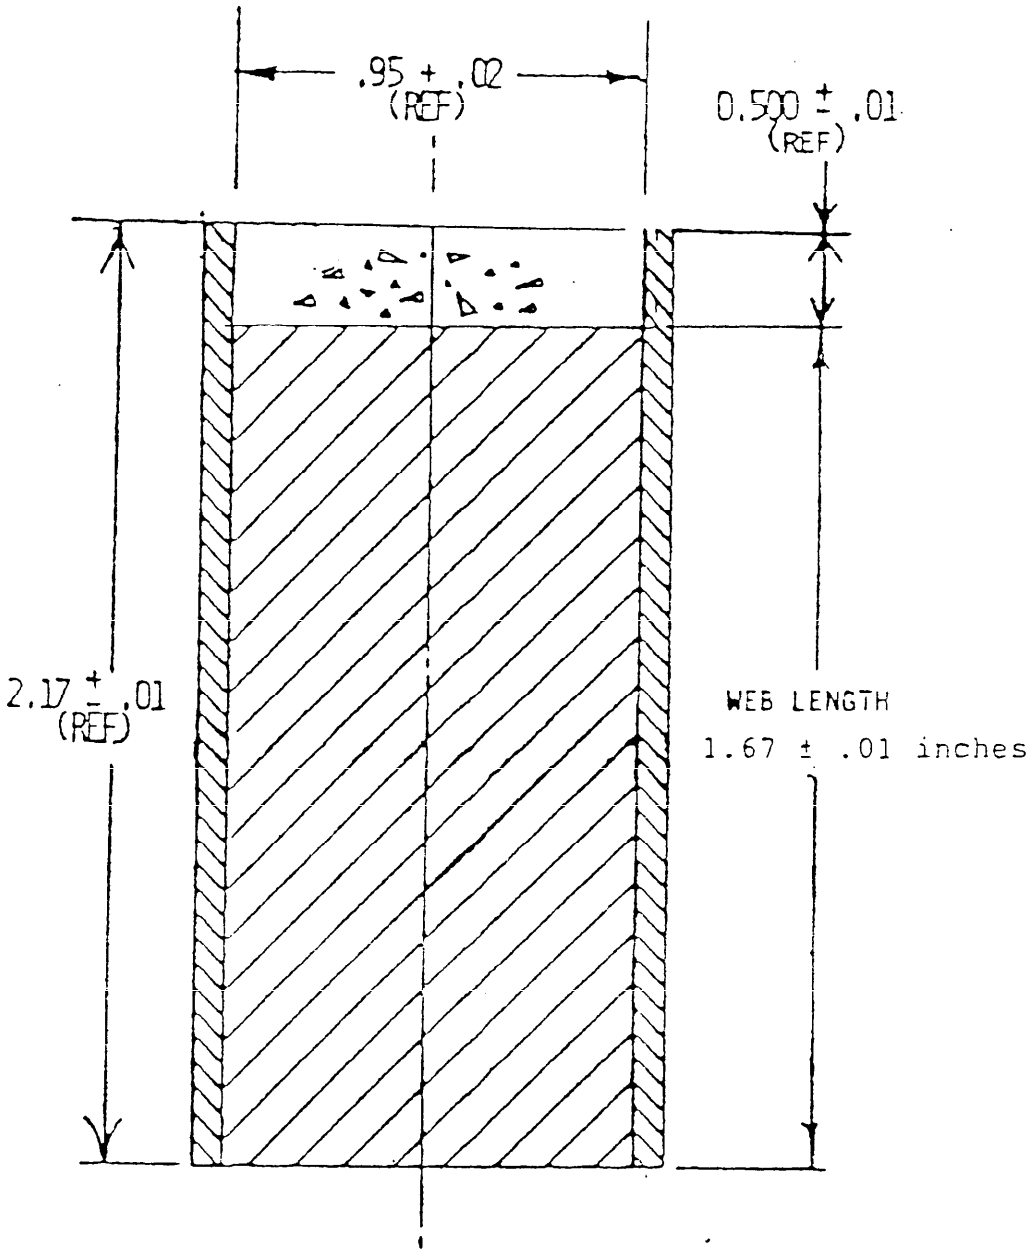


FIGURE 1. Machined propellant stick

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

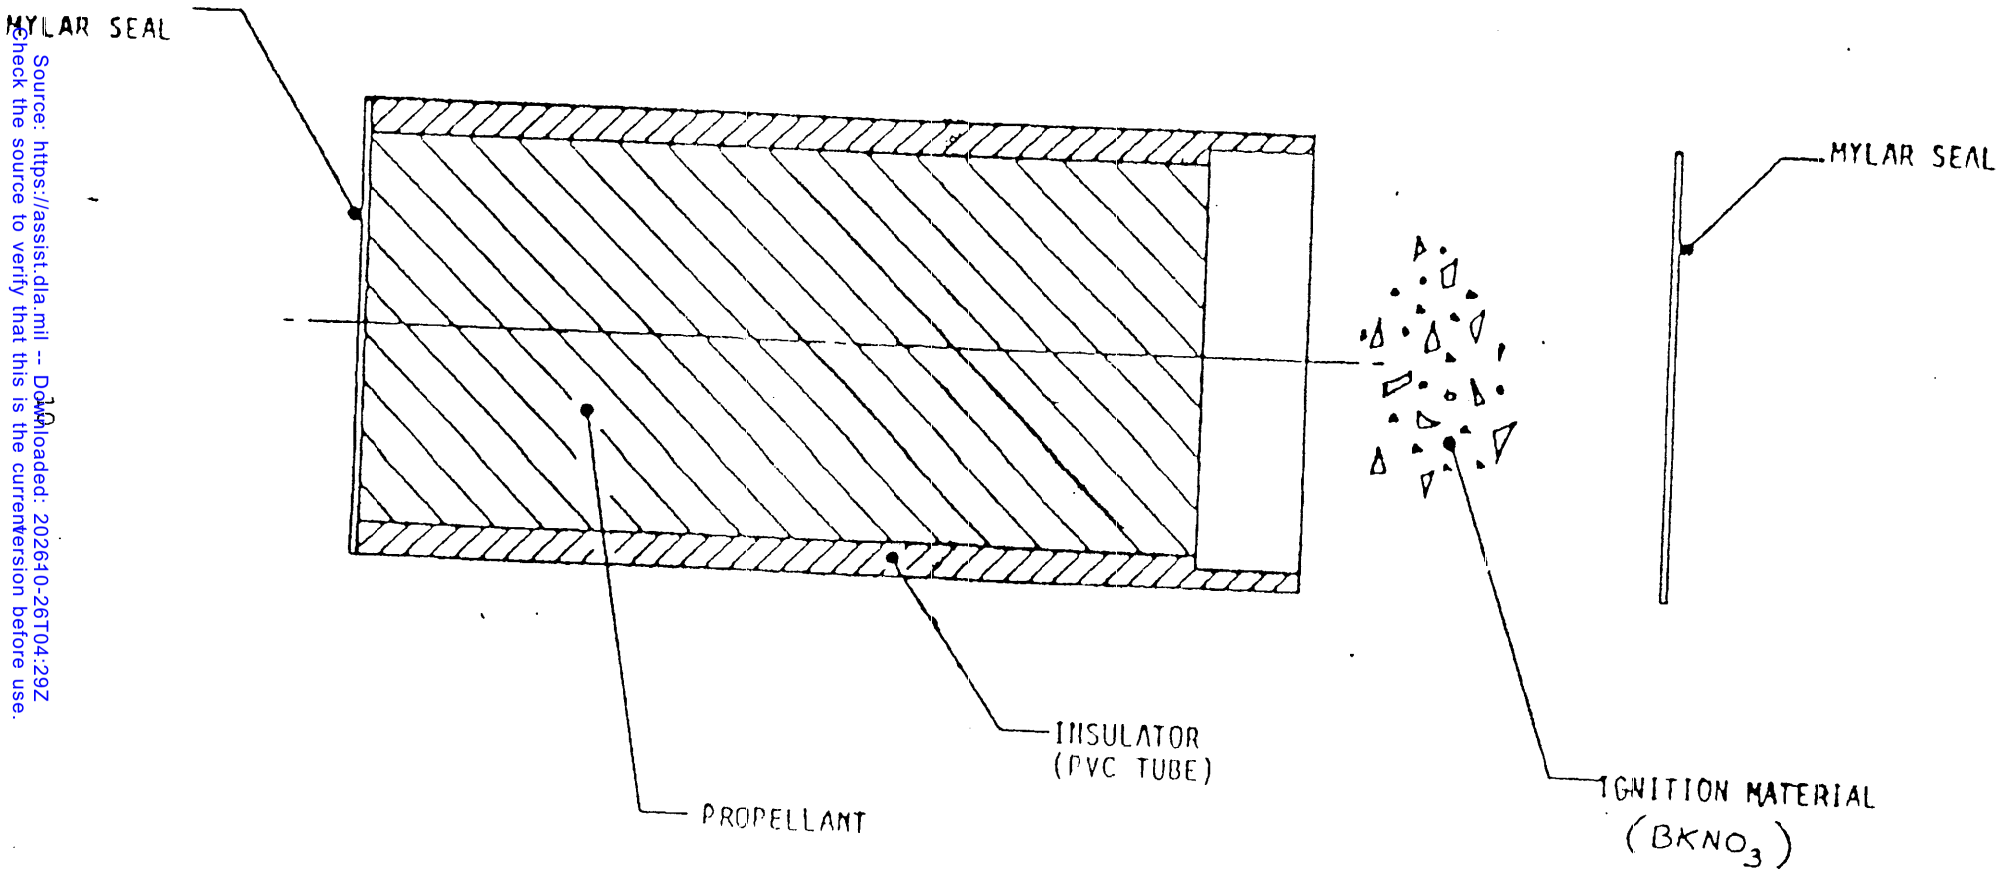


FIGURE 2 - Assembly Instructions

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

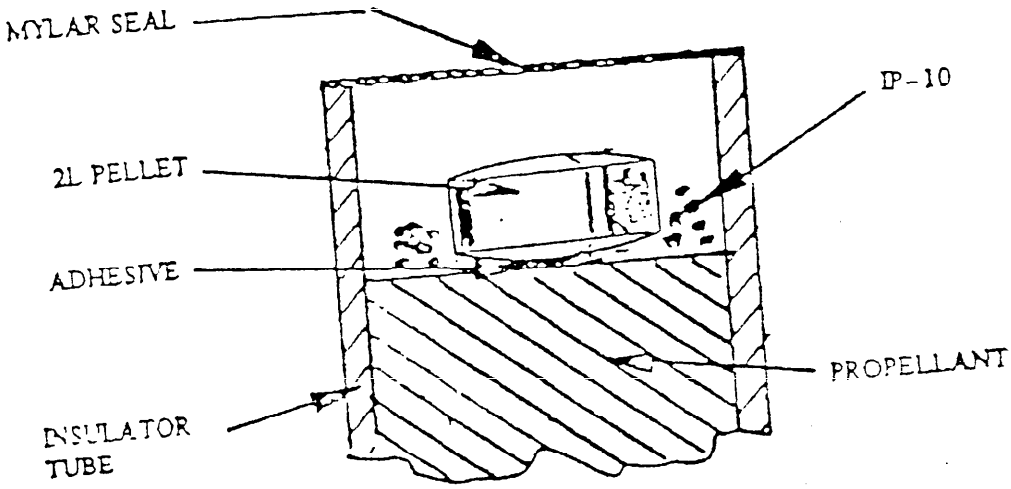


FIGURE 3: Initiator is redundant (M-100) electric matches

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

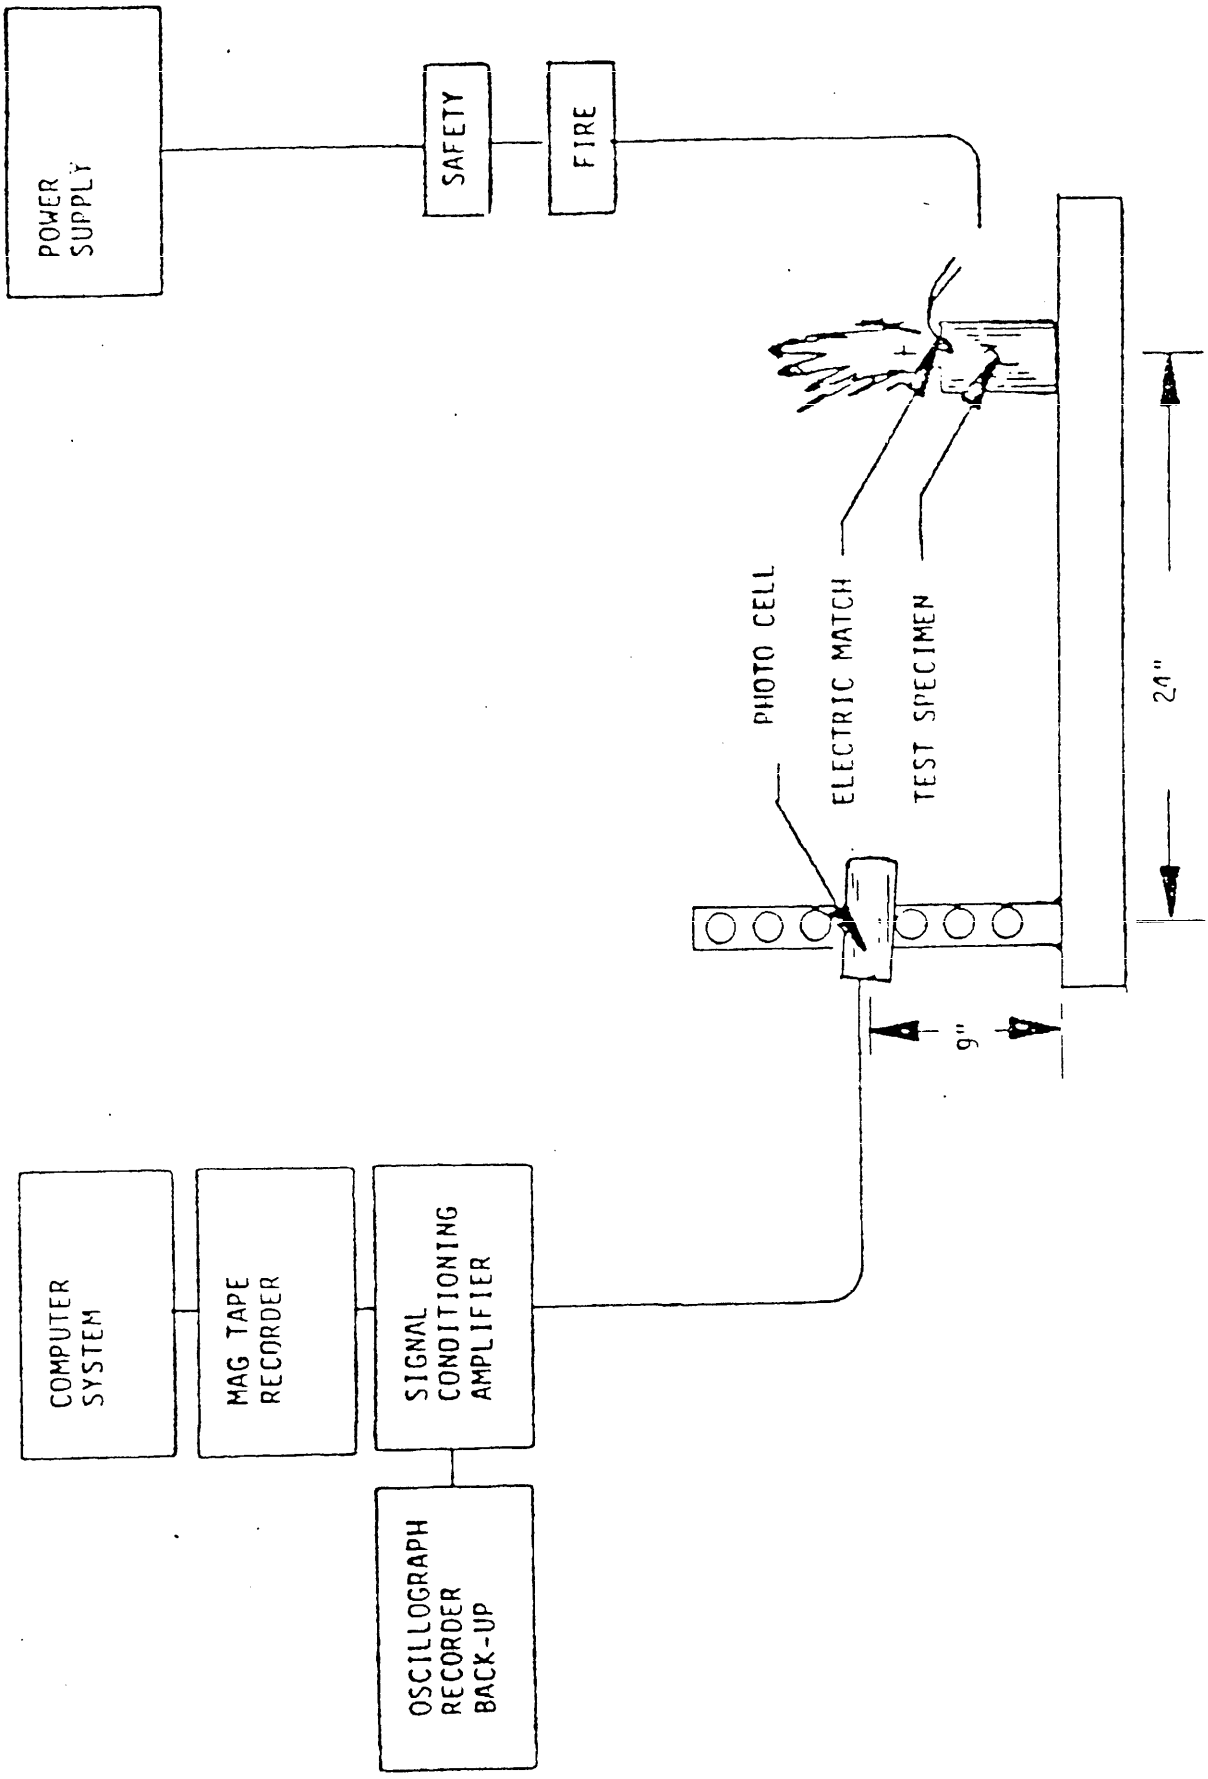


FIGURE 4. Test set and instrumentation

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

Tape Recorder	Racal	7-DS	4 Channel
Computer	Hewlett-Packard	HP-1000	-
Oscillograph	Bell and Howell	5-134	18 Channel

4.5.11.5 Evaluation of test results.

When tested at +70°F ± 5 F and 14.7 psia ± 10%, the average burn rate shall be 1.0 mm/second ± .10 mm/second. If the average of three strands fails to meet this requirement the batch shall be rejected. Calculation:

$$r_b = \frac{\text{propellant length (mm)}}{\text{burn time (seconds)}}$$

r_b = burn rate $\frac{\text{mm}}{\text{sec}}$"

* 4.5.12 Add the following new paragraph:

"4.5.12 Heat of reaction of propellant using the Parr Oxygen Bomb Adiabatic calorimeter.

4.5.12.1 Principle and status

The heat of reaction of cured propellant material is determined by ignition of a known mass in an argon atmosphere in a Parr Adiabatic Calorimeter.

4.5.12.2 Apparatus and reagents

a. Calorimeter, Parr Oxygen Bomb, Adiabatic, Automatic

b. Balance, Analytical, 0.1 mg

c. Balance, Torsion, 0.1g, 4kg. capacity

d. Scissors

e. Wash bottle

f. Water heater

g. Water cooler

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

h. Argon gas

i. Water, distilled

4.5.12.3 Preliminary. Determine the water equivalent factor of the calorimeter.

4.5.12.4 Sample Size and bomb pressure. The sample size of cured propellant material, from each batch, shall be 2.5 g ± .5g. The bomb pressure shall be 30 atm of inert gas (argon).

4.5.12.5 Procedure.

4.5.12.5.1 Calorimeter preparation. Fill the calorimeter bucket by first taring the dry bucket on a solution or trip balance; then add 2000 (± 0.5) grams of water. Distilled water is preferred, but demineralized or tap water containing less than 250 ppm of dissolved solids is satisfactory. The water temperature should be approximately 1.5 C below room temperature, but this can be varied to suit the operator's preference. It is not necessary to use exactly 2000 grams, but the amount selected must be duplicated within ± o.5 gram for each run.

4.5.12.2 Closing the Bomb. Care must be taken not to disturb the sample when moving the bomb head from the support stand to the bomb cylinder. Be sure that the contact ring is in place above the sealing ring and that the sealing ring is in good condition; then slide the head into the cylinder and push it down as far as it will go. It will be convenient (but not essential) to hold the bomb in a bench clamp during the closing and while filling the bomb with Argon. Set the screw cap on the cylinder and turn it down firmly by hand. Do not use a wrench or spanner on the cap. Hand tightening should be sufficient to secure a tight seal.

4.5.12.5.3. Filling the Bomb. Press the fitting on the end of the hose into the inlet valve socket and turn the knurled union nut finger tight. Close the valve on the filling connection; then open or "crack" the argon tank valve not more than one-quarter turn. Open the connection control valve slowly and watch the gage as the bomb pressure rises to the desired filling pressure (usually 30 atm., but never more than 40 atm); then close the control valve. The bomb inlet check valve will close automatically when the supply is off, leaving the bomb

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

filled to the highest pressure indicated on the atm. gage. Fill the bomb to 30 atm. and exhaust a total of 3 times before filling to the appropriate pressure for the particular sample being tested. When testing a powder or granular material, the filling and purging operation must be done very slowly so the sample will not be disturbed. Release the residual pressure in the filling hose by pushing downward on the lever attached to the relief valve. The gage should now return to zero. If the pressure drops slowly and a large amount of gas escapes when the pressure relief valve is opened, the check valve in the bomb head is not operating properly. This trouble will have to be corrected before the bomb can be used. If too much should accidentally be introduced into the bomb, do not proceed with the combustion. Detach the filling connection; exhaust the bomb, remove the head and reweigh the sample before repeating the filling operation.

4.5.12.5.4 Operation of calorimeter. Set the bucket in the calorimeter. Attach the lifting handle to the two holes in the side of the screw cap and lower the bomb into the water with its feet spanning the circular boss in the bottom of the bucket. Handle the bomb carefully during this operation so that the sample will not be disturbed. Remove the handle and shake any drops of water back into the bucket; then push the two ignition lead wires into the terminal sockets on the bomb head, being careful not to remove any water from the bucket with the fingers. Close the calorimeter cover. Lower the thermometer bracket. Adjust the reading lens, and turn on the power seitch to start the motor. Let the calorimeter run for seven (7) minutes while the controller brings th4e jacket temperature up to equilibrium with the bucket. After the temperatures have equalized, vibrate the thermometer and read the bucket temperature to one-tenth of the smallest scale division. Stand back from the calorimeter and fire the bomb by pressing the ignition button and holding it down until the indicator light goes out. Normally the light will glow for only about 1/2 second, but release the button with five (5) seconds regardless of the light. The bucket temperature will start to rise within twenty (20) seconds after firing. The rise will be rapid during the first few minutes; then it will become slower as the temperature approaches a stable maximum. It is not necessary to observe temperatures during the rapid rise period since the contoller will make the adjustments needed to keep the bucket and jacket temperatures equal. Start temperature readings at about seven (7) minutes after firing, vibrating to settle the mercury

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

before each observation. Read the thermometer at one minute intervals until the temperature reaches a stable maximum and remains constant for at least two minutes (three successive readings). Then, read and record this final temperature to one-tenth of the smallest scale division. Raise the thermometers. Swing the cover aside and lift the bucket out of the calorimeter, but let the motor continue to run while the calorimeter is open. Move the jacket temperature control to the purge position to lower the temperature to the starting point in preparration for another run. Remove the bomb from the bucket and open the knurled valve knob on the bomb head to release the residual gas pressure before attempting to remove the cap. Venting the bomb must be carried out either in the hood or out of doors. If no further use is to be made of the combustion products, wash the bomb thoroughly and allow to drain. If further analyses are to be made, the bomb washing should be caught and retained for analysis.

4.5.12.5.5 Calculations

$$\text{Heat of Explosion, cal/g} = \frac{WE \times \Delta T}{W}$$

Where WE = Water equivalent factor
ΔT = Temperature rise
W = Weight of sample

When Booster propellant is required, the calculation is adjusted as follows:

$$\frac{(WE \times \Delta T - CWB \times C)}{W} =$$

Where WB = Weight of booster
C = Caloric value of booster

4.5.12.5.6 Safety aspects. Do not exceed calculated maximum sample sizes or fill the bomb to greater than forty (40) atmospheres pressure. Otherwise excessive pressures may develop in the bomb. Exercise all safety precautions normally taken when handling solid propellant and gas cylinders.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

PAGE 17

6.4 Change "SMCAR-LCU-SI" to SMCAR-FSA-IM".

PAGE 18

Add new Appendix A as follows:

APPENDIX A

10.1 Application of statistical process control. The contractor will for the identified dimensions maintain Xbar and R SPC charts. After the contractor has demonstrated that his process for manufacturing a particular feature is in control, as defined in paragraph A.1.1; he will discontinue acceptance sampling inspection in favor of acceptance by SPC. However, SPC charting will be maintained for all identified dimensions whether or not the process is in control. It is expected that the contractor will make every effort to bring each process into control. It is required that the contractor re-evaluate his established control limits on a monthly basis and make those changes warranted by the data. At no time should his process parameters vary such that it will fail to meet the requirements established in subsequent paragraphs. Should this happen, the contractor will return to acceptance by sampling.

10.1.1 Implementation of SPC for acceptance of product. For those dimensions identified in the classification of defects tables as being applicable for elimination of lot sampling acceptance, the contractor shall implement, on a dimension by dimension basis, acceptance by SPC after he conforms to each of the following steps:

a. The contractor performs an indepth process capability study to establish the mean process average (Xdouble bar), Rbar, upper and lower control limits. This study will consist of at least 40 subgroups of data collection.

b. The contractor demonstrates that his process is under control for at least 20 consecutive production days. Control is defined as remaining within the established control parameters and not exhibiting any of the out of control conditions defined in paragraph A.1.2.a through A.1.2.e more than two times on an individual character basis.

c. Thirty days consecutive production have passed acceptance sampling for the feature.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

d. The process has a demonstrated Cpk equal to or greater than 1.3 and demonstrated when conducting the above test. Cpk is defined as follows:

$$Cpk = \frac{\text{process mean - nearest specification limit}}{3 \text{ sigma}}$$

sigma = process standard deviation (calculated by the range method per the referenced ANSI documents)

e. The contractor documents his detailed process description. This process description must be submitted to Commander, AMCCOM, ATTN: SMCAR-QAR-Q, Picatinny Arsenal, New Jersey 07806-5000 for review and disapproval if the description does not meet its objectives. That is the process description will identify all known contributing variables and their respective controls that are necessary to maintain the specific dimension (i.e., weight, temperature, machine speed, time, tool life, solution proportion, etc.). The Government will furnish the contractor with written notice of the acceptability of his process controls. A notice of control acceptability is required prior to the implementation of acceptance by SPC.

10.1.2 Process control analysis. Once SPC acceptance is implemented, the contractor will evaluate his process for evidence of nonrandom variation (e.g. trends, extreme values, etc.). Should any out of control condition be detected, the product produced from the last sample till the process is brought back into control will be isolated for analysis. The contractor will bring the process back into control or shut the process down. Upon determining the cause of the out of control condition, the contractor will determine if the product manufactured and isolated could be out of engineering tolerance. If the out of control condition did not result in the production of nonconforming material, the material will be released. If the out of control condition could have created nonconforming product, the contractor will sample the product using MIL-STD-105 and the AQL specified in the classification of defects table to determine the acceptability of the isolated product. This evaluation of out of control product requires the review and approval of the local Government quality assurance representative. As a minimum, the contractor will look for any of the following out of control indications:

a. If any point goes outside the Xbar or R chart control limits.

b. If 9 points in a row are either continually above or continually below the Xdouble bar.

c. If 6 points in a row are either continually increasing or continually decreasing on the Xbar chart.

d. If 6 points in row are increasing on the range chart.

e. If any individual sample, Xi, falls outside of the specification limits.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.

10.1.2.1 Process capability review. At least once a month the contractor will review his process data and establish updated control limits.

10.1.3 Mandatory return to sampling acceptance. Acceptance by SPC will be discontinued in accordance with the following paragraphs. In any case, control charting will be continued. When this occurs, the contractor may reintroduce acceptance by SPC by repeating the steps outlined in paragraph A.1.1.

10.1.3.1 Out of control incidents. If for any individual process, an out of control incident is identified 3 times within 5 consecutive shifts or 5 times within 30 consecutive shifts; and the analysis indicated that nonconforming product may have been manufactured, the contractor will return to acceptance by sampling for the pertinent feature.

10.1.3.2 Process interruption. If the process is interrupted for more than 10 calendar days, the contractor will return to acceptance by sampling for that pertinent feature.

10.1.3.3 Loss of control. If either by testing or data review it is determined that the Cpk is no longer at the required minimum of 1.3, the contractor will return to acceptance by sampling for the pertinent feature.

10.1.4 Records. The contractor will maintain all records dealing with SPC in his files for a minimum of 5 years after completion of the contract.

10.2 Government auditing. In order to verify the state of control of the process, it is recommended that Government representatives select samples at unscheduled times. The sample mean and range should then be compared to the data being recorded by the contractor. If the data is not consistent with the reported data, corrective action should be sought and if necessary, screening of material should be required.

The margins of this amendment are marked with an asterisk or vertical line to indicate where changes (additions, modifications, corrections, deletions) from the previous amendment were made. This was done as a convenience only and the Government assumes no liability whatsoever for any inaccuracies in these notations. Bidders and contractors are cautioned to evaluate the requirements of this document based on the entire content irrespective of the marginal notations and relationship to the last previous amendment.

Custodian:
Army - AR

Preparing activity:
Army - AR

(Project 1320-AC96)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:29Z
Check the source to verify that this is the current version before use.