AI SITE HISTORY REPORT

502 Church Road, Taigum QLD

Generated 07 Apr 2026 | Lat -27.333805, Lng 153.048571 | Confidence: Medium

Executive Summary

The site at 502 Church Road, Taigum QLD contains a prominent circular pond feature on the northeast side with visible water currently present. Historical imagery from 1995 to 2009 shows two larger adjacent ponds northeast off-site which are not present currently. The site does not exhibit evidence of fill or disturbance activities or slope instability features. A buried or former pond is not strongly evident on-site, but secondary possible former pond-like vegetated moist depressions are noted and warrant further investigation. Additional targeted remainder-lot rescan identified further possible buried / former pond risk areas requiring field

confirmation.

On-site: On-site there is a single clear pond feature visible currently in the northeast quadrant delineated by dense vegetation and open water. There is no clear evidence of fill areas, cut or fill batters, retaining walls, or slope instability. No large former ponds or infilled basins are directly confirmed within the site polygon. Targeted rescan placed greater emphasis on secondary former pond / buried basin risk areas.

Adjacent / context: Adjacent to the northeast and east are two larger off-site ponds historically visible on the 1995-2009 images but now likely reduced or absent. Dense vegetation and drainage influences from Cabbage Tree Creek to the northwest also provide a wetness influence context. Residential development is situated to the south.

Site Details

Address	502 Church Road, Taigum QLD
Location source	polygon
Latitude / Longitude	-27.333805, 153.048571
Site bbox	267.6 m × 274.6 m
Context bbox	321.6 m × 328.6 m
Polygon supplied	Yes

Key Flags

Key Flag	Level	Comment
Former water features	Elevated	Historical imagery shows two former ponds adjacent northeast off-site which are no longer clearly present.
Vegetation / land change	Low	Site mostly cleared with some scattered trees and shrubs predominantly on pond edges; no extensive clearing evident.
Fill / disturbance	Moderate	Minor disturbance near buildings and roads observed; no major fill areas or earthworks detected.

Flag Summary

Potential Fill / Disturbance	**Moderate**
Minor disturbance near buildings and roads observed; no major fill areas or earthworks detected.	
Former Water Features	**Elevated**

Historical imagery shows two former ponds adjacent northeast off-site which are no longer clearly present.

Vegetation / Land Change	Low
Site mostly cleared with some scattered trees and shrubs predominantly on pond edges; no extensive clearing evident.	

Screening Outcome

The site contains one active pond of moderate size with adjacent historical ponds off-site that have likely been infilled or drained. No major disturbance or slope issues are evident on-site. Subsurface investigation is recommended near the pond margin and secondary possible depressions to evaluate moisture-sensitive soil risk.

Primary On-Site Risks

Feature	Type	Relation	Confidence	Notes
Pond D	former_pond	on_site	medium	Large former pond visible in 1995 and 2015 imagery northeast of active pond, now infilled with vegetation. Shape is semi-circular with vegetated edges.
Pond E	former_pond	adjacent	low	Small former pond visible in 1995 historic imagery southwest of pond C, no longer visible in recent imagery, likely infilled or drained.

Secondary On-Site Risks

Feature	Type	Relation	Confidence	Notes
Pond A	pond	adjacent	high	Current open water clearly visible with a circular vegetated edge on the northeast side of the site.
Pond C	pond	on_site	low	Vegetated moist depression or secondary basin identified north of pond A; uncertain pond status.
Pond	pond	on_site	low	Active pond with semi-circle vegetated moist depression north of main pond A, uncertain pond status but with water/moist signature in current imagery.
Minor Disturbance Zone	disturbance	adjacent	low	Minor surface disturbance near buildings and road with some earth scarring and compacted surfaces, no major earthworks or fill areas.

Adjacent Contextual Influences

Feature	Type	Relation	Confidence	Notes
Pond B	former_pond	on_site	medium	Two distinct, larger ponds visible historically (1995, 2002) adjacent northeast off-site, now diminished or infilled.

Feature Timeline

Former Pond B — 1995: Two large ponds with open water visible adjacent northeast off-site.

Pond A — 2002-2021: Primary circular pond feature remains visible with open water.

Former Pond B — 1995: two distinct ponds with open water clearly visible northeast of main pond

Former Pond B — 2015: pond area largely infilled with vegetation, water diminished

Former Pond D — 1995: small open water body visible southwest on site

Former Pond D — 2021: former pond no longer visible, likely infilled

Pond C — 2021: vegetated moist depression with possible water presence

Detailed Findings

Visible Observations

• Single clear pond present on site northeast side

• No retaining walls, batters, or slope instability visible

• Historical adjacent ponds are no longer visible on site

• No signs of fill or disturbance detected

• active pond C with vegetated moist signature

• two former ponds B and D infilled or drained

• minor disturbance associated with buildings and access road

• no retaining walls or slope instability visible

Overall Change Timeline

1995-2009: Two large adjacent ponds northeast off-site historically visible diminish or infill by 2009; site pond remains stable.

1995-2021: substantial infill and disappearance of former ponds B and D with vegetation encroachment; pond C remains moist depression

Possible Geotechnical Implications

• Former pond signatures may indicate fill, uncontrolled fill, deep fill, soft ground, or moisture-sensitive soils.

• Disturbed ground may indicate variable near-surface conditions and localised compaction variability.

• Active pond areas may indicate local wetness influence and moisture variability in surrounding ground.

Recommended Follow-Up

• Detailed geotechnical investigation is strongly recommended based on identified site history risks.

Supporting Imagery

current_wide_context — current

Source: mapbox_bbox_wide_context

current_context — current

Source: mapbox_bbox_context

current_subzone_nw — current

Source: mapbox_bbox_subzone

current_subzone_west — current

Source: mapbox_bbox_subzone

current_site — current

Source: mapbox_bbox_site

historical_qld_followup_1 — 1995 (1995-06-18)

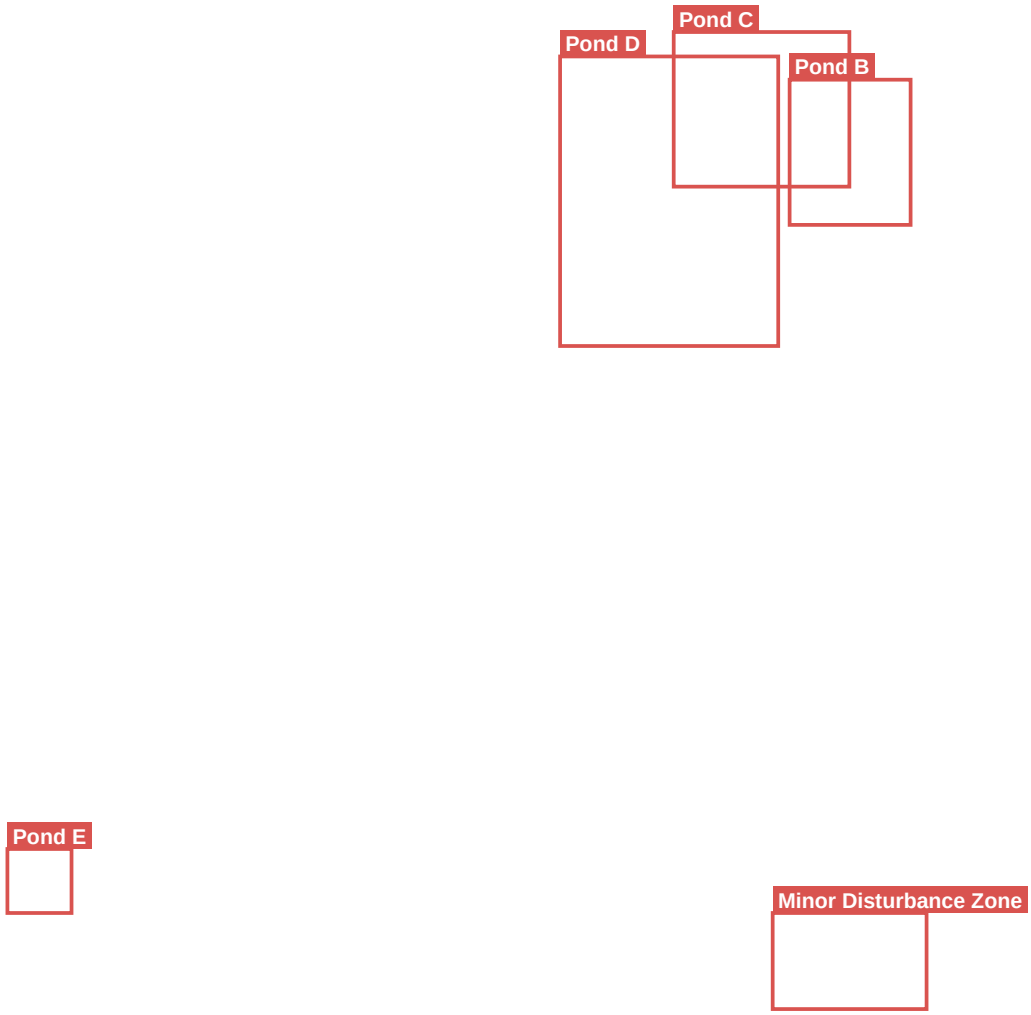

Source: qld_public_imagery | Queensland Digital Orthophoto Image Data - Brisbane_1995_60cm_9543 | Resolution: 60 2

historical_qld_followup_5 — 2009 (2009-09-13)

Source: qld_public_imagery | Queensland Digital Orthophoto Image Data - Brisbane_2009_15cm_SISP_LGA | Resolution: 15 2

historical_qld_followup_8 — 2015 (2015-05-30)

Source: qld_public_imagery | Queensland Digital Orthophoto Image Data - Brisbane_2015_10cm_SISP_LGA | Resolution: 10 2

Limitations & Disclaimer

- Historical image resolution limits precise interpretation of small former ponds
- Current imagery seasonal timing affects moisture visibility
- No subsurface data to confirm fill or soil conditions
- No recent high-resolution elevation or LIDAR data to assess subtle slope features
- Moisture presence inferred from vegetation and moisture signatures, not direct hydrological measurement
- Resolution and date gaps in historical imagery limit certainty on infill timing

This AI site history scan is a preliminary screening tool only. It is intended to identify possible visual indicators for further professional review. It must not be relied on as a substitute for geotechnical investigation, engineering assessment, or design advice.