Authorized Field Change

INTERNATIONAL

AFC G-01910

Date: August, 2001

Subject File: STEERING

Subject: Plugged Power Steering Reservoir Dipstick Vent Hole in 4300 and 4400 Models Built Between April 11, 2001 and May 11, 2001 Manufactured at the Springfield Assembly Plant

Truck Model: 4300

Start Date: 04/11/2001 End Date: 05/11/2001

Truck Model: 4400

Start Date: 04/11/2001 End Date: 05/11/2001

DESCRIPTION

Print ready (PDF file) copy of the AFC letter

The supplier of the power steering reservoir and dipstick assembly produced dipsticks with partially or completely plugged vent holes.

PARTS INFORMATION

Table 1 Parts Information

Part Number	Description	Quantity
2507059C1	Dipstick	1

SERVICE PROCEDURE

Inspect the date code on the power steering reservoir (Figure 1). If the date code is "010409" through "010503", replace the dipstick with Part Number 2507059C1.

SERVICE PROCEDURE (CONT.)

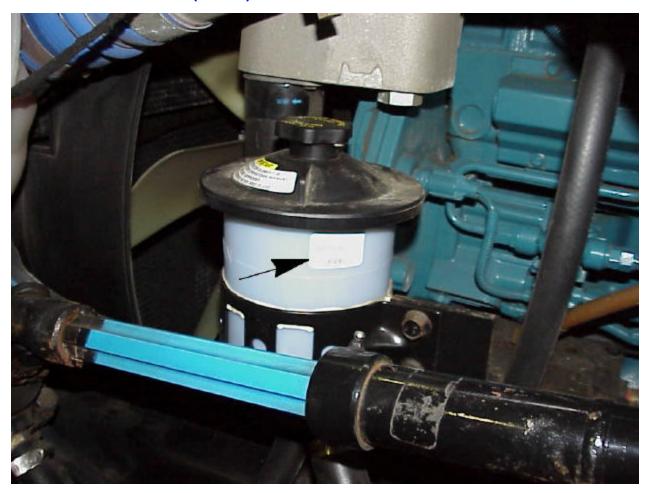


Figure 1 Arrow Indicates Label with Date Code

Operation number must appear on all claims.

Table 2 Labor Information

Operation No.	Description	Time
A40-01910-1	Inspect and Replace Dipstick	0.5 Hr.


ADMINISTRATIVE PROCEDURE

Expense is to be charged to Warranty. Claims are to be submitted in the normal manner, making reference to Authorized Field Change Number G-01910.

It is important that the coding be completed properly to assist in processing the warranty claim. Complete instructions will be found in the Warranty Manual, Section 7–1. Special attention should be given to Items 39 through 44.

To assure this important improvement is made in a timely manner, all claims for G-01910 activity must be submitted by September 30, 2004 or within the normal warranty period for the vehicle, if after September 30, 2004.

Do not return dipsticks, destroy and discard locally.

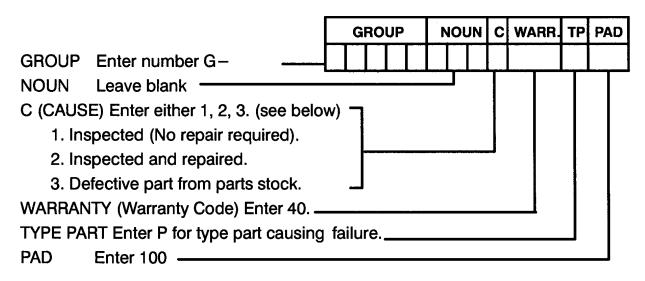

Distribution: All except J-81 Reproduction: Not required.

Figure 2