CORNER JUNCTION REMOVAL [PANEL REPLACEMENT]

id098008611400


Symbol Mark

SYMBOL MARK	MEANING
•	SPOT WELDING

ac5wzb00000078

Removal Procedure

1. Drill the 27 locations shown in the figure.

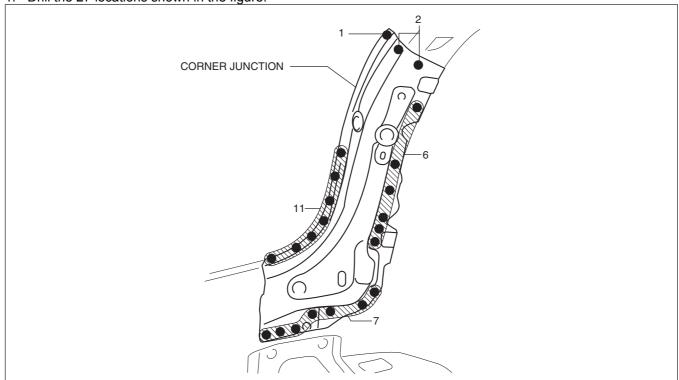

2. Remove the corner junction.

ac5wzb00000132