
WHEEL HUB COMPONENT INSPECTION

- Wheel Bearing Excessive Play Inspection

 1. Install the magnetic base and dial gauge as shown in the figure and measure the wheel bearing axial
 - excessive play.

 If it exceeds the maximum specification, replace the wheel hub component.

Rear wheel bearing maximum play 0.05 mm {0.002 in}

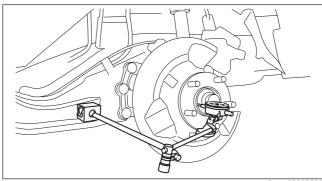

ac5wzw00002560

id031200800300