

Nokia Lumia 530 Touch screen, LCD Display Replacement

Escrito Por: ZFix (y otro participante)

Comentarios: 10 ☆ Favoritos: 8 ✓ Terminaciones: 15





Introducción

Nokia Lumia 530 - RM-1017, RM-1019

How to disassemble / take apart the phone and change broken Display or Touch screen Glass Digitizer.

_____Video tutorial: _____

Herramientas		Partes
T5 Torx Screwdriver	□ Spudger	No se especificaron partes.
T6 Torx Screwdriver	☐ 3mm adhesive tape	
Tweezers	☐ iFixit Opening Picks set of 6	

Resumen del Video

_	

Paso 1 Loudspeaker and Earpiece






- Turn off the phone.
- Remove the battery and any installed SIM and memory cards. There are two tapes screws:
 - 4x Torx T6
 - 5x Torx T5
- Remove the middle bezel.
- Earpiece
- Earpiece Flex Cable
- Loudspeaker / Ringer

Agregar un comentario

Paso 2 Logic Board

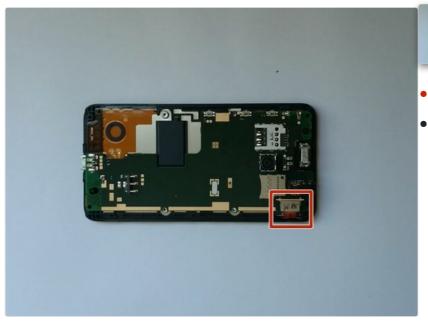



- Disconnect the touch screen & display flex cable.
- Remove the main board.

Paso 3 Touch screen or LCD Display Replacement





- If the glass is broken, put some scotch tape to prevent it breake to pieces.
- Use a hot air to make adhesive tape more soften.
- For this operation you can use a hairdryer.
- Use a cutter and make small room to insert a plastic pick.

Agregar un comentario

Reparación para todos

Paquetes creados para tus necesidades, a un precio excepcional.

Adquirir las ofertas del Black Friday

Paso 4






- Continue with the separation by using a plastic tools.
- i If necessary, use the hot air again

Agregar un comentario

Paso 5

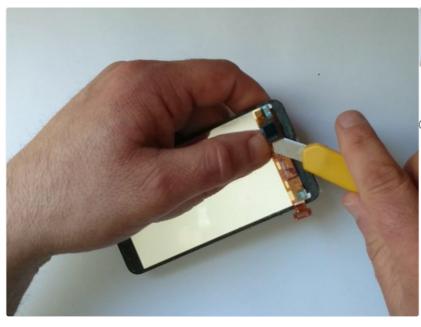




- Unstuck the Touch screen flex cable from the display.
- If you have a broken glass, you can cut the touch screen flex cable, otherwise unsolder it careful like in the next step.

Agregar un comentario

Paso 6

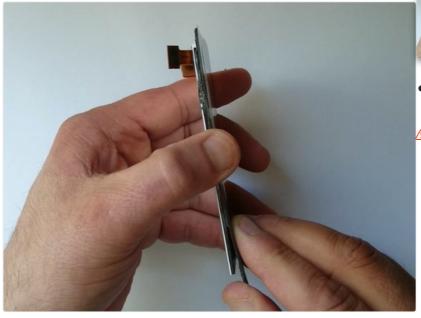



- The display edges are glued to the glass with adhesive tape.
- ⚠ Use only thin plastic tools for the separation.

Agregar un comentario

Paso 7





- Remove the blue sticker.
- With a soldering iron, remove the touch screen flex cable and install the new one.
- ⚠ Put back the blue sticker.

Agregar un comentario

Paso 8






- If the spare part is without tape, install a new one.
- Carefully put the display in place, then install the glass.
- Start with reassembling.

Agregar un comentario

Paso 9

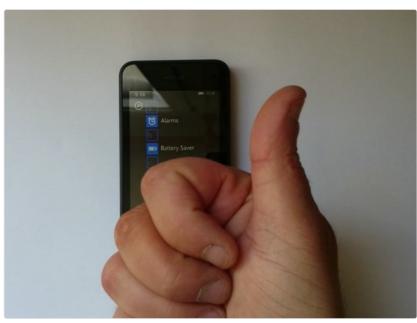

- That's all.
- •
- ,
- .
- .
- .
- Did you do it successfully?

Agregar un comentario

CONCLUSIÓN CONCLUSIÓN

To reassemble your device, follow these instructions in reverse order.

✓ Otorgar al autor +30 puntos!

15 personas más completaron esta guía.

Autor



con 1 otro colaborador

Insignias: 35







Equipo



	10 COMENTARIOS	Agregar un comentario		
\Box	What did you apply in the first frame of step 7? 4:15 in the video.			
	Paul Reich - 7 de may. de 2015			
	soldering flux			
	ZFix - 9 de may. de 2015			
	Thanks for confirming			
	Paul Reich - 14 de may. de 2015			
\Box	I didn't end up doing it correctly - it didn't work.			
I think the mistake I made was not heating the old flex cable off the connector. I didn't follow instructions correctly and I pulled it off. able to heat the leftover connectors off but after soldering the new flex onto the board and sealing up it didnt work - screen still unre:-(
It was my first attempt at replacing a screen (and I don't have any experience) so I'm not too bummed.				
	I just ordered a complete LCD and digitizer instead :-)			
	Paul Reich - 14 de may. de 2015			
\Box	Failed miserably Soldering iron not adapted. Might want to emphasise that is critical. At least I tried			
·	ricochapuis - 9 de jun. de 2015			
	∨ Cargar más comentarios			
regar	Comentario			
В.	<i>I</i> ♦ Ø • • • • • • • • • • • • • • • • • •			
		Publicar comentario		

III Ver Estadísticas: Ultimas 24 horas: 0 Ultimos 7 días: 2 Ultimos 30 días: 20 Todo El Tiempo: 36,714