



AS 9102 Rev A

Sheet / of /

Form 1 : Part Number Accountability

F-02-351(5)

Rev. Date:01 NOV 13

 초도품 검사 기록서 (AS 9102)
First Article Inspection Record (AS 9102)

Attachment #1 for Form 1

Sheet / of /

Drawing Revision Status

FAI Part Number 119A1212-601

FAI Report Number: QPI36995

Eng Doc. No.	SHT No.	Rev. No.	ECN No.	Eff. From	Eff. To
119A1212-601	MBD	A ✓		K0001	K9999
119A1212-601	PL	B ✓		K0001	K9999
MA006W	PL	D ✓		01-DEC-2001	31-DEC-2099



26 JAN 2016



01 FEB 2016



Sheet / of /

[illegible]

초도품 검사 기록서 (AS 9102)
First Article Inspection Record (AS 9102)

Sheet 1 of 10

AS 9102 Rev A

Form 3 : Characteristic Accountability, Verification and Compatibility Evaluation

1. FAI Part Number (and Engineering Part Number)				2. Part Name		3. Part S/N	4. FAI Report Number
119A1212-601(119A1212-601_A)				CHANNEL FWD		K0001	QPI36995
Characteristic Accountability				Inspection / Test Results			
5. Char. No.	6. Reference Location	7. Characteristic Designator	8. Requirement	9. Results	10. Designed Tooling	11. NCR Number	14. Note
N1	Sheet 2[Page: 3]	Flatness.1	FLT / .0100	.0001	CMM Program no: 119A1212-601_1.DMS		PAGE28~29:DATUM_A_FLT
N2	Sheet 2[Page: 4]	Linear Size.1	4 X Φ .2500 - .2540	See Char. No.N90,N93			
N3	Sheet 2[Page: 4]	Position.1	TRUP / .0140M A B C	See Char. No.N90,N93			
N4	Sheet 2[Page: 4]	Linear Size.2	Φ .0980 - .1040	Φ .0982	CMM Program no: 119A1212-601_1.DMS		PAGE8:CIRCLE_005
N5	Sheet 2[Page: 4]	Position.2	TRUP / .0140M A B C	.0116	CMM Program no: 119A1212-601_1.DMS		PAGE8:CIRCLE_005
N6	Sheet 2[Page: 4]	Linear Size.3	Φ .1280 - .1340	Φ .1281	CMM Program no: 119A1212-601_1.DMS		PAGE8:CIRCLE_006
N7	Sheet 2[Page: 4]	Position.3	TRUP / .0280M A B C	.0084	CMM Program no: 119A1212-601_1.DMS		PAGE8:CIRCLE_006
N8	Sheet 2[Page: 4]	Linear Size.4	Φ .1280 - .1340	Φ .1282	CMM Program no: 119A1212-601_1.DMS		PAGE9:CIRCLE_007
N9	Sheet 2[Page: 4]	Position.4	TRUP / .0280M A B C	.0073	CMM Program no: 119A1212-601_1.DMS		PAGE9:CIRCLE_007
N10	Sheet 2[Page: 4]	Position Surfacic Profile.1	PROP / .0100 A B C (5 SURFACES)	.0096	CMM Program no: 119A1212-601_1.DMS		PAGE2~7:PNT001-PNT047(MAXPNT027)
N11	Sheet 2[Page: 5]	Dimension.1	L (10.5)	11.20"			
N12	Sheet 2[Page: 5]	Dimension.2	ST (2.9)	3.00"			
N13	Sheet 2[Page: 5]	Dimension.3	LT (3.4)	7.90"			

Form 3 : Characteristic Accountability, Verification and Compatibility Evaluation

1. FAI Part Number (and Engineering Part Number) 119A1212-601(119A1212-601_A)				2. Part Name CHANNEL FWD		3. Part S/N K0001	4. FAI Report Number QPI36995
Characteristic Accountability				Inspection / Test Results			
5. Char. No.	6. Reference Location	7. Characteristic Designator	8. Requirement	9. Results	10. Designed Tooling	11. NCR Number	14. Note
N14	Sheet 2[Page: 6]	Text.1	PIN 1191-2200 REV: A DESCRIPTION: 1. ADDED (QTY 2) OUTBD .2500-DIA HOLES ON WEB OF CHANNELS. 2. PILOT HOLE DIA. REVISED TO #40 FROM #30 (QTY 1) REASON: BASIC RELEASE - SUPPLEMENTAL SIMILAR TO PART FOR NBMT APPROVAL: 119A1212-601 REV -. PROD INFO: AIRPLANE/PARTS MUST COMPLY MFG INFO: GRP 526D M. BURDETTE, 425-717-0554, 4/1/2015	ACCEPT <i>See char NO. N2-N5</i>			
N15	Sheet 2[Page: 7]	RDD Thk.1	.2000 ±.0100	.2015 ~ .2020			
N16	Sheet 2[Page: 7]	RDD Thk.2	.1000 ±.0100	.1000 ~ .1005			
N17	Sheet 2[Page: 7]	RDD Thk.3	.1000 ±.0100	.0995 ~ .1000			
N18	Sheet 2[Page: 7]	RDD Thk.4	.1000 ±.0100	.1000 ~ .1025			
N19	Sheet 2[Page: 7]	RDD Thk.5	.1000 ±.0100	.1005 ~ .1010			
N20	Sheet 2[Page: 7]	RDD Thk.6	.2621 ±.0100	.2645 ~ .2650			
N21	Sheet 2[Page: 7]	RDD Thk.7	.2206 ±.0100	.2230 ~ .2245			

Form 3 : Characteristic Accountability, Verification and Compatibility Evaluation

1. FAI Part Number (and Engineering Part Number) 119A1212-601(119A1212-601_A)				2. Part Name CHANNEL FWD		3. Part S/N K0001	4. FAI Report Number QPI36995
Characteristic Accountability				Inspection / Test Results			
5. Char. No.	6. Reference Location	7. Characteristic Designator	8. Requirement	9. Results	10. Designed Tooling	11. NCR Number	14. Note
N22	Sheet 2[Page: 7]	RDD Thk.8	.2010 ±.0100	.2010 ~.2025			
N23	Sheet 2[Page: 7]	RDD Thk.9	.1610 ±.0100	.1600 ~.1610			
N24	Sheet 2[Page: 7]	RDD Thk.10	.1510 ±.0100	.1515 ~.1520			
N25	Sheet 2[Page: 7]	RDD Thk.11	.1086 ±.0100	.1090 ~.1095			
N26	Sheet 2[Page: 8]	RDD Thk.12	.1037 ±.0100	.1030 ~.1040			
N27	Sheet 2[Page: 8]	RDD Thk.13	.1000 ±.0100	.0995 ~.1000			
N28	Sheet 2[Page: 8]	RDD Thk.14	.1019 ±.0100	.1020 ~.1030			
N29	Sheet 2[Page: 8]	RDD Thk.15	.1052 ±.0100	.1045 ~.1050			
N30	Sheet 2[Page: 8]	RDD Thk.16	.1556 ±.0100	.1560 ~.1565			
N31	Sheet 2[Page: 8]	RDD Thk.17	.1521 ±.0100	.1520 ~.1540			
N32	Sheet 2[Page: 8]	RDD Thk.18	.2137 ±.0100	.2150 ~.2155			
N33	Sheet 2[Page: 8]	RDD Thk.19	.2039 ±.0100	.2050 ~.2055			
N34	Sheet 2[Page: 8]	RDD Thk.20	.2110 ±.0100	.2115 ~.2120			
N35	Sheet 2[Page: 8]	RDD Thk.21	.2150 ±.0100	.2140 ~.2150			
N36	Sheet 2[Page: 8]	RDD Thk.22	.1000 ±.0100	.0995 ~.1005			
N37	Sheet 2[Page: 8]	RDD Thk.23	.1000 ±.0100	.1005 ~.1010			
N38	Sheet 2[Page: 8]	RDD Thk.24	.1000 ±.0100	.0995 ~.1000			

Form 3 : Characteristic Accountability, Verification and Compatibility Evaluation

1. FAI Part Number (and Engineering Part Number) 119A1212-601(119A1212-601_A)				2. Part Name CHANNEL FWD		3. Part S/N K0001	4. FAI Report Number QPI36995
Characteristic Accountability				Inspection / Test Results			
5. Char. No.	6. Reference Location	7. Characteristic Designator	8. Requirement	9. Results	10. Designed Tooling	11. NCR Number	14. Note
N39	Sheet 2[Page: 8]	RDD Thk.25	.1000 ±.0100	.1010 ~ .1015			
N40	Sheet 2[Page: 8]	RDD Thk.26	.2000 ±.0100	.2005 ~ .2010			
N41	Sheet 2[Page: 9]	RDD Dim.27	R.3500 (10PLS) ±.0300	(10) R.3500 ~ R.3510			
N42	Sheet 2[Page: 9]	RDD Dim.28	R.1250 (TYP) ±.0300	R.1250 ~ R.1260			
N43	Sheet 2[Page: 9]	RDD Dim.29	R.6850 ±.0300	R.6850 ~ R.6855			
N44	Sheet 2[Page: 9]	RDD Dim.30	R.5500 (2PLS) ±.0300	(2) R.5490 ~ R.5500			
N45	Sheet 2[Page: 9]	RDD Dim.31	R.8000 (2PLS) ±.0300	(2) R.7990 ~ R.8000			
N46	Sheet 2[Page: 10]	RDD Dim.32	R.5500 (2PLS) ±.0300	(2) R.5500 ~ R.5510			
N47	Sheet 2[Page: 11]	RDD Thk.33	.1500 ±.0100	.1495 ~ .1505			
N48	Sheet 2[Page: 11]	RDD Thk.34	.1500 ±.0100	.1500 ~ .1505			
N49	Sheet 2[Page: 11]	RDD Dim.35	CH .2200X45° ±.0100	CH .2200X45°			
N50	Sheet 2[Page: 11]	RDD Dim.36	CH .2000X45° ±.0100	CH .2000X45°			
N51	Sheet 2[Page: 11]	RDD Dim.37	CH .1600X45° (3PLS) ±.0100	(3) CH .1600X45°			
N52	Sheet 5[Page: 12]	Part Note	5SN0000008414/119A1212-602 IS AN EXACT OPPOSITE OF 119A1212-601. THE PART AUTHORITY DEFINITION RESIDES IN 119A1212-601 AND IS APPLICABLE TO THE PRIME AND OPPOSITE PARTS. URL	ACCEPT			
N53	Sheet 5[Page: 12]	Standard Note	5SN0000007452/THE BOEING COMPANY, BOEING COMMERCIAL AIRPLANES, SEATTLE, WASHINGTON 98124	N/A			Not a requirement to inspect

Form 3 : Characteristic Accountability, Verification and Compatibility Evaluation

1. FAI Part Number (and Engineering Part Number) 119A1212-601(119A1212-601_A)				2. Part Name CHANNEL FWD		3. Part S/N K0001	4. FAI Report Number QPI36995
Characteristic Accountability				Inspection / Test Results			
5. Char. No.	6. Reference Location	7. Characteristic Designator	8. Requirement	9. Results	10. Designed Tooling	11. NCR Number	14. Note
N54	Sheet 5[Page: 12]	Standard Note	5SN0000007471/THE 3D GEOMETRY CONTAINED IN THE CATIA DATASET IS MODELED AT FULL SCALE AND AT THE NOMINAL CONDITION.	N/A			Not a requirement to inspect
N55	Sheet 5[Page: 12]	Standard Note	5SN0000007644/BOEING PROPRIETARY - THE INFORMATION CONTAINED HEREIN IS PROPRIETARY TO THE BOEING COMPANY AND SHALL NOT BE REPRODUCED OR DISCLOSED IN WHOLE OR IN PART OR USED FOR ANY PURPOSE EXCEPT WHEN SUCH USER POSSESSES DIRECT, WRITTEN AUTHORIZATION FROM THE BOEING COMPANY.	N/A			Not a requirement to inspect
N56	Sheet 5[Page: 12]	Standard Note	5SN0000008431/SEE PL FOR LIST OF MATERIAL, USAGE AND NOTES.	N/A			Not a requirement to inspect
N57	Sheet 5[Page: 12]	Standard Note	5SN0000007995/THE CATIA DATA SET CONTAINING THE 3D GEOMETRY, DIMENSIONS, TOLERANCES, AND ANNOTATION ALONG WITH ITS RELATED DATA SPECIFY THE COMPLETE PRODUCT DEFINITION.	N/A			Not a requirement to inspect
N58	Sheet 5[Page: 12]	Standard Note	5SN0000009083/NO LICENSE IS REQUIRED FOR THE DISSEMINATION OF THE COMMERCIAL INFORMATION CONTAINED HEREIN TO FOREIGN PERSONS OTHER THAN THOSE FROM OR IN TERRORIST SUPPORTING COUNTRIES IDENTIFIED IN THE EAR. IT IS THE RESPONSIBILITY OF THE INDIVIDUAL IN CONTROL OF THIS DATA TO ABIDE BY U.S. EXPORT LAWS.	N/A			Not a requirement to inspect
N59	Sheet 5[Page: 12]	Standard Note	5SN0000009719/DIMENSIONING AND TOLERANCING PER ASME Y14.5-2009 AND AS AMENDED BY BDS-110.	N/A			Not a requirement to inspect

Form 3 : Characteristic Accountability, Verification and Compatibility Evaluation

1. FAI Part Number (and Engineering Part Number) 119A1212-601(119A1212-601_A)				2. Part Name CHANNEL FWD		3. Part S/N K0001	4. FAI Report Number QPI36995
Characteristic Accountability				Inspection / Test Results			
5. Char. No.	6. Reference Location	7. Characteristic Designator	8. Requirement	9. Results	10. Designed Tooling	11. NCR Number	14. Note
N60	Sheet 5[Page: 12]	Standard Note	5SN0000009732/DATA SET PER ASME Y14.41-2012 AND AS AMENDED BY BDS-600 AND BDS-603.	N/A			Not a requirement to inspect
N61	PL 119A1212-601	CORNER AND FILLET TOLERANCE	ALL CORNER AND FILLET RADII HAVE AN ALLOWABLE TOLERANCE OF PLUS OR MINUS +/- .0300 UNLESS OTHERWISE NOTED.	- .0100 ~ + .0100			
N62	PL 119A1212-601	FINISH - SEQUENCE	1 F-17.31 BORIC ACID-SULFURIC ACID ANODIZE IN ACCORDANCE WITH BAC 5632, CLASS 1 OR CLASS 5 OR CHROMIC ACID ANODIZE AT 22 VOLTS IN ACCORDANCE WITH BAC 5019, CLASS 3 OR CLASS 5.	ACCEPT			CONTROL Load No.: BS160119-01 19 JAN 2016
N63	PL 119A1212-601	FINISH - SEQUENCE	2 F-20.03 APPLY TWO COATS OF BMS 10-11, TYPE I PRIMER IN ACCORDANCE WITH BAC 5736.	See Char. No.N88			
N64	PL 119A1212-601	GRAIN DIRECTION REQUIREMENT	GRAIN DIRECTION CONTROLLED PART. SEE PICTURE SHEET AND/OR CATIA DATASET FOR STOCK ORIENTATION.	See Char. No.N11 - N13			
N65	PL 119A1212-601	NONCONVENTIONAL MACHINING	NONCONVENTIONAL MACHINING TECHNIQUES NOT SPECIFICALLY ALLOWED ARE PROHIBITED.	ACCEPT			
N66	PL 119A1212-601	OPPOSITE PART	119A1212-602 IS OPPOSITE TO 119A1212-601	See Char. No.N52			
N67	PL 119A1212-601	PROCESS SPECIFICATION	BREAK SHARP EDGES PER BAC 5300.	ACCEPT			
N68	PL 119A1212-601	PROCESS SPECIFICATION	MANUFACTURING OPTION - ABRASIVE WATER JET CUTTING PER BAC 5656 IS OPTIONAL TO CONVENTIONAL CUTTING TECHNIQUES.	N/A			Not a requirement to inspect
N69	PL 119A1212-601	PROCESS SPECIFICATION	MANUFACTURING OPTION - ELECTRICAL DISCHARGE MACHINING PER BAC 5969 IS OPTIONAL TO CONVENTIONAL MACHINING TECHNIQUES.	N/A			Not a requirement to inspect

Form 3 : Characteristic Accountability, Verification and Compatibility Evaluation

1. FAI Part Number (and Engineering Part Number) 119A1212-601(119A1212-601_A)				2. Part Name CHANNEL FWD		3. Part S/N K0001	4. FAI Report Number QPI36995
Characteristic Accountability				Inspection / Test Results			
5. Char. No.	6. Reference Location	7. Characteristic Designator	8. Requirement	9. Results	10. Designed Tooling	11. NCR Number	14. Note
N70	PL 119A1212-601	PROCESS SPECIFICATION	MANUFACTURING OPTION - LASER CUTTING PER BAC 5982 IS OPTIONAL TO CONVENTIONAL CUTTING TECHNIQUES.	N/A			Not a requirement to inspect
N71	PL 119A1212-601	PROCESS SPECIFICATION	MANUFACTURING OPTION - THERMAL CUTTING PER BAC 5928 CLASS 1 IS OPTIONAL TO CONVENTIONAL CUTTING TECHNIQUES.	N/A			Not a requirement to inspect
N72	PL 119A1212-601	PROCESS SPECIFICATION	MARK PARTS PER BAC 5307 CODE M	ACCEPT			 19 JAN 2016
N73	PL 119A1212-601	PROCESS SPECIFICATION	PENETRANT INSPECT PER BAC 5423.	See Char. No.N89			
N74	PL 119A1212-601	PROCESS SPECIFICATION	SURFACE ROUGHNESS 125 MICROINCHES RA ALL MACHINED SURFACES PER BACD2097.	MAX RA 76			
N75	PL 119A1212-601	PROCESS SPECIFICATION	TEMPORARY PROTECTION IN ACCORDANCE WITH BAC 5034 IS REQUIRED DURING HANDLING, TRANSPORTATION AND STORAGE.	ACCEPT			
N76	PL 119A1212-601	STANDARD NOTE - MBD TOLERANCE	UNLESS OTHERWISE NOTED WITHIN THE 3D MBD CATIA DATASET, THE LOCATION OF ALL PART FEATURES ARE SUBJECT TO A SURFACE PROFILE TOLERANCE OF .0200 WITH RESPECT TO THE PRIMARY DATUM, SECONDARY DATUM, AND TERTIARY DATUM.	.0005 ~ .0180	CMM Program no: 119A1212-601_1.DMS		PAGE9~29:PNT048-PNT209 (MAX PNT101)
N77	PL 119A1212-601	THICKNESS TOLERANCE	TOLERANCE OF ALL PART THICKNESSES +/- .0100 EXCEPT AS NOTED.	-.0005 ~ +.0039			
N78	PL 119A1212-601	DIMENSIONAL REQUIREMENT	AS ROLLED ST DIMENSION SHALL NOT EXCEED 8.5 INCHES.	See Char. No. N12			
N79	PL 119A1212-601	DIMENSIONAL REQUIREMENT-3	STOCK SIZE DOES NOT INCLUDE MANUFACTURING OR TOOLING EXCESS.	ACCEPT			

Form 3 : Characteristic Accountability, Verification and Compatibility Evaluation

1. FAI Part Number (and Engineering Part Number)				2. Part Name		3. Part S/N	4. FAI Report Number
119A1212-601(119A1212-601_A)				CHANNEL FWD		K0001	QPI36995
Characteristic Accountability				Inspection / Test Results			
5. Char. No.	6. Reference Location	7. Characteristic Designator	8. Requirement	9. Results	10. Designed Tooling	11. NCR Number	14. Note
N80	PL 119A1212-601	STOCK SIZE CONTROL - MANUFACTURING EXCESS	NO MANUFACTURING EXCESS LIMITATION IN L AND LT DIRECTIONS.	See Char. No. N11, N13			
N81	PL 119A1212-601	STANDARD NOTES	SURFACE ROUGHNESS INTERPRETATION PER BACD2097.	See Char. No. N74			
N82	PL 119A1212-601	STANDARD NOTES	UNLESS OTHERWISE SPECIFIED, DIMENSIONS ARE IN INCHES.	ACCEPT			
N83	PL 119A1212-601	STANDARD NOTES	SEE THE DRAWING SHEET OR 3D DATASET FOR DIMENSIONING AND TOLERANCING REQUIREMENTS.	N/A			Not a requirement to inspect
N84	PL 119A1212-601	STANDARD NOTES	UNLESS OTHERWISE SPECIFIED, RIVET & BOLT EDGE MARGINS PLUS OR MINUS .05.	N/A			Not a requirement to inspect
N85	PL 119A1212-601	STANDARD NOTES	UNLESS OTHERWISE SPECIFIED, BEND RADII SHALL BE PLUS OR MINUS .01 INCH ON MATERIAL THICKNESS BELOW .06 INCH AND PLUS OR MINUS .03 ON MATERIAL THICKNESS GREATER THAN .06 INCH.	N/A			Not a requirement to inspect
N86	PL 119A1212-601	STANDARD NOTES	UNLESS OTHERWISE SPECIFIED, SHEET METAL CORNER RADII SHALL BE .16 INCH TO .19 INCH ON INTERNAL RADII AND .00 INCH TO .25 INCH ON EXTERNAL RADII.	N/A			Not a requirement to inspect
N87	PL 119A1212-601	STANDARD NOTES	DIMENSIONS AND SURFACE TEXTURE DESIGNATIONS APPLY BEFORE PLATING OR FINISH COATING UNLESS OTHERWISE NOTED.	ACCEPT			
N88	BAC5736	BMS 10-11 TY1	Paint Thickness 0.8~1.6 MILS_(2)Coat	0.95~1.51 MILS			CONTROL Load No.: PC160119-02
N89	BAC 5423, BSS 7039		PENETRANT INSPECT PER BAC 5423, BSS 7039	ACCEPT			CONTROL Load No.: PT160119-01

Form 3 : Characteristic Accountability, Verification and Compatibility Evaluation

1. FAI Part Number (and Engineering Part Number)				2. Part Name		3. Part S/N	4. FAI Report Number
119A1212-601(119A1212-601_A)				CHANNEL FWD		K0001	QPI36995
Characteristic Accountability				Inspection / Test Results			
5. Char. No.	6. Reference Location	7. Characteristic Designator	8. Requirement	9. Results	10. Designed Tooling	11. NCR Number	14. Note
N90	COP 119A1212-601_Rev_New.ppt		COP 1) FABRICATE PER ENGINEERING DATASET EXCEPT OMIT (2) .2500/.2540 DIA HOLES C/T REAR SPAR WEB Identify the applicable characteristic(s) on IP or COP sketch with Char. No., and record the page number in Block 6.	ACCEPT			
N91	COP 119A1212-601_Rev_New.ppt		COP 2) DRILL (1) .0980/.1040 DIA HOLES (P/H). Identify the applicable characteristic(s) on IP or COP sketch with Char. No., and record the page number in Block 6.	See Char. No.N4, N5			
N92	COP 119A1212-601_Rev_New.ppt		COP 3) DRILL (2) .1280/.1340 DIA HOLES (P/H). Identify the applicable characteristic(s) on IP or COP sketch with Char. No., and record the page number in Block 6.	See Char. No. N6, N7, N8, N9			
N93	COP 119A1212-601_Rev_New.ppt		COP 4) DRILL (2) .2500/.2540 DIA HOLES (P/H). TRUP / .0140M A B C Identify the applicable characteristic(s) on IP or COP sketch with Char. No., and record the page number in Block 6.	(2) ϕ .2500 ~ ϕ .2501 .0012 ~ .0015	CMM Program no: 119A1212-601_1.DMS		PAGE8:CIRCLE_001-CIRCLE_002

Form 3 : Characteristic Accountability, Verification and Compatibility Evaluation

1. FAI Part Number (and Engineering Part Number) 119A1212-601(119A1212-601_A)				2. Part Name CHANNEL FWD		3. Part S/N K0001	4. FAI Report Number QPI36995
Characteristic Accountability				Inspection / Test Results			
5. Char. No.	6. Reference Location	7. Characteristic Designator	8. Requirement	9. Results	10. Designed Tooling	11. NCR Number	14. Note
The signature indicates that all characteristics are accounted for; meet drawing requirements or are properly documented for disposition. 12. Prepared By J. W. Kim (NDT 1307) 13. Date 26 JAN 2016 B.W. SAM					14a. Attachments: ☒ 119A1212-601 IP ☒ 119A1212-601 PL ☒ 119A1212-601 COP ☒ 119A1212-601 CHM ☐ ☐ ☐ ☐		

01 FEB 2016

IP-NO: IP_119A1212-601-A_00

INSPECTION PLAN SHEET 1

PAGE 1 OF 11

PROJECT: 21 PART NO.: 119A1212-601

REV.: A PREPARED BY: YJS

DATE: 151116

IP REV.: 00

MBD/CATIA SOURCE: 119A1212-601-A.Catpart

PART NAME: CHANNEL FWD

TQA Concur.

Checker

SHYang2015-11-17

Approval

HJLee2015-11-17

INSPECTION METHOD: 2 & 6

1)MYLAR 2)P_CMM 3)MOI 4)M_CMM
5)OPTICS 6)CONVENTIONAL

7)OTHERS

COMMENTS/INSTRUCTIONS: 지침서상세

1. Please view MBD/CATIA file to verify source dataset, If applied project. (모든 기준자료는 /CATIA Source 파일을 참조 하세요. 적용사업에
2. If inspection characteristics cannot be fully verified or inspected by specified MOI tooling, inform to Quality planning or tooling Q.A.(MOI에 의한 확인불가 요건에 대해서는 사업담당 QP 또는 TQA에게 통보 바랍니다.)

3. Program_CMM

- Flatness / .0100 (1PLS)
- True Position / .0140M A B C (4X Φ .2500 - .2540)
- True Position / .0140M A B C (Φ .0980 - .1040)
- True Position / .0280M A B C (2X Φ .1280 - .1340)
- Profile Surface Profile / .0100 A B C (5Surface)
- EOP(End of Part)


4.Other Dimension: Conventional Gauge

- ☒ ECCN
- ☒ ECCN=9E991
- ☒ Approval Status
- ☒ Repository= ngp1_ENOVIA_SOUTH
- ☒ Document Rev=119A1212-601--A
- ☒ Status=Approved
- ☒ Status Date`=4-10-2015
- ☒ Annotation Set.1
- ☒ Captures
- ☒ Engineering Definition Release
- ☒ All Annotations
- ☒ Primary Datums
- ☒ GD&T
- ☒ Grain Direction
- ☒ Revision Description
- ☒ Views
- ☒ Datums
- ☒ Reference Frames
- ☒ Geometrical Tolerances
 - ☒ Flatness.1
 - ☒ Position.1
 - ☒ Position.2
 - ☒ Position.3
 - ☒ Position.4
 - ☒ Position surfacic profile.1
- ☒ Dimensions

QPI 36995 Attachment



26 JAN 2016

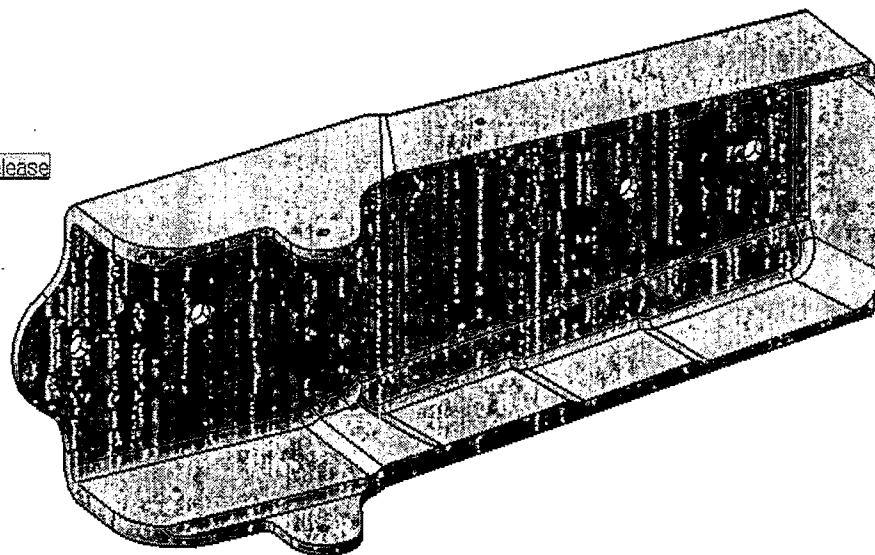

KOREAN AIR

PIA 119A 2200

REV: A

DESCRIPTION:

1. ADDD (QTY 2) OUTBO .2500 DIA HOLES ON WCB OF CHANNELS.
2. PILOT HOLE DIA. REVISED TO #40 FROM #20 (G.Y 1)


REASON: BASIC RELEASE - SUPPLEMENTAL
REVISED TO PART FOR MBMT APPROVAL: 119A1212-601 REV --

PROD INFO: AIRPLANE/PARTS MUST COMPLY


MFG INFO:

GRF 526U

V. BJRDEITE, 425 717-0654, 4/1/2015

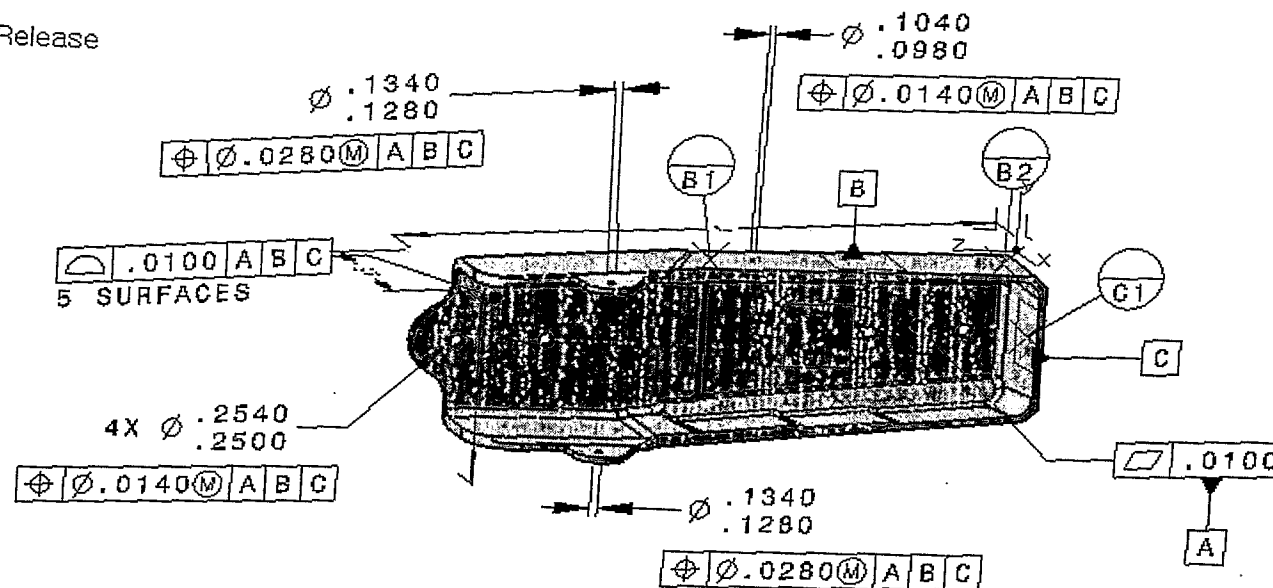

- Part Notes:
- Standard Notes:
- ECCN
 - ECCN=9E991
- Approval Status
 - Repository= ngp1_ENOVIA_SOUTH
 - `Document Rev`=119A1212-601 --A
 - Status=Approved
 - `Status Date`=4-10-2015
- Annotation Set.1
 - Captures
 - Engineering Definition Release
 - All Annotations
 - Primary Datums
 - GD&T
 - Grain Direction
 - Revision Description
 - Views
 - Datums
 - Reference Frames
 - Geometrical Tolerances
 - Flatness.1
 - Position.1
 - Position.2
 - Position.3
 - Position.4
 - Position surfacic profile.1
 - Dimensions

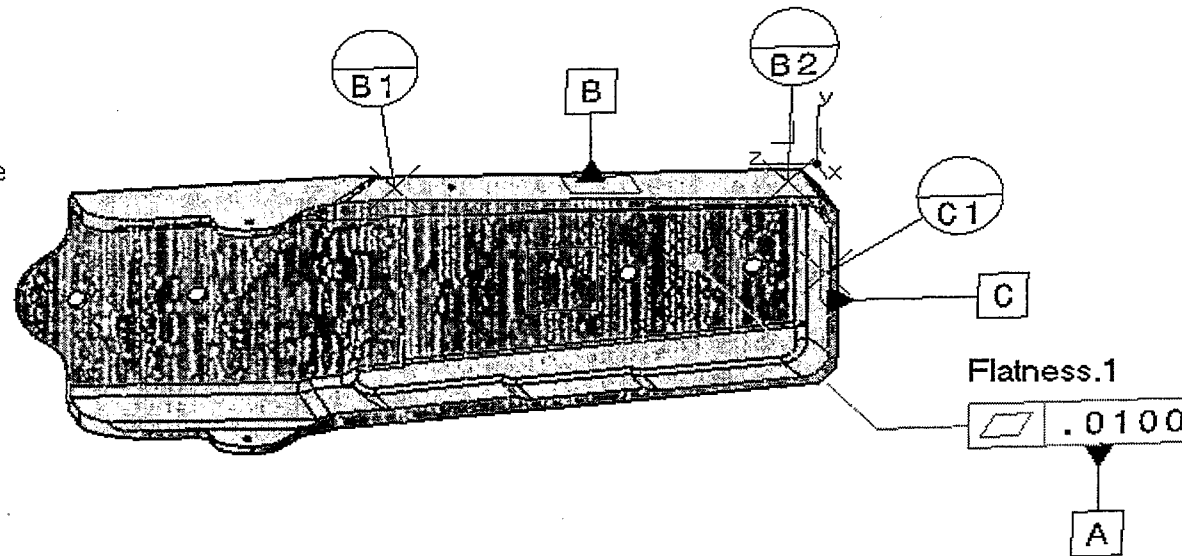

- Document Rev`=119A1212-601 --A
- Status=Approved
- Status Date`=4-10-2015

Annotation Set.1

Captures

- Engineering Definition Release
- All Annotations
- Primary Datums
- GD&T
- Grain Direction
- Revision Description

Views

Datums


Reference Frames

Geometrical Tolerances


- Flatness.1
- Position.1
- Position.2
- Position.3
- Position.4
- Position surfacic profile.1

Dimensions

- Linear Size.1
- Linear Size.2
- Linear Size.3
- Linear Size.4
- Dimension.1
- Dimension.2

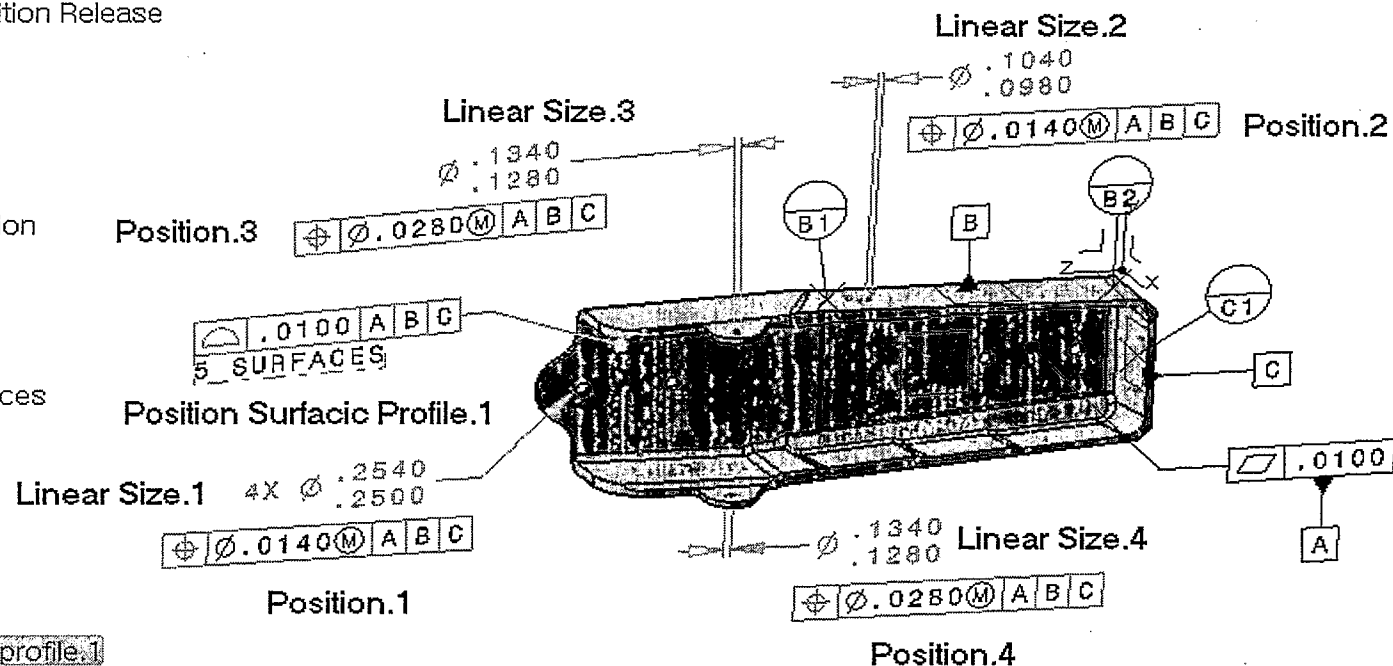

- Annotation Set.1
 - Captures
 - Engineering Definition Release
 - All Annotations
 - Primary Datums
 - GD&T
 - Grain Direction
 - Revision Description
 - Views
 - Datums
 - Reference Frames
 - Geometrical Tolerances
 - Flatness.1
 - Position.1
 - Position.2
 - Position.3
 - Position.4
 - Position surfacic profile.1
 - Dimensions
 - Linear Size.1
 - Linear Size.2
 - Linear Size.3
 - Linear Size.4
 - Dimension.1
 - Dimension.2
 - Dimension.3
 - ABC Notes
- Publication

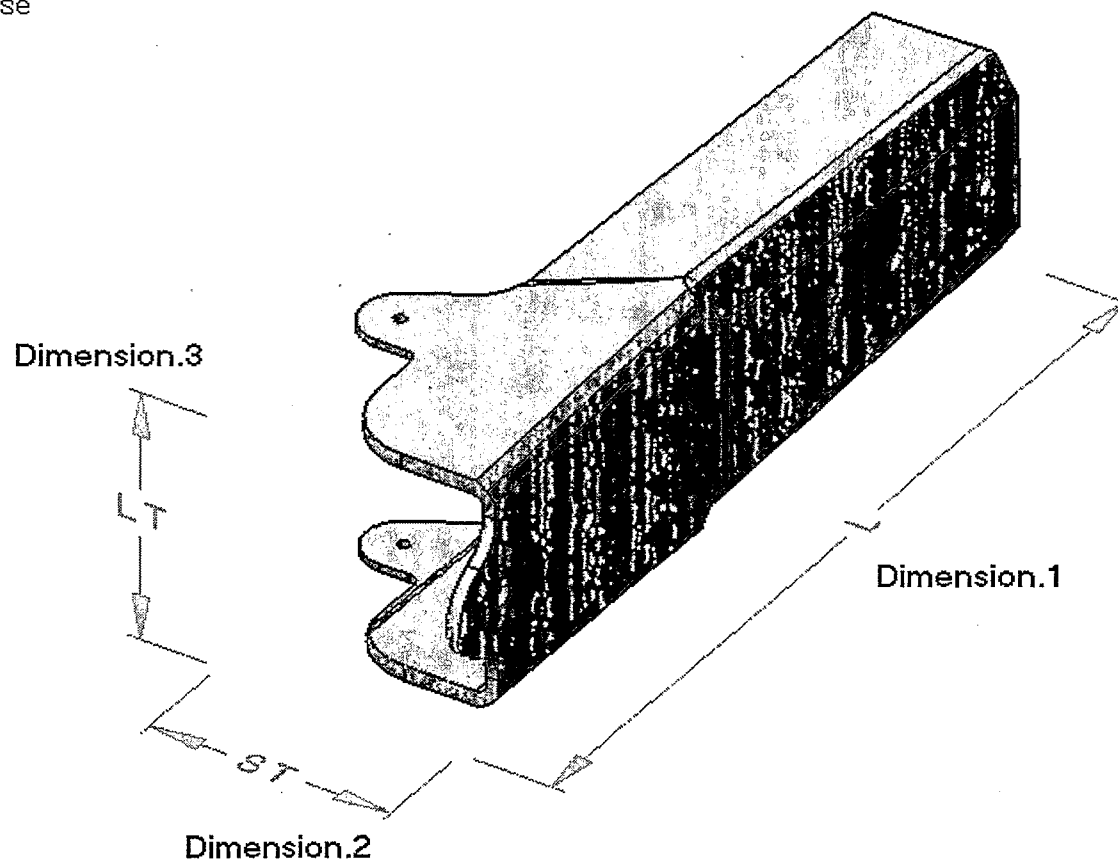

- Annotation Set.1
 - Captures
 - Engineering Definition Release
 - All Annotations
 - Primary Datums
 - GD&T
 - Grain Direction
 - Revision Description

- Views
- Datums
- Reference Frames
- Geometrical Tolerances
 - Flatness.1
 - Position.1
 - Position.2
 - Position.3
 - Position.4
 - Position surfacic profile.1

- Dimensions
 - Linear Size.1
 - Linear Size.2
 - Linear Size.3
 - Linear Size.4
 - Dimension.1
 - Dimension.2
 - Dimension.3

- Notes
 - Text.1 (PIN 1191-2200...)

Text.1

PIN 1191-2200

REV: A

DESCRIPTION:

1. ADDED (QTY 2) OUTBD .2500-DIA HOLES ON WEB OF CHANNELS.
2. PILOT HOLE DIA. REVISED TO #40 FROM #30 (QTY 1)


REASON: BASIC RELEASE - SUPPLEMENTAL


SIMILAR TO PART FOR NBMT APPROVAL: 119A1212-601 REV ..


PROD INFO: AIRPLANE/PARTS MUST COMPLY**MFG INFO:**


GRP 526D


M. BURDETTE, 425-717-0554, 4/1/2015

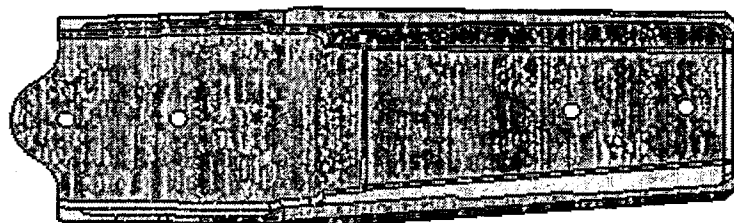


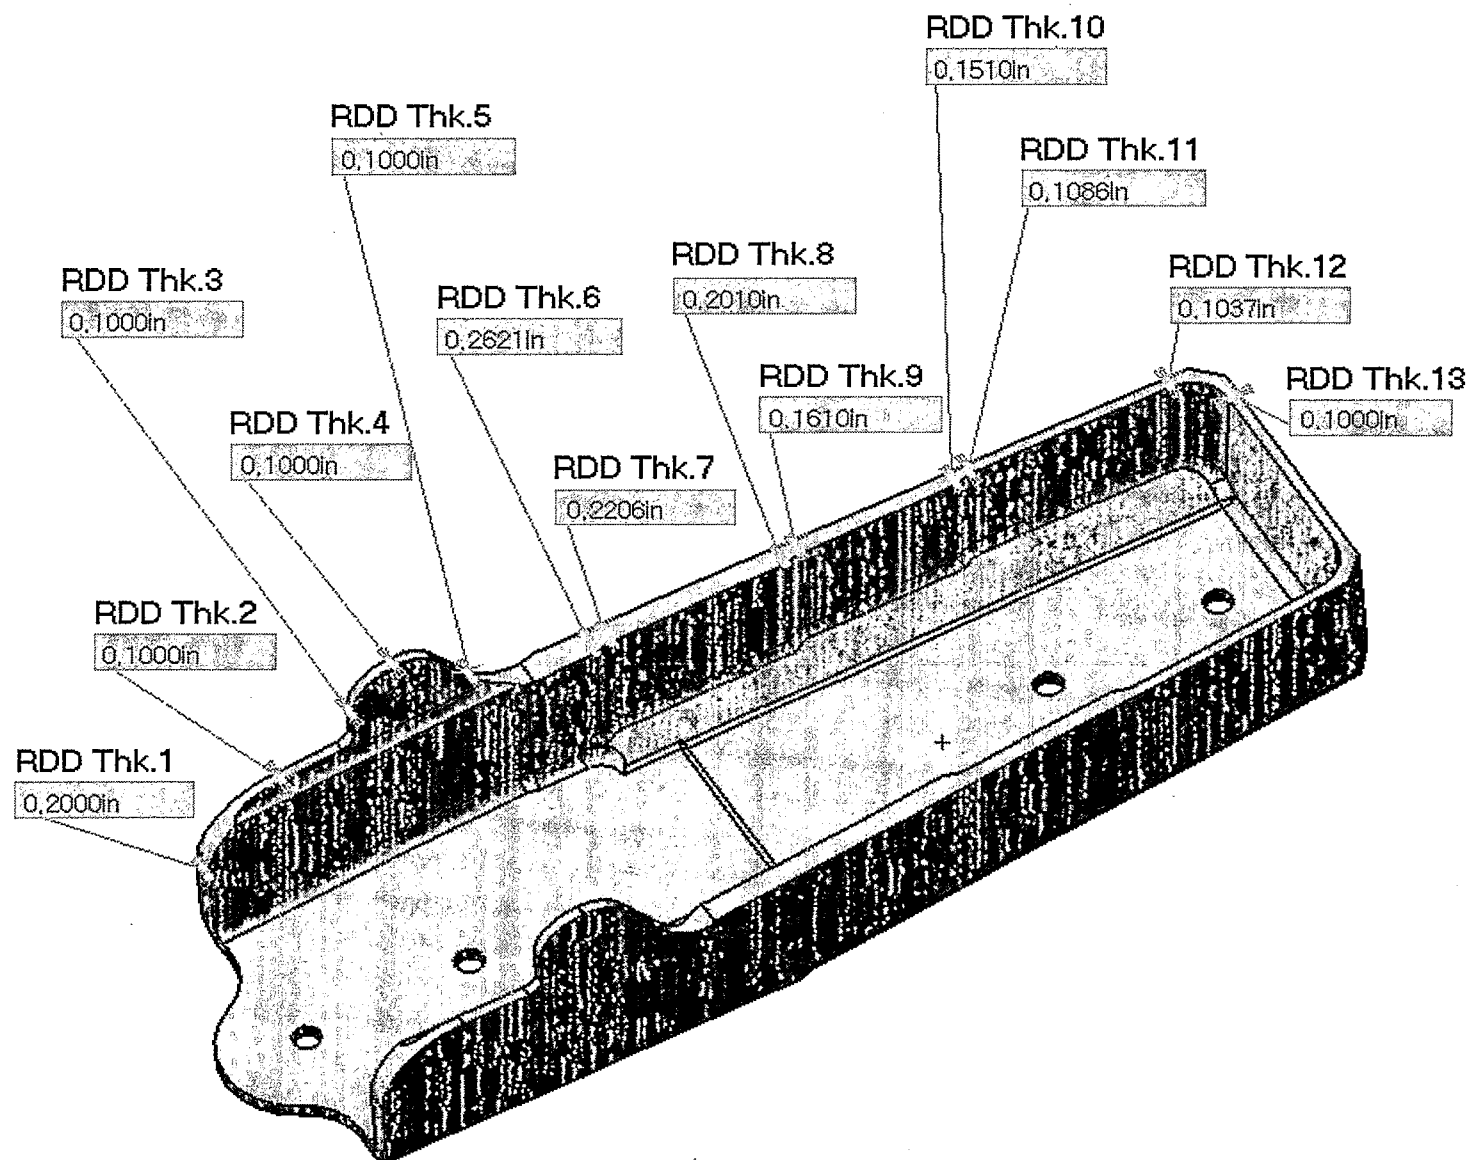

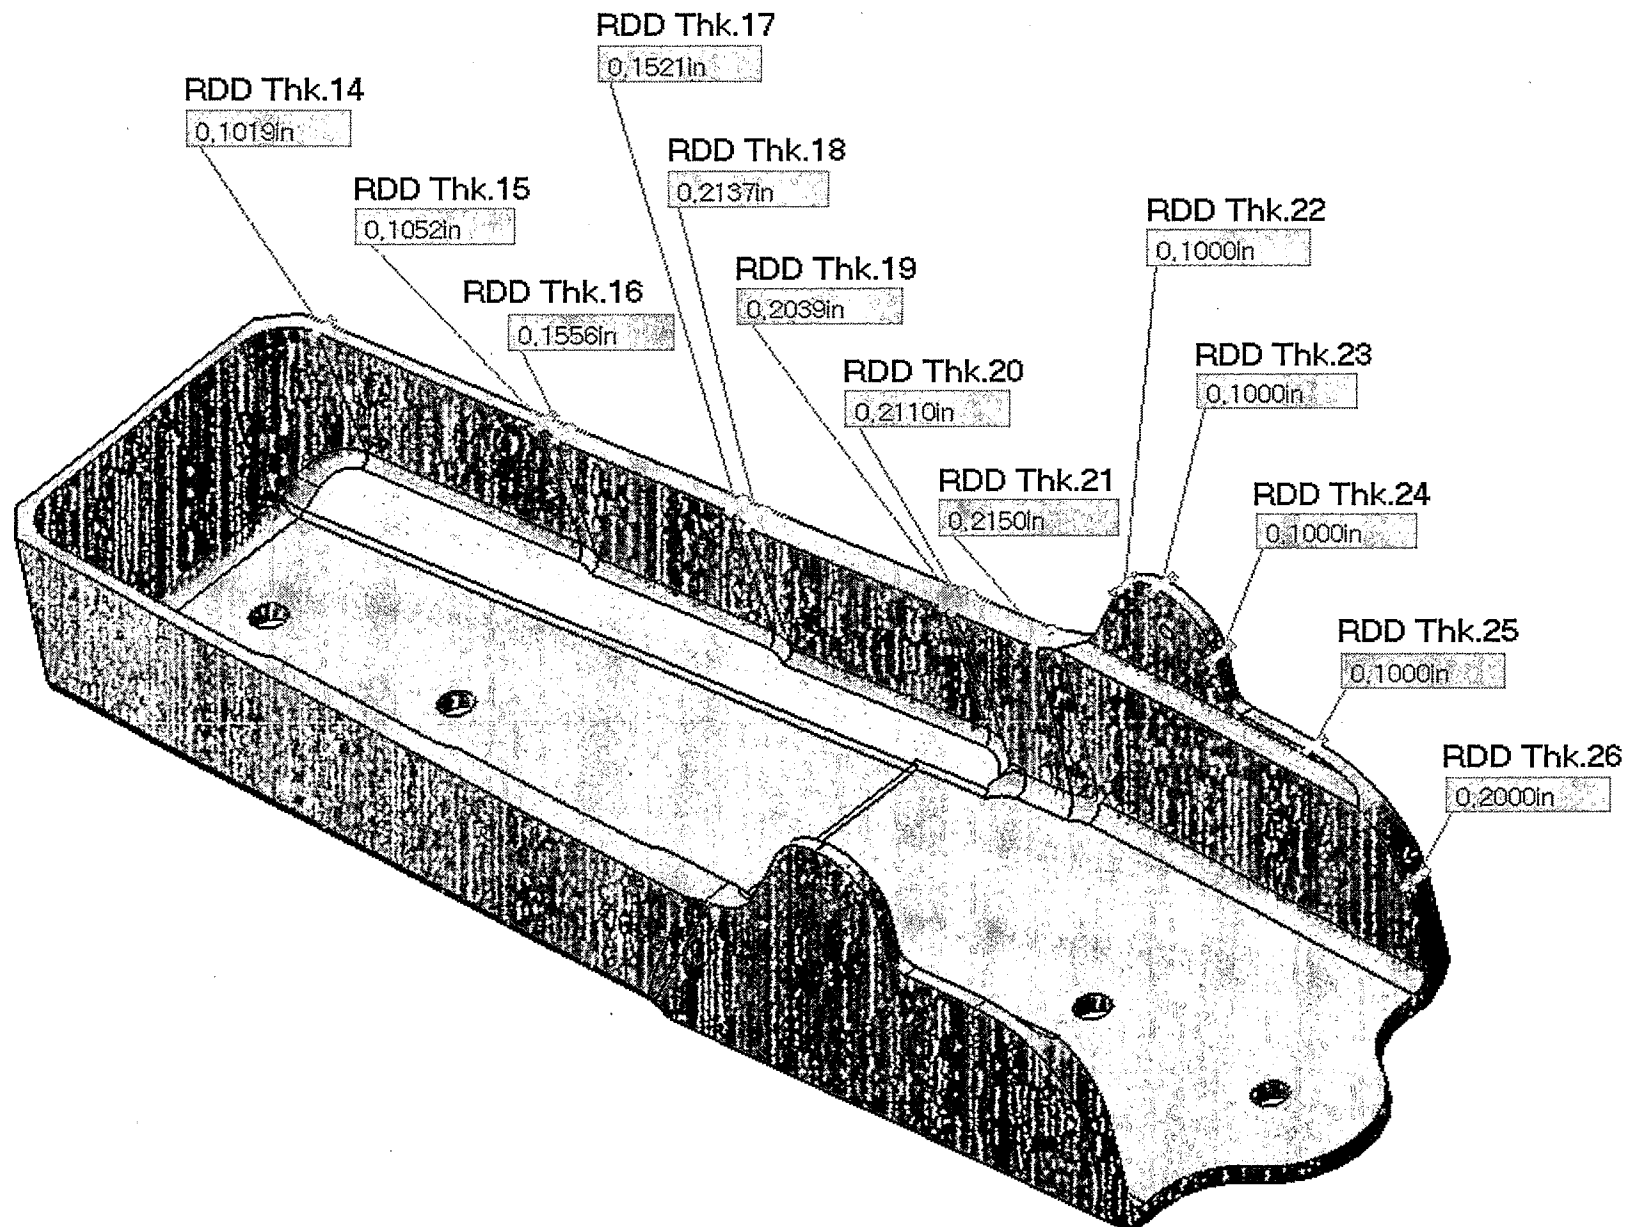

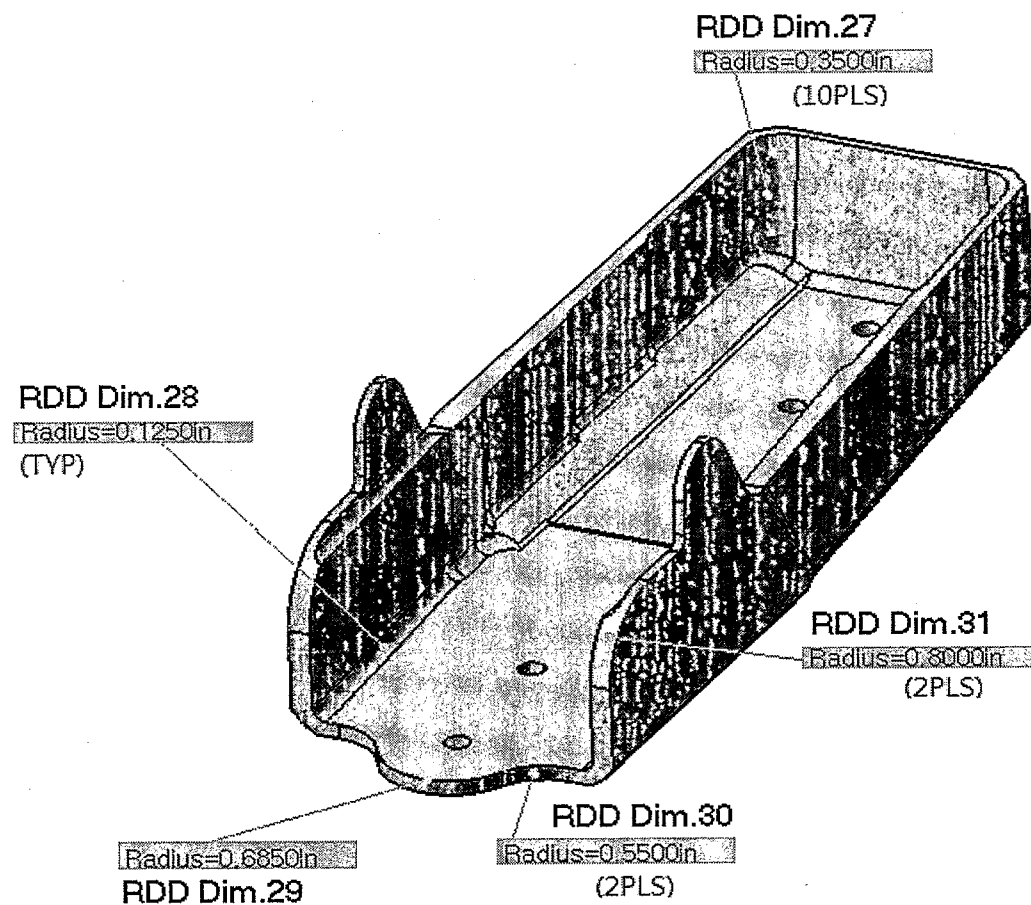

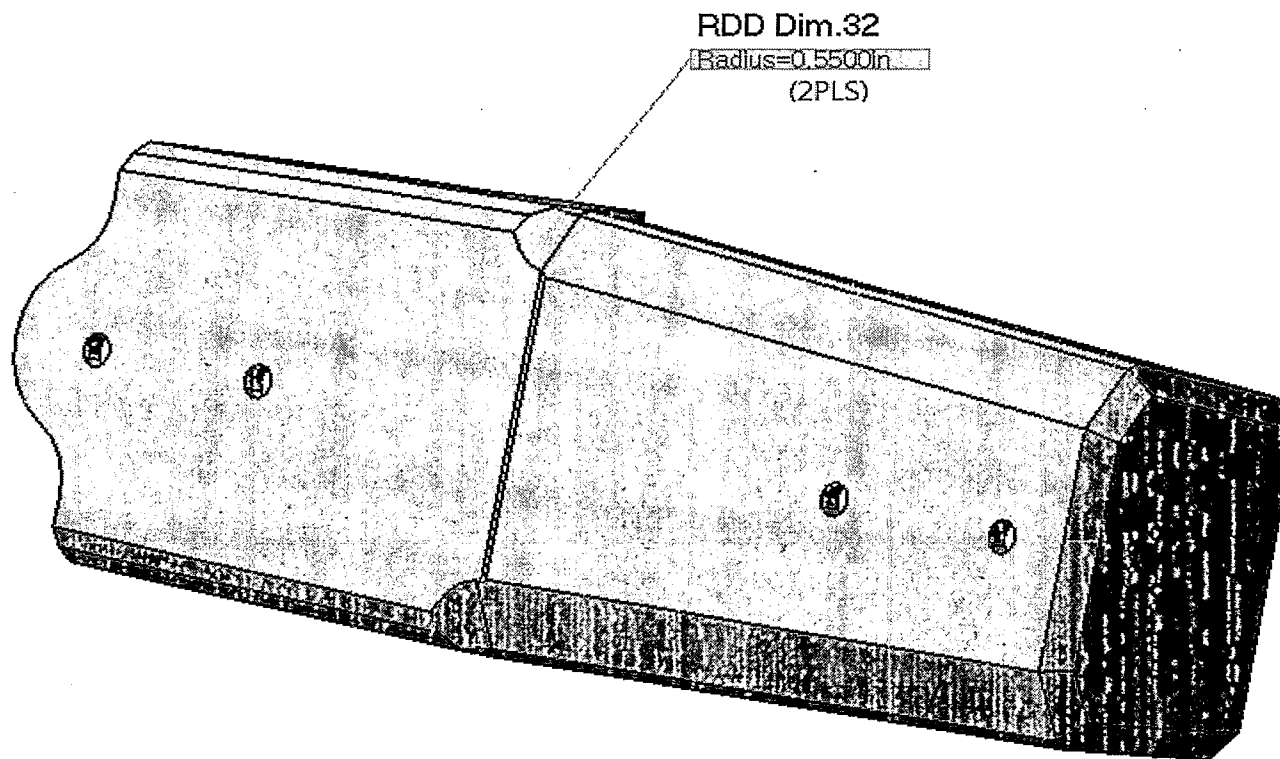

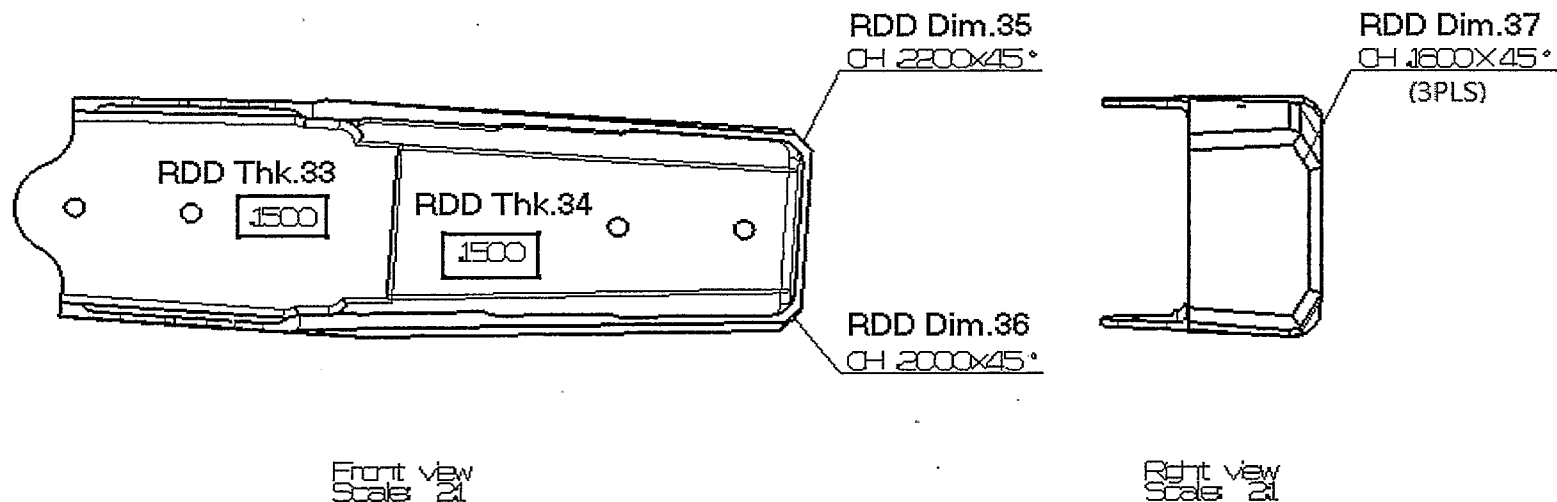

MBD Notes

IP-No : IP_119A1212-601-A_00

IP-SRC: SHEET 5 PAGE: 12 OF 12

FAI Report Number: QP136995

- N52 Part Notes 5SN0000008414 119A1212-602 IS AN EXACT OPPOSITE OF 119A1212-601. THE PART AUTHORITY DEFINITION RESIDES IN 119A1212-601 AND IS APPLICABLE TO THE PRIME AND OPPOSITE PARTS. | URL
- N53 Standard Notes 5SN0000007452 THE BOEING COMPANY, BOEING COMMERCIAL AIRPLANES, SEATTLE, WASHINGTON 98124
- N54 Standard Notes 5SN0000007471 THE 3D GEOMETRY CONTAINED IN THE CATIA DATASET IS MODELED AT FULL SCALE AND AT THE NOMINAL CONDITION.
- N55 Standard Notes 5SN0000007644 BOEING PROPRIETARY - THE INFORMATION CONTAINED HEREIN IS PROPRIETARY TO THE BOEING COMPANY AND SHALL NOT BE REPRODUCED OR DISCLOSED IN WHOLE OR IN PART OR USED FOR ANY PURPOSE EXCEPT WHEN SUCH USER POSSESSES DIRECT, WRITTEN AUTHORIZATION FROM THE BOEING COMPANY.
- N56 Standard Notes 5SN0000008431 SEE PL FOR LIST OF MATERIAL, USAGE AND NOTES.
- N57 Standard Notes 5SN0000007995 THE CATIA DATA SET CONTAINING THE 3D GEOMETRY, DIMENSIONS, TOLERANCES, AND ANNOTATION ALONG WITH ITS RELATED DATA SPECIFY THE COMPLETE PRODUCT DEFINITION.
- N58 Standard Notes 5SN0000009083 NO LICENSE IS REQUIRED FOR THE DISSEMINATION OF THE COMMERCIAL INFORMATION CONTAINED HEREIN TO FOREIGN PERSONS OTHER THAN THOSE FROM OR IN TERRORIST SUPPORTING COUNTRIES IDENTIFIED IN THE EAR. IT IS THE RESPONSIBILITY OF THE INDIVIDUAL IN CONTROL OF THIS DATA TO ABIDE BY U.S. EXPORT LAWS.
- N59 Standard Notes 5SN0000009719 DIMENSIONING AND TOLERANCING PER ASME Y14.5-2009 AND AS AMENDED BY BDS-110.
- N60 Standard Notes 5SN0000009732 DATA SET PER ASME Y14.41-2012 AND AS AMENDED BY BDS-600 AND BDS-603.

PARTS LIST	BOEING	CORPORATE OFFICES SEATTLE, WA 98124	EXPORT CONTROL COM	CAGE 81205	NUMBER 119A1212-601	REV B	SHEET 1 of 4
LIST TITLE CHANNEL FWD					MODEL	CONTRACT NUMBER	
						DATE 04-10-2015	

THE PARTS LIST IN THIS REPORT SUPERSEDES THE DRAWING SHEET PARTS LIST FOR THIS PART

OWNER WING, D. CAMPBELL, 425-919-8326

PIN/ITEM 1191-2200

QPI36995 Attachment

Char No. N61~N89

NDT 1307

26 JAN 201

REVISIONS						
REV	REVISION DESCRIPTION	APPROVED DATE	CHANGE NUMBER	PHASE	CLASS	
B	ADDED GAUGE NOTE, RADIUS NOTE, AND DATUM NOTE. SIMILAR TO PART FOR NEMT APPROVAL: 119A1212-601 REV A. SEE THE HMBD DATASET REVISION DESCRIPTION CAPTURE FOR DESCRIPTION OF CHANGE. REASON: BASIC RELEASE - SUPPLEMENTAL. PROD INFO: NA. MFG INFO: M. BURDETTE, 425-717-0554, GRP 526D. CHNG RESP: D. CAMPBELL, 425-919-8326.	04-10-2015	PIN 1C999	1191-2200	PRODUCTION	

PART SPECIFIC DATA	
NOTE TITLE	NOTE DESCRIPTION
CORNER AND FILLET TOLERANCE	N61 ALL CORNER AND FILLET RADII HAVE AN ALLOWABLE TOLERANCE OF PLUS OR MINUS .0300 UNLESS OTHERWISE NOTED.
DATASET FILENAME	119A1212-601
DATUM CONTROL	UNLESS OTHERWISE SPECIFIED IN A FEATURE CONTROL FRAME, DATUM A IS PRIMARY, DATUM B IS SECONDARY, AND DATUM C IS TERTIARY.
FINISH - SEQUENCE 1	N62 F-17.31 BORIC ACID-SULFURIC ACID ANODIZE IN ACCORDANCE WITH BAC 5632, CLASS 1 OR CLASS 5 OR CHROMIC ACID ANODIZE AT 22 VOLTS IN ACCORDANCE WITH BAC 5019, CLASS 3 OR CLASS 5.
FINISH - SEQUENCE 2	N63 F-20.03 APPLY TWO COATS OF BMS 10-11, TYPE I PRIMER IN ACCORDANCE WITH BAC 5736.
GRAIN DIRECTION REQUIREMENT	N64 GRAIN DIRECTION CONTROLLED PART. SEE PICTURE SHEET AND/OR CATIA DATASET FOR STOCK ORIENTATION.

(CONTINUED ON NEXT PAGE)

BOEING PROPRIETARY - SEE STANDARD NOTES FOR RESTRICTIONS ON DATA USE OR DISCLOSURE

PARTS LIST	BOEING		CORPORATE OFFICES SEATTLE, WA 98124	EXPORT CONTROL COM	CAGE 81205	NUMBER 119A1212-601	REV B	SHEET 2 of 4
LIST TITLE CHANNEL FWD						MODEL	CONTRACT NUMBER	
							DATE 04-10-2015	
(CONTINUED FROM PRECEDING PAGE)								
NOTE TITLE			NOTE DESCRIPTION					
MATERIAL IDENTIFIER AND TEST REQUIREMENTS CODE			C9200-002-N0					
NO LICENSE REQUIRED EAR DATA NOTE			NO LICENSE IS REQUIRED FOR THE DISSEMINATION OF THE COMMERCIAL INFORMATION CONTAINED HEREIN TO FOREIGN PERSONS OTHER THAN THOSE FROM OR IN TERRORIST SUPPORTING COUNTRIES IDENTIFIED IN THE EAR. IT IS THE RESPONSIBILITY OF THE INDIVIDUAL IN CONTROL OF THIS DATA TO ABIDE BY U.S. EXPORT LAWS.					
NO LICENSE REQUIRED ECCN			THE EXPORT CONTROL VALUE OF THIS OBJECT IS ECCN VALUE 9B991 AND HAS BEEN MARKED COM FOR PURPOSES OF EAR ACCESS CONTROL.					
NONCONVENTIONAL MACHINING			N65 NONCONVENTIONAL MACHINING TECHNIQUES NOT SPECIFICALLY ALLOWED ARE PROHIBITED.					
OPPOSITE PART			N66 119A1212-602 IS OPPOSITE TO 119A1212-601					
PROCESS SPECIFICATION			N67 BREAK SHARP EDGES PER BAC 5300.					
PROCESS SPECIFICATION			N68 MANUFACTURING OPTION - ABRASIVE WATER JET CUTTING PER HAC 5656 IS OPTIONAL TO CONVENTIONAL CUTTING TECHNIQUES.					
PROCESS SPECIFICATION			N69 MANUFACTURING OPTION - ELECTRICAL DISCHARGE MACHINING PER BAC 5969 IS OPTIONAL TO CONVENTIONAL MACHINING TECHNIQUES.					
PROCESS SPECIFICATION			N70 MANUFACTURING OPTION - LASER CUTTING PER BAC 5982 IS OPTIONAL TO CONVENTIONAL CUTTING TECHNIQUES.					
PROCESS SPECIFICATION			N71 MANUFACTURING OPTION - THERMAL CUTTING PER BAC 5928 CLASS 1 IS OPTIONAL TO CONVENTIONAL CUTTING TECHNIQUES.					
PROCESS SPECIFICATION			N72 MARK PARTS PER BAC 5307 CODE M					
PROCESS SPECIFICATION			N73 PENETRANT INSPECT PER BAC 5423.					
PROCESS SPECIFICATION			N74 SURFACE ROUGHNESS 125 MICROINCHES RA ALL MACHINED SURFACES PER BACD2097.					
PROCESS SPECIFICATION			N75 TEMPORARY PROTECTION IN ACCORDANCE WITH BAC 5034 IS REQUIRED DURING HANDLING, TRANSPORTATION AND STORAGE.					
STANDARD NOTE - MBD TOLERANCE			N76 UNLESS OTHERWISE NOTED WITHIN THE 3D MBD CATIA DATASET, THE LOCATION OF ALL PART FEATURES					
(CONTINUED ON NEXT PAGE)								
BOEING PROPRIETARY - SEE STANDARD NOTES FOR RESTRICTIONS ON DATA USE OR DISCLOSURE								

PARTS LIST	BOEING	CORPORATE OFFICES SEATTLE, WA 98124	EXPORT CONTROL COM	CAGE 81205	NUMBER 119A1212-601	REV E	SHEET 3 OF 4
LIST TITLE CHANNEL END					MODEL	CONTRACT NUMBER	
						DATE 04-10-2015	

(CONTINUED FROM PRECEDING PAGE)

NOTE TITLE

NOTE DESCRIPTION

ARE SUBJECT TO A SURFACE PROFILE TOLERANCE OF .0200 WITH RESPECT TO THE PRIMARY DATUM, SECONDARY DATUM, AND TERTIARY DATUM.

STORAGE REPOSITORY

DATASET IS STORED IN THE DATABASE REPOSITORY BCA 737 ENOVIA

THICKNESS TOLERANCE

N77

TOLERANCE OF ALL PART THICKNESSES +/- .0100 EXCEPT AS NOTED.

COMPONENTS

QTY REQD	PART OR IDENTIFYING NUMBER	DESCRIPTION	NOTE TITLE	NOTE DESCRIPTION
1	MAC06W	ALUMINUM ALLOY PLATE, SEE RM PL REPORT FOR COMPLETE DEFINITION.	DIMENSIONAL REQUIREMENT	N78 AS ROLLED ST DIMENSION SHALL NOT EXCEED 8.5 INCHES.
			N79 DIMENSIONAL REQUIREMENT - 3	STOCK SIZE DOES NOT INCLUDE MANUFACTURING OR TOOLING EXCESS.
			LONGITUDINAL	10.5
			LONG TRANSVERSE	3.4
			SHORT TRANSVERSE	2.9
			N80 STOCK SIZE CONTROL - MANUFACTURING EXCESS	NO MANUFACTURING EXCESS LIMITATION IN L AND LT DIRECTIONS.

PARENTHESIS () INDICATES SUBSTITUTE PART

BOEING PROPRIETARY - SEE STANDARD NOTES FOR RESTRICTIONS ON DATA USE OR DISCLOSURE

PARTS LIST	BOEING	CORPORATE OFFICES SEATTLE, WA 98124	EXPORT CONTROL COM	CAGE 81205	NUMBER 119A1212-601	REV E	SHEET 4 OF 4
LIST TITLE CHANNEL FWT					MODEL	CONTRACT NUMBER	
						DATE 04-10-2015	

STANDARD NOTES

NOTICE - THE INFORMATION CONTAINED HEREIN IS PROPRIETARY TO THE BOEING COMPANY AND SHALL NOT BE REPRODUCED OR DISCLOSED IN WHOLE OR IN PART OR USED FOR ANY PURPOSE EXCEPT WHEN SUCH USER POSSESSES DIRECT, WRITTEN AUTHORIZATION FROM THE BOEING COMPANY.

MATERIALS, PART & PROCESS SUBSTITUTION AND EQUIVALENTS PER 65B88700 (747), 012T2100 (767), 012W6100 (777), 012W6101 (LIAISON) AND 65-88700 (ALL OTHERS).

FASTENER SYMBOL CODES PER BACD2074. INSTALL PER BAC5004 AND BAC5047 (FLUID TIGHT).

SURFACE ROUGHNESS INTERPRETATION PER BACD2097. **N81**

UNLESS OTHERWISE SPECIFIED, DIMENSIONS ARE IN INCHES. **N82**

SEE THE DRAWING SHEET OR 3D DATASET FOR DIMENSIONING AND TOLERANCING REQUIREMENTS. **N83**

UNLESS OTHERWISE SPECIFIED, RIVET & BOLT EDGE MARGINS PLUS OR MINUS .05. **N84**

UNLESS OTHERWISE SPECIFIED, BEND RADII SHALL BE PLUS OR MINUS .01 INCH ON MATERIAL THICKNESS BELOW .06 INCH AND PLUS OR MINUS .03 ON MATERIAL THICKNESS GREATER THAN .06 INCH. **N85**

UNLESS OTHERWISE SPECIFIED, SHEET METAL CORNER RADII SHALL BE .16 INCH TO .19 INCH ON INTERNAL RADII AND .00 INCH TO .25 INCH ON EXTERNAL RADII. **N86**

DIMENSIONS AND SURFACE TEXTURE DESIGNATIONS APPLY BEFORE PLATING OR FINISH COATING UNLESS OTHERWISE NOTED. **N87**

UNLESS OTHERWISE SPECIFIED, FABRICATION, ASSEMBLY, AND INSTALLATION SHALL CONFORM TO THE FOLLOWING:

BAC5009 FOR INSTALLATION OF BOLTS AND NUTS.

BAC5300 TO FORM, PUNCH, STRAIGHTEN, BREAK SHARP EDGES AND FIT METAL PARTS.

BAC5307 FOR PART MARKING.

BAC5602 FOR HEAT TREAT OF ALUMINUM ALLOYS.

Part No : 119A1212-601,-602	PSS No & Rev : COP_119A1212-601,-602_Rev_New	
Part Name : CHANNEL FWD	Effectivity : K0001~K9999	Related Source Document : 119A1212-601

COP (Condition Of Part) Description :

QPI36995 Attachment

Char No. N90~N93




FABRICATE PER ENGINEERING DATASET EXCEPT OMIT (2) .2500/.2540 DIA HOLES C/T FRONT SPAR WEB

N90

1. DRILL (1) .0980/.1040 DIA HOLES (P/H). N91
2. DRILL (2) .1280/.1340 DIA HOLES (P/H). N92
3. DRILL (2) .2500/.2540 DIA HOLES (P/H). N93

26 JAN 2015

OMIT (2) .2500/.2540 DIA HOLES C/T FRONT SPAR WEB

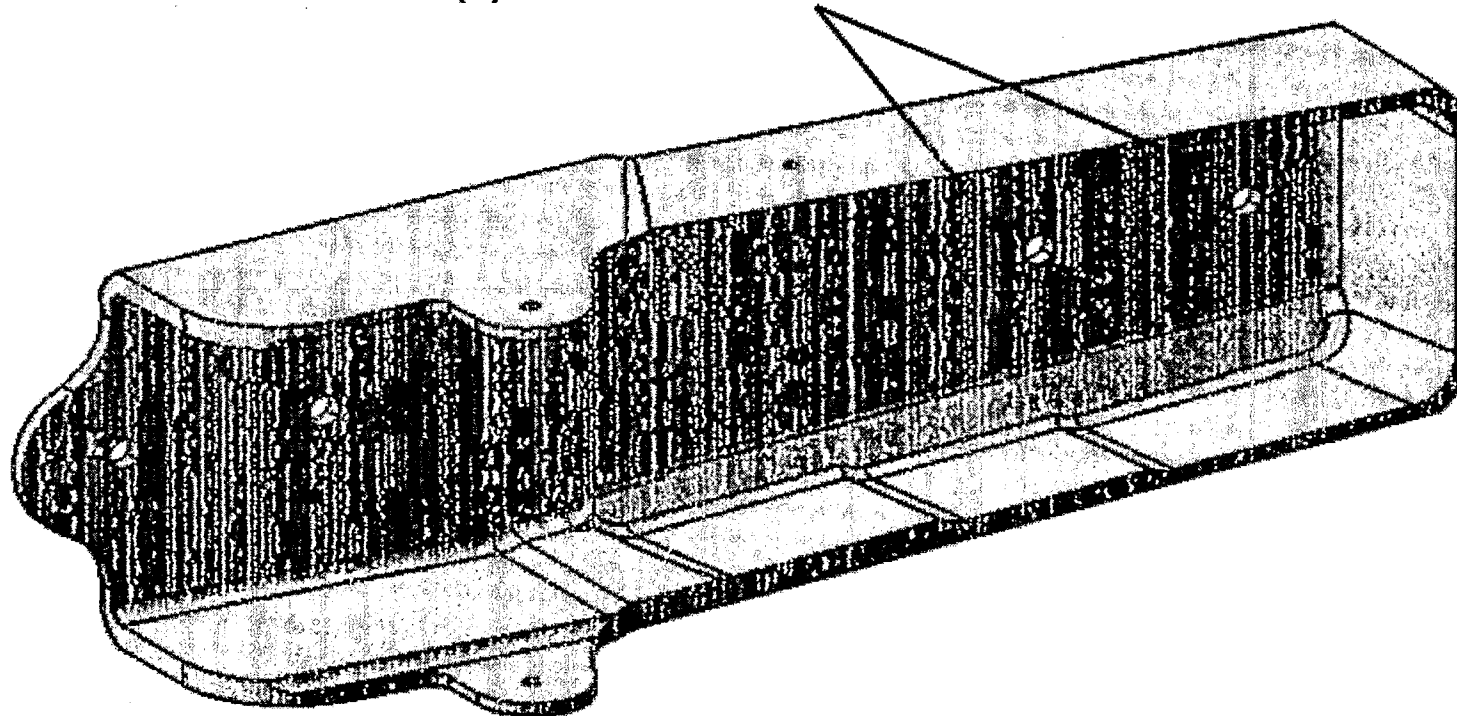



HEXAGON METROLOGY

DATE=2016-01-25 TIME=오후 7:18:16
PART NAME : 119A1212-601
REV NUMBER : A
SER NUMBER :
STATS COUNT : 1

Active alignment changed to STARTUP

1CMT 737 MAX Winglet 119A1212-601 CHANNEL FWD CMM PROGRAM
PROG.NAME = 119A1212-601_1.DMS
PROG.REV. = 00
MBD(DWG).NO. = 119A1212-601
MBD(DWG).REV. = A
PART.NO. = 119A1212-601
SOURCE = 119A1212-601--A.CATPart

DATUM_A= AUTOMATIC PLANE Measured from 2 hits
CIRCLE_C= AUTOMATIC CIRCLE Measured from 4 hits
CIRCLE_B= AUTOMATIC CIRCLE Measured from 4 hits
Active alignment changed to A0

CIRCLE_C-R= AUTOMATIC CIRCLE Measured from 4 hits
CIRCLE_B-R= AUTOMATIC CIRCLE Measured from 4 hits
Active alignment changed to A4

===== START OF AUTO PROGRAM MEASURING =====

INSP OF TARGET POINTS
DATUM_A_TARGET_POI - (A1-A3)

A1= AUTOMATIC VECTOR POINT

DIM LOC1= LOCATION OF POINT A1 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-1.4993	-1.5000	0.0050	0.0050	0.0007	0.0000
Y	0.3491	0.3500	0.0050	0.0050	-0.0009	0.0000
Z	0.0005	0.0000	0.0050	0.0050	0.0005	0.0000

A2= AUTOMATIC VECTOR POINT

DIM LOC2= LOCATION OF POINT A2 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.6995	-0.7000	0.0050	0.0050	0.0005	0.0000
Y	5.3491	5.3500	0.0050	0.0050	-0.0009	0.0000
Z	0.0004	0.0000	0.0050	0.0050	0.0004	0.0000

A3= AUTOMATIC VECTOR POINT

DIM LOC3= LOCATION OF POINT A3 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-2.6995	-2.7000	0.0050	0.0050	0.0005	0.0000
Y	5.3491	5.3500	0.0050	0.0050	-0.0009	0.0000
Z	0.0004	0.0000	0.0050	0.0050	0.0004	0.0000

INSP OF TARGET POINTS

DATUM_B_TARGET_POI - (B1-B2)

B1= AUTOMATIC VECTOR POINT

DIM LOC4= LOCATION OF POINT B1 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	0.0040	0.0000	0.0050	0.0050	0.0040	0.0000
Y	5.5892	5.5902	0.0050	0.0050	-0.0009	0.0000

QP2 36995 Attachment



26 JAN 2016

PART NUMBER=119A1212-601 DATE=2016-01-25 TIME=오후 7:18:16
Z 1.0007 1.0000 0.0050 0.0050 0.0007 0.0000

B2= AUTOMATIC VECTOR POINT

DIM LOC5= LOCATION OF POINT B2 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	0.0047	0.0000	0.0050	0.0050	0.0047	0.0000
Y	0.5225	0.5229	0.0050	0.0050	-0.0003	0.0000
Z	1.0010	1.0000	0.0050	0.0050	0.0010	0.0000

INSP OF TARGET POINTS

DATUM_C_TARGET_POI - (C1)

C1= AUTOMATIC VECTOR POINT

DIM LOC6= LOCATION OF POINT C1 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-1.3406	-1.3408	0.0050	0.0050	0.0002	0.0000
Y	-0.0010	0.0000	0.0050	0.0050	-0.0010	0.0000
Z	1.0004	1.0000	0.0050	0.0050	0.0004	0.0000

INSP OF PROFILE PLANE OUTSIDE(5 SURFACES) (PROP/.0100 A B C)

(Geometrical Tolerances - Position surfacic profile.1)(PNT001-PNT047)

PNT001= AUTOMATIC VECTOR POINT

DIM LOC13= LOCATION OF POINT PNT001 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-2.7506	-2.7508	0.0050	0.0050	0.0002	0.0000
Y	0.2368	0.2378	0.0050	0.0050	-0.0010	0.0000
Z	1.6529	1.6521	0.0050	0.0050	0.0007	0.0000
T	-0.0001	0.0000	0.0050	0.0050	-0.0001	0.0000

PNT002= AUTOMATIC VECTOR POINT

DIM LOC14= LOCATION OF POINT PNT002 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-2.8606	-2.8683	0.0050	0.0050	-0.0023	0.0000
Y	0.3077	0.3090	0.0050	0.0050	-0.0013	0.0000
Z	0.5105	0.5093	0.0050	0.0050	0.0013	0.0000
T	0.0025	0.0000	0.0050	0.0050	0.0025	0.0000

PNT003= AUTOMATIC VECTOR POINT

DIM LOC15= LOCATION OF POINT PNT003 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-2.9356	-2.9341	0.0050	0.0050	-0.0015	0.0000
Y	1.6493	1.6504	0.0050	0.0050	-0.0011	0.0000
Z	1.0460	1.0451	0.0050	0.0050	0.0009	0.0000
T	0.0017	0.0000	0.0050	0.0050	0.0017	0.0000

PNT004= AUTOMATIC VECTOR POINT

DIM LOC16= LOCATION OF POINT PNT004 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.1172	-3.1157	0.0050	0.0050	-0.0015	0.0000
Y	3.0973	3.0985	0.0050	0.0050	-0.0012	0.0000
Z	0.4905	0.4896	0.0050	0.0050	0.0009	0.0000
T	0.0017	0.0000	0.0050	0.0050	0.0017	0.0000

PNT005= AUTOMATIC VECTOR POINT

DIM LOC17= LOCATION OF POINT PNT005 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.0155	-3.0115	0.0050	0.0050	-0.0040	0.0000
Y	3.1296	3.1313	0.0050	0.0050	-0.0016	0.0000
Z	1.6437	1.6423	0.0050	0.0050	0.0014	0.0000
T	0.0045	0.0000	0.0050	0.0050	0.0045	0.0000

PNT006= AUTOMATIC VECTOR POINT

DIM LOC18= LOCATION OF POINT PNT006 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.1959	-3.1942	0.0050	0.0050	-0.0017	0.0000
Y	4.4934	4.4947	0.0050	0.0050	-0.0013	0.0000
Z	1.0261	1.0252	0.0050	0.0050	0.0009	0.0000

T 0.0019 0.0000 0.0050 0.0050 0.0019 0.0000 ----#--

PNT007= AUTOMATIC VECTOR POINT

DIM LOC19= LOCATION OF POINT PNT007 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.2909	-3.2884	0.0050	0.0050	-0.0025	0.0000 ----#--
Y	6.2364	6.2376	0.0050	0.0050	-0.0012	0.0000 ----#--
Z	1.6630	1.6620	0.0050	0.0050	0.0010	0.0000 ----#--
T	0.0027	0.0000	0.0050	0.0050	0.0027	0.0000 ----#--

PNT008= AUTOMATIC VECTOR POINT

DIM LOC20= LOCATION OF POINT PNT008 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.3397	-3.3392	0.0050	0.0050	-0.0005	0.0000 ----#--
Y	5.5403	5.5411	0.0050	0.0050	-0.0007	0.0000 ----#--
Z	0.4951	0.4942	0.0050	0.0050	0.0008	0.0000 ----#--
T	0.0006	0.0000	0.0050	0.0050	0.0006	0.0000 ----#--

PNT009= AUTOMATIC VECTOR POINT

DIM LOC21= LOCATION OF POINT PNT009 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.3511	-3.3493	0.0050	0.0050	-0.0018	0.0000 ----#--
Y	5.7315	5.7320	0.0050	0.0050	-0.0005	0.0000 ----#--
Z	0.3830	0.3822	0.0050	0.0050	0.0007	0.0000 ----#--
T	0.0018	0.0000	0.0050	0.0050	0.0018	0.0000 ----#--

PNT010= AUTOMATIC VECTOR POINT

DIM LOC22= LOCATION OF POINT PNT010 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.3462	-3.3454	0.0050	0.0050	-0.0008	0.0000 ----#--
Y	6.5774	6.5779	0.0050	0.0050	-0.0005	0.0000 ----#--
Z	1.6663	1.6660	0.0050	0.0050	0.0003	0.0000 ----#--
T	0.0008	0.0000	0.0050	0.0050	0.0008	0.0000 ----#--

PNT011= AUTOMATIC VECTOR POINT

DIM LOC27= LOCATION OF POINT PNT011 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.3491	-3.3483	0.0050	0.0050	-0.0007	0.0000 ----#--
Y	6.9796	6.9801	0.0050	0.0050	-0.0006	0.0000 ----#--
Z	0.8911	0.8901	0.0050	0.0050	0.0010	0.0000 ----#--
T	0.0007	0.0000	0.0050	0.0050	0.0007	0.0000 ----#--

PNT012= AUTOMATIC VECTOR POINT

DIM LOC28= LOCATION OF POINT PNT012 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.3522	-3.3509	0.0050	0.0050	-0.0013	0.0000 ----#--
Y	7.9053	7.9058	0.0050	0.0050	-0.0005	0.0000 ----#--
Z	0.3301	0.3291	0.0050	0.0050	0.0010	0.0000 ----#--
T	0.0013	0.0000	0.0050	0.0050	0.0013	0.0000 ----#--

PNT013= AUTOMATIC VECTOR POINT

DIM LOC29= LOCATION OF POINT PNT013 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.3477	-3.3462	0.0050	0.0050	-0.0015	0.0000 ----#--
Y	7.8704	7.8706	0.0050	0.0050	-0.0002	0.0000 ----#--
Z	1.6673	1.6670	0.0050	0.0050	0.0003	0.0000 ----#--
T	0.0015	0.0000	0.0050	0.0050	0.0015	0.0000 ----#--

PNT014= AUTOMATIC VECTOR POINT

DIM LOC30= LOCATION OF POINT PNT014 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.3494	-3.3493	0.0050	0.0050	-0.0001	0.0000 ----#--
Y	8.7020	8.7025	0.0050	0.0050	-0.0005	0.0000 ----#--
Z	0.9423	0.9415	0.0050	0.0050	0.0007	0.0000 ----#--
T	0.0001	0.0000	0.0050	0.0050	0.0001	0.0000 ----#--

PNT015= AUTOMATIC VECTOR POINT

DIM LOC31= LOCATION OF POINT PNT015 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.3538	-3.3519	0.0050	0.0050	-0.0019	0.0000 ----#--
Y	9.5086	9.5091	0.0050	0.0050	-0.0005	0.0000 ----#--
Z	0.3445	0.3438	0.0050	0.0050	0.0007	0.0000 ----#--
T	0.0019	0.0000	0.0050	0.0050	0.0019	0.0000 ----#--

PNT016= AUTOMATIC VECTOR POINT

DIM LOC32= LOCATION OF POINT PNT016 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.3482	-3.3471	0.0050	0.0050	-0.0011	0.0000 ----#--
Y	9.2854	9.2855	0.0050	0.0050	-0.0001	0.0000 ----#--
Z	1.6608	1.6605	0.0050	0.0050	0.0003	0.0000 ----#--
T	0.0011	0.0000	0.0050	0.0050	0.0011	0.0000 ----#--

PNT017= AUTOMATIC VECTOR POINT

DIM LOC33= LOCATION OF POINT PNT017 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.1909	-0.1918	0.0050	0.0050	0.0009	0.0000 ----#--
Y	9.3337	9.3328	0.0050	0.0050	0.0009	0.0000 ----#--
Z	1.6577	1.6569	0.0050	0.0050	0.0007	0.0000 ----#--
T	0.0010	0.0000	0.0050	0.0050	0.0010	0.0000 ----#--

PNT018= AUTOMATIC VECTOR POINT

DIM LOC34= LOCATION OF POINT PNT018 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.2076	-0.2082	0.0050	0.0050	0.0006	0.0000 ----#--
Y	9.5589	9.5585	0.0050	0.0050	-0.0004	0.0000 ----#--
Z	0.3421	0.3414	0.0050	0.0050	0.0007	0.0000 ----#--
T	0.0006	0.0000	0.0050	0.0050	0.0006	0.0000 ----#--

PNT019= AUTOMATIC VECTOR POINT

DIM LOC35= LOCATION OF POINT PNT019 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.1612	-0.1623	0.0050	0.0050	0.0011	0.0000 ----#--
Y	8.7209	8.7200	0.0050	0.0050	0.0009	0.0000 ----#--
Z	0.9755	0.9754	0.0050	0.0050	0.0001	0.0000 ----#--
T	0.0011	0.0000	0.0050	0.0050	0.0011	0.0000 ----#--

PNT020= AUTOMATIC VECTOR POINT

DIM LOC36= LOCATION OF POINT PNT020 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.1171	-0.1166	0.0050	0.0050	-0.0006	0.0000 ----#--
Y	7.7963	7.7955	0.0050	0.0050	0.0008	0.0000 ----#--
Z	0.3160	0.3153	0.0050	0.0050	0.0007	0.0000 ----#--
T	-0.0005	0.0000	0.0050	0.0050	-0.0005	0.0000 ----#--

PNT021= AUTOMATIC VECTOR POINT

DIM LOC37= LOCATION OF POINT PNT021 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.1177	-0.1190	0.0050	0.0050	0.0013	0.0000 ----#--
Y	7.9340	7.9334	0.0050	0.0050	0.0005	0.0000 ----#--
Z	1.6644	1.6643	0.0050	0.0050	0.0000	0.0000 ----#--
T	0.0013	0.0000	0.0050	0.0050	0.0013	0.0000 ----#--

PNT022= AUTOMATIC VECTOR POINT

DIM LOC42= LOCATION OF POINT PNT022 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.0470	-0.0489	0.0050	0.0050	0.0019	0.0000 ----#--
Y	6.5853	6.5844	0.0050	0.0050	0.0009	0.0000 ----#--
Z	1.6547	1.6540	0.0050	0.0050	0.0007	0.0000 ----#--
T	0.0019	0.0000	0.0050	0.0050	0.0019	0.0000 ----#--

PNT023= AUTOMATIC VECTOR POINT

DIM LOC43= LOCATION OF POINT PNT023 UNITS=IN

PART NUMBER=119A1212-601 DATE=2016-01-25 TIME=오후 7:18:16

PAGE#5

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.0748	-0.0764	0.0050	0.0050	0.0017	0.0000 ----#--
Y	7.0653	7.0648	0.0050	0.0050	0.0005	0.0000 ----#--
Z	0.9241	0.9234	0.0050	0.0050	0.0007	0.0000 ----#--
T	0.0017	0.0000	0.0050	0.0050	0.0017	0.0000 ----#--

PNT024= AUTOMATIC VECTOR POINT

DIM LOC44= LOCATION OF POINT PNT024 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.0172	-0.0170	0.0050	0.0050	-0.0002	0.0000 ----#--
Y	5.8835	5.8827	0.0050	0.0050	0.0008	0.0000 ----#--
Z	0.3380	0.3373	0.0050	0.0050	0.0007	0.0000 ----#--
T	-0.0002	0.0000	0.0050	0.0050	-0.0002	0.0000 ----#--

PNT025= AUTOMATIC VECTOR POINT

DIM LOC45= LOCATION OF POINT PNT025 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	0.0030	-0.0016	0.0050	0.0050	0.0046	0.0000 ----#--
Y	5.6583	5.6578	0.0050	0.0050	0.0005	0.0000 ----#--
Z	0.4890	0.4887	0.0050	0.0050	0.0003	0.0000 ----#--
T	0.0046	0.0000	0.0050	0.0050	0.0046	0.0000 ----#--

PNT026= AUTOMATIC VECTOR POINT

DIM LOC46= LOCATION OF POINT PNT026 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	0.0015	0.0002	0.0050	0.0050	0.0013	0.0000 ----#--
Y	6.2390	6.2389	0.0050	0.0050	0.0001	0.0000 ----#--
Z	1.6600	1.6596	0.0050	0.0050	0.0003	0.0000 ----#--
T	0.0013	0.0000	0.0050	0.0050	0.0013	0.0000 ----#--

PNT027= AUTOMATIC VECTOR POINT

DIM LOC47= LOCATION OF POINT PNT027 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	0.0044	-0.0004	0.0050	0.0050	0.0048	0.0000 ----#--
Y	4.5403	4.5397	0.0050	0.0050	0.0006	0.0000 ----#--
Z	1.0439	1.0431	0.0050	0.0050	0.0008	0.0000 ----#--
T	0.0048	0.0000	0.0050	0.0050	0.0048	0.0000 ----#--

PNT028= AUTOMATIC VECTOR POINT

DIM LOC48= LOCATION OF POINT PNT028 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	0.0145	0.0098	0.0050	0.0050	0.0047	0.0000 ----#--
Y	3.0463	3.0457	0.0050	0.0050	0.0006	0.0000 ----#--
Z	0.4775	0.4766	0.0050	0.0050	0.0009	0.0000 ----#--
T	0.0047	0.0000	0.0050	0.0050	0.0047	0.0000 ----#--

PNT029= AUTOMATIC VECTOR POINT

DIM LOC49= LOCATION OF POINT PNT029 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.0176	-0.0183	0.0050	0.0050	0.0007	0.0000 ----#--
Y	3.0927	3.0925	0.0050	0.0050	0.0001	0.0000 ----#--
Z	1.6525	1.6519	0.0050	0.0050	0.0006	0.0000 ----#--
T	0.0007	0.0000	0.0050	0.0050	0.0007	0.0000 ----#--

PNT030= AUTOMATIC VECTOR POINT

DIM LOC50= LOCATION OF POINT PNT030 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	0.0039	-0.0008	0.0050	0.0050	0.0047	0.0000 ----#--
Y	1.6826	1.6821	0.0050	0.0050	0.0005	0.0000 ----#--
Z	1.0250	1.0240	0.0050	0.0050	0.0009	0.0000 ----#--
T	0.0047	0.0000	0.0050	0.0050	0.0047	0.0000 ----#--

PNT031= AUTOMATIC VECTOR POINT

DIM LOC51= LOCATION OF POINT PNT031 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	0.0257	0.0216	0.0050	0.0050	0.0041	0.0000 ----#--

PART NUMBER=119A1212-601 DATE=2016-01-25 TIME=오후 7:18:16

PAGE#6

Y	0.3353	0.3347	0.0050	0.0050	0.0006	0.0000 ----#--
Z	0.4781	0.4765	0.0050	0.0050	0.0016	0.0000 ----#--
T	0.0044	0.0000	0.0050	0.0050	0.0044	0.0000 ----#--

PNT032= AUTOMATIC VECTOR POINT

DIM LOC52= LOCATION OF POINT PNT032 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.0342	-0.0361	0.0050	0.0050	0.0019	0.0000 ----#--
Y	0.2818	0.2813	0.0050	0.0050	0.0006	0.0000 ----#--
Z	1.6633	1.6623	0.0050	0.0050	0.0010	0.0000 ----#--
T	0.0019	0.0000	0.0050	0.0050	0.0019	0.0000 ----#--

PNT033= AUTOMATIC VECTOR POINT

DIM LOC53= LOCATION OF POINT PNT033 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.6157	-0.6161	0.0050	0.0050	0.0004	0.0000 ----#--
Y	5.8417	5.8417	0.0050	0.0050	0.0000	0.0000 ----#--
Z	0.0131	0.0117	0.0050	0.0050	0.0014	0.0000 ----#--
T	-0.0014	0.0000	0.0050	0.0050	-0.0014	0.0000 ----#--

PNT034= AUTOMATIC VECTOR POINT

DIM LOC54= LOCATION OF POINT PNT034 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-1.6911	-1.6916	0.0050	0.0050	0.0004	0.0000 ----#--
Y	5.6502	5.6503	0.0050	0.0050	0.0000	0.0000 ----#--
Z	0.0169	0.0155	0.0050	0.0050	0.0015	0.0000 ----#--
T	-0.0015	0.0000	0.0050	0.0050	-0.0015	0.0000 ----#--

PNT035= AUTOMATIC VECTOR POINT

DIM LOC55= LOCATION OF POINT PNT035 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-1.1370	-1.1370	0.0050	0.0050	0.0000	0.0000 ----#--
Y	6.7962	6.7962	0.0050	0.0050	0.0000	0.0000 ----#--
Z	0.0147	0.0135	0.0050	0.0050	0.0012	0.0000 ----#--
T	-0.0012	0.0000	0.0050	0.0050	-0.0012	0.0000 ----#--

PNT036= AUTOMATIC VECTOR POINT

DIM LOC56= LOCATION OF POINT PNT036 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.3224	-0.3224	0.0050	0.0050	0.0000	0.0000 ----#--
Y	6.0210	6.0210	0.0050	0.0050	0.0000	0.0000 ----#--
Z	0.0112	0.0107	0.0050	0.0050	0.0005	0.0000 ----#--
T	-0.0005	0.0000	0.0050	0.0050	-0.0005	0.0000 ----#--

PNT037= AUTOMATIC VECTOR POINT

DIM LOC57= LOCATION OF POINT PNT037 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.4460	-0.4464	0.0050	0.0050	0.0004	0.0000 ----#--
Y	7.8498	7.8498	0.0050	0.0050	0.0000	0.0000 ----#--
Z	0.0128	0.0111	0.0050	0.0050	0.0017	0.0000 ----#--
T	-0.0017	0.0000	0.0050	0.0050	-0.0017	0.0000 ----#--

PNT038= AUTOMATIC VECTOR POINT

DIM LOC58= LOCATION OF POINT PNT038 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-1.7586	-1.7590	0.0050	0.0050	0.0004	0.0000 ----#--
Y	7.6938	7.6937	0.0050	0.0050	0.0000	0.0000 ----#--
Z	0.0174	0.0167	0.0050	0.0050	0.0017	0.0000 ----#--
T	-0.0017	0.0000	0.0050	0.0050	-0.0017	0.0000 ----#--

PNT039= AUTOMATIC VECTOR POINT

DIM LOC59= LOCATION OF POINT PNT039 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-1.1508	-1.1507	0.0050	0.0050	0.0000	0.0000 ----#--
Y	8.8383	8.8383	0.0050	0.0050	0.0000	0.0000 ----#--
Z	0.0162	0.0135	0.0050	0.0050	0.0027	0.0000 ----#--

T -0.0027 0.0000 0.0050 0.0050 -0.0027 0.0000 #-----

PNT040= AUTOMATIC VECTOR POINT

DIM LOC60= LOCATION OF POINT PNT040 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.5225	-0.5224	0.0050	0.0050	0.0000	0.0000 #-----
Y	9.5546	9.5546	0.0050	0.0050	0.0000	0.0000 #-----
Z	0.0143	0.0113	0.0050	0.0050	0.0030	0.0000 #-----
T	-0.0030	0.0000	0.0050	0.0050	-0.0030	0.0000 #-----

PNT041= AUTOMATIC VECTOR POINT

DIM LOC61= LOCATION OF POINT PNT041 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-1.7706	-1.7710	0.0050	0.0050	0.0004	0.0000 #-----
Y	10.1829	10.1829	0.0050	0.0050	0.0000	0.0000 #-----
Z	0.0182	0.0157	0.0050	0.0050	0.0025	0.0000 #-----
T	-0.0025	0.0000	0.0050	0.0050	-0.0025	0.0000 #-----

PNT042= AUTOMATIC VECTOR POINT

DIM LOC62= LOCATION OF POINT PNT042 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.0440	-3.0436	0.0050	0.0050	-0.0004	0.0000 #-----
Y	9.5105	9.5106	0.0050	0.0050	-0.0001	0.0000 #-----
Z	0.0228	0.0201	0.0050	0.0050	0.0026	0.0000 #-----
T	-0.0026	0.0000	0.0050	0.0050	-0.0026	0.0000 #-----

PNT043= AUTOMATIC VECTOR POINT

DIM LOC63= LOCATION OF POINT PNT043 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-2.4717	-2.4713	0.0050	0.0050	-0.0004	0.0000 #-----
Y	8.8143	8.8142	0.0050	0.0050	0.0000	0.0000 #-----
Z	0.0206	0.0181	0.0050	0.0050	0.0025	0.0000 #-----
T	-0.0025	0.0000	0.0050	0.0050	-0.0025	0.0000 #-----

PNT044= AUTOMATIC VECTOR POINT

DIM LOC64= LOCATION OF POINT PNT044 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.0275	-3.0276	0.0050	0.0050	0.0000	0.0000 #-----
Y	7.6897	7.6897	0.0050	0.0050	-0.0001	0.0000 #-----
Z	0.0216	0.0201	0.0050	0.0050	0.0015	0.0000 #-----
T	-0.0015	0.0000	0.0050	0.0050	-0.0015	0.0000 #-----

PNT045= AUTOMATIC VECTOR POINT

DIM LOC65= LOCATION OF POINT PNT045 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-2.4157	-2.4153	0.0050	0.0050	-0.0004	0.0000 #-----
Y	6.7533	6.7533	0.0050	0.0050	0.0000	0.0000 #-----
Z	0.0192	0.0180	0.0050	0.0050	0.0012	0.0000 #-----
T	-0.0012	0.0000	0.0050	0.0050	-0.0012	0.0000 #-----

PNT046= AUTOMATIC VECTOR POINT

DIM LOC66= LOCATION OF POINT PNT046 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-2.7954	-2.7955	0.0050	0.0050	0.0000	0.0000 #-----
Y	5.5887	5.5888	0.0050	0.0050	0.0000	0.0000 #-----
Z	0.0211	0.0193	0.0050	0.0050	0.0018	0.0000 #-----
T	-0.0018	0.0000	0.0050	0.0050	-0.0018	0.0000 #-----

PNT047= AUTOMATIC VECTOR POINT

DIM LOC67= LOCATION OF POINT PNT047 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.0315	-3.0316	0.0050	0.0050	0.0000	0.0000 #-----
Y	5.8809	5.8809	0.0050	0.0050	0.0000	0.0000 #-----
Z	0.0207	0.0202	0.0050	0.0050	0.0005	0.0000 #-----
T	-0.0005	0.0000	0.0050	0.0050	-0.0005	0.0000 #-----

INSP OF TRUE POSITION (2X ϕ .2500-.2540)(TRUP/ ϕ .0140M A B C)

(Dimensions - Linear Size.1)(Geometrical Tolerances - Position.1)(CIRCLE_001-CIRCLE_002)

CIRCLE_001= AUTOMATIC CIRCLE Measured from 4 hits

DIM LOC68= LOCATION OF CIRCLE CIRCLE_001 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-1.7807	-1.7803	0.0070	0.0070	-0.0004	0.0000 #-----
Y	9.5185	9.5179	0.0070	0.0070	0.0006	0.0000 #-----
Z	0.1657	0.1657	0.0070	0.0070	0.0000	0.0000 #-----

DIM LOC72= TRUE POSITION OF CIRCLE CIRCLE_001 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	BONUS	DEV	OUTTOL
X	-1.7807	-1.7803				-0.0004	
Y	9.5185	9.5179				0.0006	
Z	0.1657	0.1657				0.0000	
DF	0.2501	0.2520	0.0020	0.0020	0.0001	-0.0019	0.0000 #-----
TP		MMC	0.0140		0.0001	0.0015	0.0000 #-----

CIRCLE_002= AUTOMATIC CIRCLE Measured from 4 hits

DIM LOC69= LOCATION OF CIRCLE CIRCLE_002 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-1.7398	-1.7392	0.0070	0.0070	-0.0005	0.0000 #-----
Y	7.9589	7.9586	0.0070	0.0070	0.0003	0.0000 #-----
Z	0.1656	0.1656	0.0070	0.0070	0.0000	0.0000 #-----

DIM LOC73= TRUE POSITION OF CIRCLE CIRCLE_002 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	BONUS	DEV	OUTTOL
X	-1.7398	-1.7392				-0.0005	
Y	7.9589	7.9586				0.0003	
Z	0.1656	0.1656				0.0000	
DF	0.2500	0.2520	0.0020	0.0020	0.0000	-0.0020	0.0000 #-----
TP		MMC	0.0140		0.0000	0.0012	0.0000 #-----

INSP OF TRUE POSITION (ϕ .0980-.1040)(TRUP/ ϕ .0140M A B C)

(Dimensions - Linear Size.2)(Geometrical Tolerances - Position.2)(CIRCLE_005)

CIRCLE_005= AUTOMATIC CIRCLE Measured from 4 hits

DIM LOC76= LOCATION OF CIRCLE CIRCLE_005 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	0.0000	-0.0001	0.0070	0.0070	0.0000	0.0000 #-----
Y	4.8675	4.8670	0.0070	0.0070	0.0006	0.0000 #-----
Z	1.0292	1.0350	0.0070	0.0070	-0.0058	0.0000 #-----

DIM LOC77= TRUE POSITION OF CIRCLE CIRCLE_005 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	BONUS	DEV	OUTTOL
X	0.0000	-0.0001				0.0000	
Y	4.8675	4.8670				0.0006	
Z	1.0292	1.0350				-0.0058	
DF	0.0982	0.1010	0.0030	0.0030	0.0002	-0.0028	0.0000 #-----
TP		MMC	0.0140		0.0002	0.0116	0.0000 #-----

INSP OF TRUE POSITION (ϕ .1280-.1340)(TRUP/ ϕ .0280M A B C)

(Dimensions - Linear Size.3)(Geometrical Tolerances - Position.3)(CIRCLE_006)

CIRCLE_006= AUTOMATIC CIRCLE Measured from 4 hits

DIM LOC78= LOCATION OF CIRCLE CIRCLE_006 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.1038	-0.1038	0.0140	0.0140	0.0000	0.0000 #-----
Y	7.6905	7.6911	0.0140	0.0140	-0.0006	0.0000 #-----
Z	2.4045	2.4086	0.0140	0.0140	-0.0041	0.0000 #-----

DIM LOC79= TRUE POSITION OF CIRCLE CIRCLE_006 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	BONUS	DEV	OUTTOL
X	-0.1038	-0.1038				0.0000	
Y	7.6905	7.6911				-0.0006	
Z	2.4045	2.4086				-0.0041	
DF	0.1281	0.1310	0.0030	0.0030	0.0001	-0.0029	0.0000 #-----
TP		MMC	0.0280		0.0001	0.0084	0.0000 #-----

INSP OF TRUE POSITION (Φ.1280-.1340)(TRUP/Φ.0280M A B C)
(Dimensions - Linear Size.4)(Geometrical Tolerances - Position.4)(CIRCLE.007)

CIRCLE.007= AUTOMATIC CIRCLE Measured from 4 hits

DIM LOC80= LOCATION OF CIRCLE CIRCLE.007 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.3434	-3.3434	0.0140	0.0140	0.0000	0.0000 ---#---
Y	7.6360	7.6350	0.0140	0.0140	0.0010	0.0000 ---#---
Z	2.4127	2.4161	0.0140	0.0140	-0.0035	0.0000 ---#---

DIM LOC81= TRUE POSITION OF CIRCLE CIRCLE.007 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	BONUS	DEV	OUTTOL
X	-3.3434	-3.3434				0.0000	
Y	7.6360	7.6350				0.0010	
Z	2.4127	2.4161				-0.0035	
DF	0.1282	0.1310	0.0030	0.0030	0.0002	-0.0028	0.0000 #-----
TP		MMC	0.0280		0.0002	0.0073	0.0000 --#-----

INSP OF OTHER PROFILE PLANE OUTSIDE (PROP/.0200 A B C)(PNT048-PNT067)

PNT048= AUTOMATIC VECTOR POINT

DIM LOC7= LOCATION OF POINT PNT048 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.3458	-3.3421	0.0100	0.0100	-0.0037	0.0000 ---#---
Y	7.6569	7.6559	0.0100	0.0100	0.0011	0.0000 ---#---
Z	2.7832	2.7825	0.0100	0.0100	0.0007	0.0000 ---#---
T	0.0037	0.0000	0.0100	0.0100	0.0037	0.0000 ---#---

PNT049= AUTOMATIC VECTOR POINT

DIM LOC8= LOCATION OF POINT PNT049 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.3457	-3.3434	0.0100	0.0100	-0.0022	0.0000 ---#---
Y	7.1662	7.1652	0.0100	0.0100	0.0010	0.0000 ---#---
Z	2.3236	2.3230	0.0100	0.0100	0.0007	0.0000 ---#---
T	0.0022	0.0000	0.0100	0.0100	0.0022	0.0000 ---#---

PNT050= AUTOMATIC VECTOR POINT

DIM LOC9= LOCATION OF POINT PNT050 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.3470	-3.3450	0.0100	0.0100	-0.0020	0.0000 ---#---
Y	6.8401	6.8390	0.0100	0.0100	0.0011	0.0000 ---#---
Z	1.8213	1.8203	0.0100	0.0100	0.0010	0.0000 ---#---
T	0.0020	0.0000	0.0100	0.0100	0.0020	0.0000 ---#---

PNT051= AUTOMATIC VECTOR POINT

DIM LOC10= LOCATION OF POINT PNT051 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.3470	-3.3447	0.0100	0.0100	-0.0023	0.0000 ---#---
Y	7.5087	7.5080	0.0100	0.0100	0.0007	0.0000 ---#---
Z	2.0269	2.0266	0.0100	0.0100	0.0003	0.0000 ---#---
T	0.0023	0.0000	0.0100	0.0100	0.0023	0.0000 ---#---

PNT052= AUTOMATIC VECTOR POINT

DIM LOC11= LOCATION OF POINT PNT052 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.3459	-3.3439	0.0100	0.0100	-0.0020	0.0000 ---#---
Y	7.9936	7.9930	0.0100	0.0100	0.0006	0.0000 ---#---
Z	2.3392	2.3390	0.0100	0.0100	0.0003	0.0000 ---#---
T	0.0020	0.0000	0.0100	0.0100	0.0020	0.0000 ---#---

PNT053= AUTOMATIC VECTOR POINT

DIM LOC12= LOCATION OF POINT PNT053 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.3473	-3.3457	0.0100	0.0100	-0.0016	0.0000 ---#---
Y	8.1071	8.1065	0.0100	0.0100	0.0006	0.0000 ---#---
Z	1.8638	1.8627	0.0100	0.0100	0.0011	0.0000 ---#---
T	0.0016	0.0000	0.0100	0.0100	0.0016	0.0000 ---#---

PNT054= AUTOMATIC VECTOR POINT

DIM LOC23= LOCATION OF POINT PNT054 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.3482	-3.3463	0.0100	0.0100	-0.0019	0.0000 ---#---
Y	8.9936	8.9929	0.0100	0.0100	0.0007	0.0000 ---#---
Z	1.8353	1.8343	0.0100	0.0100	0.0010	0.0000 ---#---
T	0.0019	0.0000	0.0100	0.0100	0.0019	0.0000 ---#---

PNT055= AUTOMATIC VECTOR POINT

DIM LOC24= LOCATION OF POINT PNT055 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.0984	-0.1022	0.0100	0.0100	0.0038	0.0000 ---#---
Y	7.6861	7.6855	0.0100	0.0100	0.0006	0.0000 ---#---
Z	2.7752	2.7745	0.0100	0.0100	0.0007	0.0000 ---#---
T	0.0039	0.0000	0.0100	0.0100	0.0039	0.0000 ---#---

PNT056= AUTOMATIC VECTOR POINT

DIM LOC25= LOCATION OF POINT PNT056 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.0791	-0.0813	0.0100	0.0100	0.0022	0.0000 ---#---
Y	7.2558	7.2549	0.0100	0.0100	0.0009	0.0000 ---#---
Z	2.3549	2.3542	0.0100	0.0100	0.0008	0.0000 ---#---
T	0.0023	0.0000	0.0100	0.0100	0.0023	0.0000 ---#---

PNT057= AUTOMATIC VECTOR POINT

DIM LOC26= LOCATION OF POINT PNT057 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.0606	-0.0635	0.0100	0.0100	0.0029	0.0000 ---#---
Y	6.8763	6.8752	0.0100	0.0100	0.0010	0.0000 ---#---
Z	1.7978	1.7971	0.0100	0.0100	0.0007	0.0000 ---#---
T	0.0030	0.0000	0.0100	0.0100	0.0030	0.0000 ---#---

PNT058= AUTOMATIC VECTOR POINT

DIM LOC38= LOCATION OF POINT PNT058 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.0992	-0.1002	0.0100	0.0100	0.0009	0.0000 ---#---
Y	7.5945	7.5939	0.0100	0.0100	0.0006	0.0000 ---#---
Z	2.0022	2.0021	0.0100	0.0100	0.0000	0.0000 ---#---
T	0.0010	0.0000	0.0100	0.0100	0.0010	0.0000 ---#---

PNT059= AUTOMATIC VECTOR POINT

DIM LOC39= LOCATION OF POINT PNT059 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.1210	-0.1228	0.0100	0.0100	0.0018	0.0000 ---#---
Y	8.0525	8.0521	0.0100	0.0100	0.0004	0.0000 ---#---
Z	2.3523	2.3523	0.0100	0.0100	0.0000	0.0000 ---#---
T	0.0018	0.0000	0.0100	0.0100	0.0018	0.0000 ---#---

PNT060= AUTOMATIC VECTOR POINT

DIM LOC40= LOCATION OF POINT PNT060 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.1269	-0.1288	0.0100	0.0100	0.0019	0.0000 ---#---
Y	8.1346	8.1341	0.0100	0.0100	0.0006	0.0000 ---#---
Z	1.8483	1.8475	0.0100	0.0100	0.0007	0.0000 ---#---
T	0.0019	0.0000	0.0100	0.0100	0.0019	0.0000 ---#---

PNT061= AUTOMATIC VECTOR POINT

DIM LOC41= LOCATION OF POINT PNT061 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.1762	-0.1780	0.0100	0.0100	0.0018	0.0000 ---#---
Y	9.0770	9.0765	0.0100	0.0100	0.0005	0.0000 ---#---
Z	1.8091	1.8084	0.0100	0.0100	0.0007	0.0000 ---#---
T	0.0018	0.0000	0.0100	0.0100	0.0018	0.0000 ---#---

PNT062= AUTOMATIC VECTOR POINT

DIM LOC82= LOCATION OF POINT PNT062 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.3433	-0.3435	0.0100	0.0100	0.0003	0.0000 ---#---
Y	-0.0130	-0.0114	0.0100	0.0100	-0.0016	0.0000 ---#---
Z	1.6407	1.6405	0.0100	0.0100	0.0002	0.0000 ---#---
T	0.0016	0.0000	0.0100	0.0100	0.0016	0.0000 ---#---

PNT063= AUTOMATIC VECTOR POINT

DIM LOC83= LOCATION OF POINT PNT063 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.4416	-0.4420	0.0100	0.0100	0.0005	0.0000 ---#---
Y	0.0420	0.0438	0.0100	0.0100	-0.0018	0.0000 ---#---
Z	0.3405	0.3403	0.0100	0.0100	0.0002	0.0000 ---#---
T	0.0018	0.0000	0.0100	0.0100	0.0018	0.0000 ---#---

PNT064= AUTOMATIC VECTOR POINT

DIM LOC84= LOCATION OF POINT PNT064 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-1.3787	-1.3791	0.0100	0.0100	0.0004	0.0000 ---#---
Y	0.0194	0.0202	0.0100	0.0100	-0.0007	0.0000 ---#---
Z	0.5240	0.5241	0.0100	0.0100	-0.0001	0.0000 ---#---
T	0.0007	0.0000	0.0100	0.0100	0.0007	0.0000 ---#---

PNT065= AUTOMATIC VECTOR POINT

DIM LOC85= LOCATION OF POINT PNT065 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-1.3544	-1.3545	0.0100	0.0100	0.0000	0.0000 ---#---
Y	-0.0202	-0.0193	0.0100	0.0100	-0.0010	0.0000 ---#---
Z	1.4355	1.4356	0.0100	0.0100	-0.0001	0.0000 ---#---
T	0.0010	0.0000	0.0100	0.0100	0.0010	0.0000 ---#---

PNT066= AUTOMATIC VECTOR POINT

DIM LOC86= LOCATION OF POINT PNT066 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-2.4250	-2.4254	0.0100	0.0100	0.0004	0.0000 ---#---
Y	-0.0461	-0.0456	0.0100	0.0100	-0.0005	0.0000 ---#---
Z	1.6299	1.6300	0.0100	0.0100	-0.0001	0.0000 ---#---
T	0.0005	0.0000	0.0100	0.0100	0.0005	0.0000 ---#---

PNT067= AUTOMATIC VECTOR POINT

DIM LOC87= LOCATION OF POINT PNT067 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-2.3871	-2.3874	0.0100	0.0100	0.0003	0.0000 ---#---
Y	0.0107	0.0118	0.0100	0.0100	-0.0010	0.0000 ---#---
Z	0.3327	0.3324	0.0100	0.0100	0.0003	0.0000 ---#---
T	0.0010	0.0000	0.0100	0.0100	0.0010	0.0000 ---#---

INSP OF OTHER PROFILE PLANE OUTSIDE RADIUS & CHAMFER (PROP/.0200 A B C)(PNT068-PNT115)

PNT068= AUTOMATIC VECTOR POINT

DIM LOC88= LOCATION OF POINT PNT068 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.3095	-3.3061	0.0100	0.0100	-0.0034	0.0000 ---#---
Y	6.3873	6.3889	0.0100	0.0100	-0.0017	0.0000 ---#---
Z	1.6642	1.6628	0.0100	0.0100	0.0014	0.0000 ---#---
T	0.0039	0.0000	0.0100	0.0100	0.0039	0.0000 ---#---

PNT069= AUTOMATIC VECTOR POINT

DIM LOC89= LOCATION OF POINT PNT069 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.3328	-3.3303	0.0100	0.0100	-0.0025	0.0000 ---#---
Y	6.2089	6.2102	0.0100	0.0100	-0.0013	0.0000 ---#---
Z	1.3076	1.3061	0.0100	0.0100	0.0015	0.0000 ---#---
T	0.0030	0.0000	0.0100	0.0100	0.0030	0.0000 ---#---

PNT070= AUTOMATIC VECTOR POINT

DIM LOC90= LOCATION OF POINT PNT070 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
----	------	---------	------	------	-----	--------

X	-3.3396	-3.3370	0.0100	0.0100	-0.0026	0.0000 ---#---
Y	5.9575	5.9587	0.0100	0.0100	-0.0013	0.0000 ---#---
Z	0.9425	0.9414	0.0100	0.0100	0.0011	0.0000 ---#---
T	0.0029	0.0000	0.0100	0.0100	0.0029	0.0000 ---#---

PNT071= AUTOMATIC VECTOR POINT

DIM LOC91= LOCATION OF POINT PNT071 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-2.6962	-2.6967	0.0100	0.0100	0.0005	0.0000 ---#---
Y	0.1179	0.1176	0.0100	0.0100	0.0003	0.0000 ---#---
Z	1.6516	1.6507	0.0100	0.0100	0.0009	0.0000 ---#---
T	-0.0005	0.0000	0.0100	0.0100	-0.0005	0.0000 ---#---

PNT072= AUTOMATIC VECTOR POINT

DIM LOC92= LOCATION OF POINT PNT072 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-2.6247	-2.6258	0.0100	0.0100	0.0011	0.0000 ---#---
Y	0.0198	0.0188	0.0100	0.0100	0.0010	0.0000 ---#---
Z	1.0124	1.0116	0.0100	0.0100	0.0009	0.0000 ---#---
T	-0.0015	0.0000	0.0100	0.0100	-0.0015	0.0000 ---#---

PNT073= AUTOMATIC VECTOR POINT

DIM LOC93= LOCATION OF POINT PNT073 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-2.8082	-2.8062	0.0100	0.0100	-0.0020	0.0000 ---#---
Y	0.1642	0.1663	0.0100	0.0100	-0.0021	0.0000 ---#---
Z	0.4133	0.4123	0.0100	0.0100	0.0010	0.0000 ---#---
T	0.0030	0.0000	0.0100	0.0100	0.0030	0.0000 ---#---

PNT074= AUTOMATIC VECTOR POINT

DIM LOC94= LOCATION OF POINT PNT074 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-2.8475	-2.8463	0.0100	0.0100	-0.0012	0.0000 ---#---
Y	0.2591	0.2598	0.0100	0.0100	-0.0008	0.0000 ---#---
Z	0.3650	0.3650	0.0100	0.0100	0.0000	0.0000 ---#---
T	0.0012	0.0000	0.0100	0.0100	0.0012	0.0000 ---#---

PNT075= AUTOMATIC VECTOR POINT

DIM LOC95= LOCATION OF POINT PNT075 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.0785	-3.0761	0.0100	0.0100	-0.0024	0.0000 ---#---
Y	2.8818	2.8831	0.0100	0.0100	-0.0013	0.0000 ---#---
Z	0.3320	0.3324	0.0100	0.0100	-0.0004	0.0000 ---#---
T	0.0025	0.0000	0.0100	0.0100	0.0025	0.0000 ---#---

PNT076= AUTOMATIC VECTOR POINT

DIM LOC96= LOCATION OF POINT PNT076 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.3254	-3.3243	0.0100	0.0100	-0.0011	0.0000 ---#---
Y	5.4659	5.4670	0.0100	0.0100	-0.0012	0.0000 ---#---
Z	0.3634	0.3634	0.0100	0.0100	0.0000	0.0000 ---#---
T	0.0011	0.0000	0.0100	0.0100	0.0011	0.0000 ---#---

PNT077= AUTOMATIC VECTOR POINT

DIM LOC97= LOCATION OF POINT PNT077 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-2.9007	-2.9008	0.0100	0.0100	0.0001	0.0000 ---#---
Y	5.4038	5.4046	0.0100	0.0100	-0.0008	0.0000 ---#---
Z	0.0509	0.0496	0.0100	0.0100	0.0013	0.0000 ---#---
T	-0.0011	0.0000	0.0100	0.0100	-0.0011	0.0000 ---#---

PNT078= AUTOMATIC VECTOR POINT

DIM LOC98= LOCATION OF POINT PNT078 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-2.9861	-2.9860	0.0100	0.0100	-0.0002	0.0000 ---#---
Y	2.8608	2.8612	0.0100	0.0100	-0.0004	0.0000 ---#---

Z	0.2347	0.2338	0.0100	0.0100	0.0009	0.0000	---	---
T	-0.0007	0.0000	0.0100	0.0100	-0.0007	0.0000	---	---

PNT079= AUTOMATIC VECTOR POINT

DIM LOC99= LOCATION OF POINT PNT079 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL		
X	-2.4231	-2.4234	0.0100	0.0100	0.0003	0.0000	---	---
Y	0.2783	0.2786	0.0100	0.0100	-0.0002	0.0000	---	---
Z	0.0498	0.0476	0.0100	0.0100	0.0022	0.0000	---	---
T	-0.0021	0.0000	0.0100	0.0100	-0.0021	0.0000	---	---

PNT080= AUTOMATIC VECTOR POINT

DIM LOC100= LOCATION OF POINT PNT080 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL		
X	-2.7775	-2.7768	0.0100	0.0100	-0.0007	0.0000	---	---
Y	5.4849	5.4854	0.0100	0.0100	-0.0005	0.0000	---	---
Z	0.0163	0.0148	0.0100	0.0100	0.0015	0.0000	---	---
T	-0.0015	0.0000	0.0100	0.0100	-0.0015	0.0000	---	---

PNT081= AUTOMATIC VECTOR POINT

DIM LOC101= LOCATION OF POINT PNT081 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL		
X	-1.6766	-1.6760	0.0100	0.0100	-0.0007	0.0000	---	---
Y	5.5072	5.5079	0.0100	0.0100	-0.0007	0.0000	---	---
Z	0.0134	0.0120	0.0100	0.0100	0.0015	0.0000	---	---
T	-0.0016	0.0000	0.0100	0.0100	-0.0016	0.0000	---	---

PNT082= AUTOMATIC VECTOR POINT

DIM LOC102= LOCATION OF POINT PNT082 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL		
X	-3.2117	-3.2122	0.0100	0.0100	0.0005	0.0000	---	---
Y	5.8795	5.8800	0.0100	0.0100	-0.0005	0.0000	---	---
Z	0.0920	0.0903	0.0100	0.0100	0.0018	0.0000	---	---
T	-0.0017	0.0000	0.0100	0.0100	-0.0017	0.0000	---	---

PNT083= AUTOMATIC VECTOR POINT

DIM LOC103= LOCATION OF POINT PNT083 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL		
X	-3.1599	-3.1603	0.0100	0.0100	0.0004	0.0000	---	---
Y	7.6911	7.6919	0.0100	0.0100	-0.0008	0.0000	---	---
Z	0.0545	0.0528	0.0100	0.0100	0.0017	0.0000	---	---
T	-0.0016	0.0000	0.0100	0.0100	-0.0016	0.0000	---	---

PNT084= AUTOMATIC VECTOR POINT

DIM LOC104= LOCATION OF POINT PNT084 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL		
X	-3.2070	-3.2080	0.0100	0.0100	0.0010	0.0000	---	---
Y	9.5243	9.5248	0.0100	0.0100	-0.0005	0.0000	---	---
Z	0.0882	0.0856	0.0100	0.0100	0.0025	0.0000	---	---
T	-0.0026	0.0000	0.0100	0.0100	-0.0026	0.0000	---	---

PNT085= AUTOMATIC VECTOR POINT

DIM LOC105= LOCATION OF POINT PNT085 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL		
X	-3.3223	-3.3234	0.0100	0.0100	0.0011	0.0000	---	---
Y	9.5395	9.5401	0.0100	0.0100	-0.0006	0.0000	---	---
Z	0.2185	0.2173	0.0100	0.0100	0.0012	0.0000	---	---
T	-0.0016	0.0000	0.0100	0.0100	-0.0016	0.0000	---	---

PNT086= AUTOMATIC VECTOR POINT

DIM LOC106= LOCATION OF POINT PNT086 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL		
X	-3.2854	-3.2848	0.0100	0.0100	-0.0006	0.0000	---	---
Y	7.6902	7.6903	0.0100	0.0100	-0.0001	0.0000	---	---
Z	0.1640	0.1635	0.0100	0.0100	0.0006	0.0000	---	---
T	0.0002	0.0000	0.0100	0.0100	0.0002	0.0000	---	---

PNT087= AUTOMATIC VECTOR POINT

DIM LOC107= LOCATION OF POINT PNT087 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL		
X	-3.3214	-3.3207	0.0100	0.0100	-0.0007	0.0000	---	---
Y	5.8423	5.8424	0.0100	0.0100	-0.0001	0.0000	---	---
Z	0.2171	0.2169	0.0100	0.0100	0.0002	0.0000	---	---
T	0.0004	0.0000	0.0100	0.0100	0.0004	0.0000	---	---

PNT088= AUTOMATIC VECTOR POINT

DIM LOC108= LOCATION OF POINT PNT088 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL		
X	-0.2400	-0.2385	0.0100	0.0100	-0.0015	0.0000	---	---
Y	9.5805	9.5801	0.0100	0.0100	0.0004	0.0000	---	---
Z	0.2084	0.2068	0.0100	0.0100	0.0016	0.0000	---	---
T	-0.0021	0.0000	0.0100	0.0100	-0.0021	0.0000	---	---

PNT089= AUTOMATIC VECTOR POINT

DIM LOC109= LOCATION OF POINT PNT089 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL		
X	-0.1790	-0.1786	0.0100	0.0100	-0.0004	0.0000	---	---
Y	7.7503	7.7494	0.0100	0.0100	0.0008	0.0000	---	---
Z	0.1573	0.1566	0.0100	0.0100	0.0008	0.0000	---	---
T	-0.0007	0.0000	0.0100	0.0100	-0.0007	0.0000	---	---

PNT090= AUTOMATIC VECTOR POINT

DIM LOC110= LOCATION OF POINT PNT090 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL		
X	-0.0514	-0.0508	0.0100	0.0100	-0.0005	0.0000	---	---
Y	5.9883	5.9875	0.0100	0.0100	0.0008	0.0000	---	---
Z	0.2081	0.2074	0.0100	0.0100	0.0007	0.0000	---	---
T	-0.0008	0.0000	0.0100	0.0100	-0.0008	0.0000	---	---

PNT091= AUTOMATIC VECTOR POINT

DIM LOC111= LOCATION OF POINT PNT091 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL		
X	-0.6203	-0.6206	0.0100	0.0100	0.0003	0.0000	---	---
Y	5.5311	5.5303	0.0100	0.0100	0.0008	0.0000	---	---
Z	0.0108	0.0093	0.0100	0.0100	0.0015	0.0000	---	---
T	-0.0014	0.0000	0.0100	0.0100	-0.0014	0.0000	---	---

PNT092= AUTOMATIC VECTOR POINT

DIM LOC112= LOCATION OF POINT PNT092 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL		
X	-0.1686	-0.1681	0.0100	0.0100	-0.0005	0.0000	---	---
Y	6.0272	6.0268	0.0100	0.0100	0.0004	0.0000	---	---
Z	0.0783	0.0766	0.0100	0.0100	0.0016	0.0000	---	---
T	-0.0016	0.0000	0.0100	0.0100	-0.0016	0.0000	---	---

PNT093= AUTOMATIC VECTOR POINT

DIM LOC113= LOCATION OF POINT PNT093 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL		
X	-0.3169	-0.3161	0.0100	0.0100	-0.0008	0.0000	---	---
Y	7.7513	7.7510	0.0100	0.0100	0.0003	0.0000	---	---
Z	0.0386	0.0364	0.0100	0.0100	0.0022	0.0000	---	---
T	-0.0022	0.0000	0.0100	0.0100	-0.0022	0.0000	---	---

PNT094= AUTOMATIC VECTOR POINT

DIM LOC114= LOCATION OF POINT PNT094 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL		
X	-0.3443	-0.3428	0.0100	0.0100	-0.0015	0.0000	---	---
Y	9.5773	9.5770	0.0100	0.0100	0.0003	0.0000	---	---
Z	0.0873	0.0841	0.0100	0.0100	0.0031	0.0000	---	---
T	-0.0034	0.0000	0.0100	0.0100	-0.0034	0.0000	---	---

PNT095= AUTOMATIC VECTOR POINT

DIM LOC115= LOCATION OF POINT PNT095 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.4780	-0.4775	0.0100	0.0100	-0.0004	0.0000
Y	5.4958	5.4952	0.0100	0.0100	0.0006	0.0000
Z	0.0484	0.0466	0.0100	0.0100	0.0018	0.0000
T	-0.0018	0.0000	0.0100	0.0100	-0.0018	0.0000

PNT096= AUTOMATIC VECTOR POINT

DIM LOC116= LOCATION OF POINT PNT096 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.1193	-0.1188	0.0100	0.0100	-0.0005	0.0000
Y	2.8716	2.8711	0.0100	0.0100	0.0006	0.0000
Z	0.2434	0.2416	0.0100	0.0100	0.0018	0.0000
T	-0.0018	0.0000	0.0100	0.0100	-0.0018	0.0000

PNT097= AUTOMATIC VECTOR POINT

DIM LOC117= LOCATION OF POINT PNT097 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.4463	-0.4452	0.0100	0.0100	-0.0011	0.0000
Y	0.3121	0.3123	0.0100	0.0100	-0.0002	0.0000
Z	0.0433	0.0413	0.0100	0.0100	0.0020	0.0000
T	-0.0023	0.0000	0.0100	0.0100	-0.0023	0.0000

PNT098= AUTOMATIC VECTOR POINT

DIM LOC118= LOCATION OF POINT PNT098 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	0.0039	0.0048	0.0100	0.0100	-0.0008	0.0000
Y	0.3364	0.3370	0.0100	0.0100	-0.0006	0.0000
Z	0.3632	0.3634	0.0100	0.0100	-0.0003	0.0000
T	-0.0007	0.0000	0.0100	0.0100	-0.0007	0.0000

PNT099= AUTOMATIC VECTOR POINT

DIM LOC119= LOCATION OF POINT PNT099 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.0200	-0.0209	0.0100	0.0100	0.0009	0.0000
Y	2.8806	2.8813	0.0100	0.0100	-0.0007	0.0000
Z	0.3344	0.3353	0.0100	0.0100	-0.0008	0.0000
T	0.0011	0.0000	0.0100	0.0100	0.0011	0.0000

PNT100= AUTOMATIC VECTOR POINT

DIM LOC120= LOCATION OF POINT PNT100 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.0224	-0.0221	0.0100	0.0100	-0.0003	0.0000
Y	5.5534	5.5540	0.0100	0.0100	-0.0006	0.0000
Z	0.3656	0.3659	0.0100	0.0100	-0.0003	0.0000
T	-0.0001	0.0000	0.0100	0.0100	-0.0001	0.0000

PNT101= AUTOMATIC VECTOR POINT

DIM LOC121= LOCATION OF POINT PNT101 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.0280	-0.0368	0.0100	0.0100	0.0089	0.0000
Y	6.4250	6.4235	0.0100	0.0100	0.0015	0.0000
Z	1.6465	1.6466	0.0100	0.0100	-0.0002	0.0000
T	0.0090	0.0000	0.0100	0.0100	0.0090	0.0000

PNT102= AUTOMATIC VECTOR POINT

DIM LOC122= LOCATION OF POINT PNT102 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.0065	-0.0150	0.0100	0.0100	0.0085	0.0000
Y	6.0742	6.0718	0.0100	0.0100	0.0024	0.0000
Z	1.0813	1.0819	0.0100	0.0100	-0.0006	0.0000
T	0.0088	0.0000	0.0100	0.0100	0.0088	0.0000

PNT103= AUTOMATIC VECTOR POINT

DIM LOC123= LOCATION OF POINT PNT103 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
----	------	---------	------	------	-----	--------

X	-0.0028	-0.0098	0.0100	0.0100	0.0070	0.0000
Y	5.7974	5.7960	0.0100	0.0100	0.0014	0.0000
Z	0.5087	0.5086	0.0100	0.0100	0.0001	0.0000
T	0.0071	0.0000	0.0100	0.0100	0.0071	0.0000

PNT104= AUTOMATIC VECTOR POINT

DIM LOC124= LOCATION OF POINT PNT104 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.0769	-0.0785	0.0100	0.0100	0.0016	0.0000
Y	0.1725	0.1739	0.0100	0.0100	-0.0015	0.0000
Z	1.6500	1.6490	0.0100	0.0100	0.0010	0.0000
T	0.0022	0.0000	0.0100	0.0100	0.0022	0.0000

PNT105= AUTOMATIC VECTOR POINT

DIM LOC125= LOCATION OF POINT PNT105 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.1780	-0.1824	0.0100	0.0100	0.0044	0.0000
Y	0.0535	0.0578	0.0100	0.0100	-0.0043	0.0000
Z	1.0090	1.0083	0.0100	0.0100	0.0007	0.0000
T	0.0061	0.0000	0.0100	0.0100	0.0061	0.0000

PNT106= AUTOMATIC VECTOR POINT

DIM LOC126= LOCATION OF POINT PNT106 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.0240	-0.0253	0.0100	0.0100	0.0013	0.0000
Y	0.2181	0.2198	0.0100	0.0100	-0.0017	0.0000
Z	0.4099	0.4093	0.0100	0.0100	0.0006	0.0000
T	0.0022	0.0000	0.0100	0.0100	0.0022	0.0000

PNT107= AUTOMATIC VECTOR POINT

DIM LOC127= LOCATION OF POINT PNT107 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.1324	-0.1325	0.0100	0.0100	0.0001	0.0000
Y	0.1726	0.1719	0.0100	0.0100	0.0007	0.0000
Z	0.2703	0.2696	0.0100	0.0100	0.0007	0.0000
T	-0.0009	0.0000	0.0100	0.0100	-0.0009	0.0000

PNT108= AUTOMATIC VECTOR POINT

DIM LOC128= LOCATION OF POINT PNT108 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.3515	-0.3514	0.0100	0.0100	-0.0001	0.0000
Y	0.0850	0.0843	0.0100	0.0100	0.0007	0.0000
Z	0.2463	0.2453	0.0100	0.0100	0.0010	0.0000
T	-0.0011	0.0000	0.0100	0.0100	-0.0011	0.0000

PNT109= AUTOMATIC VECTOR POINT

DIM LOC129= LOCATION OF POINT PNT109 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.4741	-0.4739	0.0100	0.0100	-0.0002	0.0000
Y	0.1747	0.1737	0.0100	0.0100	0.0010	0.0000
Z	0.0751	0.0738	0.0100	0.0100	0.0014	0.0000
T	-0.0016	0.0000	0.0100	0.0100	-0.0016	0.0000

PNT110= AUTOMATIC VECTOR POINT

DIM LOC130= LOCATION OF POINT PNT110 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.5844	-0.5849	0.0100	0.0100	0.0004	0.0000
Y	0.1755	0.1752	0.0100	0.0100	0.0003	0.0000
Z	0.0415	0.0411	0.0100	0.0100	0.0005	0.0000
T	-0.0005	0.0000	0.0100	0.0100	-0.0005	0.0000

PNT111= AUTOMATIC VECTOR POINT

DIM LOC131= LOCATION OF POINT PNT111 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-1.4157	-1.4162	0.0100	0.0100	0.0004	0.0000
Y	0.0755	0.0752	0.0100	0.0100	0.0003	0.0000

Z 0.1278 0.1272 0.0100 0.0100 0.0005 0.0000 ---#---
 T -0.0006 0.0000 0.0100 0.0100 -0.0006 0.0000 ---#---

PNT112= AUTOMATIC VECTOR POINT

DIM LOC132= LOCATION OF POINT PNT112 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-2.2512	-2.2515	0.0100	0.0100	0.0003	0.0000 ---#---
Y	0.1524	0.1514	0.0100	0.0100	0.0010	0.0000 ---#---
Z	0.0385	0.0372	0.0100	0.0100	0.0013	0.0000 ---#---
T	-0.0017	0.0000	0.0100	0.0100	-0.0017	0.0000 ---#---

PNT113= AUTOMATIC VECTOR POINT

DIM LOC133= LOCATION OF POINT PNT113 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-2.3636	-2.3644	0.0100	0.0100	0.0008	0.0000 ---#---
Y	0.1471	0.1465	0.0100	0.0100	0.0006	0.0000 ---#---
Z	0.0678	0.0670	0.0100	0.0100	0.0008	0.0000 ---#---
T	-0.0012	0.0000	0.0100	0.0100	-0.0012	0.0000 ---#---

PNT114= AUTOMATIC VECTOR POINT

DIM LOC134= LOCATION OF POINT PNT114 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-2.4725	-2.4730	0.0100	0.0100	0.0005	0.0000 ---#---
Y	0.0527	0.0525	0.0100	0.0100	0.0002	0.0000 ---#---
Z	0.2407	0.2403	0.0100	0.0100	0.0004	0.0000 ---#---
T	-0.0005	0.0000	0.0100	0.0100	-0.0005	0.0000 ---#---

PNT115= AUTOMATIC VECTOR POINT

DIM LOC135= LOCATION OF POINT PNT115 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-2.7204	-2.7209	0.0100	0.0100	0.0005	0.0000 ---#---
Y	0.1308	0.1311	0.0100	0.0100	-0.0003	0.0000 ---#---
Z	0.2734	0.2733	0.0100	0.0100	0.0001	0.0000 ---#---
T	0.0000	0.0000	0.0100	0.0100	0.0000	0.0000 ---#---

INSP OF OTHER PROFILE PLANE INSIDE RADIUS (PROP/.0200 A B C)(PNT116-PNT148)

PNT116= AUTOMATIC VECTOR POINT

DIM LOC136= LOCATION OF POINT PNT116 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-2.8032	-2.8077	0.0100	0.0100	0.0045	0.0000 ---#---
Y	2.3695	2.3721	0.0100	0.0100	-0.0025	0.0000 ---#---
Z	1.6394	1.6395	0.0100	0.0100	-0.0001	0.0000 ---#---
T	0.0051	0.0000	0.0100	0.0100	0.0051	0.0000 ---#---

PNT117= AUTOMATIC VECTOR POINT

DIM LOC137= LOCATION OF POINT PNT117 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-2.8704	-2.8739	0.0100	0.0100	0.0035	0.0000 ---#---
Y	2.2800	2.2809	0.0100	0.0100	-0.0010	0.0000 ---#---
Z	1.0951	1.0951	0.0100	0.0100	0.0000	0.0000 ---#---
T	0.0035	0.0000	0.0100	0.0100	0.0035	0.0000 ---#---

PNT118= AUTOMATIC VECTOR POINT

DIM LOC138= LOCATION OF POINT PNT118 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-2.9023	-2.9053	0.0100	0.0100	0.0030	0.0000 ---#---
Y	2.3571	2.3589	0.0100	0.0100	-0.0018	0.0000 ---#---
Z	0.5880	0.5881	0.0100	0.0100	0.0000	0.0000 ---#---
T	0.0034	0.0000	0.0100	0.0100	0.0034	0.0000 ---#---

PNT119= AUTOMATIC VECTOR POINT

DIM LOC139= LOCATION OF POINT PNT119 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.0030	-3.0064	0.0100	0.0100	0.0034	0.0000 ---#---
Y	3.9973	3.9996	0.0100	0.0100	-0.0023	0.0000 ---#---
Z	0.5715	0.5715	0.0100	0.0100	0.0000	0.0000 ---#---

T 0.0040 0.0000 0.0100 0.0100 0.0040 0.0000 ---#---

PNT120= AUTOMATIC VECTOR POINT

DIM LOC140= LOCATION OF POINT PNT120 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-2.9709	-2.9734	0.0100	0.0100	0.0026	0.0000 ---#---
Y	3.9118	3.9129	0.0100	0.0100	-0.0011	0.0000 ---#---
Z	1.1156	1.1159	0.0100	0.0100	-0.0003	0.0000 ---#---
T	0.0027	0.0000	0.0100	0.0100	0.0027	0.0000 ---#---

PNT121= AUTOMATIC VECTOR POINT

DIM LOC141= LOCATION OF POINT PNT121 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-2.8973	-2.9009	0.0100	0.0100	0.0036	0.0000 ---#---
Y	4.0086	4.0109	0.0100	0.0100	-0.0023	0.0000 ---#---
Z	1.6492	1.6494	0.0100	0.0100	-0.0002	0.0000 ---#---
T	0.0042	0.0000	0.0100	0.0100	0.0042	0.0000 ---#---

PNT122= AUTOMATIC VECTOR POINT

DIM LOC142= LOCATION OF POINT PNT122 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.0326	-3.0379	0.0100	0.0100	0.0052	0.0000 ---#---
Y	5.7145	5.7158	0.0100	0.0100	-0.0013	0.0000 ---#---
Z	1.6103	1.6105	0.0100	0.0100	-0.0002	0.0000 ---#---
T	0.0053	0.0000	0.0100	0.0100	0.0053	0.0000 ---#---

PNT123= AUTOMATIC VECTOR POINT

DIM LOC143= LOCATION OF POINT PNT123 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.0625	-3.0659	0.0100	0.0100	0.0034	0.0000 ---#---
Y	5.8367	5.8393	0.0100	0.0100	-0.0026	0.0000 ---#---
Z	1.0125	1.0126	0.0100	0.0100	0.0000	0.0000 ---#---
T	0.0042	0.0000	0.0100	0.0100	0.0042	0.0000 ---#---

PNT124= AUTOMATIC VECTOR POINT

DIM LOC144= LOCATION OF POINT PNT124 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.1382	-3.1441	0.0100	0.0100	0.0059	0.0000 ---#---
Y	5.7155	5.7165	0.0100	0.0100	-0.0010	0.0000 ---#---
Z	0.5344	0.5347	0.0100	0.0100	-0.0003	0.0000 ---#---
T	0.0060	0.0000	0.0100	0.0100	0.0060	0.0000 ---#---

PNT125= AUTOMATIC VECTOR POINT

DIM LOC145= LOCATION OF POINT PNT125 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.1142	-3.1194	0.0100	0.0100	0.0052	0.0000 ---#---
Y	6.5126	6.5106	0.0100	0.0100	0.0020	0.0000 ---#---
Z	1.6364	1.6357	0.0100	0.0100	0.0008	0.0000 ---#---
T	0.0055	0.0000	0.0100	0.0100	0.0055	0.0000 ---#---

PNT126= AUTOMATIC VECTOR POINT

DIM LOC146= LOCATION OF POINT PNT126 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.1347	-3.1397	0.0100	0.0100	0.0049	0.0000 ---#---
Y	6.5699	6.5690	0.0100	0.0100	0.0009	0.0000 ---#---
Z	1.0319	1.0312	0.0100	0.0100	0.0007	0.0000 ---#---
T	0.0050	0.0000	0.0100	0.0100	0.0050	0.0000 ---#---

PNT127= AUTOMATIC VECTOR POINT

DIM LOC147= LOCATION OF POINT PNT127 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.1123	-3.1176	0.0100	0.0100	0.0054	0.0000 ---#---
Y	6.4991	6.4968	0.0100	0.0100	0.0024	0.0000 ---#---
Z	0.4164	0.4157	0.0100	0.0100	0.0007	0.0000 ---#---
T	0.0059	0.0000	0.0100	0.0100	0.0059	0.0000 ---#---

PNT128= AUTOMATIC VECTOR POINT

DIM LOC148= LOCATION OF POINT PNT128 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.1932	-3.1969	0.0100	0.0100	0.0037	0.0000 ---#---
Y	6.7652	6.7662	0.0100	0.0100	-0.0010	0.0000 ---#---
Z	1.7726	1.7671	0.0100	0.0100	0.0055	0.0000 ---#---
T	0.0066	0.0000	0.0100	0.0100	0.0066	0.0000 ---#---

PNT129= AUTOMATIC VECTOR POINT

DIM LOC149= LOCATION OF POINT PNT129 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.2288	-3.2331	0.0100	0.0100	0.0043	0.0000 ---#---
Y	7.9354	7.9362	0.0100	0.0100	-0.0008	0.0000 ---#---
Z	1.8141	1.8111	0.0100	0.0100	0.0030	0.0000 ---#---
T	0.0052	0.0000	0.0100	0.0100	0.0052	0.0000 ---#---

PNT130= AUTOMATIC VECTOR POINT

DIM LOC150= LOCATION OF POINT PNT130 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.1940	-3.1982	0.0100	0.0100	0.0042	0.0000 ---#---
Y	9.1493	9.1505	0.0100	0.0100	-0.0012	0.0000 ---#---
Z	1.7732	1.7689	0.0100	0.0100	0.0063	0.0000 ---#---
T	0.0076	0.0000	0.0100	0.0100	0.0076	0.0000 ---#---

PNT131= AUTOMATIC VECTOR POINT

DIM LOC151= LOCATION OF POINT PNT131 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.3355	-0.3317	0.0100	0.0100	-0.0037	0.0000 ---#---
Y	9.2075	9.2076	0.0100	0.0100	-0.0001	0.0000 ---#---
Z	1.7638	1.7583	0.0100	0.0100	0.0054	0.0000 ---#---
T	0.0066	0.0000	0.0100	0.0100	0.0066	0.0000 ---#---

PNT132= AUTOMATIC VECTOR POINT

DIM LOC152= LOCATION OF POINT PNT132 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.2416	-0.2389	0.0100	0.0100	-0.0027	0.0000 ---#---
Y	8.0035	8.0032	0.0100	0.0100	0.0004	0.0000 ---#---
Z	1.7956	1.7932	0.0100	0.0100	0.0024	0.0000 ---#---
T	0.0035	0.0000	0.0100	0.0100	0.0035	0.0000 ---#---

PNT133= AUTOMATIC VECTOR POINT

DIM LOC153= LOCATION OF POINT PNT133 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.2099	-0.2069	0.0100	0.0100	-0.0029	0.0000 ---#---
Y	6.8139	6.8136	0.0100	0.0100	0.0003	0.0000 ---#---
Z	1.7626	1.7581	0.0100	0.0100	0.0044	0.0000 ---#---
T	0.0053	0.0000	0.0100	0.0100	0.0053	0.0000 ---#---

PNT134= AUTOMATIC VECTOR POINT

DIM LOC154= LOCATION OF POINT PNT134 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.2682	-0.2622	0.0100	0.0100	-0.0061	0.0000 ---#---
Y	6.6100	6.6079	0.0100	0.0100	0.0021	0.0000 ---#---
Z	1.6399	1.6391	0.0100	0.0100	0.0008	0.0000 ---#---
T	0.0064	0.0000	0.0100	0.0100	0.0064	0.0000 ---#---

PNT135= AUTOMATIC VECTOR POINT

DIM LOC155= LOCATION OF POINT PNT135 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.2641	-0.2586	0.0100	0.0100	-0.0055	0.0000 ---#---
Y	6.6476	6.6462	0.0100	0.0100	0.0014	0.0000 ---#---
Z	0.9782	0.9755	0.0100	0.0100	0.0008	0.0000 ---#---
T	0.0056	0.0000	0.0100	0.0100	0.0056	0.0000 ---#---

PNT136= AUTOMATIC VECTOR POINT

DIM LOC156= LOCATION OF POINT PNT136 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.2743	-0.2679	0.0100	0.0100	-0.0065	0.0000 ---#---
Y	6.6041	6.6019	0.0100	0.0100	0.0022	0.0000 ---#---
Z	0.3954	0.3946	0.0100	0.0100	0.0008	0.0000 ---#---
T	0.0068	0.0000	0.0100	0.0100	0.0068	0.0000 ---#---

PNT137= AUTOMATIC VECTOR POINT

DIM LOC157= LOCATION OF POINT PNT137 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.2477	-0.2431	0.0100	0.0100	-0.0046	0.0000 ---#---
Y	5.8447	5.8460	0.0100	0.0100	-0.0013	0.0000 ---#---
Z	1.6362	1.6355	0.0100	0.0100	0.0007	0.0000 ---#---
T	0.0048	0.0000	0.0100	0.0100	0.0048	0.0000 ---#---

PNT138= AUTOMATIC VECTOR POINT

DIM LOC158= LOCATION OF POINT PNT138 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.2287	-0.2251	0.0100	0.0100	-0.0036	0.0000 ---#---
Y	5.7836	5.7840	0.0100	0.0100	-0.0004	0.0000 ---#---
Z	1.0467	1.0460	0.0100	0.0100	0.0007	0.0000 ---#---
T	0.0036	0.0000	0.0100	0.0100	0.0036	0.0000 ---#---

PNT139= AUTOMATIC VECTOR POINT

DIM LOC159= LOCATION OF POINT PNT139 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.2484	-0.2438	0.0100	0.0100	-0.0047	0.0000 ---#---
Y	5.8590	5.8605	0.0100	0.0100	-0.0015	0.0000 ---#---
Z	0.5291	0.5284	0.0100	0.0100	0.0007	0.0000 ---#---
T	0.0049	0.0000	0.0100	0.0100	0.0049	0.0000 ---#---

PNT140= AUTOMATIC VECTOR POINT

DIM LOC160= LOCATION OF POINT PNT140 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.1883	-0.1840	0.0100	0.0100	-0.0044	0.0000 ---#---
Y	4.0663	4.0682	0.0100	0.0100	-0.0019	0.0000 ---#---
Z	0.5732	0.5729	0.0100	0.0100	0.0003	0.0000 ---#---
T	0.0048	0.0000	0.0100	0.0100	0.0048	0.0000 ---#---

PNT141= AUTOMATIC VECTOR POINT

DIM LOC161= LOCATION OF POINT PNT141 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.1709	-0.1673	0.0100	0.0100	-0.0036	0.0000 ---#---
Y	3.9764	3.9769	0.0100	0.0100	-0.0005	0.0000 ---#---
Z	1.0998	1.0998	0.0100	0.0100	0.0000	0.0000 ---#---
T	0.0036	0.0000	0.0100	0.0100	0.0036	0.0000 ---#---

PNT142= AUTOMATIC VECTOR POINT

DIM LOC162= LOCATION OF POINT PNT142 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.1974	-0.1928	0.0100	0.0100	-0.0046	0.0000 ---#---
Y	4.0300	4.0315	0.0100	0.0100	-0.0015	0.0000 ---#---
Z	1.6517	1.6517	0.0100	0.0100	0.0000	0.0000 ---#---
T	0.0048	0.0000	0.0100	0.0100	0.0048	0.0000 ---#---

PNT143= AUTOMATIC VECTOR POINT

DIM LOC163= LOCATION OF POINT PNT143 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.1561	-0.1517	0.0100	0.0100	-0.0043	0.0000 ---#---
Y	2.4097	2.4112	0.0100	0.0100	-0.0015	0.0000 ---#---
Z	1.6408	1.6406	0.0100	0.0100	0.0003	0.0000 ---#---
T	0.0045	0.0000	0.0100	0.0100	0.0045	0.0000 ---#---

PNT144= AUTOMATIC VECTOR POINT

DIM LOC164= LOCATION OF POINT PNT144 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.1187	-0.1152	0.0100	0.0100	-0.0036	0.0000 ---#---

Y	2.3446	2.3448	0.0100	0.0100	-0.0002	0.0000	----	#----
Z	1.1182	1.1179	0.0100	0.0100	0.0003	0.0000	----	#----
T	0.0035	0.0000	0.0100	0.0100	0.0035	0.0000	----	#----

PNT145= AUTOMATIC VECTOR POINT

DIM LOC165= LOCATION OF POINT PNT145 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL		
X	-0.1299	-0.1251	0.0100	0.0100	-0.0048	0.0000	----	#----
Y	2.4416	2.4438	0.0100	0.0100	-0.0021	0.0000	----	#----
Z	0.6074	0.6071	0.0100	0.0100	0.0003	0.0000	----	#----
T	0.0052	0.0000	0.0100	0.0100	0.0052	0.0000	----	#----

PNT146= AUTOMATIC VECTOR POINT

DIM LOC166= LOCATION OF POINT PNT146 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL		
X	-0.7477	-0.7471	0.0100	0.0100	-0.0006	0.0000	----	#----
Y	5.3319	5.3331	0.0100	0.0100	-0.0012	0.0000	----	#----
Z	0.1575	0.1538	0.0100	0.0100	0.0037	0.0000	----	#----
T	0.0039	0.0000	0.0100	0.0100	0.0039	0.0000	----	#----

PNT147= AUTOMATIC VECTOR POINT

DIM LOC167= LOCATION OF POINT PNT147 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL		
X	-1.6920	-1.6918	0.0100	0.0100	-0.0002	0.0000	----	#----
Y	5.3191	5.3203	0.0100	0.0100	-0.0013	0.0000	----	#----
Z	0.1577	0.1546	0.0100	0.0100	0.0032	0.0000	----	#----
T	0.0034	0.0000	0.0100	0.0100	0.0034	0.0000	----	#----

PNT148= AUTOMATIC VECTOR POINT

DIM LOC168= LOCATION OF POINT PNT148 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL		
X	-2.6507	-2.6505	0.0100	0.0100	-0.0002	0.0000	----	#----
Y	5.3030	5.3051	0.0100	0.0100	-0.0021	0.0000	----	#----
Z	0.1614	0.1548	0.0100	0.0100	0.0065	0.0000	----	#----
T	0.0069	0.0000	0.0100	0.0100	0.0069	0.0000	----	#----

INSP OF OTHER PROFILE PLANE TOP FACE (PROP/.0200 A B C)(PNT149-PNT209)

PNT149= AUTOMATIC VECTOR POINT

DIM LOC169= LOCATION OF POINT PNT149 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL		
X	-3.1878	-3.1876	0.0100	0.0100	-0.0002	0.0000	----	#----
Y	6.3381	6.3385	0.0100	0.0100	-0.0005	0.0000	----	#----
Z	1.7232	1.7200	0.0100	0.0100	0.0032	0.0000	----	#----
T	0.0032	0.0000	0.0100	0.0100	0.0032	0.0000	----	#----

PNT150= AUTOMATIC VECTOR POINT

DIM LOC170= LOCATION OF POINT PNT150 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL		
X	-2.9848	-2.9842	0.0100	0.0100	-0.0006	0.0000	----	#----
Y	4.0748	4.0744	0.0100	0.0100	0.0004	0.0000	----	#----
Z	1.7215	1.7200	0.0100	0.0100	0.0015	0.0000	----	#----
T	0.0015	0.0000	0.0100	0.0100	0.0015	0.0000	----	#----

PNT151= AUTOMATIC VECTOR POINT

DIM LOC171= LOCATION OF POINT PNT151 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL		
X	-2.8631	-2.8625	0.0100	0.0100	-0.0006	0.0000	----	#----
Y	2.4353	2.4349	0.0100	0.0100	0.0004	0.0000	----	#----
Z	1.7215	1.7200	0.0100	0.0100	0.0015	0.0000	----	#----
T	0.0015	0.0000	0.0100	0.0100	0.0015	0.0000	----	#----

PNT152= AUTOMATIC VECTOR POINT

DIM LOC172= LOCATION OF POINT PNT152 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL		
X	-2.5853	-2.5846	0.0100	0.0100	-0.0006	0.0000	----	#----
Y	0.1015	0.1012	0.0100	0.0100	0.0004	0.0000	----	#----

Z	1.7199	1.7200	0.0100	0.0100	-0.0001	0.0000	----	#----
T	-0.0001	0.0000	0.0100	0.0100	-0.0001	0.0000	----	#----

PNT153= AUTOMATIC VECTOR POINT

DIM LOC173= LOCATION OF POINT PNT153 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL		
X	-1.3774	-1.3768	0.0100	0.0100	-0.0006	0.0000	----	#----
Y	0.0165	0.0161	0.0100	0.0100	0.0004	0.0000	----	#----
Z	1.7181	1.7200	0.0100	0.0100	-0.0019	0.0000	----	#----
T	-0.0019	0.0000	0.0100	0.0100	-0.0019	0.0000	----	#----

PNT154= AUTOMATIC VECTOR POINT

DIM LOC174= LOCATION OF POINT PNT154 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL		
X	-0.2053	-0.2047	0.0100	0.0100	-0.0006	0.0000	----	#----
Y	0.1381	0.1385	0.0100	0.0100	-0.0004	0.0000	----	#----
Z	1.7153	1.7200	0.0100	0.0100	-0.0047	0.0000	----	#----
T	-0.0047	0.0000	0.0100	0.0100	-0.0047	0.0000	----	#----

PNT155= AUTOMATIC VECTOR POINT

DIM LOC175= LOCATION OF POINT PNT155 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL		
X	-0.0998	-0.0992	0.0100	0.0100	-0.0006	0.0000	----	#----
Y	2.4717	2.4722	0.0100	0.0100	-0.0005	0.0000	----	#----
Z	1.7171	1.7200	0.0100	0.0100	-0.0029	0.0000	----	#----
T	-0.0029	0.0000	0.0100	0.0100	-0.0029	0.0000	----	#----

PNT156= AUTOMATIC VECTOR POINT

DIM LOC176= LOCATION OF POINT PNT156 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL		
X	-0.1064	-0.1058	0.0100	0.0100	-0.0006	0.0000	----	#----
Y	4.1068	4.1073	0.0100	0.0100	-0.0005	0.0000	----	#----
Z	1.7184	1.7200	0.0100	0.0100	-0.0016	0.0000	----	#----
T	-0.0016	0.0000	0.0100	0.0100	-0.0016	0.0000	----	#----

PNT157= AUTOMATIC VECTOR POINT

DIM LOC177= LOCATION OF POINT PNT157 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL		
X	-0.1276	-0.1270	0.0100	0.0100	-0.0006	0.0000	----	#----
Y	5.9024	5.9030	0.0100	0.0100	-0.0005	0.0000	----	#----
Z	1.7206	1.7200	0.0100	0.0100	0.0006	0.0000	----	#----
T	0.0006	0.0000	0.0100	0.0100	0.0006	0.0000	----	#----

PNT158= AUTOMATIC VECTOR POINT

DIM LOC178= LOCATION OF POINT PNT158 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL		
X	-0.1486	-0.1483	0.0100	0.0100	-0.0003	0.0000	----	#----
Y	6.3896	6.3900	0.0100	0.0100	-0.0004	0.0000	----	#----
Z	1.7218	1.7200	0.0100	0.0100	0.0018	0.0000	----	#----
T	0.0018	0.0000	0.0100	0.0100	0.0018	0.0000	----	#----

PNT159= AUTOMATIC VECTOR POINT

DIM LOC179= LOCATION OF POINT PNT159 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL		
X	-0.1495	-0.1489	0.0100	0.0100	-0.0006	0.0000	----	#----
Y	6.5695	6.5704	0.0100	0.0100	-0.0009	0.0000	----	#----
Z	1.7305	1.7270	0.0100	0.0100	0.0035	0.0000	----	#----
T	0.0036	0.0000	0.0100	0.0100	0.0036	0.0000	----	#----

PNT160= AUTOMATIC VECTOR POINT

DIM LOC180= LOCATION OF POINT PNT160 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL		
X	-0.1145	-0.1138	0.0100	0.0100	-0.0007	0.0000	----	#----
Y	6.7795	6.7819	0.0100	0.0100	-0.0024	0.0000	----	#----
Z	1.8114	1.8079	0.0100	0.0100	0.0035	0.0000	----	#----
T	0.0042	0.0000	0.0100	0.0100	0.0042	0.0000	----	#----

PNT161= AUTOMATIC VECTOR POINT

DIM LOC181= LOCATION OF POINT PNT161 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.1172	-0.1165	0.0100	0.0100	-0.0007	0.0000 ----#----
Y	6.9262	6.9286	0.0100	0.0100	-0.0024	0.0000 ----#----
Z	1.9487	1.9466	0.0100	0.0100	0.0021	0.0000 ----#----
T	0.0032	0.0000	0.0100	0.0100	0.0032	0.0000 ----#----

PNT162= AUTOMATIC VECTOR POINT

DIM LOC182= LOCATION OF POINT PNT162 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.1189	-0.1180	0.0100	0.0100	-0.0009	0.0000 ----#----
Y	6.9963	6.9951	0.0100	0.0100	0.0012	0.0000 ----#----
Z	2.0572	2.0571	0.0100	0.0100	0.0001	0.0000 ----#----
T	-0.0011	0.0000	0.0100	0.0100	-0.0011	0.0000 ----#----

PNT163= AUTOMATIC VECTOR POINT

DIM LOC183= LOCATION OF POINT PNT163 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.1325	-0.1319	0.0100	0.0100	-0.0006	0.0000 ----#----
Y	7.2803	7.2789	0.0100	0.0100	0.0014	0.0000 ----#----
Z	2.5598	2.5600	0.0100	0.0100	-0.0002	0.0000 ----#----
T	-0.0014	0.0000	0.0100	0.0100	-0.0014	0.0000 ----#----

PNT164= AUTOMATIC VECTOR POINT

DIM LOC184= LOCATION OF POINT PNT164 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.1362	-0.1358	0.0100	0.0100	-0.0004	0.0000 ----#----
Y	7.3434	7.3412	0.0100	0.0100	0.0021	0.0000 ----#----
Z	2.6630	2.6643	0.0100	0.0100	-0.0013	0.0000 ----#----
T	-0.0025	0.0000	0.0100	0.0100	-0.0025	0.0000 ----#----

PNT165= AUTOMATIC VECTOR POINT

DIM LOC185= LOCATION OF POINT PNT165 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.1536	-0.1534	0.0100	0.0100	-0.0003	0.0000 ----#----
Y	7.6856	7.6861	0.0100	0.0100	-0.0005	0.0000 ----#----
Z	2.8370	2.8398	0.0100	0.0100	-0.0028	0.0000 ----#----
T	-0.0028	0.0000	0.0100	0.0100	-0.0028	0.0000 ----#----

PNT166= AUTOMATIC VECTOR POINT

DIM LOC186= LOCATION OF POINT PNT166 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.1750	-0.1748	0.0100	0.0100	-0.0002	0.0000 ----#----
Y	8.1134	8.1134	0.0100	0.0100	0.0000	0.0000 ----#----
Z	2.4843	2.4835	0.0100	0.0100	0.0008	0.0000 ----#----
T	0.0002	0.0000	0.0100	0.0100	0.0002	0.0000 ----#----

PNT167= AUTOMATIC VECTOR POINT

DIM LOC187= LOCATION OF POINT PNT167 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.1743	-0.1741	0.0100	0.0100	-0.0002	0.0000 ----#----
Y	8.1209	8.1197	0.0100	0.0100	0.0012	0.0000 ----#----
Z	2.3480	2.3473	0.0100	0.0100	0.0007	0.0000 ----#----
T	0.0012	0.0000	0.0100	0.0100	0.0012	0.0000 ----#----

PNT168= AUTOMATIC VECTOR POINT

DIM LOC188= LOCATION OF POINT PNT168 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.1751	-0.1754	0.0100	0.0100	0.0003	0.0000 ----#----
Y	8.1213	8.1197	0.0100	0.0100	0.0016	0.0000 ----#----
Z	2.1142	2.1134	0.0100	0.0100	0.0007	0.0000 ----#----
T	0.0016	0.0000	0.0100	0.0100	0.0016	0.0000 ----#----

PNT169= AUTOMATIC VECTOR POINT

DIM LOC189= LOCATION OF POINT PNT169 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.1762	-0.1765	0.0100	0.0100	0.0003	0.0000 ----#----
Y	8.1327	8.1294	0.0100	0.0100	0.0033	0.0000 ----#----
Z	1.9964	1.9943	0.0100	0.0100	0.0021	0.0000 ----#----
T	0.0038	0.0000	0.0100	0.0100	0.0038	0.0000 ----#----

PNT170= AUTOMATIC VECTOR POINT

DIM LOC190= LOCATION OF POINT PNT170 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.1762	-0.1764	0.0100	0.0100	0.0002	0.0000 ----#----
Y	8.1631	8.1589	0.0100	0.0100	0.0042	0.0000 ----#----
Z	1.9561	1.9517	0.0100	0.0100	0.0044	0.0000 ----#----
T	0.0060	0.0000	0.0100	0.0100	0.0060	0.0000 ----#----

PNT171= AUTOMATIC VECTOR POINT

DIM LOC191= LOCATION OF POINT PNT171 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.1835	-0.1839	0.0100	0.0100	0.0004	0.0000 ----#----
Y	8.2010	8.1983	0.0100	0.0100	0.0028	0.0000 ----#----
Z	1.9319	1.9286	0.0100	0.0100	0.0034	0.0000 ----#----
T	0.0060	0.0000	0.0100	0.0100	0.0060	0.0000 ----#----

PNT172= AUTOMATIC VECTOR POINT

DIM LOC192= LOCATION OF POINT PNT172 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.1858	-0.1863	0.0100	0.0100	0.0005	0.0000 ----#----
Y	8.3055	8.3054	0.0100	0.0100	0.0001	0.0000 ----#----
Z	1.9174	1.9177	0.0100	0.0100	-0.0003	0.0000 ----#----
T	-0.0003	0.0000	0.0100	0.0100	-0.0003	0.0000 ----#----

PNT173= AUTOMATIC VECTOR POINT

DIM LOC193= LOCATION OF POINT PNT173 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.2093	-0.2098	0.0100	0.0100	0.0005	0.0000 ----#----
Y	8.7786	8.7786	0.0100	0.0100	0.0001	0.0000 ----#----
Z	1.9155	1.9177	0.0100	0.0100	-0.0023	0.0000 ----#----
T	-0.0023	0.0000	0.0100	0.0100	-0.0023	0.0000 ----#----

PNT174= AUTOMATIC VECTOR POINT

DIM LOC194= LOCATION OF POINT PNT174 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.2200	-0.2205	0.0100	0.0100	0.0005	0.0000 ----#----
Y	8.9171	8.9163	0.0100	0.0100	0.0008	0.0000 ----#----
Z	1.9179	1.9148	0.0100	0.0100	0.0031	0.0000 ----#----
T	0.0031	0.0000	0.0100	0.0100	0.0031	0.0000 ----#----

PNT175= AUTOMATIC VECTOR POINT

DIM LOC195= LOCATION OF POINT PNT175 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.2972	-0.2976	0.0100	0.0100	0.0004	0.0000 ----#----
Y	9.4118	9.4090	0.0100	0.0100	0.0029	0.0000 ----#----
Z	1.6873	1.6843	0.0100	0.0100	0.0030	0.0000 ----#----
T	0.0041	0.0000	0.0100	0.0100	0.0041	0.0000 ----#----

PNT176= AUTOMATIC VECTOR POINT

DIM LOC196= LOCATION OF POINT PNT176 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-0.3114	-0.3116	0.0100	0.0100	0.0003	0.0000 ----#----
Y	9.6404	9.6382	0.0100	0.0100	0.0023	0.0000 ----#----
Z	1.2116	1.2105	0.0100	0.0100	0.0012	0.0000 ----#----
T	0.0024	0.0000	0.0100	0.0100	0.0024	0.0000 ----#----

PNT177= AUTOMATIC VECTOR POINT

DIM LOC197= LOCATION OF POINT PNT177 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
----	------	---------	------	------	-----	--------

PART NUMBER=119A1212-601 DATE=2016-01-25 TIME=오후 7:18:16

PAGE#:=25

X	-0.3147	-0.3151	0.0100	0.0100	0.0004	0.0000	---#---
Y	9.6451	9.6434	0.0100	0.0100	0.0018	0.0000	---#---
Z	1.0472	1.0472	0.0100	0.0100	0.0000	0.0000	---#---
T	0.0017	0.0000	0.0100	0.0100	0.0017	0.0000	---#---

PNT178= AUTOMATIC VECTOR POINT

DIM LOC198= LOCATION OF POINT PNT178 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL	
X	-0.3230	-0.3233	0.0100	0.0100	0.0003	0.0000	---#---
Y	9.6464	9.6431	0.0100	0.0100	0.0034	0.0000	---#---
Z	0.2794	0.2794	0.0100	0.0100	0.0000	0.0000	---#---
T	0.0033	0.0000	0.0100	0.0100	0.0033	0.0000	---#---

PNT179= AUTOMATIC VECTOR POINT

DIM LOC199= LOCATION OF POINT PNT179 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL	
X	-0.5870	-0.5871	0.0100	0.0100	0.0001	0.0000	---#---
Y	9.6335	9.6294	0.0100	0.0100	0.0042	0.0000	---#---
Z	0.0848	0.0848	0.0100	0.0100	0.0000	0.0000	---#---
T	0.0041	0.0000	0.0100	0.0100	0.0041	0.0000	---#---

PNT180= AUTOMATIC VECTOR POINT

DIM LOC200= LOCATION OF POINT PNT180 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL	
X	-0.7220	-0.7231	0.0100	0.0100	0.0010	0.0000	---#---
Y	9.6312	9.6259	0.0100	0.0100	0.0053	0.0000	---#---
Z	0.0842	0.0842	0.0100	0.0100	0.0000	0.0000	---#---
T	0.0054	0.0000	0.0100	0.0100	0.0054	0.0000	---#---

PNT181= AUTOMATIC VECTOR POINT

DIM LOC201= LOCATION OF POINT PNT181 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL	
X	-0.9592	-0.9622	0.0100	0.0100	0.0030	0.0000	---#---
Y	9.7021	9.6974	0.0100	0.0100	0.0048	0.0000	---#---
Z	0.0867	0.0871	0.0100	0.0100	-0.0004	0.0000	---#---
T	0.0056	0.0000	0.0100	0.0100	0.0056	0.0000	---#---

PNT182= AUTOMATIC VECTOR POINT

DIM LOC202= LOCATION OF POINT PNT182 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL	
X	-1.1433	-1.1478	0.0100	0.0100	0.0045	0.0000	---#---
Y	9.8743	9.8713	0.0100	0.0100	0.0030	0.0000	---#---
Z	0.0901	0.0905	0.0100	0.0100	-0.0004	0.0000	---#---
T	0.0054	0.0000	0.0100	0.0100	0.0054	0.0000	---#---

PNT183= AUTOMATIC VECTOR POINT

DIM LOC203= LOCATION OF POINT PNT183 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL	
X	-1.2170	-1.2200	0.0100	0.0100	0.0030	0.0000	---#---
Y	9.9970	9.9947	0.0100	0.0100	0.0022	0.0000	---#---
Z	0.0873	0.0874	0.0100	0.0100	-0.0001	0.0000	---#---
T	0.0037	0.0000	0.0100	0.0100	0.0037	0.0000	---#---

PNT184= AUTOMATIC VECTOR POINT

DIM LOC204= LOCATION OF POINT PNT184 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL	
X	-1.7598	-1.7607	0.0100	0.0100	0.0009	0.0000	---#---
Y	10.3027	10.2988	0.0100	0.0100	0.0039	0.0000	---#---
Z	0.0886	0.0890	0.0100	0.0100	-0.0004	0.0000	---#---
T	0.0039	0.0000	0.0100	0.0100	0.0039	0.0000	---#---

PNT185= AUTOMATIC VECTOR POINT

DIM LOC205= LOCATION OF POINT PNT185 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL	
X	-2.3682	-2.3676	0.0100	0.0100	-0.0006	0.0000	---#---
Y	9.9834	9.9822	0.0100	0.0100	0.0012	0.0000	---#---

PART NUMBER=119A1212-601 DATE=2016-01-25 TIME=오후 7:18:16

PAGE#:=26

Z	0.0906	0.0910	0.0100	0.0100	-0.0004	0.0000	---#---
T	0.0012	0.0000	0.0100	0.0100	0.0012	0.0000	---#---

PNT186= AUTOMATIC VECTOR POINT

DIM LOC206= LOCATION OF POINT PNT186 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL	
X	-2.4456	-2.4438	0.0100	0.0100	-0.0018	0.0000	---#---
Y	9.8476	9.8457	0.0100	0.0100	0.0019	0.0000	---#---
Z	0.0907	0.0908	0.0100	0.0100	-0.0001	0.0000	---#---
T	0.0025	0.0000	0.0100	0.0100	0.0025	0.0000	---#---

PNT187= AUTOMATIC VECTOR POINT

DIM LOC207= LOCATION OF POINT PNT187 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL	
X	-2.6201	-2.6183	0.0100	0.0100	-0.0018	0.0000	---#---
Y	9.6807	9.6769	0.0100	0.0100	0.0038	0.0000	---#---
Z	0.0907	0.0910	0.0100	0.0100	-0.0003	0.0000	---#---
T	0.0042	0.0000	0.0100	0.0100	0.0042	0.0000	---#---

PNT188= AUTOMATIC VECTOR POINT

DIM LOC208= LOCATION OF POINT PNT188 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL	
X	-2.8384	-2.8380	0.0100	0.0100	-0.0003	0.0000	---#---
Y	9.6062	9.6008	0.0100	0.0100	0.0054	0.0000	---#---
Z	0.0944	0.0949	0.0100	0.0100	-0.0004	0.0000	---#---
T	0.0054	0.0000	0.0100	0.0100	0.0054	0.0000	---#---

PNT189= AUTOMATIC VECTOR POINT

DIM LOC209= LOCATION OF POINT PNT189 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL	
X	-2.9729	-2.9736	0.0100	0.0100	0.0007	0.0000	---#---
Y	9.6020	9.5968	0.0100	0.0100	0.0052	0.0000	---#---
Z	0.0945	0.0949	0.0100	0.0100	-0.0004	0.0000	---#---
T	0.0052	0.0000	0.0100	0.0100	0.0052	0.0000	---#---

PNT190= AUTOMATIC VECTOR POINT

DIM LOC210= LOCATION OF POINT PNT190 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL	
X	-3.2578	-3.2585	0.0100	0.0100	0.0007	0.0000	---#---
Y	9.6016	9.5966	0.0100	0.0100	0.0050	0.0000	---#---
Z	0.3014	0.3021	0.0100	0.0100	-0.0007	0.0000	---#---
T	0.0050	0.0000	0.0100	0.0100	0.0050	0.0000	---#---

PNT191= AUTOMATIC VECTOR POINT

DIM LOC211= LOCATION OF POINT PNT191 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL	
X	-3.2549	-3.2556	0.0100	0.0100	0.0007	0.0000	---#---
Y	9.6008	9.5966	0.0100	0.0100	0.0042	0.0000	---#---
Z	1.0598	1.0604	0.0100	0.0100	-0.0006	0.0000	---#---
T	0.0042	0.0000	0.0100	0.0100	0.0042	0.0000	---#---

PNT192= AUTOMATIC VECTOR POINT

DIM LOC212= LOCATION OF POINT PNT192 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL	
X	-3.2519	-3.2526	0.0100	0.0100	0.0007	0.0000	---#---
Y	9.5964	9.5917	0.0100	0.0100	0.0046	0.0000	---#---
Z	1.2171	1.2168	0.0100	0.0100	0.0004	0.0000	---#---
T	0.0046	0.0000	0.0100	0.0100	0.0046	0.0000	---#---

PNT193= AUTOMATIC VECTOR POINT

DIM LOC213= LOCATION OF POINT PNT193 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL	
X	-3.2451	-3.2458	0.0100	0.0100	0.0007	0.0000	---#---
Y	9.3730	9.3700	0.0100	0.0100	0.0030	0.0000	---#---
Z	1.6888	1.6863	0.0100	0.0100	0.0024	0.0000	---#---
T	0.0039	0.0000	0.0100	0.0100	0.0039	0.0000	---#---

PNT194= AUTOMATIC VECTOR POINT

DIM LOC214= LOCATION OF POINT PNT194 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.2947	-3.2955	0.0100	0.0100	0.0007	0.0000 ----#----
Y	8.8575	8.8563	0.0100	0.0100	0.0013	0.0000 ----#----
Z	1.9297	1.9263	0.0100	0.0100	0.0034	0.0000 ----#----
T	0.0035	0.0000	0.0100	0.0100	0.0035	0.0000 ----#----

PNT195= AUTOMATIC VECTOR POINT

DIM LOC215= LOCATION OF POINT PNT195 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.2947	-3.2955	0.0100	0.0100	0.0007	0.0000 ----#----
Y	8.7325	8.7316	0.0100	0.0100	0.0009	0.0000 ----#----
Z	1.9322	1.9285	0.0100	0.0100	0.0037	0.0000 ----#----
T	0.0037	0.0000	0.0100	0.0100	0.0037	0.0000 ----#----

PNT196= AUTOMATIC VECTOR POINT

DIM LOC216= LOCATION OF POINT PNT196 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.2947	-3.2955	0.0100	0.0100	0.0007	0.0000 ----#----
Y	8.2460	8.2450	0.0100	0.0100	0.0010	0.0000 ----#----
Z	1.9321	1.9286	0.0100	0.0100	0.0035	0.0000 ----#----
T	0.0035	0.0000	0.0100	0.0100	0.0035	0.0000 ----#----

PNT197= AUTOMATIC VECTOR POINT

DIM LOC217= LOCATION OF POINT PNT197 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.2941	-3.2948	0.0100	0.0100	0.0007	0.0000 ----#----
Y	8.1534	8.1507	0.0100	0.0100	0.0026	0.0000 ----#----
Z	1.9411	1.9357	0.0100	0.0100	0.0054	0.0000 ----#----
T	0.0059	0.0000	0.0100	0.0100	0.0059	0.0000 ----#----

PNT198= AUTOMATIC VECTOR POINT

DIM LOC218= LOCATION OF POINT PNT198 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.2927	-3.2933	0.0100	0.0100	0.0007	0.0000 ----#----
Y	8.1092	8.1039	0.0100	0.0100	0.0053	0.0000 ----#----
Z	1.9698	1.9653	0.0100	0.0100	0.0045	0.0000 ----#----
T	0.0069	0.0000	0.0100	0.0100	0.0069	0.0000 ----#----

PNT199= AUTOMATIC VECTOR POINT

DIM LOC219= LOCATION OF POINT PNT199 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.2936	-3.2942	0.0100	0.0100	0.0006	0.0000 ----#----
Y	8.0816	8.0762	0.0100	0.0100	0.0054	0.0000 ----#----
Z	2.0094	2.0074	0.0100	0.0100	0.0020	0.0000 ----#----
T	0.0058	0.0000	0.0100	0.0100	0.0058	0.0000 ----#----

PNT200= AUTOMATIC VECTOR POINT

DIM LOC220= LOCATION OF POINT PNT200 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.2918	-3.2924	0.0100	0.0100	0.0006	0.0000 ----#----
Y	8.0720	8.0674	0.0100	0.0100	0.0047	0.0000 ----#----
Z	2.1075	2.1083	0.0100	0.0100	-0.0007	0.0000 ----#----
T	0.0046	0.0000	0.0100	0.0100	0.0046	0.0000 ----#----

PNT201= AUTOMATIC VECTOR POINT

DIM LOC221= LOCATION OF POINT PNT201 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.2942	-3.2946	0.0100	0.0100	0.0004	0.0000 ----#----
Y	8.0707	8.0673	0.0100	0.0100	0.0033	0.0000 ----#----
Z	2.3686	2.3679	0.0100	0.0100	0.0007	0.0000 ----#----
T	0.0033	0.0000	0.0100	0.0100	0.0033	0.0000 ----#----

PNT202= AUTOMATIC VECTOR POINT

DIM LOC222= LOCATION OF POINT PNT202 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.2921	-3.2925	0.0100	0.0100	0.0004	0.0000 ----#----
Y	8.0636	8.0614	0.0100	0.0100	0.0022	0.0000 ----#----
Z	2.4933	2.4923	0.0100	0.0100	0.0010	0.0000 ----#----
T	0.0024	0.0000	0.0100	0.0100	0.0024	0.0000 ----#----

PNT203= AUTOMATIC VECTOR POINT

DIM LOC223= LOCATION OF POINT PNT203 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.2911	-3.2915	0.0100	0.0100	0.0005	0.0000 ----#----
Y	7.6409	7.6400	0.0100	0.0100	0.0009	0.0000 ----#----
Z	2.8538	2.8507	0.0100	0.0100	0.0030	0.0000 ----#----
T	0.0030	0.0000	0.0100	0.0100	0.0030	0.0000 ----#----

PNT204= AUTOMATIC VECTOR POINT

DIM LOC224= LOCATION OF POINT PNT204 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.2917	-3.2919	0.0100	0.0100	0.0002	0.0000 ----#----
Y	7.2928	7.2922	0.0100	0.0100	0.0006	0.0000 ----#----
Z	2.6808	2.6806	0.0100	0.0100	0.0002	0.0000 ----#----
T	-0.0004	0.0000	0.0100	0.0100	-0.0004	0.0000 ----#----

PNT205= AUTOMATIC VECTOR POINT

DIM LOC225= LOCATION OF POINT PNT205 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.2915	-3.2917	0.0100	0.0100	0.0002	0.0000 ----#----
Y	7.2343	7.2340	0.0100	0.0100	0.0002	0.0000 ----#----
Z	2.5863	2.5856	0.0100	0.0100	0.0007	0.0000 ----#----
T	0.0002	0.0000	0.0100	0.0100	0.0002	0.0000 ----#----

PNT206= AUTOMATIC VECTOR POINT

DIM LOC226= LOCATION OF POINT PNT206 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.2950	-3.2952	0.0100	0.0100	0.0002	0.0000 ----#----
Y	6.9334	6.9336	0.0100	0.0100	-0.0003	0.0000 ----#----
Z	2.0549	2.0539	0.0100	0.0100	0.0011	0.0000 ----#----
T	0.0008	0.0000	0.0100	0.0100	0.0008	0.0000 ----#----

PNT207= AUTOMATIC VECTOR POINT

DIM LOC227= LOCATION OF POINT PNT207 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.2944	-3.2947	0.0100	0.0100	0.0002	0.0000 ----#----
Y	6.8701	6.8717	0.0100	0.0100	-0.0017	0.0000 ----#----
Z	1.9526	1.9505	0.0100	0.0100	0.0020	0.0000 ----#----
T	0.0026	0.0000	0.0100	0.0100	0.0026	0.0000 ----#----

PNT208= AUTOMATIC VECTOR POINT

DIM LOC228= LOCATION OF POINT PNT208 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.2821	-3.2821	0.0100	0.0100	0.0001	0.0000 ----#----
Y	6.6894	6.6912	0.0100	0.0100	-0.0018	0.0000 ----#----
Z	1.7833	1.7891	0.0100	0.0100	0.0042	0.0000 ----#----
T	0.0045	0.0000	0.0100	0.0100	0.0045	0.0000 ----#----

PNT209= AUTOMATIC VECTOR POINT

DIM LOC229= LOCATION OF POINT PNT209 UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
X	-3.2172	-3.2172	0.0100	0.0100	-0.0001	0.0000 ----#----
Y	6.4873	6.4875	0.0100	0.0100	-0.0002	0.0000 ----#----
Z	1.7282	1.7235	0.0100	0.0100	0.0047	0.0000 ----#----
T	0.0046	0.0000	0.0100	0.0100	0.0046	0.0000 ----#----

INSP OF FLATNESS DATUM -A- (FLT/.0100)

(Geometrical Tolerances - Flatness.1)

DATUM_A_FLT= AUTOMATIC PLANE Measured from 2 hits

PART NUMBER=119A1212-601 DATE=2016-01-25 TIME=오후 7:18:16 PAGE#=29

DIM FLAT1= FLATNESS OF PLANE DATUM_A_FLT UNITS=IN

AX	MEAS	NOMINAL	+TOL	-TOL	DEV	OUTTOL
M	0.0001	0.0000	0.0100	0.0000	0.0001	0.0000 #-----

====> END OF AUTO PROGRAM MEASURING <=====

END OF MEASUREMENT FOR

PN=119A1212-601

DWG=A

SN=

TOTAL # OF MEAS =880 # CUT OF TOL =0 # OF HOURS =00:36:16

5W-16-0238

1/19

Process: NDT (PT)	공정 Check List (Process Check List) Routing Sheet		Rev. No : 11 Rev. Date: 2015.09.07 Ctrol No : PI73-01
고객 (Customer)	KAL	규격 (Specification)	BAC 5423 (W), BSS 7039 (C) SW-PI-73 (12), SW-PI-78(04)
품명 (Part Name)	침투 감조	품번 (Part Number)	침투 감조
Order Number	침투 감조	Lot Number	PT 160119-01
Serial Number	N/A	Project	B 737
수량 (Quantity)	80%	샘플 수량 (Sample Quantity)	N/A
Material	N/A	Work Date	2016.1.19

※ 침투 검사 전, 침투 탐상 공정에 대한 점검 사항을 확인할 것. 부적합 발생 시, 작업을 중단하고 QM부서에 통보할 것 (Prior to Penetrant Examination, shall check the verification about Penetrant Examination. If occur the non-conformance, shall notify to QM dept.)

Step	공정 순서 (Process Sequence)	Actual Results	확인 (Verify)
1	수입 검사 (Incoming Inspection) ☒ Smeared part ☐ Non Smeared part		M/I
※ "smearing part" 또는 "Non smearing part" 인지 확인하고 다음 공정으로 이동 Verify the part whether "smearing part" or "Non-smearing part", move next operation.			
2	필요 시, 용제탈지(Solvent degrease,if necessary)(3min~5min)	N/A min	
3	필요 시, 랙킹 (Racking, if necessary)		
4	알카리 탈지 (Alkaline Clean) (5 min~10 min, 44 °C~55 °C)	50 °C 7 min	M/I
5	Rinse (1 min~5 min)	3 min	
6	Water Break Test (Min. 30 sec)	35 sec	M/I
7	De-Oxidizing/Etching ☐ 에칭 미적용(Not Apply the etching), 1min ~ 10min ☒ 에칭 적용(Apply the etching), Refer to SW-PI-78(Table I)	76 min	M/I
8	Rinse (Min. 10 min)	12 min	
9	Air-Blower, if necessary (As required)		
10	건조 상태 확인 후, Racking After checking dry statues, Racking		
11	침투액 적용 (Penetrant application) ※침투액이 고르게 적용되었는지를 확인하고 다음 공정으로 이동. Verify penetrant applying uniformity on Parts, move next operation.	Batch No: 12k095	M/I
12	침투액 유지 (Penetrant Dwell) (10 min ~ 120 min) ※침투액 유지 시간이 최대 시간을 초과하였을 경우, 재작업 실시 Reprocess parts exceeding the maximum dwell time.	15 min	
13	세척 (Cleaning)		
14	건조 (Drying) (49±8 °C, Max. 30 min) ※ 부품 전체가 건조되었는지를 확인하고, 다음 공정으로 이동 Verify dry condition of all surface of parts, move next operation	50 °C 18 min	M/I
15	현상제 적용 (Developer application) ※현상액이 고르게 적용되었는지를 확인하고 다음 공정으로 이동. Verify Developer applying uniformity on Parts, move next operation.	Batch No: 12k134	M/I
16	현상제 유지 (Developer Dwell) (10 min ~ 60 min) ※현상제 유지 시간이 최대 시간을 초과하였을 경우, 재작업 실시 Reprocess parts exceeding the maximum developer time.	15 min	

Process: NDT (PT)		공정 Check List (Process Check List) Routing Sheet		Rev. No : 11 Rev. Date: 2015.09.07 Ctrol No : PI73-01	
Step	공정 순서 (Process Sequence)	Actual Results	확인(Verify)		
※ 부품에서 발견된 지시결함의 재-평가가 필요할 경우 17 Step부터 수행을 하며, 재-평가가 필요하지 않을 경우 판정을 수행한다. (When need the re-evaluation about questionable indication on parts, shall perform the process from 17 Step. Otherwise, implement the judgment.)					
17	면봉 또는 Wiper 에 솔벤트를 조금 적신다. Lightly dampen a cotton swab or wiper with solvent.	Batch No: 121107k			
18	면봉 또는 Wiper를 한방향으로 돌리면서 지시를 닦는다. Wipe the indication, in one direction only, rotating the swab or wiper as it passed over the indication.				
19	곧바로 현상제를 적용(Immediately apply developer)	Batch No: 11B03k			
20	유지 시간 (10분 ~ 60분)을 준다. Allow for normal development time (10 minutes ~ 60 minutes).	15 min			
▶ 지시결함이 아닐 경우, 이 Check sheet를 종료. 의심나는 지시결함일 경우, 21번 공정을 다시 수행 If not indication, complete this check sheet with judgment. If questionable relevant indication, implement 5 step.					
21	면봉 또는 Wiper 에 솔벤트를 조금 적신다. Lightly dampen a cotton swab or wiper with solvent.	Batch No:	M/I		
22	면봉 또는 Wiper를 한방향으로 돌리면서 지시를 닦는다. Wipe the indication, in one direction only, rotating the swab or wiper as it passed over the indication.		M/I		
23	곧바로 현상제를 적용(Immediately apply developer)	Batch No:	M/I		
24	유지 시간 (10분 ~ 60분)을 준다. Allow for normal development time (10 minutes ~ 60 minutes).	min	M/I		
[Note]: 지시결함을 자세하게 기입할 것 (Please record the information of indication on parts detaily.)					
※ 합격 기준은 고객 규격 (BAC 5423, BSS7039)의 요구사항을 따른다. The standard of acceptance shall meet in accordance with customer specification (BAC5423, BSS7039)					
판 정 (Judgment)		☐ 지시결함 (Indication)		☒ 비관련 지시 (Non-relevant indication)	
작성일 (Date Issued): 2016.1.19		검사자 (Inspected by): Level 2 이영철			



SAM WOO METAL INDUSTRIES CO., LTD

HEAD OFFICE AND PLANT#1: 53 Seongju-ro, Seongsan-gu, Changwon-city 642-090 South Korea

Tel.: (+82-55-282-4236), fax. : (+82-55-285-7882)

PLANT #2: 97-15 Seongju-ro, Seongsan-gu, Changwon-city 642-090 South Korea

Tel.: (+82-55-298-8722-4), fax. : (+82-55-298-8725)

Certification of Conformance

To: KOREAN AIR.

File No.: SW-16-0238

1) Project : B737

2) Process : Refer to below applied process

3) Process Batch No. : PT160119-01

4) Manufactured items are as follow table;

No	W/O No	Part No	Part Name	Q'ty	Applied Process
1	15957655	119A1212-601	CHANNEL FWD	2	Penetrant inspection per BAC 5423 W, BSS7039 C.
2	15957656	119A1212-602	CHANNEL FWD	2	Penetrant inspection per BAC 5423 W, BSS7039 C.
3	15957658	119A1212-604	CHANNEL AFT	2	Penetrant inspection per BAC 5423 W, BSS7039 C.
4	15957657	119A1212-603	CHANNEL AFT	2	Penetrant inspection per BAC 5423 W, BSS7039 C.
			BLANK		

5) We hereby certify that the items covered by this document have been inspected and tested and conform to drawing, P.O and applicable specifications. This is substantiated by our own inspection and test. Satisfactory documentary evidence is on file. And quality system controlled by AS/EN 9100 certificate GB04/63080.



Jan.19.2016

Sung-Mun Seo / Quality Manager
Quality Management Department

5W-16-0239

1/19

Process		Boric acid-Sulfuric acid Anodizing		공정 체크 LIST(PCL) Routing sheet				Rev No. : 010 Rev. date : 15.10.16 Ctrl No : PI69-01	
Customer	K A L	Part Name	천 북 창 조	Part No.	천 북 창 조	Project	B737	Rework	N/A
Spec.	BAC5632 D. MIL-A-8625, TY. IC F. SW-PI-69 F.	MQS No.	-	Material	-	Work date	19 JAN 2016	Date	N/A
Order No	천 북 창 조	Lot No.	BS16019-01	Q'ty	8EA	Specimen Q'ty	N/A		

※ 작업 전 용액분석 결과를 확인할 것. 부적합 사항 발생 시 작업 중단 후 즉시 관련부서에 통보하십시오.

The analysis result of solution must verified, if occurred not to meet specified requirement in processing stop the operation and notify the QA engineers.

OP No.	공정 단계 Process step	주요 관리 항목/관련 절차서 Description of work / Procedure	시간 Time	온도 Temp.	전압 Volt.	수량 Q'ty	인장/서명 Stamp/Sign	일자 Date
1	수입 검사 Incoming inspection	응력제거, 슛피닝, 경도등 이전 공정 및 흠, 피트, 찍힘 확인 Check the pre-process such as stress relief, shot peening, hardness and part shall be free from blemishes, pits, dent and other irregularities / Refer to SWS-QA08-200.				8EA	003 SMI	19 JAN 2016
2	용제 탈지 Solvent degrease	필요시(If necessary) 시간(Time) : 3 ~ 5 min.	N/A				M N/A	
3	마스킹 및 랙킹 Mask and rack	MQS에 의거 마스킹 및 랙킹 수행 확인. ※ 필요시 (If necessary) Verify whether masking or racking per MQS. * Masking materials : N/A					003 SMI	19 JAN 2016
4	알카리 탈지 Alkaline clean	온도(Temperature) : 45 ~ 55 ℃, 시간(Time) : 5 ~ 10 min.	7min	48℃			003 SMI	19 JAN 2016
5	수 세 (Rinse)	시간(Time) : 1 ~ 2 min. * Note 1) 시간(Time) : 1 ~ 2 min. * Note 1)	96sec 96sec					
6	Water break test	물깨짐 현상이 없는지 30초이상 확인하십시오. 표면에 물깨짐이 없이 흘러내려야 한다. Check water-break free for at least 30 seconds. Water run down on surface without Water break.	28sec				003 SMI	19 JAN 2016
7	탈산처리 Deoxidizing	시간(Time) : 1 ~ 10 min.	4min				003 SMI	19 JAN 2016
8	수 세 (Rinse)	시간(Time) : 1 ~ 2 min. * Note 1) 시간(Time) : 1 ~ 2 min. * Note 1)	96sec 102sec					

Process		Boric acid-Sulfuric acid Anodizing	공정 체크 LIST(PCL) Routing sheet				Rev No. : 010 Rev. date : 15.10.16 Ctrl No : PI69-01		
OP No.	공정 단계 Process step	주요 관리 항목/관련 절차서 Description of work / Procedure	시간 Time	온도 Temp.	전압 Volt.	수량 Q'ty	인장/서명 Stamp/Sign	일자 Date	
9	Water break test	물깨짐 현상이 없는지 30초이상 확인하시오. 표면에 물깨짐이 없이 흘러내려야 한다. Check water-break free for at least 30 seconds. Water run down on surface without Water break.	36sec				003 SMI	19 JAN 2016	
10	붕산-황산 양극산화피막 Boric acid-Sulfuric acid Anodizing	온도(Temperature) : 24.5 ~ 28.9 °C 시간(Time) : 18 ~ 22 min 전압(Volt.) : Max. 5V/min 상승(Rise), 최종전압(Final Volt) : 15±1V 완료 시간 (Finish Time) : (10:00)	20min	27°C	15V	8EA	003 SMI	19 JAN 2016	
11	수 세 (Rinse)	시간(Time) : 1 ~ 5 min. 시간(Time) : 2 ~ 10 min.	4min 6min						
12	묽은 크롬산염 봉공 처리 Dilute chromate Sealing	필요시 Class 1 만 적용 (If necessary, Class 1 Only) 온도(Temperature) : 88 ~ 93 °C 시간(Time) : 23 ~ 28 min.	N/A				M N/A		
13	수 세 (Rinse) 필요시 (If necessary)	시간(Time) : Max. 30 sec. 시간(Time) : Max. 30 sec.	24sec 24sec						
14	건 조 (Dry)	온도(Temperature) : 71 °C 이하(Maximum), 시간(Time) : 필요한 만큼(As req'd)	5min	60°C			003 SMI	19 JAN 2016	
15	마스킹 제거 De-mask	완벽하게 마스킹이 제거되었는지 확인하시오. 필요시(If necessary) Verify whether masking material has been removed from parts perfectly.					M N/A		
16	검 사 Inspection	외관 검사(Appearance inspection) / Refer to MQS.	T/Q'ty 8EA	A/Q'ty 8EA			013 SMI	19 JAN 2016	
17	포장 및 취급 Package and handling	SWS-QA10-300 및 고객의 요구사항에 따라 실시하시오. Per SWS-QA10-300 and requirements of customer					013 SMI	19 JAN 2016	
18	출 하 delivery	고객의 요청시에 그 요구사항에 따라 출하하시오. Make a delivery(shipment) as requested, if required by customer.				8EA	013 SMI	19 JAN 2016	

Note 1) 용액이 고여 있을 수 있는 제품에 대해서는 제품을 수세수에서 최소 10분간 침지한다.
Where solution entrapment is possible, immerse the parts in cold water for 10 minutes minimum.



SAM WOO METAL INDUSTRIES CO., LTD

HEAD OFFICE AND PLANT#1: 53 Seongju-ro, Seongsan-gu, Changwon-city 642-090 South Korea

Tel.: (+82-55-282-4236), fax. : (+82-55-285-7882)

PLANT #2: 97-15 Seongju-ro, Seongsan-gu, Changwon-city 642-090 South Korea

Tel.: (+82-55-298-8722-4), fax. : (+82-55-298-8725)

Certification of Conformance

To: KOREAN AIR.

File No.: SW-16-0239

1) Project : B737

2) Process : Refer to below applied process

3) Process Batch No. : BS160119-01

4) Manufactured items are as follow table;

No	W/O No	Part No	Part Name	Q'ty	Applied Process
1	15957655	119A1212-601	CHANNEL FWD	2	BORIC ACID-SULFURIC ACID ANODIZE PER BAC5632 D. CLASS 5
2	15957656	119A1212-602	CHANNEL FWD	2	BORIC ACID-SULFURIC ACID ANODIZE PER BAC5632 D. CLASS 5
3	15957658	119A1212-604	CHANNEL AFT	2	BORIC ACID-SULFURIC ACID ANODIZE PER BAC5632 D. CLASS 5
4	15957657	119A1212-603	CHANNEL AFT	2	BORIC ACID-SULFURIC ACID ANODIZE PER BAC5632 D. CLASS 5
			BLANK		

5) We hereby certify that the items covered by this document have been inspected and tested and conform to drawing, P.O and applicable specifications. This is substantiated by our own inspection and test. Satisfactory documentary evidence is on file. And quality system controlled by AS/EN 9100 certificate GB04/63080.



Sung-Mun Seo

Jan.19.2016

Sung-Mun Seo / Quality Manager
Quality Management Department

5w-16-0240

1/19

Process		EPOXY PRIMER		공정 체크 LIST(PCL) Routing sheet				Rev No. : 008 Rev. data : 15.10.16 Ctrl No : PI75-01	
Customer	K A L	Part Name	충북 합조	Part No.	충북 합조	Project	B1737	Rework	N/A
Spec	BAC 5736. W SW-PI-75. F	MQS No.	-	Material	-	Work date	19 JAN 2016	Date	N/A
Order No	충북 합조	Lot No.	PC160119-02	Q'ty	8EA	Specimen Q'ty	N/A		

※ 작업 진행 중 부적합 사항 발생 시, 작업 중단 후 즉시 관련부서에 통보하십시오.

If occurred not to meet specified requirement on processing, immediately stop the operation and notify the related departments.

OP No.	공정 단계 Process step	주요 관리 항목/관련 절차서 Description of work / Procedure	시간 Time	온도 Temp.	습도 Humi.	수량 Q'ty	인장/서명 Stamp/Sign	일자 Date
1	수입 검사 Incoming inspection	이전 공정이 있을 경우, 이전 공정을 확인하십시오. 흠, 피트 찍힘 등의 부적합 면이 없어야 한다. If pre-process is existence, Check the pre-process. Shall be free from blemishes, pits, dent and other irregularities. / Per SWS-QA08-200 Primer 적용 제한 시간(Time limit to primer) CrO ₃ Anodizing : (Sealing part : 48hours), (Unsealing part : 16 hours) Boric acid-Sulfuric acid Anodizing(Unsealing part) : 16hours Chemical conversion coating : 48hours (48~72hours : Protection Required)				8EA	007 SMI	19 JAN 2016
2	표면 세정 Surface cleaning	표면에 이물질 존재 시 M.E.K를 사용하여 세정할 것. If the foreign substance existed on surface, clean the part to use M.E.K.				8EA	007 SMI	19 JAN 2016
3	마스킹과 랙킹 Mask and rack	마스킹 및 랙킹 수행 확인. (필요시) Verify whether the masking or racking (If necessary). * Masking materials : N/A					007 SMI	19 JAN 2016
4	Primer 준비 Preparation of Primer	자재규격(Material spec.) : BMS 10-11 Ty I, CI A, GR A Base Batch No. : (04120308), Curing agent Batch No. : (84191022) Shaking Time : 10 ~ 15 min. 혼합비율(Mixing rate) : 부피비 (Vol.%) - Primer : 경화제(Curing agent) : Thinner = 1 : 1 (1 : 1) 혼합 시간(Mixing Finish Time) : (12:30) 점도 (Viscosity) : 30±5 sec. (Using #1 Zahn cup) 혼합 후 유지시간(Induction Time after mixing) : 30분 이상 (Min.30 min)	2min				007 SMI	19 JAN 2016
			28sec				010 SMI	19 JAN 2016
			3min				007 SMI	19 JAN 2016

Process		EPOXY PRIMER		공정 체크 LIST(PCL) Routing sheet				Rev No. : 008 Rev. data : 15.10.16 Ctrl No : PI75-01		
OP No.	공정 단계 Process step	주요 관리 항목/관련 절차서 Description of work / Procedure		시간 Time	온도 Temp.	습도 Humi.	수량 Q'ty	인장/서명 Stamp/Sign	일자 Date	
* 용기 수명은 8시간 이하이며, 혼합 후 코팅까지 8시간을 넘기면 안 된다. Pot life is Maximum 8 hours, shall not be exceed 8 hours from mixing to coating.										
5	프라이머 코팅 Primer coating	Start time : (12:00) , Finish time : (14:00) 온도(Temp.) : above 10℃, 습도(Humi.) : below 85%		1HR	21℃	52%	8EA	007 SMI	19 JAN 2016	
6	자연 경화 Air-dried	Time : 15분 이상 (Min. 15min.) 온도 : Room Temperature.		20min						
7	마스킹 제거 De-mask	완벽하게 마스킹이 제거되었는지 확인하십시오. (If necessary) Verify whether masking material has been removed from parts perfectly.						M		
8	Oven 경화	시간(Time) : 1시간 (1 hrs.) 온도(Temp.) : 60℃ (140°F) 필요시, 틈새부위 Touch-up. (If necessary, Touch-up the gab) 완료 후 검사 (Inspection after Complete)		1HR	60℃			007 SMI	19 JAN 2016	
9	프라이머 두께 Primer Thickness	One Coat : 7.6 ~ 20.3μm (0.0003 ~ 0.0008") Two Coat : 20.3 ~ 40.6μm (0.0008 ~ 0.0016") 경화 후 코팅두께(thickness of after curing) : (0.00095 ~ 0.0014").						007 SMI	19 JAN 2016	
10	검 사 Inspection	외관 검사(Appearance inspection) / Refer to SW-PI-75 Para. 9.1.		T/Q'ty	A/Q'ty			010 SMI	19 JAN 2016	
				8EA	8EA					
		최종 코팅 두께 (Thickness of the final coated parts. Apply to primer) 요구치 (Requirement) One Coat : 7.6 ~ 20μm (0.0003 ~ 0.0008") Two Coat : 20.3 ~ 40.6μm (0.0008 ~ 0.0016") 측정치(Actual) : (0.00095 ~ 0.0014")		8EA	8EA					
		접착력(Adhesion) : On Parts / Refer to SW-PI-75 Para. 9.3 * AI Rod adhesion Test : ☒ Accept / ☐ Reject * Dry adhesion Test : ☒ Accept / ☐ Reject * Wet adhesion Test : ☒ Accept / ☐ Reject		8EA	8EA					
		용매 저항성 시험 : SW-PI-75 Para. 9.3 Solvent Resistance Test (Apply To Primer)		4EA	4EA					
11	포장 및 취급 Package and Handling	SWS-QA10-300 및 고객의 요구사항에 따라 실시 Per SWS-QA10-300 and requirements of customer						010 SMI	19 JAN 2016	
12	출하 Delivery	고객의 요청시에 그 요구사항에 따라 출하하십시오. Make a delivery(shipment) as requested, if required by customer.					8EA	010 SMI	19 JAN 2016	

[illegible]



SAM WOO METAL INDUSTRIES CO., LTD

HEAD OFFICE AND PLANT#1: 53 Seongju-ro, Seongsan-gu, Changwon-city 642-090 South Korea

Tel.: (+82-55-282-4236), fax. : (+82-55-285-7882)

PLANT #2: 97-15 Seongju-ro, Seongsan-gu, Changwon-city 642-090 South Korea

Tel.: (+82-55-298-8722-4), fax. : (+82-55-298-8725)

Certification of Conformance

To: KOREAN AIR.

File No.: SW-16-0240

- 1) Project : B737
- 2) Process : Refer to below applied process
- 3) Process Batch No. : PC160119-02
- 4) Manufactured items are as follow table;

No	W/O No	Part No	Part Name	Q'ty	Applied Process
1	15957655	119A1212-601	CHANNEL FWD	2	Primer Coating per BAC5736
2	15957656	119A1212-602	CHANNEL FWD	2	Primer Coating per BAC5736
3	15957658	119A1212-604	CHANNEL AFT	2	Primer Coating per BAC5736
4	15957657	119A1212-603	CHANNEL AFT	2	Primer Coating per BAC5736
			BLANK		

- 5) We hereby certify that the items covered by this document have been inspected and tested and conform to drawing, P.O and applicable specifications. This is substantiated by our own inspection and test. Satisfactory documentary evidence is on file. And quality system controlled by AS/EN 9100 certificate GB04/63080.



Jan.19.2016

Sung-Mun Seo / Quality Manager
Quality Management Department