

	DOCUMENT TITLE: Internal Quality Audit Final Report	Revision: A
	DOCUMENT #: FM3-QM.SLQ017	Effective Date: 25Sep2020

Internal Quality Audit Final Report

AREA OR SECTION OF QUALITY SYSTEM AUDITED:	Current Good Manufacturing Practices 21 CFR Part 820; ISO 13485:2016 Sections 5.6, 6, 7, and 8
AUDIT NUMBER:	22-01
DATE(S) OF AUDIT:	September 28 – 29, 2022
DATE OF REPORT:	07 Oct 2022
PURPOSE OF AUDIT:	GMP Audit
AUDITOR(S):	Bryan Wong
APPLICABLE STANDARDS:	21 CFR 820, ISO 13485:2016
FINDINGS: (REFERENCE APPROPRIATE CAPA NUMBER, IF APPLICABLE)	Two (2) findings were observed during the audit. Finding No.: Finding #1 Audit Criteria: 21 CFR Part 820, ISO 13485:2016 Corrective Action Plan Due Date: 07 Nov 2022 Corrective Action Implementation Due Date: 09 Jan 2023 Document Ref #: Training SOP, QP-017 Rev E Action Required: Submit corrective action plan Finding: No evidence of qualifications for the role of production assemblers. Requirement: 21 CFR 820.25 Personnel (a) <i>"General. Each manufacturer shall have sufficient personnel with the necessary education, background, training, and experience to assure that all activities required by this part are correctly performed."</i> ISO 13485:2016 cl. 6.2 <i>"Personnel performing work affecting product quality shall be competent on the basis of appropriate education, training, skills and experience."</i> Objective Evidence:



DOCUMENT TITLE:
Internal Quality Audit Final Report

Revision:
A

DOCUMENT #:
FM3-QM.SLQ017

Effective Date:
25Sep2020

There were no CV's or resumes for Amalia Fuller or Eva Tamayo on file to support qualifications for their job description.

Finding No.: Finding #2

Audit Criteria: 21 CFR Part 820, ISO 13485:2016

Corrective Action Plan Due Date: 07 Nov 2022

Corrective Action Implementation Due Date: 09 Jan 2023

Document Ref #: Training SOP, QP-017 Rev E

Action Required: Submit corrective action plan

Finding:

Personnel performing work on product Lot #'s SLQ1610-012022 and SLQ1610-012122 per applicable procedures MP-SLQ-0001 Rev A and MP-SLQ-0002 Rev A were trained after the dates the work was performed. See MP-SLQ-0001 Rev A training records for Sean Tamayo, Amalia Fuller, and Eva Tamayo. See MP-SLQ-0002 Rev A training record for Will Hail.

Requirement:

21 CFR 820.25 Personnel (b)

"Training. Each manufacturer shall establish procedures for identifying training needs and ensure that all personnel are trained to adequately perform their assigned responsibilities. Training shall be documented."

ISO 13485:2016 cl. 6.2 (b)

"The organization shall: ...

b) provide training or take other actions to achieve or maintain the necessary competence"

Objective Evidence:

During review of DHR for Lot #'s SLQ1610-012022 and SLQ1610-012122, it was noted the personnel who performed work on the batches which included Sean Tamayo, Amalia Fuller, Eva Tamayo, and Will Hail. In subsequent review of personnel training records, it was found that the training records for manufacturing procedures MP-SLQ-0001 Rev A and MP-SLQ-0002 Rev A were dated after the work performed on Lot #'s SLQ1610-012022 and SLQ1610-012122.

RECOMMENDATIONS:

There was a total of ten (10) observations observed during the audit summarized below. For additional details, see the internal quality audit checklist.



DOCUMENT TITLE:
Internal Quality Audit Final Report

Revision:
A

DOCUMENT #:
FM3-QM.SLQ017

Effective Date:
25Sep2020

Observation #1

In review of DHRs for Lot #'s SLQ1610-012022 and SLQ1610-012122, there are empty fields for the secondary lot information. Should be marked N/A per Section 6.1.7 of the Quality Records SOP. [QP-003 Rev F]

ISO 13485:2016 Section 6 – Resource Management

Observation #2

In review of Larry Dacoron's (Quality Engineer) training records, no training record exists for MP-SLQ-0001 Rev A. As the quality reviewer of device history records, it is recommended to be trained to applicable procedures (MP-SLQ-0002, MP-SLQ-0001, TM-HDX-0001, TM-HDX-0002) of the process in order to adequately review the performed tasks and data of the processes. [ISO 13485:2016 cl. 6.2 (b), 21 CFR 820.25 (b)]

ISO 13485:2016 Section 7 – Product Realization

Observation #3

Supporting documentation to support the operation and maintenance requirements of the automated foley catheter coater equipment (Asset # ES-0091-01) could not be found in document control. Reviewed IQ Checklist for the Automated Foley Catheter Coater Equipment (TR-0117 Rev A). [ISO 13485:2016 cl. 7.6, 21 CFR 820.72]

Observation #4

In review of DHRs for Lot #'s SLQ1610-012022 and SLQ1610-012122, the work order number format does not conform to the format specified in Section 7.2 of Work Order procedure. [WI-0006 Rev D]

Observation #5

Recommend providing traceability to customer purchase order number in a work order. Reviewed DHRs for Lot #'s SLQ1610-012022 and SLQ1610-012122. [ISO 13485:2016 cl. 7.2.1]

Observation #6

In review of TM-HDX-0001 Rev A and TM-HDX-0002 Rev A, no acceptance criteria specified. However, Inspection Record Templates for SLQ-8004 A include acceptance criteria.



DOCUMENT TITLE:
Internal Quality Audit Final Report

Revision:
A

DOCUMENT #:
FM3-QM.SLQ017

Effective Date:
25Sep2020

Recommendation to update test method procedures to include appropriate acceptance criteria. [ISO 13485:2016 cl. 7.2.1 (a)]

Observation #7

In review of receiving inspection records for pouch HDX-5001 Rev A (Lot #A199054) and catheter SLQ-6004 Rev A (Lot #20211122), there is no reference to the purchase order number. Recommend referencing the PO for traceability. Additionally, a quantity of 7000 was received for HDX-5001 Rev A (Lot # A199054) under Pathway PO-1285, however, this quantity does not match the associated Silq PO# 0000044. [ISO 13485:2016 cl. 7.4.2 & 7.4.3, 21 CFR 820.50 (b)]

Observation #8

In review of DHRs for Lot #'s SLQ1610-012022 and SLQ1610-012122, BOM Item No. 2 (Polymer Solution) was indicated as substitute that was used. However, based on review of inspection records for Polymer Solution (Lot #HYX-111921A), the part number and revision should be SLQ-3000 Rev A. Recommend correcting DHR's to indicate primary material designation was used. [ISO 13485:2016 cl. 7.5.1]

Observation #9

In review of the supplier survey form FM-0049 Rev B completed by Ningbo Yingmed Medical Instruments on 7/27/22, they indicated that the company had been inspected by the FDA and are undergoing regulatory action, however, they did not include an explanation on the form. Recommend to follow up with the supplier. [ISO 13485:2016 cl. 7.4.1, 21 CFR 820.50 (a)(1)]

ISO 13485:2016 Section 6 – Measurement, analysis and improvement

Observation #10

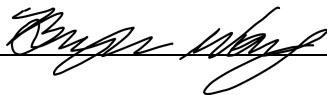
In review of CAPA No's 21-0010 and 21-0011, it is not clear if CAPAs were closed. It is recommended to update the CAPA form (FM-0020 Rev A) to include a CAPA closure section to conform with Section 7.7 of the CAPA SOP. [QP-023 Rev D]

CONCLUSIONS:

Based on the evidence observed, it is concluded that the management system is largely in conformity with the audit criteria and can be considered effective in assuring that the organization's objectives will be met and to ensure compliance to applicable regulatory and customer requirements. The two

	DOCUMENT TITLE: Internal Quality Audit Final Report	Revision: A
	DOCUMENT #: FM3-QM.SLQ017	Effective Date: 25Sep2020

	(2) findings of nonconformity and ten (10) observations are determined to be correctable and to not impact the overall determination of conformity of Pathway's QMS and customer product. A corrective action plan should be implemented in order to address the findings and observations before they become significant issues.
ADDITIONAL COMMENTS:	See attached internal quality audit checklist 22-01 for details of audit notes.

Auditor Signature: 
 Date: 19 Oct 2022