

Technical Service Information

THM 4L60-E

NEW DESIGN OUTPUT SHAFT SPEED SENSOR

CHANGE:

Beginning at the start of production for 1996 models, some THM 4L60-E transmissions were built with a new design Output Shaft Speed Sensor, as shown in Figure 1. Corvette models will be the only vehicle that will continue to use the previous design speed sensor, as shown in

Figure 1.

REASON:

Ease of assembly and cost savings.

PARTS AFFECTED:

(1) EXTENSION HOUSING - New casting with smaller speed sensor bore diameter, to accept the new design Output Shaft Speed Sensor, as shown in Figure 1.

SERVICE INFORMATION:


Output Shaft Speed Sensor (Previous Design)	
Output Shaft Speed Sensor (1996 New Design)	


Copyright © 2000 ATSG




Technical Service Information

1996 SPEED SENSORS

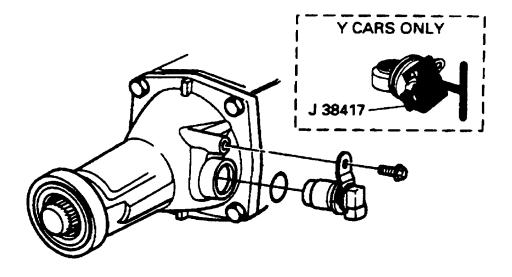

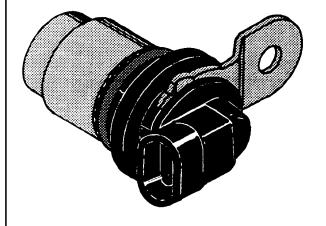

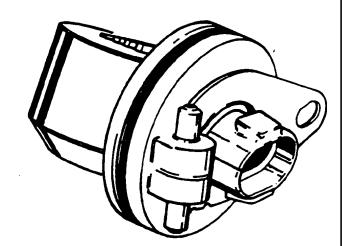

1996 SPEED SENSOR ALL "EXCEPT" CORVETTE PART NUMBER 10456194 1996 SPEED SENSOR CORVETTE ONLY PART NUMBER 8673299