



FAMAX QC SYSTEM

IPQC, IQC & OQC

Faiz Fazli

faiz.fazli@fmefamax.com


Table of Contents

GENERAL USER GUIDE	2
USER GUIDE BY ROLE ACCESS	8
ENGINEER ACCESS	10
REGISTER ACCESS	13
PRODUCTION ACCESS.....	18


GENERAL USER GUIDE

1. Enter Famax QC System by clicking this link
<http://192.168.0.5/FamaxQCSysstem/index.html>

2. Main page will show as below image.

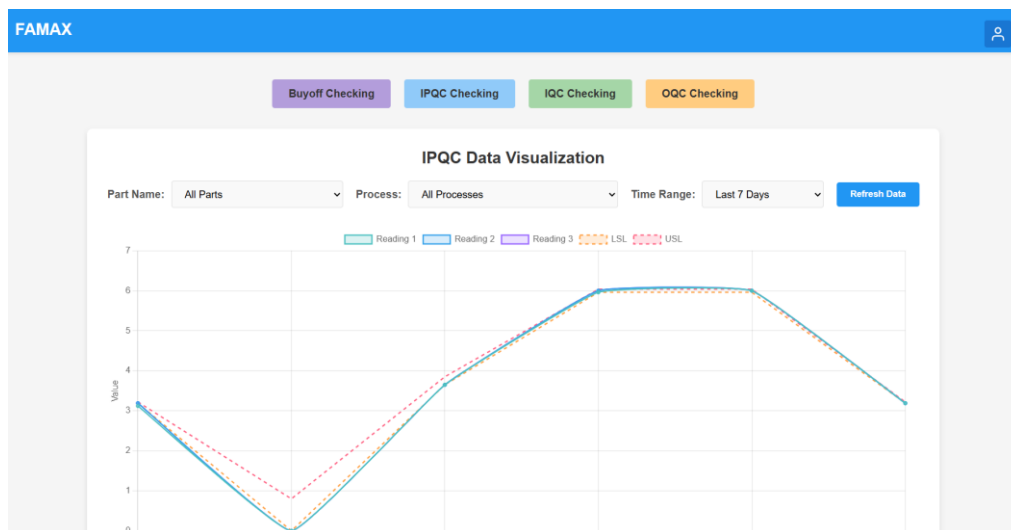

3. The user can/only click the button in red box.

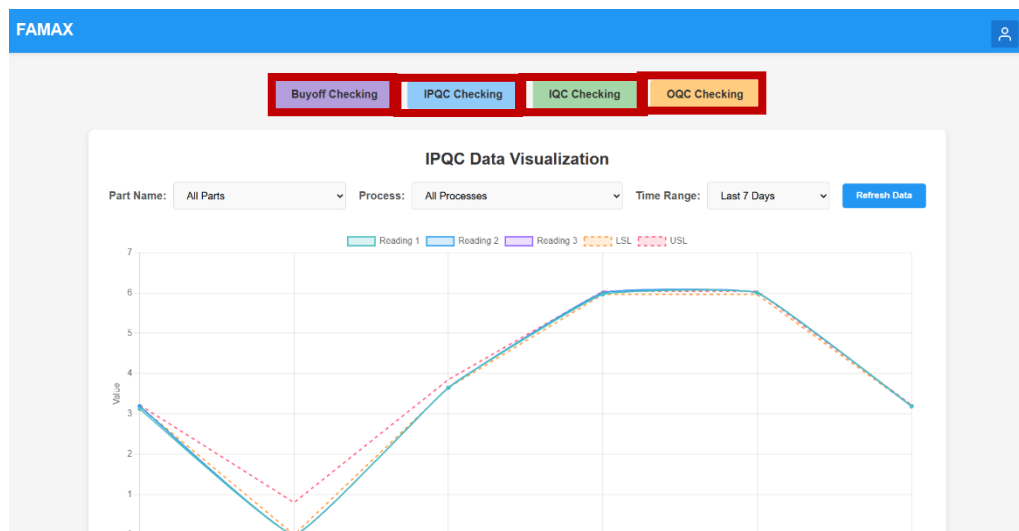

4. When user performing
 - i. IPQC – Then click “IPQC Checking” button.
 - ii. IQC – Then click “IQC Checking” button.
 - iii. OQC – Then click “OQC Checking” button.

5. The image shows what happens once “IPQC Checking” button is clicked.
- First you must select Part Name from the dropdown box.

IPQC Checking System

Part and Process Selection

Select Part Name:

Search and select

MC 704 STEM

© 2025 Farnax System. All rights reserved.

- Then all IPQC process related to the part chosen will be shown. Select the process.

IPQC Checking System

Part and Process Selection

Select Part Name:

MC 704 STEM

Select Process:

Search and select

CUTTING

ID & LENGTH TURNING (T4)

ID BORE & OD TURN (T3)

MILLING & TAP (M2)

MILLING POLISH EDGE (P43)

- Then, system will ask for JO Number and select machine number from the dropdown and click “Continue” button.

IPQC Checking System

Part and Process Selection

Select Part Name:

MC 704 STEM

Select Process:

CUTTING

Select Job Order Number:

17032025

Select Machine Number:

PP01

Continue

© 2025 Farnax System. All rights reserved.

6. This will be the screen after clicking “Continue”.
 - a. Fill in the checker’s name in the first red box
 - b. Fill in the reading for each zone.
 - c. After that click next to process.

Note : Wrong values would prompt telegram alert, so make sure take correct reading.

IPQC Checking System

Part: CATHODE / CHOKE COLLAR	Process: SWISS AUTO LATHE MACHINING	Job Order: 1234567	Machine: PP01
---------------------------------	--	-----------------------	------------------

Person Name:

123456

Machine : Swiss Auto-Lathe Machining
Surface Roughness Ra 0.8 (4)
No Dented, No Burr, Break Edges

Zone 1: 1 (MIC)

Drawing Zone	Measuring Instrument	Min or OK	Max or NG	SC
1 (MIC)	CMM	3.19	3.22	QC

Reading 1 for Zone 1:

Reading 2 for Zone 1:

Reading 3 for Zone 1:

Back
Next

© 2025 Famax System. All rights reserved.


- d. Complete all reading zones and click submit all reading buttons.

IPQC Reference Image

Part: CATHODE / CHOKE COLLAR Process: SWISS AUTO LATHE MACHINING Job Order: 1234567 Machine: PP01

Person Name: Faiz Ikhwan

1 2 3 4 5 6

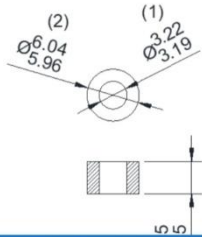

Machine : Swiss Auto-Lathe Machining
Surface Roughness Ra 0.8 (4)
No Dented, No Burr, Break Edges

IPQC Checking System

Zone 6: 4

Drawing Zone	Measuring Instrument	Min or OK	Max or NG	SC
4	RT	0	0.8	QC

Reading 1 for Zone 6:
0.8


Reading 2 for Zone 6:
0.8

Reading 3 for Zone 6:
0.9

Back Submit All Readings

© 2025 Farnax System. All rights reserved.

7. Message will prompt out if there is out of spec measurements and this will notify management.

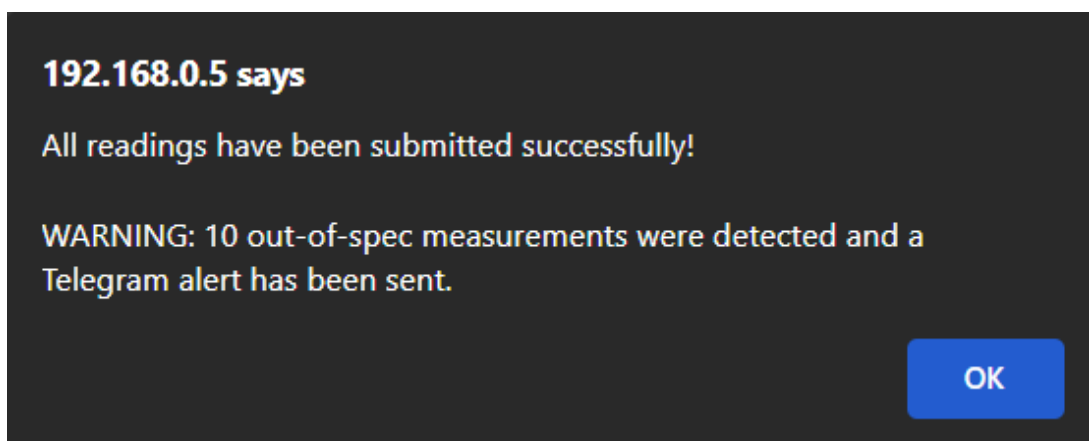

8. You will then be redirected to summary page where you can see the wrong readings. The red column shows wrong reading, so take necessary action like informing technician or engineer.

- a. Click on “Finish” button

IPQC Checking System

Inspection Summary

Part:
CATHODE / CHOKE COLLAR

Process:
SWISS AUTO LATHE MACHINING

Job Order:
1234567

Machine:
PP01

Person Name:
Faiz Ikhwani

Zone 1: 1 (MIC)

Measurement	Reading 1	Reading 2	Reading 3
Range: 3.19 - 3.22	3.08	3.23	3.52

Zone 2: 1 (MMC)

Measurement	Reading 1	Reading 2	Reading 3
Range: 3.19 - 3.22	3.19	3.29	3.29

Zone 3: 2 (MIC)

Measurement	Reading 1	Reading 2	Reading 3
Range: 5.96 - 6.04	5.95	5.98	6.05

Zone 4: 2 (MMC)

Measurement	Reading 1	Reading 2	Reading 3
Range: 5.96 - 6.04	5.96	5.96	6.00

Zone 5: 3

Measurement	Reading 1	Reading 2	Reading 3
Range: 3.65 - 3.85	3.9	3.85	3.86

Zone 6: 4

Measurement	Reading 1	Reading 2	Reading 3
Range: 0 - 0.8	0.8	0.8	0.9

Finish

© 2025 Famax System. All rights reserved.


9. It will prompt this message and click “OK”

192.168.0.5 says

Suggested filename for saving: 20251024_170801_CATHODE/_CHOKE_COLLAR_SWISS_AUTO_LATHE_MACHINING.pdf


OK

10. Choose Save as PDF and click Save.

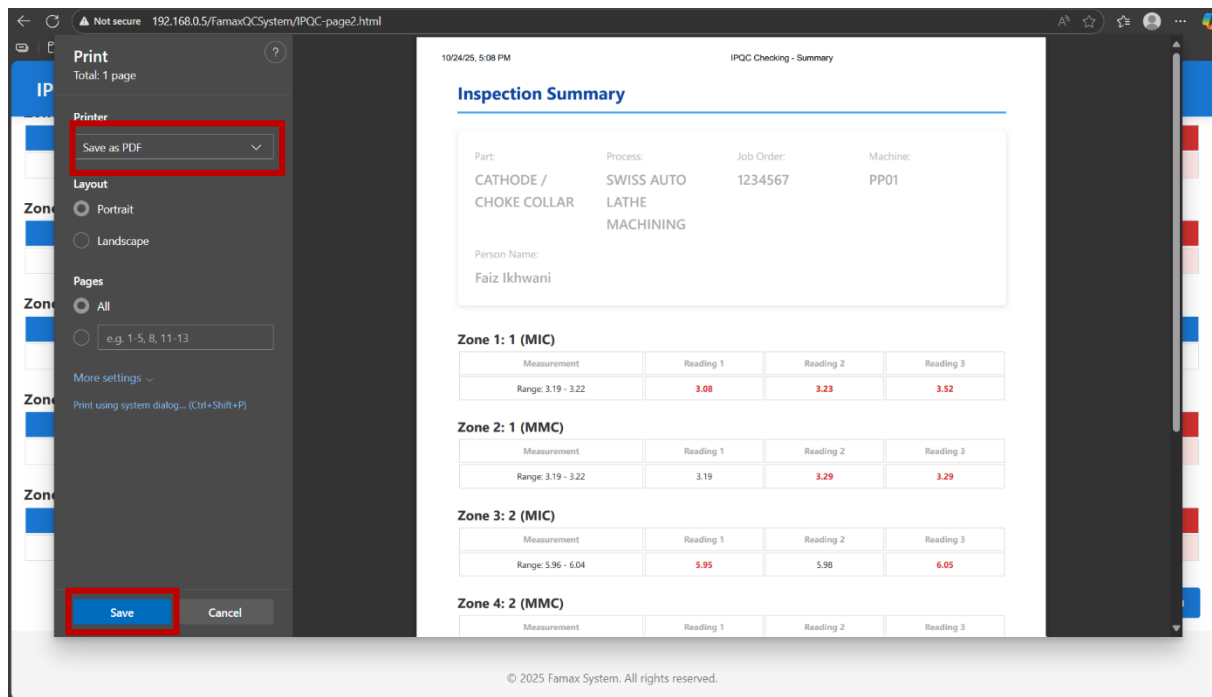


11. It will return to the main page.

12. All process is the same for IPQC, IQC and OQC but for IQC and OQC have and button “Inspection Guide”. If click that button, then you can straight view inspection guide if you have anything to refer.

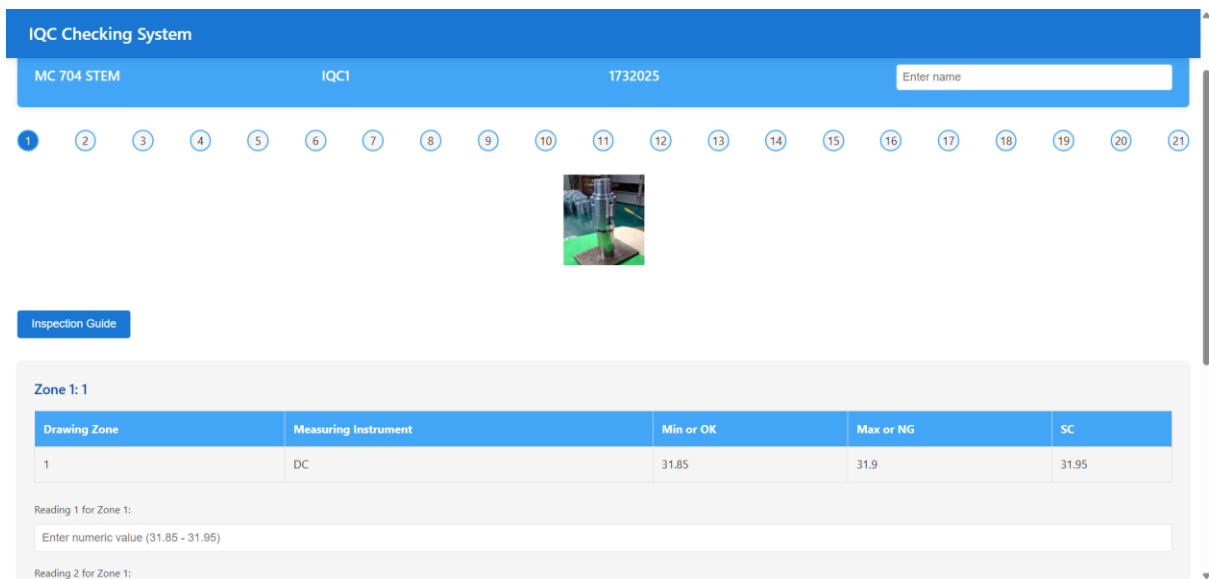

USER GUIDE BY ROLE ACCESS

1. There is a login button. Click the button. This is accessible with credential only.

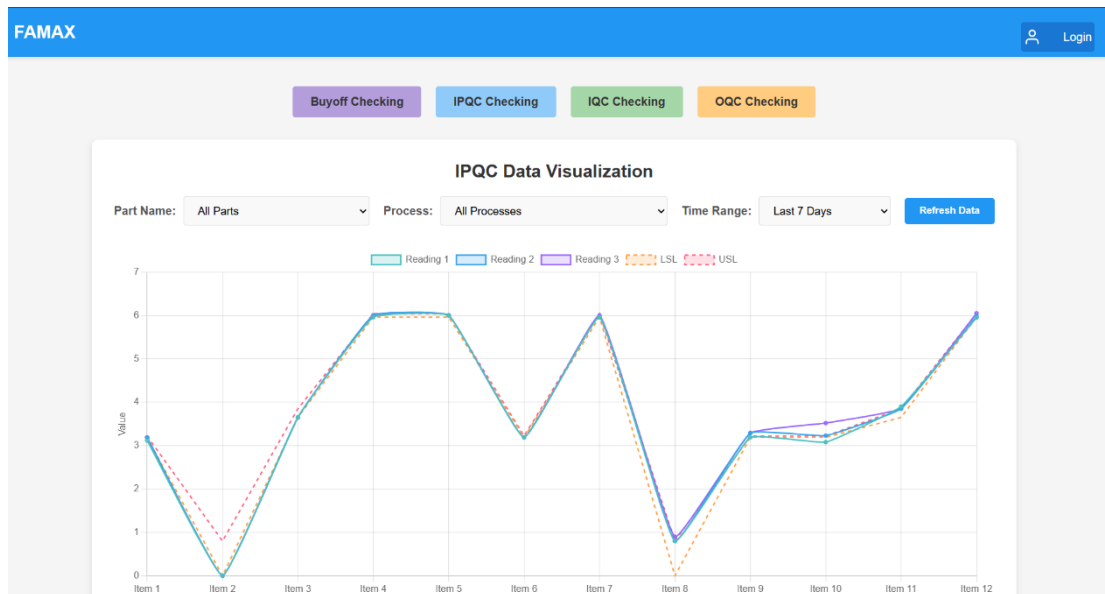


2. Click “Login” and it will be prompt this box.


The Admin Login modal box is displayed over the dashboard. It contains the following fields and buttons:

- Admin Login** (Title)
- User ID** (Label)
- (Input field)
- Password** (Label)
- (Input field)
- Cancel** (Button)
- Login** (Button)


a. Below shows images of access level.

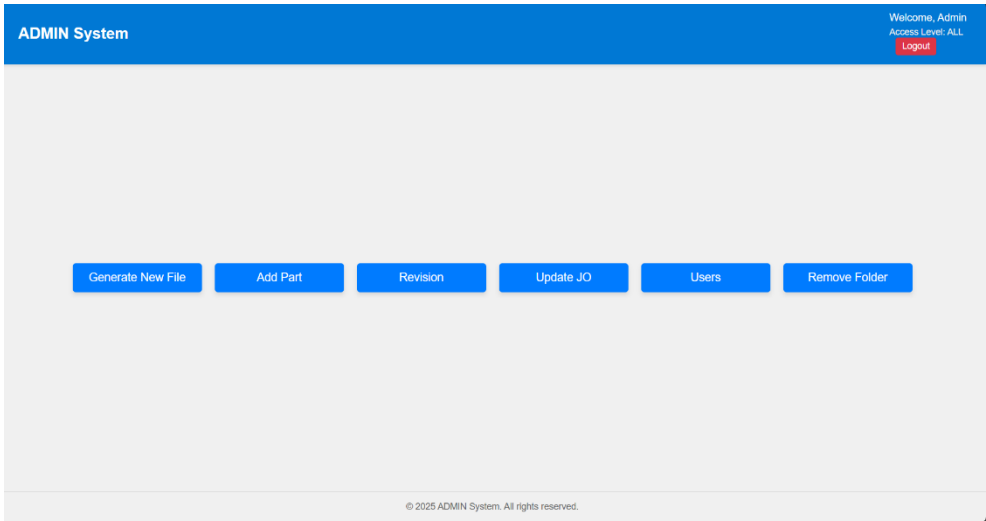

All access has no buttons blocked. Only administrators are allowed to access all functions.

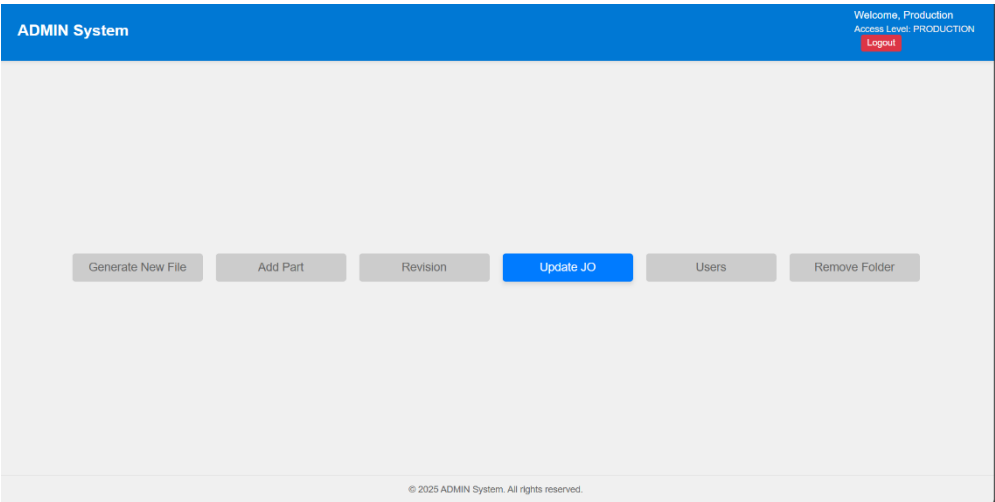

Production access can only access Update JO.

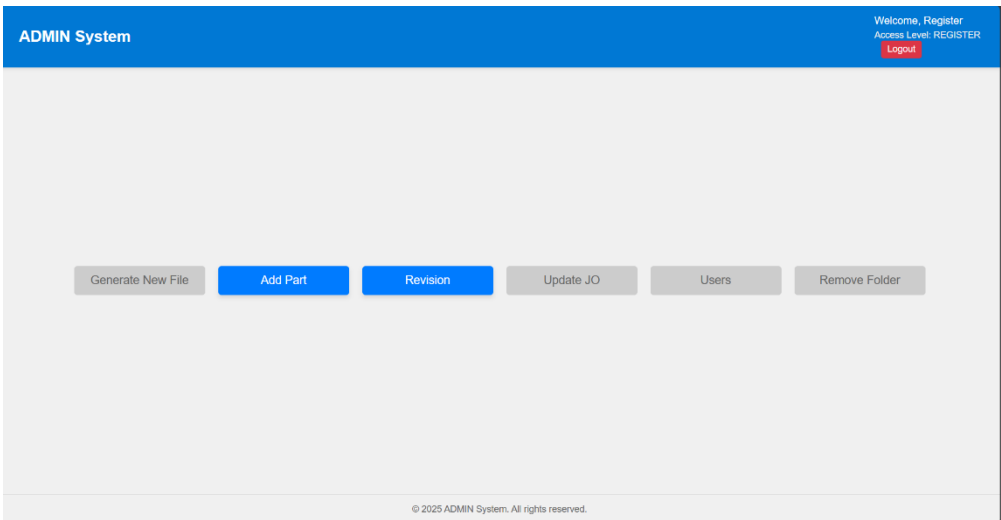

REGISTER access can only access Add Part and Revision.

ENGINEER ACCESS

ADMIN System

Welcome, Engineer
Access Level: ENGINEER
[Logout](#)

Generate New File

Add Part

Revision

Update JO

Users

Remove Folder

© 2025 ADMIN System. All rights reserved.

ENGINEER access can only access to Generate New File & Remove Folder.

3. Now, when you click “Generate New File” button. You will get a page as below.



FAMAX TECHNOLOGY (M) SDN BHD

200601028954 (748710-K)

PART DESCRIPTION:

PART NO:

RAW MATERIAL:

RAW MATERIAL GRADE:

RAW MATERIAL SIZE:

No.	Process	Process Image	Document	FlowChart	Action
Add Process					

Submit

© 2025 Famax System. All rights reserved.

4. Make sure all cells are filled and all process is determined before generating document for the process.
- DO NOT USE process name as: Milling (M1). Avoid bracket.**
- Then click submit button.

**FAMAX TECHNOLOGY (M) SDN BHD**200601028954 (748710-K)

PART DESCRIPTION:
Part 1A

PART NO:
1A321

RAW MATERIAL:
Steel

RAW MATERIAL GRADE:
Steel Grade A1

RAW MATERIAL SIZE:
10mm*10mm


No.	Process	Process Image	Document	FlowChart	Action
1	Process A	Choose File SWIS S AUTO LATHE MAC HINING_IPQC.png	IPQC	FABRICATION	Remove

Add Process

Submit

© 2025 Famax System. All rights reserved.

5. Click OK when the “All processes and documents created successfully”

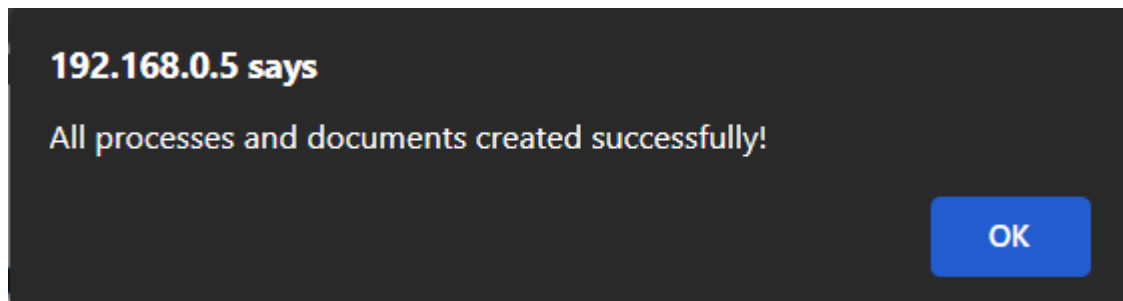

6. Make sure no error and move to next page.



FAMAX TECHNOLOGY (M) SDN BHD
200801028954 (748710-K)

PROCESS FLOW DIAGRAM

PART NUMBER: 1A321
PART NAME: Part 1A

PRODUCT ENGINEER: Faiz
DEPARTMENT: IT
REVISION:

DATE: 27/10/2025

STEP	PROCESS FLOW	OPERATION DESCRIPTION	PRODUCT CHARACTERISTIC (KPC)	CONTROL CHARACTERISTIC (KCC)
1		Process A	Enter KPC	Enter KCC

© 2025 Famax System. All rights reserved.

7. Fill in everything properly and click submit. Once click submit wait patiently as it may take some time. Wait until the pdf saved message pops out successfully. If anything, error please inform IT department immediately. **Do Not RETRY**



FAMAX TECHNOLOGY (M) SDN BHD
200801028954 (748710-K)

PROCESS FLOW DIAGRAM

PART NUMBER: 1A321
PART NAME: Part 1A

PRODUCT ENGINEER: Faiz
DEPARTMENT: IT
REVISION:

DATE: 27/10/2025

STEP	PROCESS FLOW	OPERATION DESCRIPTION	PRODUCT CHARACTERISTIC (KPC)	CONTROL CHARACTERISTIC (KCC)
1		Process A	Enter KPC	Enter KCC


© 2025 Famax System. All rights reserved.

192.168.0.5 says
PDF saved successfully on the server!


OK

REGISTER ACCESS


1. Now, let's move to "Add Part" Button. This part is done by Register only after all documents are done properly.

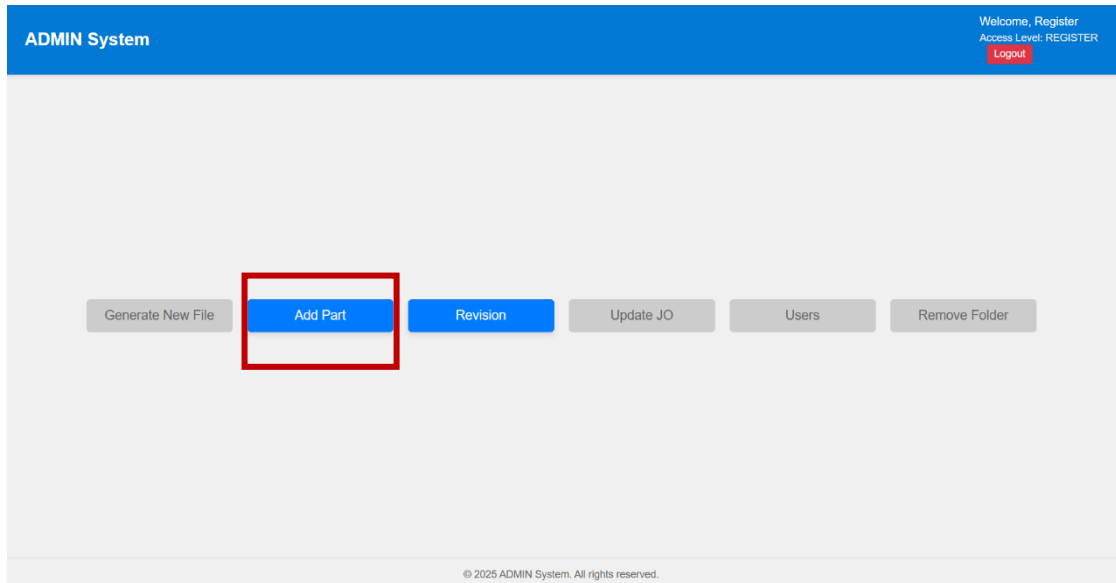


2. Choose the part name. We will do for "Part 1A" now.
 - a. Select Part Name from dropdown field.
 - b. Choose folder that contains all Excel files.

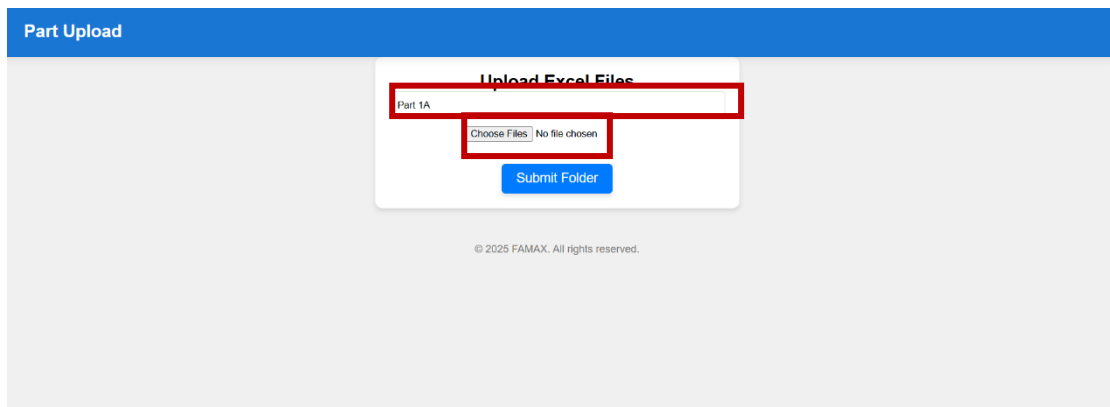

3. Upload the completed folder that contains all excel files.

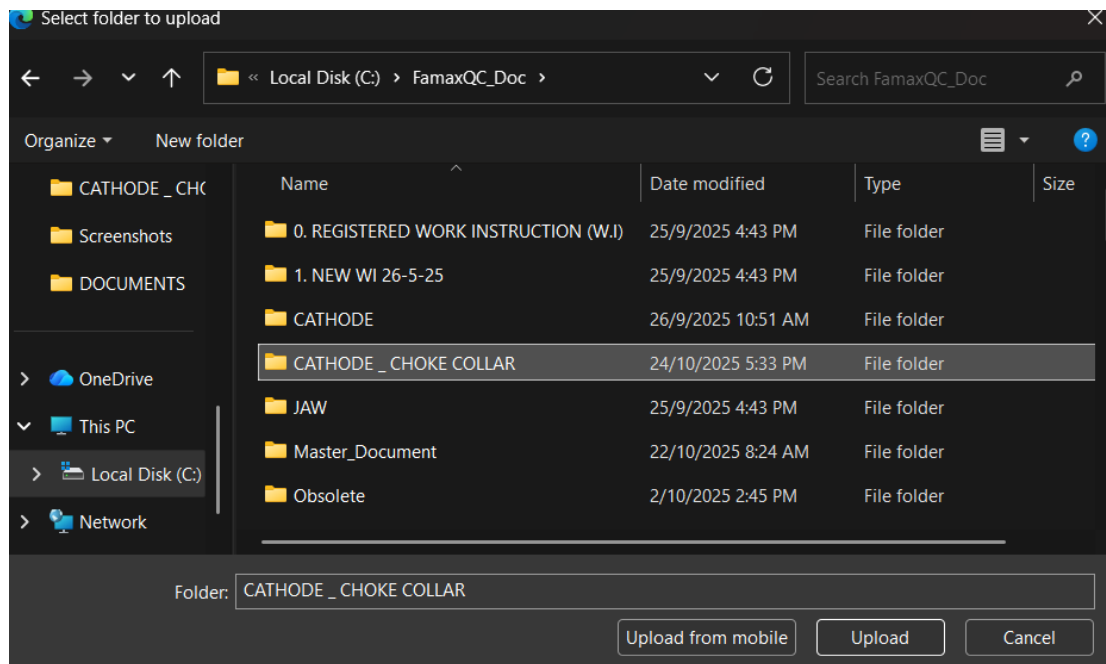

4. Do not disturb the setting as all will be detected automatically. And then click "Submit Folder" button.

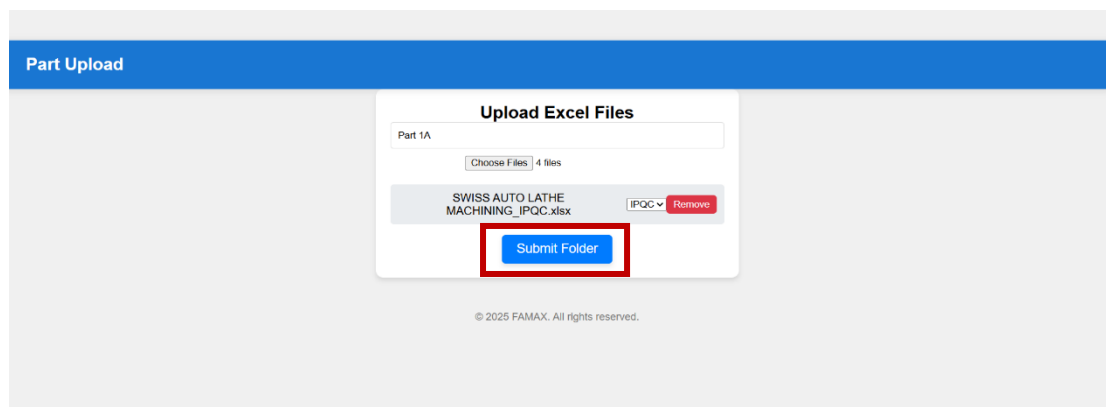

5. After uploading the folder consist of excel, the system will redirect to this page. Please upload the image folder consist of the product process image.

Folder Upload

Part: Part 1A

Upload a folder of images


Choose File | No file chosen

Submit

Reset Area

© 2025 Famax System. All rights reserved.

6. Here you must add folder containing all images. Image name and Process name must match. IQC and OQC must add pdf of Inspection guide as well. Then, click “Submit” button. Make sure no errors, if ERROR report immediately.

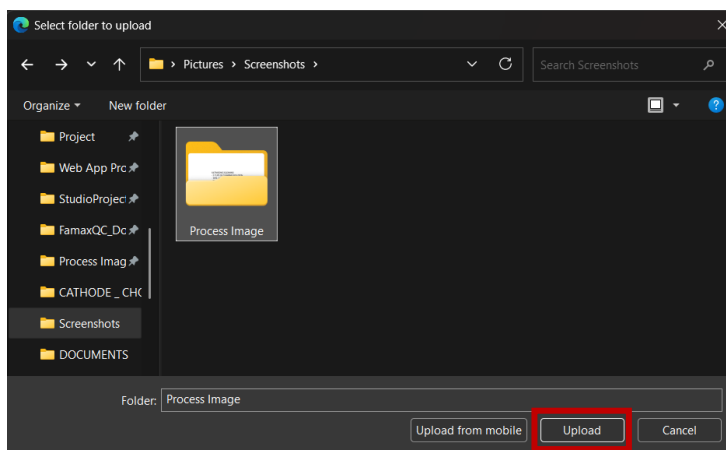

Folder Upload

Part: Part 1A

Upload a folder of images

Choose File | 2 files

 SWISS AUTO LATHE MACHINING_IPQC.png

SWISS AUTO LATHE MACHINING
IPQC

View


Remove

Submit

Reset Area

© 2025 Famax System. All rights reserved.


7. Next, is for “Revision” button.

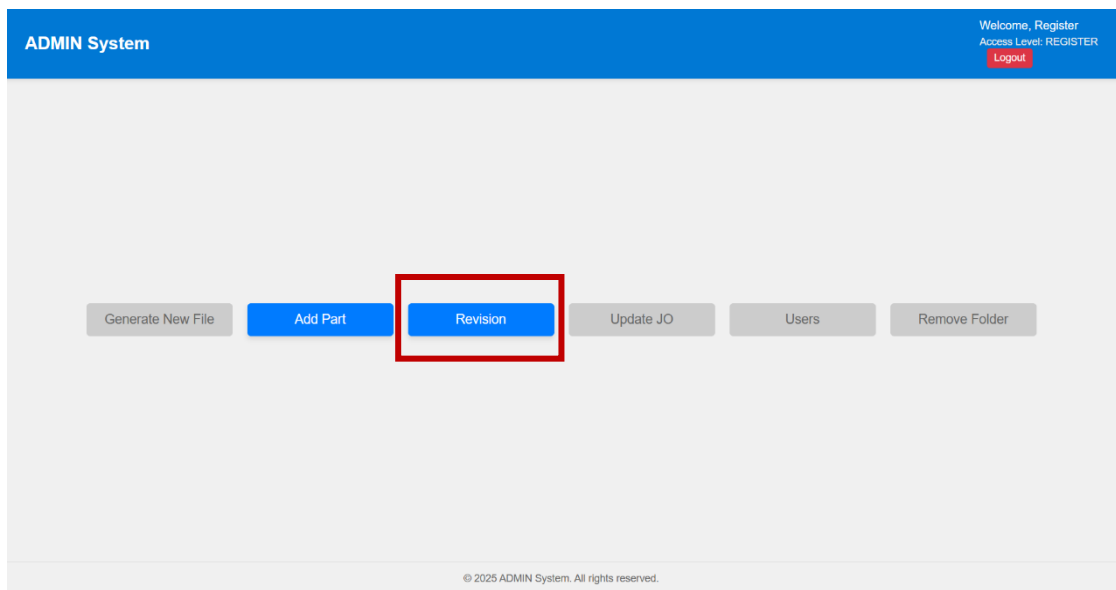

8. Once this button is clicked, select the Document Type > Part Name > Process. Process related only will be shown as dropdown option.


The screenshot shows the IPQC Checking System interface. At the top, there is a blue header with the text "IPQC Checking System". Below the header, there is a form titled "Document Revision". The form contains three dropdown menus: "Document Type:" with "IPQC" selected, "Part Name:" with "Part 10" selected, and "Process:" with "Select process" selected. Below the "Process:" dropdown, there is a list of options: "Milling 1". At the bottom right of the form, there is a blue "Continue" button.

9. Once you have chosen the process you must upload the latest excel file. The file naming must be controlled. So the latest file must be **Vx_Milling 1_IPQC.xlsx**. Let's say document is use is V2 the latest one must be V3.

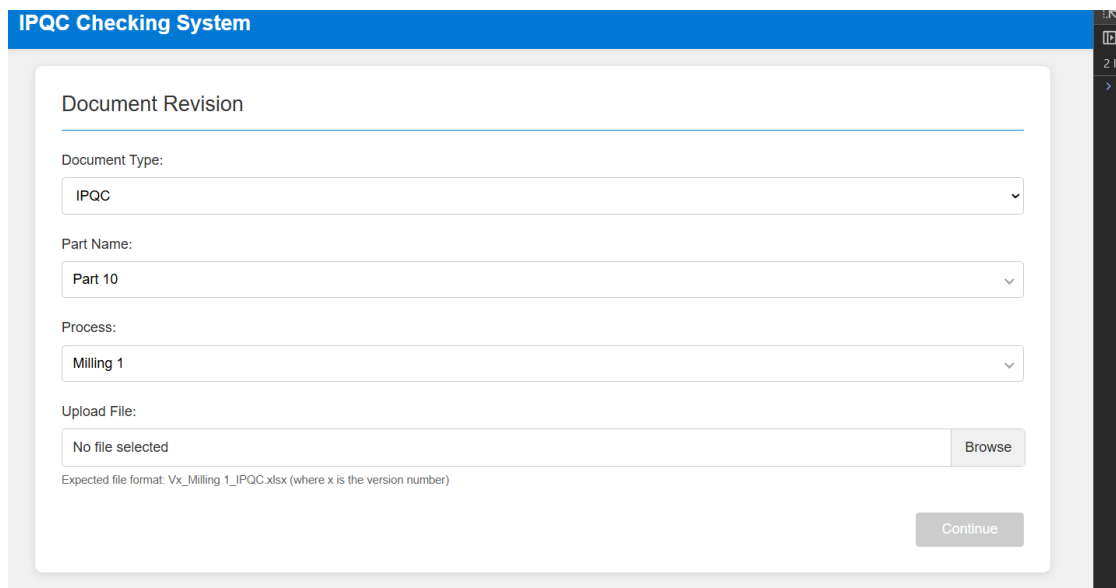


The screenshot shows the 'IPQC Checking System' interface. The 'Document Revision' section contains four dropdown menus: 'Document Type' (IPQC), 'Part Name' (Part 10), 'Process' (Milling 1), and 'Upload File' (No file selected). A 'Browse' button is next to the 'Upload File' dropdown. Below the dropdowns, a text label reads 'Expected file format: Vx_Milling 1_IPQC.xlsx (where x is the version number)'. A 'Continue' button is at the bottom right of the form.

Example Filing Name

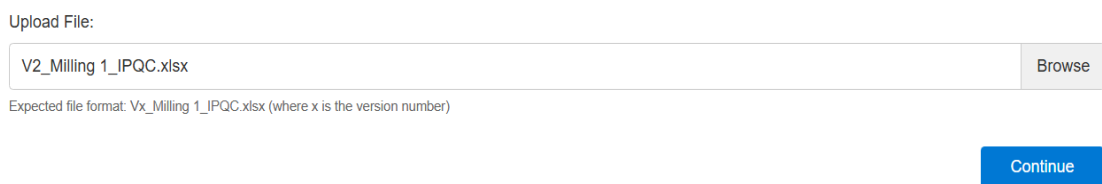

This form shows the 'Upload File' section. The 'Upload File' dropdown is set to 'V2_Milling 1_IPQC.xlsx'. A 'Browse' button is to the right. Below the dropdown, the text 'Expected file format: Vx_Milling 1_IPQC.xlsx (where x is the version number)' is displayed. A blue 'Continue' button is at the bottom right.


10. Then, click “Continue” button. You will redirect to the next page to upload the image. Only one image can be uploaded. If “IQC” document or “OQC” document the must upload pdf as well. Then, click “Submit” button.

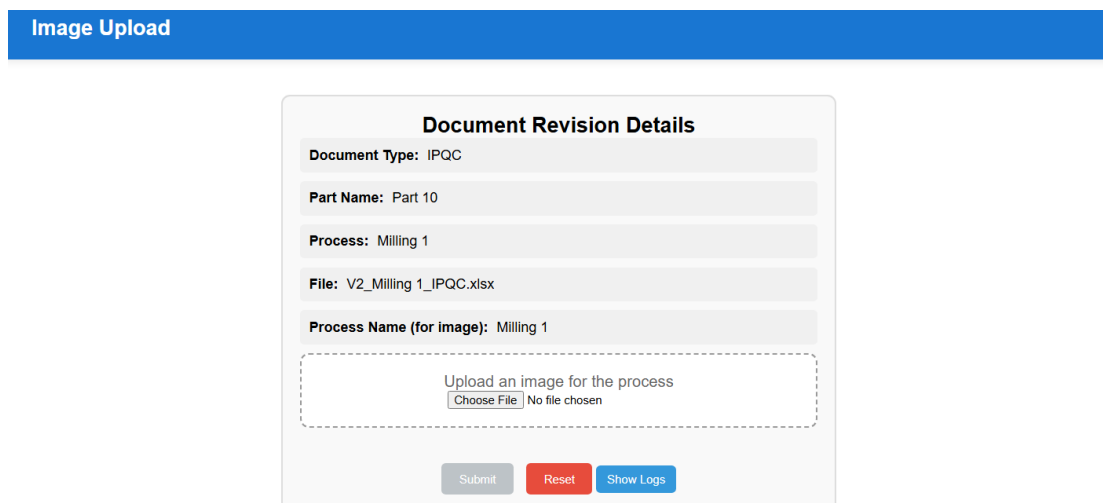


The screenshot shows the 'Image Upload' section. The 'Document Revision Details' form displays the following information: 'Document Type: IPQC', 'Part Name: Part 10', 'Process: Milling 1', 'File: V2_Milling 1_IPQC.xlsx', and 'Process Name (for image): Milling 1'. Below this, there is a dashed box containing the text 'Upload an image for the process' and a 'Choose File' button. At the bottom of the form, there are three buttons: 'Submit' (grey), 'Reset' (red), and 'Show Logs' (blue).

PRODUCTION ACCESS


1. Next is “Update JO” button.

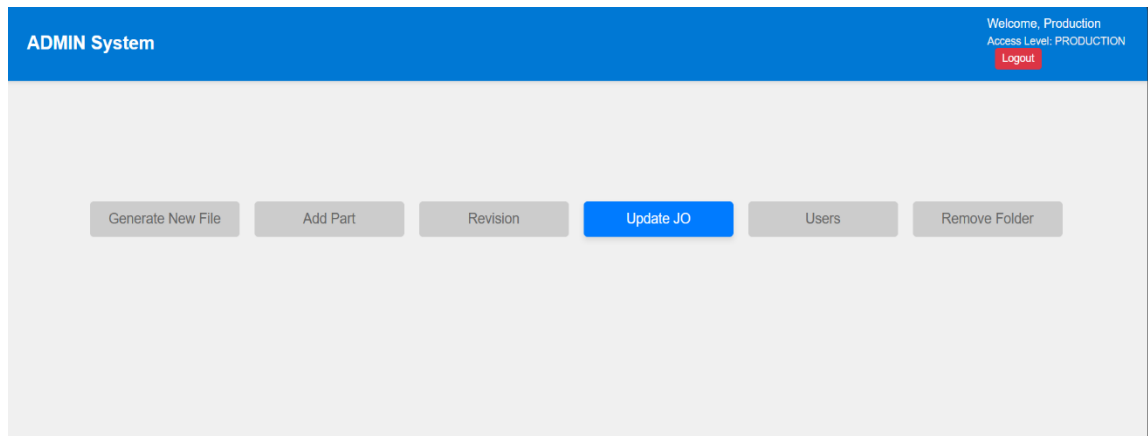

2. Go to “Add New Job Order”.

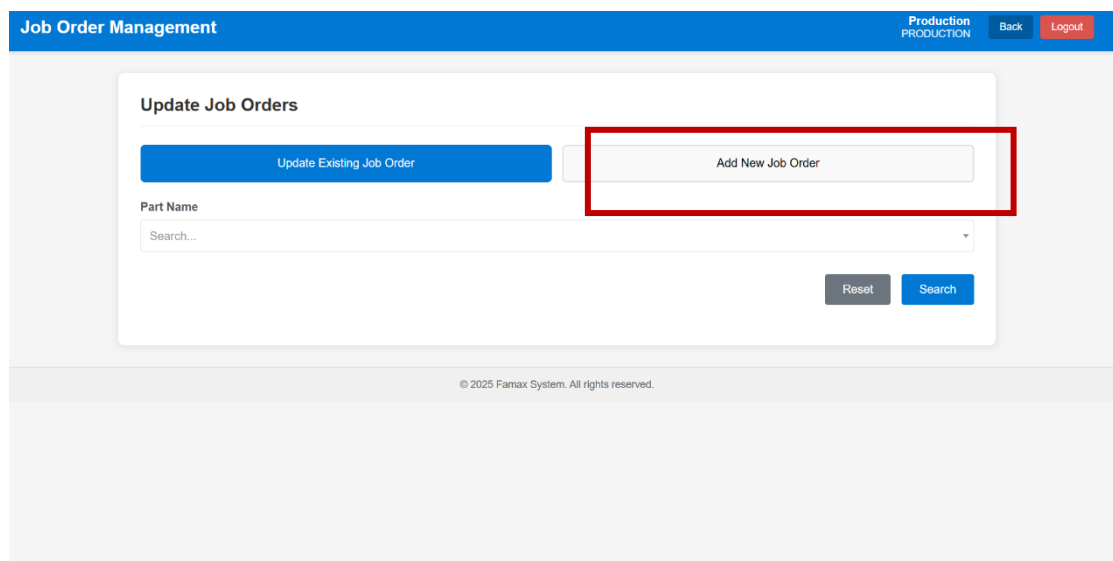

3. Enter the details to all the cell and click “Add Job Order” button.

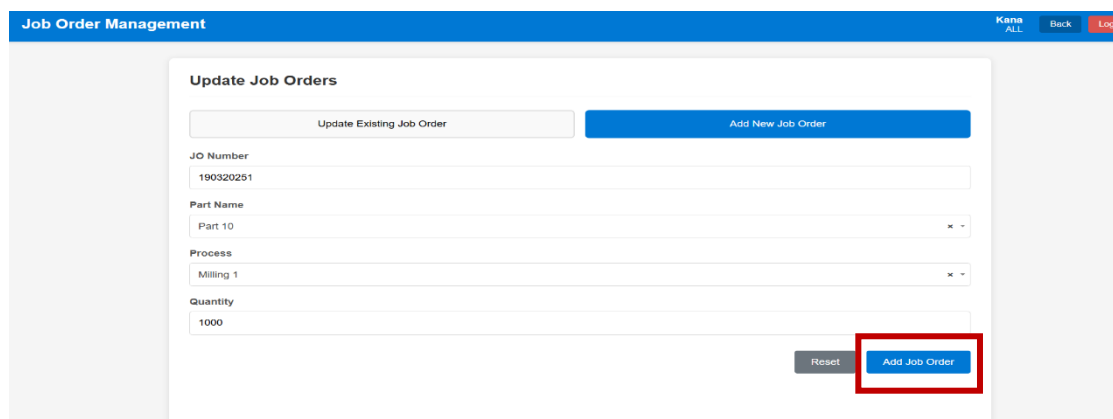

4. Now, let's go to "Update Existing Job Order" section and select part name.

Job Order Management

Kana ALL Back Logout

Update Job Orders

Update Existing Job Order Add New Job Order

Part Name

Select Part Name

Reset Search

© 2025 Farnax System. All rights reserved.

5. If there is job order created, this menu will be appear after selecting the part name.

Job Order Management

Kana ALL

Update Job Orders

Update Existing Job Order Add New Job Order

Part Name

Part 10

Reset Search

Job Orders

☐ Select All

Select	JO Number	Part Name	Process	Quantity	Created Date	Status
☐	190320251	Part 10	Milling 1	1000	3/19/2025	active
☐	12344	Part 10	Milling 1	100	3/19/2025	active

Cancel Update Status to Completed

6. Choose the JO that you completed and you want to update. Then, click "Update Status to Completed" button and confirm.

Job Order Management

Kana ALL Back Logout

Update Job Orders

Update Existing Job Order Add New Job Order

Part Name

Part 10

Reset Search

Job Orders

☐ Select All

Select	JO Number	Part Name	Process	Quantity	Created Date	Status
☐	190320251	Part 10	Milling 1	1000	3/19/2025	active
☒	12344	Part 10	Milling 1	100	3/19/2025	active

Cancel Update Status to Completed