

HS2 Function

Note:serial call Api calls must be, that is, when the end of an Api, can call an Api, Otherwie it will appear the Api function failure.

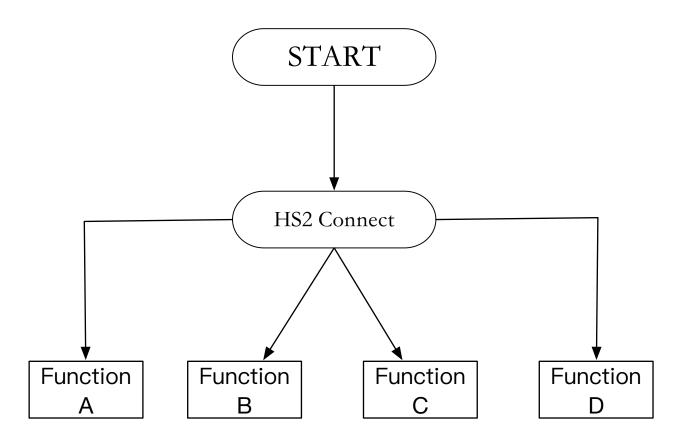


HS2 Function A On-line measurement

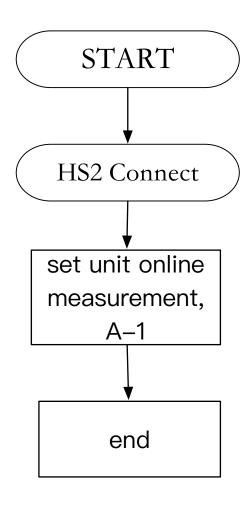


A-1: commandHS2MeasureWithUint: Weight: StableWeight: DisposeErrorBlock:

HS2 Function B get offline data

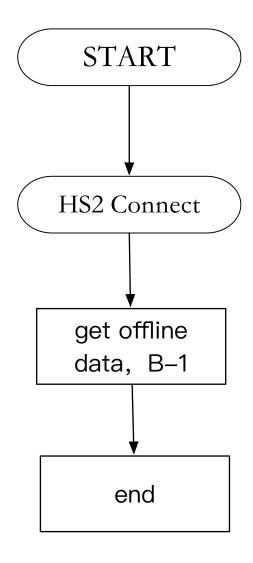


B-1: commandHS2TransferMemorryData: DisposeProgress: progrMemorryData: FinishTransmission: DisposeErrorBlock:

HS2 Function C get device battery

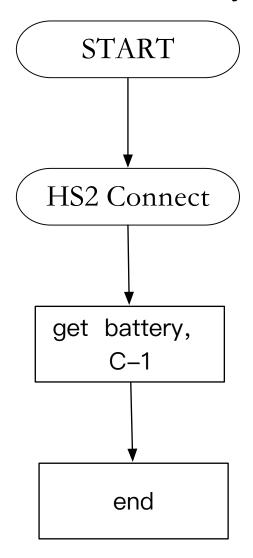

C-1: commandGetHS2Battery: DiaposeErrorBlock:

HS2 Function D Disconnect device

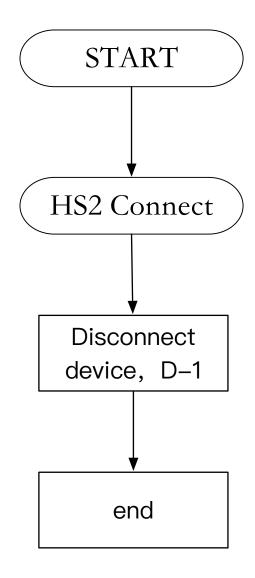

D-1:commandDisconnectDevice